GeoLogix
GEOLOGIC STRATEGIES, P.C.
5316 Deep Valley Run Raleigh, NC 27606

Phase I Environmental Site Assessment (ESA)

at

The Wood Pile Block A-45 Parcels
E. Hargett St./S. Bloodworth St./E. Martin St.
Raleigh, North Carolina

Prepared for:

City of Raleigh

June 17, 2013

GeoLogix, Inc.
Environmental Consulting
& Contracting Services

PH: 919-859-4544
FAX 919-859-4544
geologix2002@yahoo.com

Geologic Strategies, P.C.
Professional Geological
Services

TABLE OF CONTENTS

1.0 EXECUTIVE SUMMARY 1

2.0 OBJECTIVES, PURPOSE, and SCOPE 4

3.0 SITE OVERVIEW 7
- 3.1 Site Location 7
- 3.2 Adjoining and Surrounding Property Use 7
- 3.3 Vehicle Reconnaissance 7

4.0 HISTORICAL SITE USE and PROPERTY CONDITIONS 8
- 4.1 Current and Prior Ownership 8
- 4.2 Interviews 8
- 4.3 Aerial Photograph Review 8
- 4.4 Chain-of-Title Search 9

5.0 ENVIRONMENTAL SETTING/CONDITIONS 10
- 5.1 Surface Water Characteristics 10
- 5.2 Groundwater Characteristics 10

6.0 SITE INSPECTION 11
- 6.1 Site Inspection Methodology 11
- 6.2 Site Inspection Observations 11
  - 6.2.1 Roadway Access to Site 11
  - 6.2.2 Wooded Areas and Variations of Vegetation 11
  - 6.2.3 Water Bodies, Swamps, Rivers, Lakes, Pits, Ponds, Lagoons, Surface Impoundments or Holding Ponds 11
  - 6.2.4 Solid Waste, Landfill, Dumping, Disturbed Soils, Direct Burial Activity 11
  - 6.2.5 Underground/Aboveground Storage Tanks 12
  - 6.2.6 Potable Water and Sewage Disposal 12
  - 6.2.7 Drains, Floor Drains and Sumps 12
  - 6.2.8 Wells, Piezometers and Other Subsurface Monitoring Devices 12
  - 6.2.9 Wastewater Discharges 12
  - 6.2.10 Groundwater or Surface Water Contamination 12
  - 6.2.11 Stained or Discolored Soils or Pavement 12
  - 6.2.12 Distressed, Discolored, or Stained Vegetation 12
  - 6.2.13 Buildings, Structures, Foundations, and Old Ruins 13
  - 6.2.14 Electrical Equipment/Suspected PCB-Filled Equipment 13
  - 6.2.15 Utilities 13
  - 6.2.16 Foul/Suspicious Odors 13
  - 6.2.17 Hazardous Substances/Hazardous Wastes 13
  - 6.2.18 Chemicals, Chemical Spills or Releases 13
  - 6.2.19 Storage Containers and Drums 13
  - 6.2.20 Petroleum Products 13
  - 6.2.21 Pesticides, Herbicides, Soil Conditioners, Fertilizers and Farm Wastes 14
  - 6.2.22 Air Emissions 14
  - 6.2.23 Other Known or Observed Environmentally Sensitive or Suspected Conditions 14

TABLE OF CONTENTS (CONTINUED)

7.0 ENVIRONMENTAL/REGULATORY AGENCY REVIEW 15
7.1 Federal and State Regulatory Agencies 15
7.2 Sanborn Maps 16
7.3 Environmental Lien Search 17
7.4 City Directory Information 17

8.0 CONCLUSIONS AND RECOMMENDATIONS 18

APPENDICES

EXHIBITS

1.0 EXECUTIVE SUMMARY

A Phase I Environmental Site Assessment (ESA) was conducted by *GeoLogix* personnel on twelve (12) individual parcels located along E. Hargett Street, S. Bloodworth Street, and E. Martin Street just east of downtown Raleigh, North Carolina. The parcels are included in what is termed Block A-45, the city block just east of Moore Square. The lots studied in this report will be combined into one Phase I ESA and will be referred to as the "subject property", "lots", or "parcels". Information regarding the subject property was gathered through an on-site reconnaissance, a review of aerial photographs, questionnaires, and a review of environmental regulatory agency database information.

The address numbers of the parcels are as follows: 330 E. Hargett Street; 210, 214, 218, 224, 226, and 228 S. Bloodwoth Street; and 317, 319, 323, 325, and 327 E. Martin Street. There are no structures on the subject property. The northwest corner of the combined subject property consists of a paved parking lot, and the northeast corner consists of a gravel parking lot. Both are bounded by E. Hargett Street to the north. Most of the remainder of the subject property is grassed with the exception of a few pavement strips and some graveled areas in the southernmost part of the parcels. What appeared to be minor structural remains/remnants were visible in the central region and along the western property line of the subject property.

Aerial photographs were reviewed from years 1949, 1965, 1981, 1988, 1993, 1999, 2005, and 2010. Due to the scale of the 1949 and 1965 photos, it was difficult to determine detail, but it did appear that the subject property was used for residential. In the 1981 and 1988 photos, the subject property was utilized for residential and parking areas. In the 1993 photo, again there was a lack of detail available for review due to the photo scale. In the 1999 photo, residences were visible along S. Bloodworth Street and E. Martin Street. The remainder of the subject property appeared to be used for parking. In the 2005 and 2010 photos, it appeared that some trees on the S. Bloodworth side of the subject property had been removed. The subject property appeared to be used only for parking. Copies of the aerial photographs reviewed are contained in Appendix C of this report.

Solid waste was observed on the subject property. Most of the waste was concentrated in the west-central region of the subject property where plastic bags of waste were in a pile. Otherwise, only domestic trash such as various containers or plastic/paper items was noted. There was no evidence of landfilling or burial of solid waste observed. No significant adverse environmental impact to the subject property would be anticipated from the solid waste observed on any of the lots. There was no evidence of hazardous wastes/toxic substances observed on the subject property.

There was no physical evidence observed during the site reconnaissance to indicate the existence of an underground fuel storage tank (UST) on site. No above ground tanks were observed on the subject property parcels.

Three (3) RCRA hazardous waste notifiers (including two standard RCRA facilities and one RCRA-CORRACTS), forty-six (46) UST/groundwater/release incidents, nine (9) State Hazardous Waste Sites, and three (3) Hazardous Substances Disposal Sites were identified within or close to standard ASTM search distances of the subject property in a review of environmental regulatory agency informational databases. Based on general knowledge from working downtown areas of Raleigh, much of the groundwater, and to some extent the soil, has been compromised by past releases from gasoline stations, dry cleaners, and other facilities. In addition to that, a review of the EDR database information indicated that two particular off-site facilities were identified with the potential to adversely impact the subject property parcels. One is the U. S. Postal Service (General Services Administration) where a release was identified from the Post Office's maintenance facility just across E. Hargett Street from the subject property. The other potential facility identified was the Moore Square Museums Magnet Middle School to the southwest across E. Martin Street. There, soil and groundwater contamination have been identified.

In addition to the information contained in the EDR database report, City of Raleigh personnel provided *GeoLogix* with information discovered during a Limited Phase II Environmental Assessment recently conducted by another environmental consultant on property adjacent to, and west of, the subject property. Groundwater contamination was indicated in several of the groundwater samples obtained from in proximity to Killo Extermination and the Salvation Army building.

An environmental lien search of the twelve (12) subject property deeds was conducted. No environmental liens or Activity Use Limitations (AUL) were found associated with the subject property deeds. A copy of the deeds for the parcels comprising the subject property lots can be found behind the first purple divider page in the Exhibits section of this report. Also, copies of prior ownership information including deed books and page numbers obtained from the Wake County GIS/web site precede the deed copies.

City Directory information for the subject property was ordered from EDR. Appropriate pages from the City Directory information covering the subject property addresses were printed and can be found behind a yellow divider page in Section F of this report. The City Directory information confirmed information gathered from aerial photographs and Sanborn Maps that the property has generally remained residential over the years, and more recently, after demolition of the residences, used for parking. Some of the residences along E. Martin Street, according to the City Directory information, apparently had small businesses operating on the premises.

In summary, this Phase I Environmental Assessment revealed no observable evidence of environmental contamination or environmental impairment associated with the subject property for in-scope items. The solid waste observed on the parcels can be easily removed and does not, in the opinion of the environmental professional, rise to the level of a Recognized Environmental Condition (REC). However, while there was no observable evidence of contamination observed on site, documented incidents of soil and groundwater contamination have been identified on adjacent properties.

This Phase I Environmental Site Assessment represents a thorough attempt to identify potential sources of environmental contamination. However, there is always the possibility that sources of contamination have escaped detection due to the limitations of this study, the inaccuracy of governmental records, the presence of undetected/unreported environmental incidents, or inaccuracy of information furnished by other parties used to arrive at the conclusions reached in this report.

There were some "data gaps" of ten to fifteen years encountered in conducting this Phase I ESA. However, the use of the property appears has been documented. Based on information gathered during this study, the lots comprising the subject property appear to have been used generally for residential purposes or have been vacant. Accordingly, the data gaps encountered are considered inconsequential. An environmental lien search indicated that there are no environmental liens or Activity Use Limitations (AUL) associated with the subject property lots. There was nothing regarding the sale price of the subject property that would indicate that the subject property was underpriced in order to sell a parcel with suspect environmental conditions.

The findings contained in this report are relevant to the dates of the site work and should not be relied upon to represent site conditions at other times. The Phase I study of the subject property was performed generally within the scope and limitations of ASTM Standard E-1527-05 including the new All Appropriate Inquiry Rules adopted into the ASTM standards and effective November 1, 2006. An exception to the standard was that a formal chain-of-title search was not conducted. *GeoLogix* was able to reach appropriate conclusions regarding the subject property without conducting a formal title search.

2.0 OBJECTIVES, PURPOSE and SCOPE

The objective of this Phase I Environmental Site Assessment was to assess the environmental status of the subject property for the purpose of identifying existing or potential environmental liabilities which could be reasonably anticipated. The work was performed under an agreement between the City of Raleigh, represented by Mr. Gregg Pollard, and *GeoLogix*. The environmental assessment at the subject property was specifically requested by Mr. Pollard.

This report is presented as follows: Section 2.0 outlines the scope of the services performed in conducting this assessment and the limitations of the assessment. Section 3.0 provides a description of the site, and Section 4.0 discusses the site history. Section 5.0 summarizes the physical environmental setting of the subject property, and Section 6.0 presents information obtained during the site reconnaissance. Section 7.0 summarizes the information obtained from a review of government environmental regulatory agency databases ordered from Environmental Data Resources (EDR) and the results of environmental lien searches, Sanborn maps, and City Directory information. Section 8.0 includes the summary and conclusions reached from this assessment.

Appendices at the conclusion of this report include the following: Site location map, site property map, aerial photographs, U. S. Geological Survey topographic quadrangle map, representative photographs of the subject property, environmental regulatory agency information (EDR radial search), and qualifications of *GeoLogix* personnel. Exhibits are found behind the report appendices and include environmental lien search information (property deeds review), an "end user" questionnaire, and a subject property questionnaire.

The scope of this project included a visual inspection of the property to check for conditions indicative of past use or storage of hazardous or toxic substances/wastes or other environmental contaminants. During the site walkover, a search was conducted for specific items outlined in Section 6 of this report. Readily available information regarding historical site usage, surface and subsurface conditions, interviews with persons associated with the subject property, and a review of governmental regulatory information was used in preparation of this report. The scope of this Phase I assessment did not include, nor was *GeoLogix* requested to conduct, a detailed groundwater review, asbestos testing, vapor intrusion assessment, mold/mildew assessment, lead-based paint assessment, wetlands study, or sampling of air, soil, surface water or groundwater for environmental contaminants. However, *GeoLogix* was requested to conduct a Limited Phase II ESA on the subject property which did include obtaining a limited number of groundwater and soil samples. The Limited Phase II ESA report will be issued under separate cover.

The scope of work conducted in this assessment was agreed upon in discussions between Mr. Greg Pollard of the City of Raleigh, and Mr. Rob Livermon of *GeoLogix*. Routine services performed were in general accordance with ASTM Standard E-1527-05, including the requirements of All Appropriate Inquiry (AAI) rules effective November 1, 2006. An exception to the ASTM standard was that: (1) a formal chain-of-title search for prior ownership was not conducted, but some information was gleaned from the Wake County GIS/web site

GeoLogix's tasks consisted of the following:

Task 1 - Historic Activities Review

GeoLogix researched readily available historic information regarding past users, owners, or activities conducted on, or adjacent to, the subject property which may have resulted in an adverse environmental impact.

Task 2 - Environmental Incidents and Regulatory Agency Review

This task involved identification of known or suspected environmental incidents or regulatory/compliance enforcement action on or near the subject property. Readily-available environmental incident and regulatory information databases were researched. Sanborn Maps and City Directory information were available. An environmental lien/Activity Use Limitations (AUL) search was conducted by reviewing the property deeds.

Task 3 - Review of Area Environmental Setting

Information on site topography, surface water, anticipated groundwater information, and the surrounding area was reviewed to characterize the physical environmental setting of the site. Informational sources can include maps, topographic maps, reports, publicly accessible documentation, and interviews.

Task 4 - Site Reconnaissance

GeoLogix conducted a site reconnaissance on readily-accessible areas of the subject property to observe current site conditions and evaluate potential sources of environmental contamination identified in Tasks 1 and 2. Observations were made of adjacent properties during the site reconnaissance and the vehicle reconnaissance.

Task 5 - Phase 1 Report Preparation

Information collected in the four tasks above was evaluated and summarized in this report. The report is based on information from the field reconnaissance and visual observations made on the site and adjacent property. Available information was interpreted and documentation reviewed.

This report is intended for the use by the City of Raleigh and its employees. The scope of services performed in this assessment may not be appropriate to satisfy the needs of other users. Any use or re-use of this document or the findings, conclusions, or recommendations present are at the risk of the user.

This study was undertaken and completed in accordance with the professional standards and generally accepted practices of environmental consultants at the time of preparation of this study. The scope of services for this assessment was limited and should not be construed as a guarantee that no currently unrecognized environmental concerns exist at the site. The study was not intended to be a definitive investigation of potential environmental concerns at the subject property. The scope of this Phase I report did not include, nor was *GeoLogix* requested to conduct, a detailed groundwater review, asbestos testing, mold/mildew assessment, lead-based paint assessment, vapor intrusion assessment, wetlands study, or sampling of air, soil, surface water or groundwater for environmental contaminants.

However, while the scope of a Phase I ESA, including this one, does not include invasive sampling such as soil and groundwater sampling, the City of Raleigh requested that *GeoLogix* begin a Limited Phase II ESA to include obtaining groundwater and soil samples shortly after the Phase I ESA process was commenced.

The opinions and recommendations presented in this report apply to the site conditions at the time of the assessment and those reasonably foreseeable. They cannot necessarily apply to site changes of which *GeoLogix* was not aware and has not had the opportunity to evaluate.

3.0 SITE OVERVIEW

3.1 Site Location

This report provides the results of a Phase I Environmental Site Assessment (ESA) conducted by *GeoLogix* on twelve (12) individual lots/parcels located at the following addresses in Raleigh, North Carolina:

330 E. Hargett Street	REID: 0014973
210 S. Bloodworth St.	REID: 0006045
214 S. Bloodworth St.	REID: 0004770
218 S. Bloodworth St.	REID: 0048492
224 S. Bloodworth St.	REID: 0004774
226 S. Bloodworth St.	REID: 0004773
228 S. Bloodworth St.	REID: 0004772
317 E. Martin St.	REID: 0066856
319 E. Martin St.	REID: 0039069
323 E. Martin St.	REID: 0071314
325 E. Martin St.	REID: 0004775
327 E. Martin St.	REID: 0004771

This report contains site vicinity (Appendix A) and site property maps (Appendix B).

3.2 Adjoining and Surrounding Property Use

The subject property is surrounded by land with mixed uses including older single-family residential, new single family homes, multi-family complexes, churches, a school, Post Office building, federal building, homeless shelters, miscellaneous commercial businesses, and open, vacant parcels. An obvious potential source of environmental concern was a U. S. Post Office vehicle maintenance building and former fuel dispenser island located to the north across E. Hargett Street.

3.3 Vehicle Reconnaissance

A vehicle reconnaissance was performed to verify surrounding land usage and identify potential sources of environmental concerns in the vicinity of the subject property. The vehicle reconnaissance was performed on the following roads: S. Bloodworth Street, E. Martin Street, E. Hargett Street, S. Person Street, New Bern Avenue, and E. Davie Street. Land usage observed in the vicinity of the subject property included older single-family residences, churches, a school, apartment buildings, miscellaneous commercial businesses, the U. S. Post Office, federal building, and vacant undeveloped areas and lots. Potential environmental concerns identified during the vehicle reconnaissance included

the U. S. Post Office maintenance building to the north across E. Hargett Street, and Killo Exterminating located adjacent to S. Person Street to the west of the subject property.

4.0 HISTORICAL SITE USE AND PROPERTY CONDITIONS

4.1 Current and Prior Ownership

Information obtained from the Wake County web site regarding ownership of the twelve (12) individual parcels which comprise the subject property was researched. The information is contained in the Exhibits Section of this report behind the first purple divider page entitled "Environmental Lien Search Information". Prior ownership is shown on the chain of deeds/ownership on a page for each parcel printed from the Wake County web site which precedes the current deed for each of the parcels.

Based on a review of the deeds in conjunction with a review of the Sanborn Map information ordered from EDR, it is concluded that the subject property parcels have only been used generally for residential purposes. The exceptions are a building described as "apartments" at the corner of E. Hargett Street and S. Bloodworth Street. Also, it appears that small businesses were operated out of residences along E. Martin Street decades ago.

Accordingly, based on the available information, it does not appear that any activities have occurred on the subject property which would cause adverse environmental impact.

Again, prior ownership information is available in the Exhibits Section of this report preceding the individual parcel deeds.

4.2 Interviews, Questionnaires, and *User Responsibilities*

In order to gather input from the current owner of the subject property parcels as part of the *User Responsibilities* requirement, *GeoLogix* sent a questionnaire to Mr. Gordon Smith representing the owner of the subject property, The Wood Pile, LLC. The completed questionnaire can be found behind the third purple divider page in the Exhibits section of this report. An "End User" questionnaire was sent to Mr. Gregg Pollard representing the City of Raleigh, the "end user" of this Phase I ESA. The "end user" questionnaire was completed by Mr. Pollard, and it is contained behind the second purple divider page in the Exhibits section of this report.

4.3 Aerial Photograph Review

The study included a review of aerial photographs available at the U. S. Department of Agriculture (USDA), Natural Resources Conservation Office (formerly the Soil Conservation Service) in Raleigh, North Carolina. The 1981, 1988, 1999, 2005, and 2010 aerial photos were obtained from the Wake County web site. The first available aerial photograph of the subject property was taken in 1949. Aerial photographs reviewed included:

- Photo BOP-3F-37, Grid K-10a, flown March 29, 1949 - USDA Natural Resources Conservation
- Photo BOP-5FF-22, Grid K-10, flown March 15, 1965- USDA Natural Resources Conservation
- 1981 aerial photo – Wake County GIS/web site
- 1988 aerial photo – Wake County GIS/web site
- Photo NAPP 6136-28, Grid E-8, flown February 19, 1993- USDA Natural Resources Conservation
- 1999 aerial photo – Wake County GIS/web site
- 2005 aerial photo – Wake County GIS/web site
- 2010 aerial photo - Wake County GIS/web site

Aerial photographs were reviewed from years 1949, 1965, 1981, 1988, 1993, 1999, 2005, and 2010. Due to the scale of the 1949 and 1965 photos, it was difficult to determine detail, but it did appear that the subject property was used for residential. In the 1981 and 1988 photos, the subject property was utilized for residential and parking areas. In the 1993 photo, again there was a lack of detail available for review due to the photo scale. In the 1999 photo, residences were visible along S. Bloodworth Street and E. Martin Street. The remainder of the subject property appeared to be used for parking. In the 2005 and 2010 photos, it appeared that trees on the S. Bloodworth side of the subject property had been removed. The subject property appeared to be used only for parking.

4.4 Chain-of-Title Search

A discussion of prior parcel ownership is contained in Section 4.1 above. Parcel information containing past owners along with deed books and page numbers are contained in the Exhibits section of this report preceding the individual parcel property deeds behind the first purple divider page entitled “Environmental Lien Search Information”.

A review of the subject property deeds indicated that there were no environmental liens or Activity Use Limitations associated with the subject property lots.

5.0 ENVIRONMENTAL SETTING/CONDITIONS

5.1 Surface Water Characteristics

Surface water drainage characteristics were generally determined from information derived during the site reconnaissance and from review of the USGS topographic map for the West Raleigh quadrangle. No bodies of water were observed on the subject property. Drainage on the subject property varies locally, but generally the entire area appears to drain from northwest to southeast or north to south. Surface runoff can potentially enter the subject property lots from adjacent properties and roads. However, no significant source of surface water environmental contamination was identified upgradient which would be expected to cause significant environmental impact to the subject property.

5.2 Groundwater Characteristics

The geology in the area of the tract is dominated by metamorphic rocks of the Raleigh Belt (Geologic Map of North Carolina - 1985). Rock types anticipated in the area of the subject property would include injected gneisses such as biotite gneisses and schist. The hydrogeological system in the area of the subject property includes both the surficial sediments and underlying bedrock. Groundwater in sediments is present in pores between individual sediment grains. In bedrock, groundwater is present predominantly in horizontal and subhorizontal unloading fractures, and in near, vertical stress fractures. Groundwater depths are variable and generally approach ground surface near streams and rivers. Based on the historical groundwater flow characteristics in this area, groundwater flow typically mirrors surface topography. Accordingly, groundwater flow in the vicinity of the subject property would be expected to trend generally from northwest to southeast or north to south. Potential threats to groundwater were identified at the U. S. Post Office maintenance building to the north across E. Hargett Street, and at the Killo Exterminating business to the west along S. Person Street in the same city block.

6.0 SITE INSPECTION

6.1 Site Inspection Methodology

A site walkover on the subject property was performed by *GeoLogix* personnel on May 30, 2013. Site walkovers are performed for the purpose of observing conditions which might indicate the presence of environmental contaminants on the subject property and/or on adjacent properties. The limits of the properties included in this study are depicted in the Site Property Map included with this report (Appendix B). The following site descriptions are based on field observations and supplemented by information from other sources.

6.2 Site Inspection Observations

6.2.1 Roadway Access to Site

The subject property parcels are accessible from E. Hargett Street, S. Bloodworth Street, and E. Martin Street.

6.2.2 Wooded Areas and Variations of Vegetation

There were some trees along the central and northern parts of the western property boundary, and some additional trees located between the paved and gravel parking lots which bound E. Hargett Street in the northern region of the subject property. However, most of the subject property is open and grassed.

6.2.3 Water Bodies, Swamps, Rivers, Lakes, Pits, Ponds, Lagoons, Surface Impoundments or Holding Ponds

No water bodies, swamps, rivers, lakes, pits, ponds, lagoons, holding ponds, surface impoundments, or other surface water bodies were observed on site.

6.2.4 Solid Waste, Landfill, Dumping, Disturbed Soils, Direct Burial Activity

Some solid waste was observed on the subject property. Most of the waste was concentrated in one area, the west-central region of the subject property, where multiple bags of waste were observed disposed (see picture in Appendix E). Otherwise, only scattered domestic trash was observed on site. There was no evidence of landfilling or burial of solid waste observed. No adverse environmental impact to the subject property would be anticipated from the solid

waste observed disposed on any of the lots. There was no evidence of hazardous wastes or toxic substances used or stored on the subject property.

6.2.5 Underground/Aboveground Storage Tanks

No underground storage tanks (USTs) are registered on the subject property lots. No fill pipes, vent pipes, mounds, or depressions suggesting the existence of a UST were observed on the subject property during the site reconnaissance. No above ground fuel storage tanks were observed on site.

6.2.6 Potable Water and Sewage Disposal

Potable water and sanitary waste services are not currently active, but water and sanitary waste services would be available via the City of Raleigh systems upon connection.

6.2.7 Drains, Floor Drains and Sumps

No drains or floor drains were observed on the subject property.

6.2.8 Wells, Piezometers and Other Subsurface Monitoring Devices

No wells, piezometers or other subsurface monitoring devices were specifically observed on the subject property parcels during the site reconnaissance.

6.2.9 Wastewater Discharges

There are no wastewater discharges generated on the subject property.

6.2.10 Groundwater or Surface Water Contamination

No evidence of groundwater or surface water contamination was observed on the subject property during the site reconnaissance. However, without installation of monitoring wells and collection of surface water and groundwater samples, *GeoLogix* is unable to determine the actual quality of surface water or groundwater located in the vicinity of the subject property.

6.2.11 Stained or Discolored Soils or Pavement

No stained or discolored soils or pavement were observed on the subject property during the site reconnaissance.

6.2.12 Distressed, Discolored, or Stained Vegetation

There was no evidence of chemically distressed, discolored, or stained vegetation observed on the subject property during the site reconnaissance.

6.2.13 Buildings, Structures, Foundations, and Old Ruins

There were no structures observed on the subject property during the site walkover. What appeared to be structural remnants (see pictures in Appendix E) were observed in the central region of the subject property and also at a couple of places along the southern part of the western property boundary.

6.2.14 Electrical Equipment/Suspected PCB-Filled Equipment

Pole-mount electrical transformers were observed on or near the subject property. There was no evidence of a release of dielectric fluid from any of the transformers. No other electrical equipment was observed on the subject property lots during the site reconnaissance.

6.2.15 Utilities

Electrical, phone, natural gas, water, and sanitary sewer services were available at many locations of the subject property.

6.2.16 Foul/Suspicious Odors

There was no evidence of foul or suspicious odors noted during the site reconnaissance.

6.2.17 Hazardous Substances/Hazardous Wastes

No evidence of hazardous substances or hazardous wastes was observed during the site reconnaissance.

6.2.18 Chemicals, Chemical Spills or Releases

There was no evidence of chemical spills or releases into the environment observed on the subject property during the site reconnaissance.

6.2.19 Storage Containers and Drums

No significant storage containers were observed on the subject property lots during the site reconnaissance.

6.2.20 Petroleum Products

No containers of petroleum products were observed during the site walkover.

6.2.21 Pesticides, Herbicides, Soil Conditioners, Fertilizers and Farm Wastes

There was no evidence of any of the above products stored on the subject property during the site reconnaissance.

6.2.22 Air Emissions

There are no activities on the subject property which would generate air emissions.

6.2.23 Other Known or Observed Environmentally Sensitive or Suspected Conditions

There were no other known or observed environmentally sensitive or suspected conditions observed during the site reconnaissance.

7.0 ENVIRONMENTAL/REGULATORY AGENCY REVIEW

7.1 Federal and State Regulatory Agencies

Current environmental regulatory agency information was reviewed. A review of environmental regulatory agency database information was conducted using recent information obtained from Environmental Data Resources (EDR). A copy of the EDR database information is contained in Appendix F of this report.

The following significant environmental regulatory agency databases, among others, were reviewed:

- Federal National Priorities List (NPL). The NPL is the U. S. Environmental Protection Agency's (EPA) database of uncontrolled or abandoned hazardous waste sites identified for priority remedial actions under the Superfund program.

- Resource Conservation and Recovery Act (RCRA) notifiers. This database is a compilation of facilities which have notified appropriate environmental regulatory agencies that they generate, store, transport, treat and/or dispose of hazardous wastes.

- UST/groundwater/release incidents. This is a database of sites where release incidents involving Underground Storage Tanks (USTs) and certain other spills which may affect groundwater are reported.

- CERCLIS (Comprehensive Environmental Response, Compensation and Liability Information System) sites. This is a compilation of facilities which EPA has investigated or is currently investigating for a release or threatened release of hazardous substances as defined by CERCLA.

- Solid waste facilities. This is a database of permitted solid waste facilities.

- Hazardous Waste/Hazardous Substances Disposal sites. This is a database of hazardous waste sites and hazardous substances disposal sites.

The following was indicated during the review of environmental regulatory agency listings:

- No NPL sites were identified within the standard ASTM search distance of one mile.

- Two (2) facilities (Acme Cleaners and Federal Courthouse Building) were identified in the EDR map findings summary as RCRA hazardous waste notifiers within or close to the standard ASTM search distance of one mile in the EDR report. There was also a RCRA-CORRACTS (Ashland) facility identified. Due to the nature and/or location of

these facilities relative to the subject property, no adverse environmental impact to the subject property would be anticipated.

- Forty-six (46) UST/groundwater incidents/releases were identified within or close to the standard ASTM search distance of ½ mile. The closest incident, the Moore Square Museums Magnet Middle School (also known as the "Ask Mart" location) facility at 328 E. Martin Street, has been closed out by the N. C. Department of Environment & Natural Resources (DENR). The nearest incident which has not been closed out is the U. S. General Services Administration (Post Office) at 310 New Bern Avenue. The Moore Square school incident is situated downgradient from the subject property and would not be anticipated to cause an adverse impact to the subject property. The potential impact to the subject property from the release at the U. S. Post Office facility cannot be determined from the available information. None of the other identified facilities would appear to pose a risk to the subject property.

- No standard CERCLIS facilities were identified within or close to the standard ASTM search distance of ½ mile in the EDR map findings summary.

- No permitted solid waste management facilities were identified within ½ mile of the subject property on the database of permitted solid waste facilities.

- Nine (9) facilities were identified within or close to standard ASTM search distances from the subject property on the State Hazardous Waste Sites database. The properties would not be anticipated to adversely affect the subject property. The nearest identified facility is over one-eighth mile from the subject property as well as downgradient. Three (3) Hazardous Substances Disposal Sites were identified in the database search. They were Ashland, Inc., and Raleigh Coal Gas Plant Nos. 1 and 2. Due to the location of these identified facilities relative to the subject property (at least one-half mile away), no adverse environmental impact to the subject property would be anticipated.

The subject property was not identified in any of the databases.

The entire EDR radial database map consisted of 306 pages. Only the pages for incidents and facilities identified on nearby properties to the subject property were printed and included in Appendix F.

7.2 Sanborn Maps

Sanborn fire insurance maps were available for the subject property parcels from years 1896, 1903, 1909, 1914, 1950, and 1972. The Sanborns indicated that the subject property parcels appeared to be used for residential properties during all of those years. The Sanborn Maps can be found immediately behind a yellow divider page following the EDR radial database information in Appendix F of this report.

7.3 Environmental Lien Search

An environmental lien search of the twelve (12) subject property deeds was conducted. No environmental liens or Activity Use Limitations (AUL) were found associated with the subject property deeds. A copy of the deeds for the parcels comprising the subject property lots can be found behind the first purple divider page in the Exhibits section of this report. Also, copies of prior ownership information including deed books and page numbers obtained from the Wake County GIS/web site precede the deed copies.

7.4 City Directory Information

City Directory information for the subject property was ordered from EDR. Appropriate pages from the City Directory information covering the subject property addresses were printed and can be found behind a yellow divider page in Section F of this report. The City Directory information confirmed information gathered from aerial photographs and Sanborn Maps that the property has generally remained residential over the years, and more recently, after demolition of the residences, used for parking.

Some of the residences along E. Martin Street, according to the City Directory information, apparently had small businesses operating on the premises.

8.0 CONCLUSIONS AND RECOMMENDATIONS

On May 30, 2013, *GeoLogix* personnel conducted the site reconnaissance portion of a Phase I Environmental Site Assessment on twelve (12) individual parcels of land located between E. Hargett Street to the north, S. Bloodworth Street to the east, and E. Martin Street to the south in downtown Raleigh, North Carolina. The subject property parcels are situated in what is commonly referred to as city block A-45. A list of the specific property addresses of the lots is contained in Section 3.1 of this report.

No structures were observed on the subject property lots during the site reconnaissance. What appeared to be a few structural remnants were observed in the central region and along the western property boundary of the subject property.

Aerial photographs were reviewed from years 1949, 1965, 1981, 1988, 1993, 1999, 2005, and 2010. Due to the scale of the 1949, 1965, and 1993 photos, it was difficult to determine detail, but the subject property appeared to be residential in nature. In the 1981, 1988, and 1999 photos, the subject property was utilized for residential and parking areas. In the 2005 and 2010 photos, it appeared that the subject property was used only for parking.

Three (3) RCRA hazardous waste notifiers (including two standard RCRA facilities and one RCRA-CORRACTS), forty-six (46) UST/groundwater/release incidents, nine (9) State Hazardous Waste Sites, and three (3) Hazardous Substances Disposal Sites were identified within or close to standard ASTM search distances of the subject property in a review of environmental regulatory agency informational databases. None of the identified incidents were situated on the subject property. The EDR database information identified two off-site facilities with the potential to adversely impact the subject property parcels. One was the U. S. Postal Service (General Services Administration), and the other was the Moore Square Museums Magnet Middle School to the southwest across E. Martin Street. Soil and/or groundwater contamination have been identified at both locations. The U. S. Post Office release incident would appear to have more potential to adversely impact the subject property since it is upgradient, and the school is downgradient, from the subject property.

In addition to the potential impacts identified on nearby properties in the EDR database report, information furnished to *GeoLogix* by the City of Raleigh indicated soil and groundwater contamination identified on adjacent properties to the west in a recently completed Limited Phase II Environmental Assessment by another consultant.

City Directory information ordered from EDR confirmed aerial photographs and Sanborn Maps information that the property has generally remained residential over the years, and more recently, after demolition of the residences, the subject property has been used for parking.

No environmental liens or Activity Use Limitations (AUL) were found associated with the subject property deeds in a review of the subject property deeds.

Solid waste was observed on the subject property. However, it was generally minimal in volume. Some plastic bags of waste were observed along the central part of the western property boundary. Otherwise, along pieces of domestic trash were observed at various locations on site. There was no evidence of landfilling or burial of solid waste observed. No significant adverse environmental impact to the subject property would be anticipated from the solid waste observed disposed on any of the lots. There was no evidence of hazardous wastes or toxic substances observed used or stored on the subject property.

There was no physical evidence observed during the site reconnaissance to indicate the existence of an underground fuel storage tank (UST) on the subject property. No above ground fuel storage tanks were observed on site.

In summary, this Phase I ESA revealed no specific observed evidence of environmental contamination or impairment on the subject property for in-scope items. There were no Recognized Environmental Conditions (RECs) observed. The solid waste observed on site does not rise to the level of a REC in the opinion of the environmental professional. However, soil/groundwater contamination has been identified on adjacent properties.

Conclusions – *GeoLogix* has performed a Phase I Environmental Site Assessment in general conformance with the scope and limitations of ASTM Practice E-1527-05 on twelve (12) parcels of land included in the subject property on City Block A-45 in downtown Raleigh, North Carolina. There was one exception/deviation to, or deletion from, this practice: (1) as previously mentioned, a formal chain-of-title was not conducted as the use of the land was easily determined through other sources.

This assessment did not reveal any evidence of a Recognized Environmental Condition (REC) in connection with the subject property. However, soil and groundwater contaminants were identified on adjacent property to the west, and release incidents identified on properties to the north and south of the subject property. Accordingly, after consultation with City of Raleigh personnel, a Limited Phase II ESA to include soil and groundwater sampling was planned to commence shortly after beginning the Phase I ESA.

I declare that, to the best of my professional knowledge and belief, I meet the definition of *Environmental Professional* as defined in 40 CFR 312.10. I have the specific qualifications based on education, training, and experience to assess a *property* of the nature, history, and setting of the subject *property*. I have developed and performed the all appropriate inquiries in general conformance with the standards and practices set forth in 40 CFR Part 312.

Robert H. Livermon, Jr., P. G.



APPENDICES

A. **Site Vicinity Map**

B. **Site Property Map**

C. **Aerial Photographs of Subject Property**

D. **U. S. Geological Survey Topographic Map**

E. **Representative Photographs of Subject Property**

F. **Regulatory Agency Information/Database Search**

G. ***GeoLogix/*Geologic Strategies, P.C. – Qualifications of Personnel**

Exhibits:

1. **Environmental Lien Search Information**
2. **"End User" Questionnaire**
3. **Questionnaire – Subject Property Owner**


Appendix A

Site Vicinity Map

Google

Address **218 S Bloodworth St**
Raleigh, NC 27601

Get Google Maps on your phone
Text the word "GMAPS" to 466453

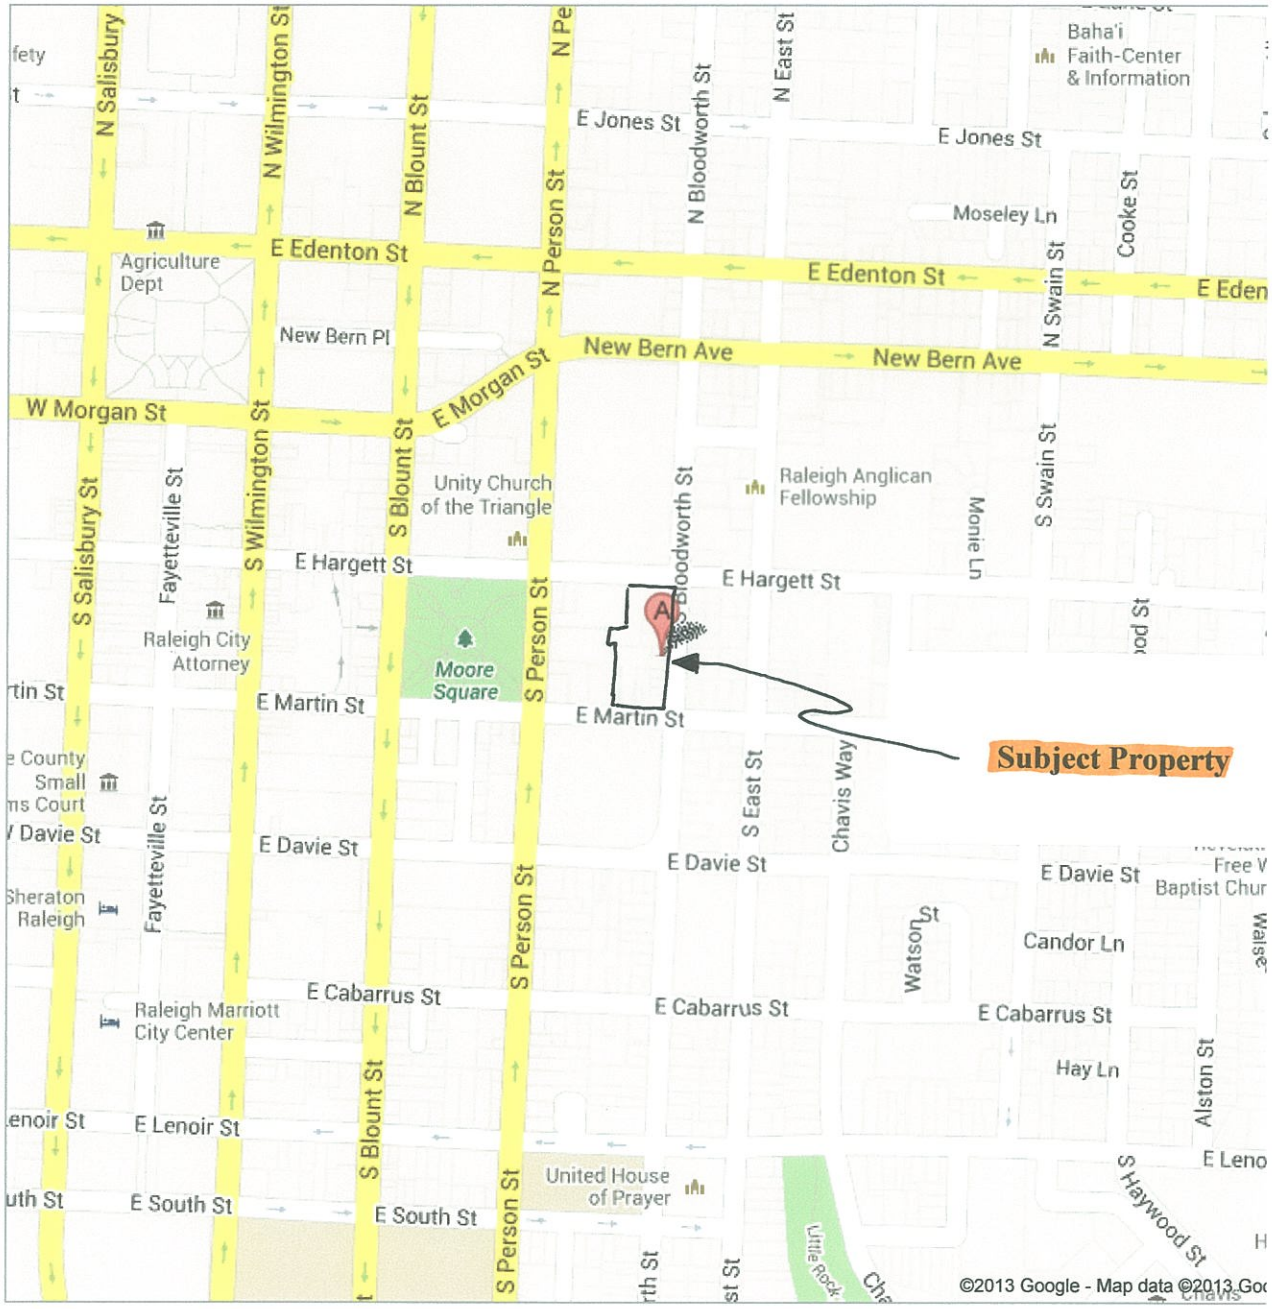

Appendix B

Site Property Map



MAP TITLE

N

0 50 100 200 Feet

1 inch = 100 feet

Disclaimer


*iMaps makes every effort to produce and publish the most current and accurate information possible. However, the maps are produced for information purposes, and are **NOT** surveys. No warranties, expressed or implied ,are provided for the data therein, its use,or its interpretation.*

Appendix C

Aerial Photographs of Subject Property



U. S. Department of Agriculture
Natural Resources Conservation
Aerial Photo BOP-3F-37, Grid K-10a
March 29, 1949

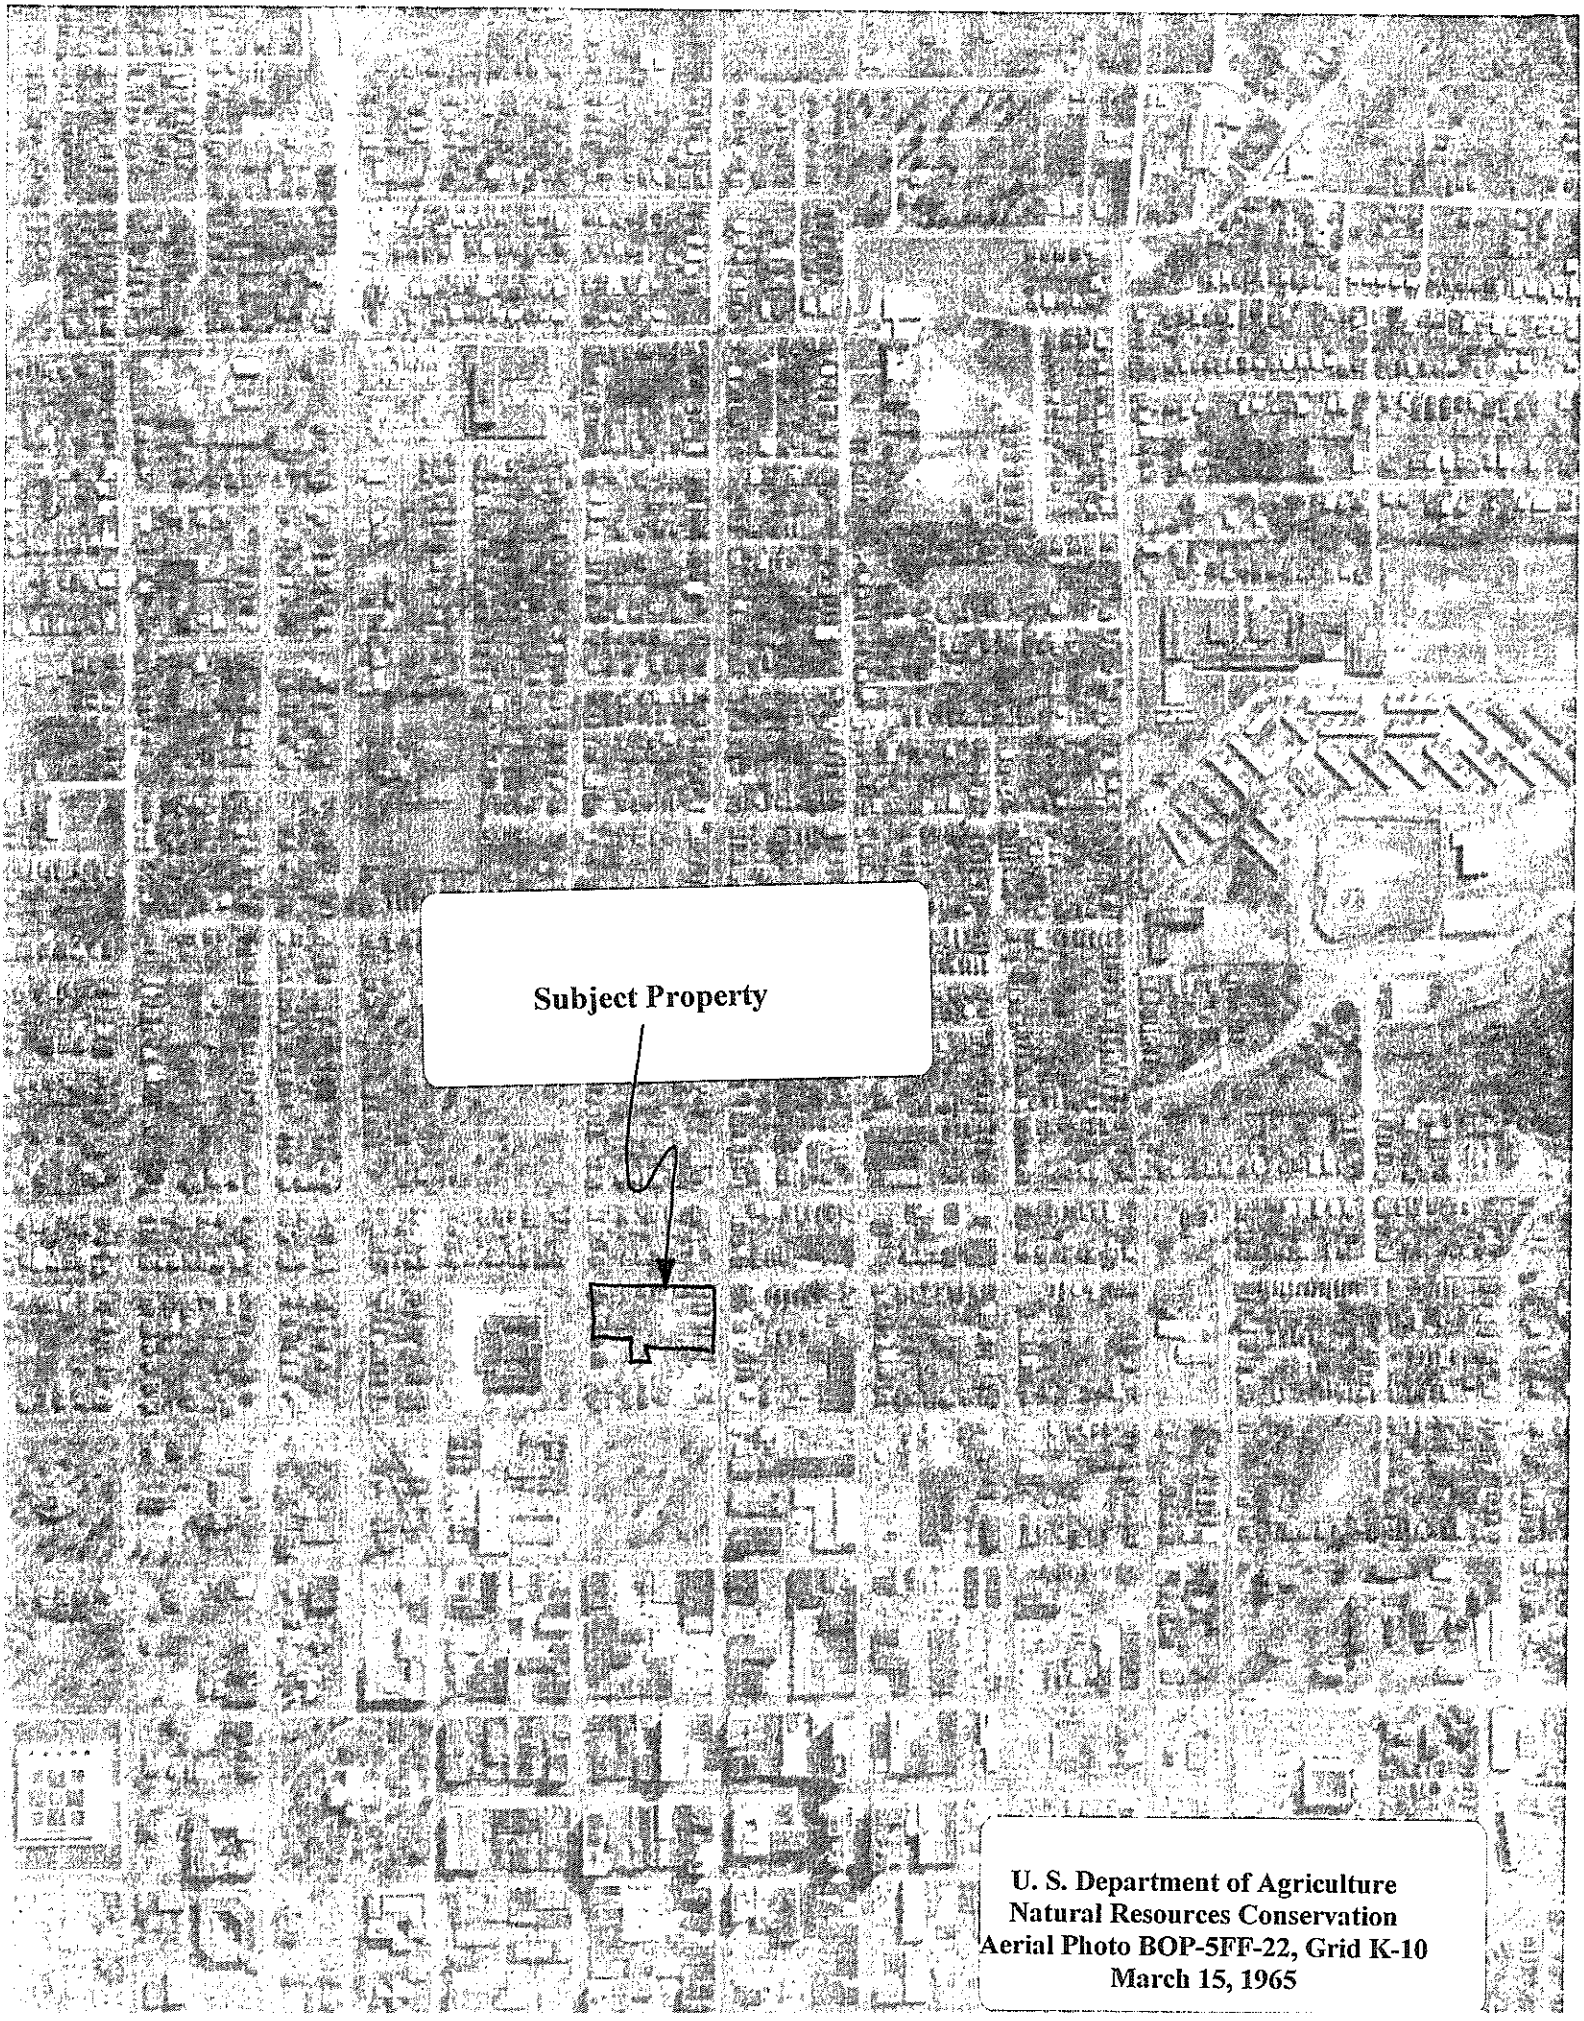

U. S. Department of Agriculture
Natural Resources Conservation
Aerial Photo BOP-5FF-22, Grid K-10
March 15, 1965



MAP TITLE

Subject Property

N

0 50 100 200 Feet

1 inch = 100 feet

Aerial Photograph
Wake County GIS
1981



MAP TITLE


Subject Property

N

0 50 100 200 Feet

1 inch = 100 feet

Aerial Photograph
Wake County GIS
1988

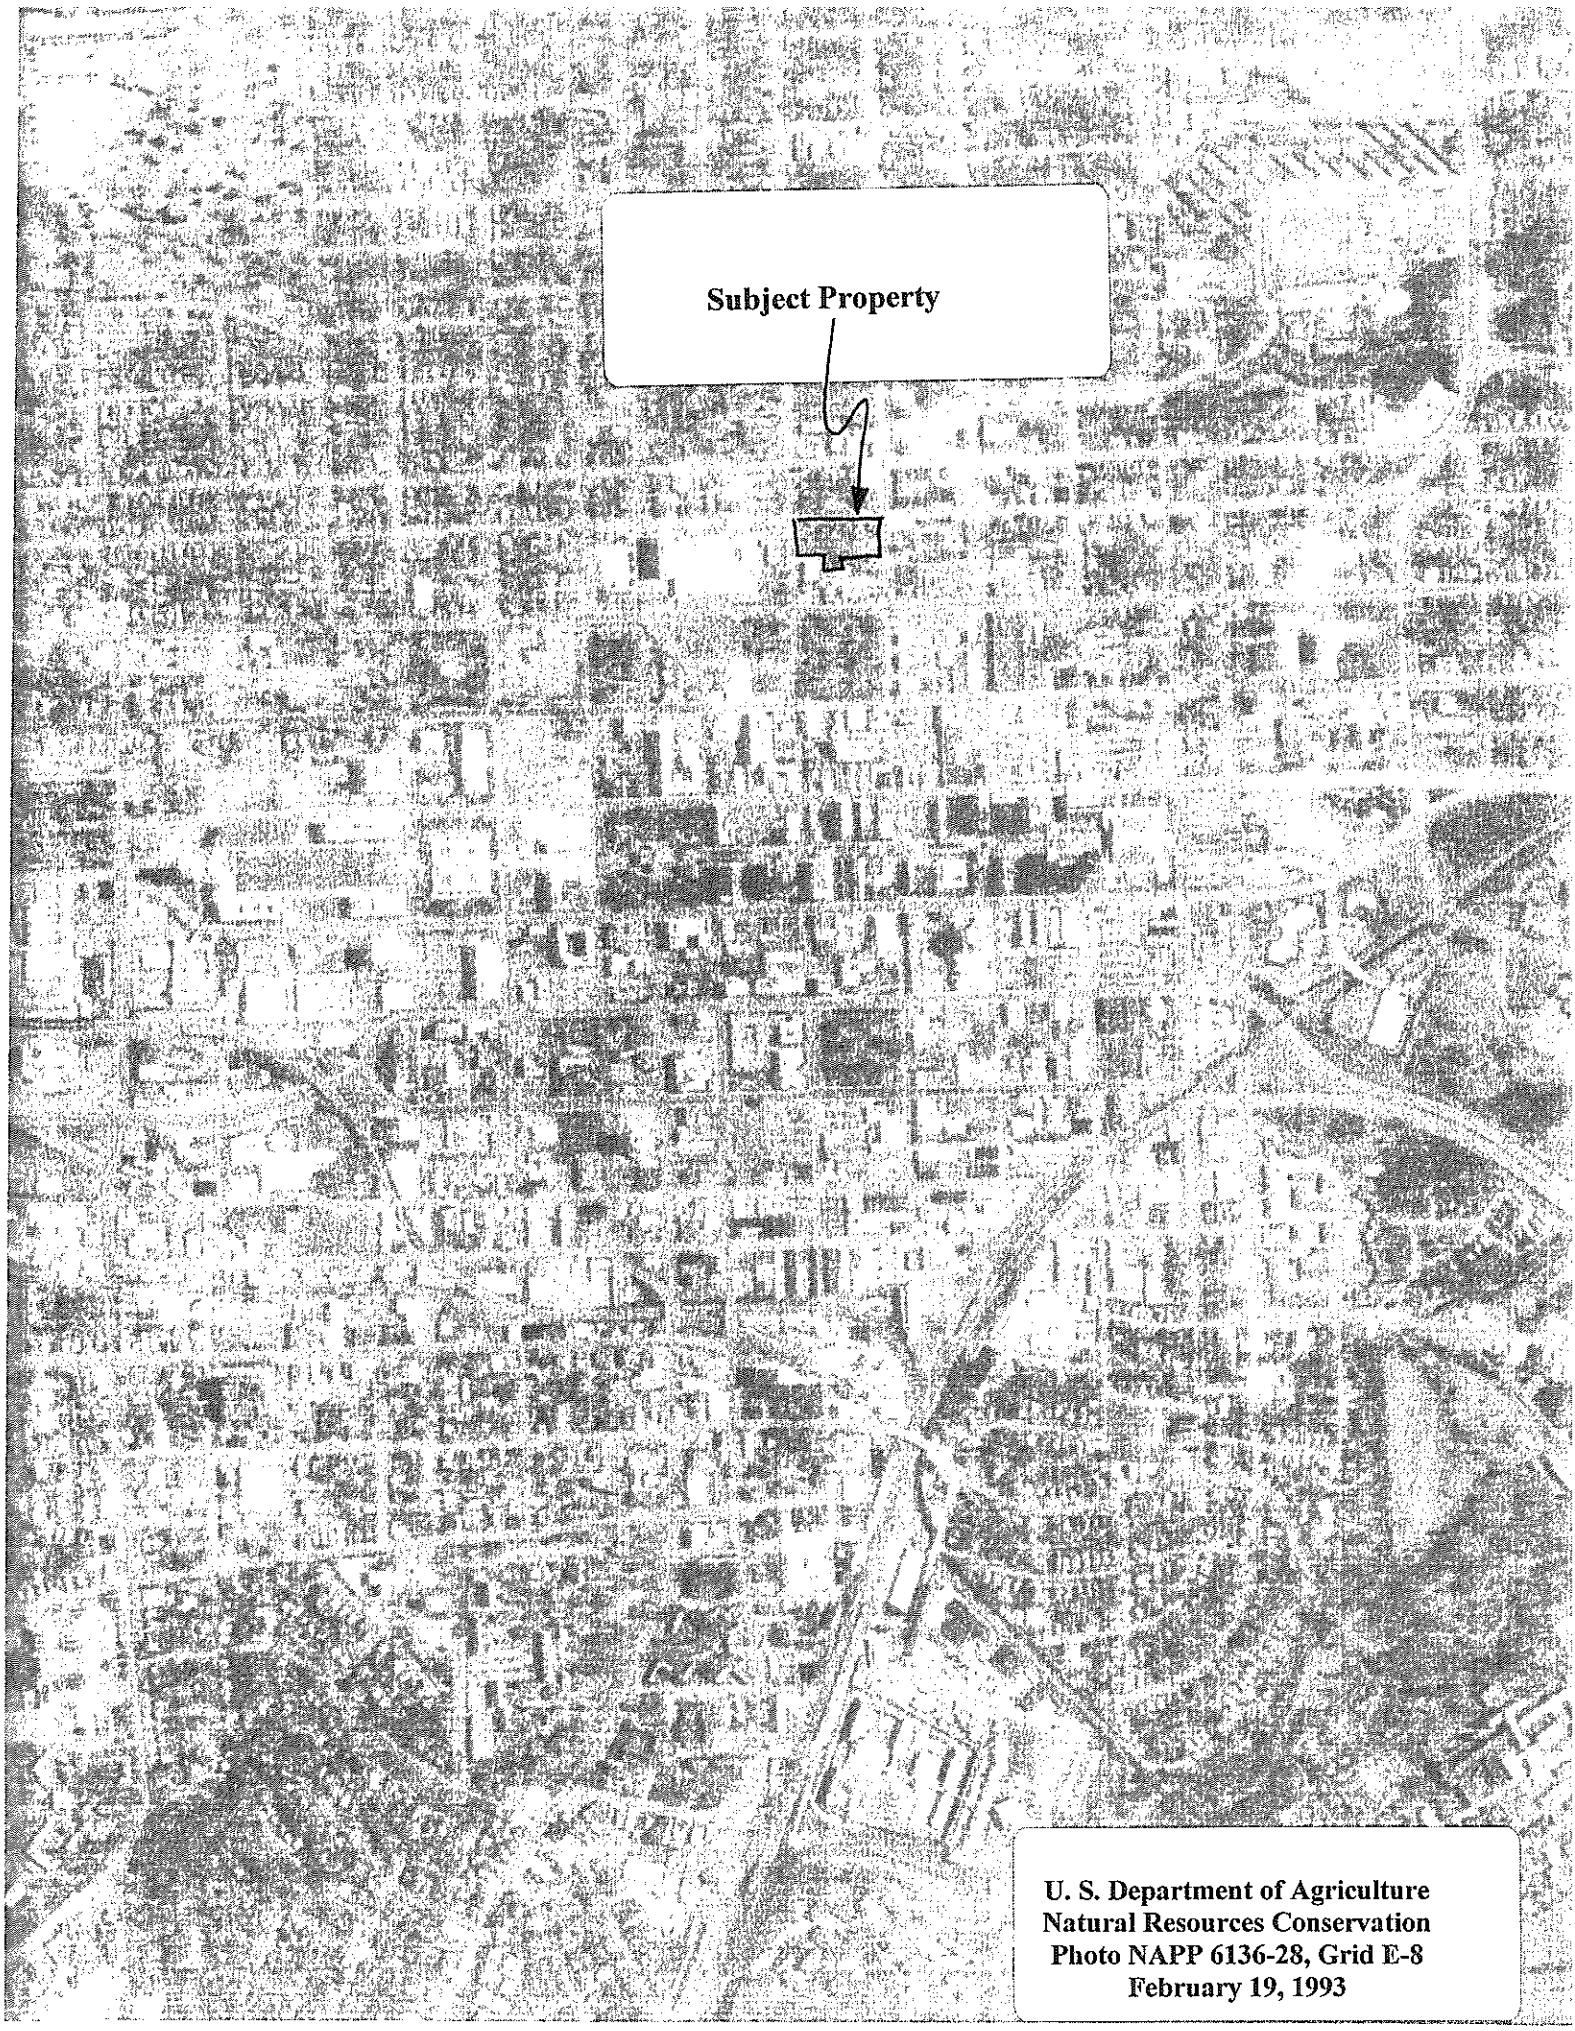

U. S. Department of Agriculture
Natural Resources Conservation
Photo NAPP 6136-28, Grid E-8
February 19, 1993



MAP TITLE

Subject Property

N

0 50 100 200 Feet

1 inch = 100 feet

Aerial Photograph
Wake County GIS
1999

s,
d
on.



MAP TITLE

Subject Property

N

0 50 100 200 Feet

1 inch = 100 feet

Aerial Photograph
Wake County GIS
2005

n.



MAP TITLE

Subject Property

N

0 50 100 200 Feet

1 inch = 100 feet

Aerial Photograph
Wake County GIS
2010

Appendix D

U. S. Geological Survey Topographic Map



INTERIOR - GEOLOGICAL SURVEY, RESTON, VIRGINIA - 2004

ROAD CLASSIFICATION

Primary highway hard surface .....

Secondary highway hard surface .....

Light-duty road, hard or improved surface .....

Unimproved road .....

NC

Appendix E

Representative Photographs of Subject Property



Paved Parking Lot in Northwest Corner of Subject Property - Facing South From E. Hargett St.



Paved Parking Area - Indention in Western Property Boundary Behind Raleigh Rescue Mission Property



Possible Old Structural Remnants in Central Region of Subject Property



Solid Waste Disposed Near Western Property Boundary – West-Central Region of Subject Property



Possible Old Structural Remnants Adjacent to Western Property Boundary



Facing North Along Western Property Line From Southwest Corner of Subject Property at E. Martin Street



Facing East Along Southern Property Line From Southwest Corner of Subject Property



Steps to Possible Former Residence Along E. Martin Street



Facing North Along Eastern Property Line (S. Bloodworth St.) From Southeast Corner of Subject Property



Clump of Vegetation Adjacent to Eastern Property Line (S. Bloodworth Street)



Facing West Along Northern Property Line (E. Hargett Street)
From Northeast Corner of Subject Property



Gravel Parking Lot at Northeast Corner of Subject Property



General View of Eastern Half of Subject Property Facing South From Gravel Parking Lot



Facing East Along Northern Property Line (E. Hargett Street)
From Northwest Corner of Subject Property

Appendix F

Regulatory Agency Information/Database Search

EDR Radial Environmental Database

Wood Pile Block A-45
218 S. Bloodworth Street
Raleigh, NC 27601

Inquiry Number: 3618453.2s
May 29, 2013

The EDR Radius Map™ Report with GeoCheck®

EDR® Environmental Data Resources Inc

440 Wheelers Farms Road
Milford, CT 06461
Toll Free: 800.352.0050
www.edrnet.com

TABLE OF CONTENTS

SECTION	PAGE
Executive Summary	ES1
Overview Map	2
Detail Map	3
Map Findings Summary	4
Map Findings	7
Orphan Summary	243
Government Records Searched/Data Currency Tracking	GR-1

GEOCHECK ADDENDUM

Physical Setting Source Addendum	A-1
Physical Setting Source Summary	A-2
Physical Setting Source Map	A-8
Physical Setting Source Map Findings	A-9
Physical Setting Source Records Searched	A-10

Thank you for your business.
Please contact EDR at 1-800-352-0050
with any questions or comments.

Disclaimer - Copyright and Trademark Notice

This Report contains certain information obtained from a variety of public and other sources reasonably available to Environmental Data Resources, Inc. It cannot be concluded from this Report that coverage information for the target and surrounding properties does not exist from other sources. **NO WARRANTY EXPRESSED OR IMPLIED, IS MADE WHATSOEVER IN CONNECTION WITH THIS REPORT. ENVIRONMENTAL DATA RESOURCES, INC. SPECIFICALLY DISCLAIMS THE MAKING OF ANY SUCH WARRANTIES, INCLUDING WITHOUT LIMITATION, MERCHANTABILITY OR FITNESS FOR A PARTICULAR USE OR PURPOSE. ALL RISK IS ASSUMED BY THE USER. IN NO EVENT SHALL ENVIRONMENTAL DATA RESOURCES, INC. BE LIABLE TO ANYONE, WHETHER ARISING OUT OF ERRORS OR OMISSIONS, NEGLIGENCE, ACCIDENT OR ANY OTHER CAUSE, FOR ANY LOSS OF DAMAGE, INCLUDING, WITHOUT LIMITATION, SPECIAL, INCIDENTAL, CONSEQUENTIAL, OR EXEMPLARY DAMAGES. ANY LIABILITY ON THE PART OF ENVIRONMENTAL DATA RESOURCES, INC. IS STRICTLY LIMITED TO A REFUND OF THE AMOUNT PAID FOR THIS REPORT.** Purchaser accepts this Report "AS IS". Any analyses, estimates, ratings, environmental risk levels or risk codes provided in this Report are provided for illustrative purposes only, and are not intended to provide, nor should they be interpreted as providing any facts regarding, or prediction or forecast of, any environmental risk for any property. Only a Phase I Environmental Site Assessment performed by an environmental professional can provide information regarding the environmental risk for any property. Additionally, the information provided in this Report is not to be construed as legal advice.

Copyright 2013 by Environmental Data Resources, Inc. All rights reserved. Reproduction in any media or format, in whole or in part, of any report or map of Environmental Data Resources, Inc., or its affiliates, is prohibited without prior written permission.

EDR and its logos (including Sanborn and Sanborn Map) are trademarks of Environmental Data Resources, Inc. or its affiliates. All other trademarks used herein are the property of their respective owners.

EXECUTIVE SUMMARY

A search of available environmental records was conducted by Environmental Data Resources, Inc (EDR). The report was designed to assist parties seeking to meet the search requirements of EPA's Standards and Practices for All Appropriate Inquiries (40 CFR Part 312), the ASTM Standard Practice for Environmental Site Assessments (E 1527-05) or custom requirements developed for the evaluation of environmental risk associated with a parcel of real estate.

TARGET PROPERTY INFORMATION

ADDRESS

218 S. BLOODWORTH STREET
RALEIGH, NC 27601

COORDINATES

Latitude (North):	35.7774000 - 35° 46' 38.64''
Longitude (West):	78.6337000 - 78° 38' 1.32''
Universal Tranverse Mercator:	Zone 17
UTM X (Meters):	713891.2
UTM Y (Meters):	3961642.5
Elevation:	310 ft. above sea level

USGS TOPOGRAPHIC MAP ASSOCIATED WITH TARGET PROPERTY

Target Property Map:	35078-G6 RALEIGH WEST, NC
Most Recent Revision:	1993
East Map:	35078-G5 RALEIGH EAST, NC
Most Recent Revision:	1993

AERIAL PHOTOGRAPHY IN THIS REPORT

Photo Year:	2012
Source:	USDA

TARGET PROPERTY SEARCH RESULTS

The target property was not listed in any of the databases searched by EDR.

DATABASES WITH NO MAPPED SITES

No mapped sites were found in EDR's search of available ("reasonably ascertainable ") government records either on the target property or within the search radius around the target property for the following databases:

STANDARD ENVIRONMENTAL RECORDS

Federal NPL site list

NPL---------- National Priority List

EXECUTIVE SUMMARY

Proposed NPL ---------- Proposed National Priority List Sites
NPL LIENS ---------- Federal Superfund Liens

Federal Delisted NPL site list

Delisted NPL ---------- National Priority List Deletions

Federal CERCLIS list

FEDERAL FACILITY ---------- Federal Facility Site Information listing

Federal RCRA generators list

RCRA-LQG ---------- RCRA - Large Quantity Generators

Federal institutional controls / engineering controls registries

US ENG CONTROLS ---------- Engineering Controls Sites List
US INST CONTROL ---------- Sites with Institutional Controls
LUCIS ---------- Land Use Control Information System

Federal ERNS list

ERNS ---------- Emergency Response Notification System

State and tribal landfill and/or solid waste disposal site lists

NC SWF/LF ---------- List of Solid Waste Facilities
NC OLI ---------- Old Landfill Inventory

State and tribal leaking storage tank lists

INDIAN LUST ---------- Leaking Underground Storage Tanks on Indian Land

State and tribal registered storage tank lists

NC AST ---------- AST Database
INDIAN UST ---------- Underground Storage Tanks on Indian Land
FEMA UST ---------- Underground Storage Tank Listing

State and tribal institutional control / engineering control registries

NC INST CONTROL ---------- No Further Action Sites With Land Use Restrictions Monitoring

State and tribal voluntary cleanup sites

INDIAN VCP ---------- Voluntary Cleanup Priority Listing

ADDITIONAL ENVIRONMENTAL RECORDS

Local Lists of Landfill / Solid Waste Disposal Sites

DEBRIS REGION 9 ---------- Torres Martinez Reservation Illegal Dump Site Locations
ODI ---------- Open Dump Inventory

NC HIST LF - Solid Waste Facility Listing
NC SWRCY - Recycling Center Listing
INDIAN ODI - Report on the Status of Open Dumps on Indian Lands

Local Lists of Hazardous waste / Contaminated Sites

US CDL - Clandestine Drug Labs
US HIST CDL - National Clandestine Laboratory Register

Local Land Records

LIENS 2 - CERCLA Lien Information

Records of Emergency Release Reports

HMIRS - Hazardous Materials Information Reporting System
NC SPILLS 90 - SPILLS 90 data from FirstSearch
NC SPILLS 80 - SPILLS 80 data from FirstSearch

Other Ascertainable Records

RCRA NonGen / NLR - RCRA - Non Generators
DOT OPS - Incident and Accident Data
DOD - Department of Defense Sites
FUDS - Formerly Used Defense Sites
CONSENT - Superfund (CERCLA) Consent Decrees
ROD - Records Of Decision
UMTRA - Uranium Mill Tailings Sites
US MINES - Mines Master Index File
TRIS - Toxic Chemical Release Inventory System
TSCA - Toxic Substances Control Act
FTTS - FIFRA/ TSCA Tracking System - FIFRA (Federal Insecticide, Fungicide, & Rodenticide Act)/TSCA (Toxic Substances Control Act)
HIST FTTS - FIFRA/TSCA Tracking System Administrative Case Listing
SSTS - Section 7 Tracking Systems
ICIS - Integrated Compliance Information System
PADS - PCB Activity Database System
MLTS - Material Licensing Tracking System
RADINFO - Radiation Information Database
RAATS - RCRA Administrative Action Tracking System
RMP - Risk Management Plans
NC UIC - Underground Injection Wells Listing
NC NPDES - NPDES Facility Location Listing
INDIAN RESERV - Indian Reservations
SCRD DRYCLEANERS - State Coalition for Remediation of Drycleaners Listing
NC COAL ASH - Coal Ash Disposal Sites
EPA WATCH LIST - EPA WATCH LIST
PRP - Potentially Responsible Parties
PCB TRANSFORMER - PCB Transformer Registration Database
COAL ASH DOE - Steam-Electric Plant Operation Data
COAL ASH EPA - Coal Combustion Residues Surface Impoundments List
LEAD SMELTERS - Lead Smelter Sites

SURROUNDING SITES: SEARCH RESULTS

Surrounding sites were identified in the following databases.

EXECUTIVE SUMMARY

Elevations have been determined from the USGS Digital Elevation Model and should be evaluated on a relative (not an absolute) basis. Relative elevation information between sites of close proximity should be field verified. Sites with an elevation equal to or higher than the target property have been differentiated below from sites with an elevation lower than the target property.
Page numbers and map identification numbers refer to the EDR Radius Map report where detailed data on individual sites can be reviewed.

Sites listed in ***bold italics*** are in multiple databases.

Unmappable (orphan) sites are not considered in the foregoing analysis.

STANDARD ENVIRONMENTAL RECORDS

Federal RCRA CORRACTS facilities list

CORRACTS: CORRACTS is a list of handlers with RCRA Corrective Action Activity. This report shows which nationally-defined corrective action core events have occurred for every handler that has had corrective action activity.

A review of the CORRACTS list, as provided by EDR, and dated 02/12/2013 has revealed that there is 1 CORRACTS site within approximately 1 mile of the target property.

Lower Elevation	Address	Direction / Distance	Map ID	Page
ASHLAND INC.	***1415 BLOODWORTH ST***	***S 1/2 - 1 (0.963 mi.)***	***92***	***222***

Federal RCRA generators list

RCRA-CESQG: RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Conditionally exempt small quantity generators (CESQGs) generate less than 100 kg of hazardous waste, or less than 1 kg of acutely hazardous waste per month.

A review of the RCRA-CESQG list, as provided by EDR, and dated 02/12/2013 has revealed that there are 2 RCRA-CESQG sites within approximately 0.25 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
ACME CLEANERS	***331 NEW BERN AVE***	***N 1/8 - 1/4 (0.198 mi.)***	***F20***	***54***
FEDERAL COURTHOUSE BLDG	***310 NEW BERN AVE***	***NNW 1/8 - 1/4 (0.200 mi.)***	***F22***	***58***

State- and tribal - equivalent NPL

NC HSDS: The Hazardous Substance Disposal Sites list contains locations of uncontrolled and unregulated hazardous waste sites. The file contains sites on the national priority list as well as the state priority list. The data source is the North Carolina Center for Geographic Information and Analysis.

A review of the NC HSDS list, as provided by EDR, and dated 08/09/2011 has revealed that there are 3 NC HSDS sites within approximately 1 mile of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
ASHLAND CHEM CO		S 1/2 - 1 (0.891 mi.)	0	7
RALEIGH COAL GAS PLANT NO. 1		WSW 1/2 - 1 (0.520 mi.)	0	7
RALEIGH COAL GAS PLANT NO. 2		WSW 1/2 - 1 (0.759 mi.)	0	7

State- and tribal - equivalent CERCLIS

NC SHWS: The State Hazardous Waste Sites records are the states' equivalent to CERCLIS. These sites may or may not already be listed on the federal CERCLIS list. Priority sites planned for cleanup using state funds (state equivalent of Superfund) are identified along with sites where cleanup will be paid for by potentially responsible parties. The data come from the Department of Environment & Natural Resources' Inactive Hazardous Sites Program.

A review of the NC SHWS list, as provided by EDR, and dated 01/15/2013 has revealed that there are 9 NC SHWS sites within approximately 1 mile of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
CITY OF RALEIGH PROPERTY	***702 E MARTIN ST***	***E 1/4 - 1/2 (0.368 mi.)***	***M48***	***129***
RALEIGH TTA-WILSON PARCEL	200 S WEST ST	W 1/2 - 1 (0.697 mi.)	86	217
RALEIGH TTA-SE PARCEL	S WEST ST & MORGAN ST	WNW 1/2 - 1 (0.709 mi.)	Z87	217
RALEIGH TTA-DILLON PARCEL A	102 S WEST ST	WNW 1/2 - 1 (0.709 mi.)	Z88	217
ROGERS REALTY PROPERTY	***500 WEST MORGAN, 10 S.***	***WNW 1/2 - 1 (0.710 mi.)***	***Z89***	***217***

Lower Elevation	Address	Direction / Distance	Map ID	Page
RALEIGH WELDING WORKS (FORMER)	***414 SOUTH EAST STREET***	***SSE 1/8 - 1/4 (0.169 mi.)***	***E13***	***43***
RALEIGH COAL GAS PLANT NO. 1	***S. MCDOWELL ST AT W. CA***	***WSW 1/2 - 1 (0.541 mi.)***	***Y83***	***212***
CONTEMPORARY ART MUSEUM	***409 W MARTIN ST***	***W 1/2 - 1 (0.650 mi.)***	***85***	***215***
GLENWOOD AVENUE	***413 SOUTH GLENWOOD AVEN***	***NW 1/2 - 1 (0.948 mi.)***	***91***	***219***

State and tribal leaking storage tank lists

NC LUST: The Leaking Underground Storage Tank Incidents Management Database contains an inventory of reported leaking underground storage tank incidents. The data come from the Department of Environment, & Natural Resources' Incidents by Address.

A review of the NC LUST list, as provided by EDR, and dated 02/08/2013 has revealed that there are 46 NC LUST sites within approximately 0.5 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
MOORE SQUARE MUSEUMS MAGNET	***328 E MARTIN ST***	***SW 0 - 1/8 (0.065 mi.)***	***A1***	***8***
Incident Phase: Closed Out				
ASK MART (FORMER)	***304 MARTIN ST***	***SW 0 - 1/8 (0.075 mi.)***	***A2***	***12***
ASK MART/ BLOCK A-42	***E MARTIN ST & S PERSON***	***WSW 0 - 1/8 (0.085 mi.)***	***B3***	***15***
Incident Phase: Closed Out				
WAREHOUSE OF TIRES	***319 S PERSON ST***	***SW 0 - 1/8 (0.096 mi.)***	***B6***	***22***
Incident Phase: Closed Out				
GENERAL SERVICES ADMIN.	***420 S PERSON ST***	***SSW 1/8 - 1/4 (0.174 mi.)***	***D15***	***48***
Incident Phase: Closed Out				
U.S. GENERAL SERVICES ADMIN.	***310 NEW BERN AVENUE***	***NNW 1/8 - 1/4 (0.200 mi.)***	***F23***	***60***
Incident Phase: Response				

EXECUTIVE SUMMARY

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
BRADLEY SPEEDOMETER SHOP Incident Phase: Closed Out	101 S. BLOUNT STREET	NW 1/8 - 1/4 (0.211 mi.)	25	65
MCLAURIN CO PARKER LOT Incident Phase: Closed Out	***120 EAST DAVIE STREET***	***WSW 1/4 - 1/2 (0.255 mi.)***	***30***	***72***
NC SCHOOL BOARD ASSOCIATION Incident Phase: Closed Out	***311 E EDENTON ST***	***N 1/4 - 1/2 (0.256 mi.)***	***31***	***79***
GODWIN ELEVATOR BLDG. (FORMER) Incident Phase: Closed Out	325 S. WILMINGTON STREE	WSW 1/4 - 1/2 (0.265 mi.)	H32	82
PARKING DECK CONSTRUCTION SITE Incident Phase: Closed Out	***331 SOUTH WILMINGTON ST***	***WSW 1/4 - 1/2 (0.267 mi.)***	***H34***	***84***
FIRST BAPTIST CHURCH	***101 S. WILMINGTON STREE***	***WNW 1/4 - 1/2 (0.287 mi.)***	***J37***	***93***
CP&L-WILMINGTON & DAVIE ST. Incident Phase: Closed Out	***WILMINGTON & DAVIE ST***	***WSW 1/4 - 1/2 (0.292 mi.)***	***39***	***97***
HUDSON BELK CO. Incident Phase: Response	***319 FAYETTEVILLE ST. MA***	***W 1/4 - 1/2 (0.317 mi.)***	***K41***	***100***
HONEYCUTT CLEANERS	***605 NEW BERN AVE***	***NE 1/4 - 1/2 (0.335 mi.)***	***43***	***106***
CHARTER SQUARE Incident Phase: Closed Out	501 FAYETTEVILLE STREET	WSW 1/4 - 1/2 (0.353 mi.)	L45	119
NEW WAKE CO JAIL Incident Phase: Response	***330 S SALISBURY ST***	***W 1/4 - 1/2 (0.375 mi.)***	***N50***	***133***
NC MUSEUM OF NATURAL SCIENCE-G Incident Phase: Closed Out	***123 N SALISBURY ST***	***WNW 1/4 - 1/2 (0.383 mi.)***	***O52***	***137***
RALEIGH PROFESSIONAL BUILDING Incident Phase: Closed Out	***127 W HARGETT STREET***	***W 1/4 - 1/2 (0.393 mi.)***	***P53***	***140***
NC DEPARTMENT OF REVENUE Incident Phase: Closed Out	***100 W MORGAN ST***	***WNW 1/4 - 1/2 (0.394 mi.)***	***O55***	***143***
STATE FAIRGROUNDS (VAULT) Incident Phase: Closed Out	***HILLSBOROUGH RD***	***WNW 1/4 - 1/2 (0.400 mi.)***	***Q56***	***146***
MEREDITH COLLEGE BREWER CENTER Incident Phase: Closed Out	***HILLSBOROUGH ST***	***WNW 1/4 - 1/2 (0.400 mi.)***	***Q57***	***150***
MITCHELL DISTRIBUTING COMPANY Incident Phase: Closed Out	***HWY 54***	***WNW 1/4 - 1/2 (0.400 mi.)***	***Q58***	***153***
BELL SOUTH RLGHNCMO 21311 Incident Phase: Closed Out	***121 W MORGAN ST***	***WNW 1/4 - 1/2 (0.409 mi.)***	***R60***	***157***
CABARRUS ST PARKING DECK Incident Phase: Closed Out	***436 S SALISBURY ST***	***WSW 1/4 - 1/2 (0.431 mi.)***	***S63***	***162***
RALEIGH CIVIC CENTER Incident Phase: Closed Out	***500 FAYETTEVILLE ST MAL***	***SW 1/4 - 1/2 (0.431 mi.)***	***T65***	***169***
CITY OF RALEIGH CONVENTION CEN Incident Phase: Closed Out	***528 S SALISBURY ST***	***SW 1/4 - 1/2 (0.456 mi.)***	***67***	***173***
CIVIC CENTER LOTS - CITY OF RA Incident Phase: Closed Out	10 WEST SOUTH STREET	SW 1/4 - 1/2 (0.458 mi.)	68	176
NEWS & OBSERVER PUBLISHING CO. Incident Phase: Closed Out	215 S MCDOWELL ST	W 1/4 - 1/2 (0.459 mi.)	U70	182
WAKE COUNTY EMS (FORMER) Incident Phase: Response	***201 W MARTIN ST***	***W 1/4 - 1/2 (0.464 mi.)***	***V71***	***184***
NC DEPT. OF JUSTICE BLDG. Incident Phase: Closed Out	128 WEST EDENTON STREET	NW 1/4 - 1/2 (0.466 mi.)	72	187

EXECUTIVE SUMMARY

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
RALEIGH POLICE SERVICE CENTER	***110 S MCDOWELL ST***	***WNW 1/4 - 1/2 (0.476 mi.)***	***73***	***189***
Incident Phase: Response				
NC TRUCKING ASSOC.	***219 WEST MARTIN STREET***	***W 1/4 - 1/2 (0.480 mi.)***	***V74***	***192***
Incident Phase: Closed Out				
WAKE DEPT OF SOCIAL SERVICES	***201 W DAVIE ST***	***WSW 1/4 - 1/2 (0.482 mi.)***	***W76***	***195***
Incident Phase: Closed Out				
DAVIDSON HEIRS (MARTHA)	***817 COTTON ST***	***ENE 1/4 - 1/2 (0.485 mi.)***	***X78***	***199***
Incident Phase: Response				

Lower Elevation	Address	Direction / Distance	Map ID	Page
NW CORNER EAST & MARTIN STREET	***EAST & MARTIN ST***	***ESE 0 - 1/8 (0.086 mi.)***	***5***	***19***
Incident Phase: Closed Out				
KLYMAN ESTATE	***412 E DAVIE ST***	***S 1/8 - 1/4 (0.143 mi.)***	***C7***	***24***
Incident Phase: Closed Out				
CARLTON PLACE DEVELOPMENT, LLC	***415 SOUTH BLOODWORTH ST***	***S 1/8 - 1/4 (0.156 mi.)***	***C9***	***29***
Incident Phase: Closed Out				
RALEIGHS 500 E. DAVIE STREET P	500 E. DAVIE STREET	SSE 1/8 - 1/4 (0.157 mi.)	E11	34
WILKINS DETAIL AND REPAIR	***418 S EAST ST***	***SSE 1/8 - 1/4 (0.172 mi.)***	***E14***	***45***
Incident Phase: Closed Out				
DUNNS TEXACO SERVICE	***502 S BLOODWORTH STREET***	***S 1/8 - 1/4 (0.237 mi.)***	***G27***	***68***
BLOUNT STREET SERVICE STATION	***500 S BLOUNT ST***	***SW 1/4 - 1/2 (0.285 mi.)***	***I36***	***90***
Incident Phase: Closed Out				
SHAW UNIVERSI NORTHEAST CAMPUS	***E LENOIR & S BLOODWORTH***	***S 1/4 - 1/2 (0.323 mi.)***	***42***	***103***
Incident Phase: Closed Out				
IVERSON PROPERTY (TERRY)	***523 E. LANE STREET***	***NNE 1/4 - 1/2 (0.445 mi.)***	***66***	***171***
Incident Phase: Closed Out				
ENTERPRISE RENT-A-CAR	***431 SOUTH MCDOWELL STRE***	***WSW 1/4 - 1/2 (0.487 mi.)***	***80***	***203***
POOLE PROPERTY (BOBBY)	701 EAST LANE STREET	NNE 1/4 - 1/2 (0.491 mi.)	82	210
Incident Phase: Closed Out				

NC LUST TRUST: This database contains information about claims against the State Trust Funds for reimbursements for expenses incurred while remediating Leaking USTs.

A review of the NC LUST TRUST list, as provided by EDR, and dated 04/03/2013 has revealed that there are 9 NC LUST TRUST sites within approximately 0.5 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
MCLAURIN CO PARKER LOT	***120 EAST DAVIE STREET***	***WSW 1/4 - 1/2 (0.255 mi.)***	***30***	***72***
NC SCHOOL BOARD ASSOCIATION	***311 E EDENTON ST***	***N 1/4 - 1/2 (0.256 mi.)***	***31***	***79***
BELLSOUTH - MORGAN ST.	121 WEST MORGAN STREET	WNW 1/4 - 1/2 (0.409 mi.)	R61	161
CABARRUS ST PARKING DECK	***436 S SALISBURY ST***	***WSW 1/4 - 1/2 (0.431 mi.)***	***S63***	***162***
WAKE COUNTY EMS (FORMER)	***201 W MARTIN ST***	***W 1/4 - 1/2 (0.464 mi.)***	***V71***	***184***
NC TRUCKING ASSOC.	***219 WEST MARTIN STREET***	***W 1/4 - 1/2 (0.480 mi.)***	***V74***	***192***
DAVIDSON HEIRS (MARTHA)	***817 COTTON ST***	***ENE 1/4 - 1/2 (0.485 mi.)***	***X78***	***199***

Lower Elevation	Address	Direction / Distance	Map ID	Page
DAVIE STREET S/C	***412 EAST DAVIE STREET***	***S 1/8 - 1/4 (0.143 mi.)***	***C8***	***27***

Lower Elevation	Address	Direction / Distance	Map ID	Page
IVERSON PROPERTY (TERRY)	***523 E. LANE STREET***	***NNE 1/4 - 1/2 (0.445 mi.)***	***66***	***171***

NC LAST: A listing of leaking aboveground storage tank site locations.

A review of the NC LAST list, as provided by EDR, and dated 02/08/2013 has revealed that there are 7 NC LAST sites within approximately 0.5 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
WAKE COUNTY PUBLIC SCHOOLS (BL	***SOUTH PERSON AND EAST D***	***SSW 1/8 - 1/4 (0.156 mi.)***	***D10***	***31***
PARKING DECK CONSTRUCTION SITE	***331 SOUTH WILMINGTON ST***	***WSW 1/4 - 1/2 (0.267 mi.)***	***H34***	***84***
CAROLINA POWER & LIGHT	***411 FAYETTEVILLE STREET***	***WSW 1/4 - 1/2 (0.341 mi.)***	***L44***	***112***
WAKE CO. OFFICE BLDG.	***337 SOUTH SALISBURY ST.***	***W 1/4 - 1/2 (0.374 mi.)***	***N49***	***130***
STATE FAIRGROUNDS (VAULT)	***HILLSBOROUGH RD***	***WNW 1/4 - 1/2 (0.400 mi.)***	***Q56***	***146***

Lower Elevation	Address	Direction / Distance	Map ID	Page
BLOCK A-24 PARKING DECK-CABARR	***CABARRUS AND SOUTH BLOC***	***SW 1/4 - 1/2 (0.284 mi.)***	***I35***	***87***
RICHARDSON, JOHN - PROPERTY	412 E. SOUTH ST.	S 1/4 - 1/2 (0.376 mi.)	51	135

State and tribal registered storage tank lists

NC UST: The Underground Storage Tank database contains registered USTs. USTs are regulated under Subtitle I of the Resource Conservation and Recovery Act (RCRA). The data come from the Department of Environment & Natural Resources' Petroleum Underground Storage Tank Database.

A review of the NC UST list, as provided by EDR, and dated 02/12/2013 has revealed that there are 6 NC UST sites within approximately 0.25 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
GENERAL SERVICES ADMINISTRATIO	420 S PERSON STREEET	SSW 1/8 - 1/4 (0.174 mi.)	D16	51
FLOYD S PIKE ELEC CONTRACTOR I	430 NEWBURN AVE PO BOX	N 1/8 - 1/4 (0.190 mi.)	18	52
U.S. GENERAL SERVICES ADMIN.	***310 NEW BERN AVENUE***	***NNW 1/8 - 1/4 (0.200 mi.)***	***F23***	***60***
TRAILWAYS TERMINAL	313 NEW BERN AVENUE	NNW 1/8 - 1/4 (0.202 mi.)	F24	64

Lower Elevation	Address	Direction / Distance	Map ID	Page
DAVIE STREET S/C	***412 EAST DAVIE STREET***	***S 1/8 - 1/4 (0.143 mi.)***	***C8***	***27***
DUNNS TEXACO SERVICE	***502 S BLOODWORTH STREETS***	***1/8 - 1/4 (0.237 mi.)***	***G27***	***68***

State and tribal Brownfields sites

NC BROWNFIELDS: A brownfield site is an abandoned, idled, or underused property where the threat of environmental contamination has hindered its redevelopment. All of the sites in the inventory are working toward a a brownfield agreement for cleanup and liabitliy control.

A review of the NC BROWNFIELDS list, as provided by EDR, and dated 04/04/2013 has revealed that there

are 2 NC BROWNFIELDS sites within approximately 0.5 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
RBC TOWER PARKING DECK	331 S. WILMINGTON STREE	WSW 1/4 - 1/2 (0.266 mi.)	H33	84
301 FAYETTEVILLE STREET	301 FAYETTEVILLE STREET	W 1/4 - 1/2 (0.301 mi.)	K40	100

ADDITIONAL ENVIRONMENTAL RECORDS

Local Brownfield lists

US BROWNFIELDS: The EPA's listing of Brownfields properties from the Cleanups in My Community program, which provides information on Brownfields properties for which information is reported back to EPA, as well as areas served by Brownfields grant programs.

A review of the US BROWNFIELDS list, as provided by EDR, and dated 12/10/2012 has revealed that there are 5 US BROWNFIELDS sites within approximately 0.5 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
CONVENTION CENTER PARKING LOTS	***500 AND 615 FAYETTEVILL***	***WSW 1/4 - 1/2 (0.354 mi.)***	***L46***	***120***
702-706 E. MARTIN STREET	702-706 E. MARTIN STREE	E 1/4 - 1/2 (0.368 mi.)	M47	127
0 WEST SOUTH STREET	***0 WEST SOUTH STREET***	***SW 1/4 - 1/2 (0.487 mi.)***	***79***	***201***
SITE FOUR	***600-616 S. SALISBURY ST***	***SW 1/4 - 1/2 (0.491 mi.)***	***81***	***208***

Lower Elevation	Address	Direction / Distance	Map ID	Page
500 E. DAVIE STREET	***500 E. DAVIE STREET***	***SSE 1/8 - 1/4 (0.157 mi.)***	***E12***	***36***

Records of Emergency Release Reports

NC IMD: Incident Management Database.

A review of the NC IMD list, as provided by EDR, and dated 07/21/2006 has revealed that there are 45 NC IMD sites within approximately 0.5 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
MOORE SQUARE MUSEUMS MAGNET	***328 E MARTIN ST***	***SW 0 - 1/8 (0.065 mi.)***	***A1***	***8***
ASK MART (FORMER)	***304 MARTIN ST***	***SW 0 - 1/8 (0.075 mi.)***	***A2***	***12***
ASK MART/ BLOCK A-42	***E MARTIN ST & S PERSON***	***WSW 0 - 1/8 (0.085 mi.)***	***B3***	***15***
WAKE CO. PUBLIC SCHOOLS	S. PERSON ST. AND E. MA	WSW 0 - 1/8 (0.085 mi.)	B4	18
WAREHOUSE OF TIRES	***319 S PERSON ST***	***SW 0 - 1/8 (0.096 mi.)***	***B6***	***22***
WAKE COUNTY PUBLIC SCHOOLS (BL	***SOUTH PERSON AND EAST D***	***SSW 1/8 - 1/4 (0.156 mi.)***	***D10***	***31***
GENERAL SERVICES ADMIN.	***420 S PERSON ST***	***SSW 1/8 - 1/4 (0.174 mi.)***	***D15***	***48***
US POST OFFICE VMF	310 NEW BERN AVE	NNW 1/8 - 1/4 (0.200 mi.)	F21	56
MCLAURIN CO PARKER LOT	***120 EAST DAVIE STREET***	***WSW 1/4 - 1/2 (0.255 mi.)***	***30***	***72***
NC SCHOOL BOARD ASSOCIATION	***311 E EDENTON ST***	***N 1/4 - 1/2 (0.256 mi.)***	***31***	***79***
FIRST BAPTIST CHURCH	***101 S. WILMINGTON STREE***	***WNW 1/4 - 1/2 (0.287 mi.)***	***J37***	***93***
RALEIGH, CITY OF	101 E MORGAN ST	WNW 1/4 - 1/2 (0.287 mi.)	J38	96
CP&L-WILMINGTON & DAVIE ST.	***WILMINGTON & DAVIE ST***	***WSW 1/4 - 1/2 (0.292 mi.)***	***39***	***97***
HUDSON BELK CO.	***319 FAYETTEVILLE ST. MA***	***W 1/4 - 1/2 (0.317 mi.)***	***K41***	***100***
HONEYCUTT CLEANERS	***605 NEW BERN AVE***	***NE 1/4 - 1/2 (0.335 mi.)***	***43***	***106***
CAROLINA POWER & LIGHT	***411 FAYETTEVILLE STREET***	***WSW 1/4 - 1/2 (0.341 mi.)***	***L44***	***112***

EXECUTIVE SUMMARY

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
WAKE CO. OFFICE BLDG.	***337 SOUTH SALISBURY ST.***	***W 1/4 - 1/2 (0.374 mi.)***	***N49***	***130***
NEW WAKE CO JAIL	***330 S SALISBURY ST***	***W 1/4 - 1/2 (0.375 mi.)***	***N50***	***133***
NC MUSEUM OF NATURAL SCIENCE-G	***123 N SALISBURY ST***	***WNW 1/4 - 1/2 (0.383 mi.)***	***O52***	***137***
RALEIGH PROFESSIONAL BLDG.	127 W HARGETT ST	W 1/4 - 1/2 (0.393 mi.)	P54	142
NC DEPARTMENT OF REVENUE	***100 W MORGAN ST***	***WNW 1/4 - 1/2 (0.394 mi.)***	***O55***	***143***
STATE FAIRGROUNDS (VAULT)	***HILLSBOROUGH RD***	***WNW 1/4 - 1/2 (0.400 mi.)***	***Q56***	***146***
MEREDITH COLLEGE BREWER CENTER	***HILLSBOROUGH ST***	***WNW 1/4 - 1/2 (0.400 mi.)***	***Q57***	***150***
MITCHELL DISTRIBUTING COMPANY	***HWY 54***	***WNW 1/4 - 1/2 (0.400 mi.)***	***Q58***	***153***
SOUTHERN BELL(GLC 21311)	121 W MORGAN ST	WNW 1/4 - 1/2 (0.409 mi.)	R59	156
NC D0A-CABARRUS ST. PARKING DE	436 S SALISBURY ST	WSW 1/4 - 1/2 (0.431 mi.)	S62	161
CABARRUS ST PARKING DECK	***436 S SALISBURY ST***	***WSW 1/4 - 1/2 (0.431 mi.)***	***S63***	***162***
RALEIGH CONVENTION & CONF. CEN	500 FAYETTEVILLE STREET	SW 1/4 - 1/2 (0.431 mi.)	T64	168
CITY OF RALEIGH CONVENTION CEN	***528 S SALISBURY ST***	***SW 1/4 - 1/2 (0.456 mi.)***	***67***	***173***
NEWS & OBSERVER PUBLISHING CO	***215 S MCDOWELL ST***	***W 1/4 - 1/2 (0.459 mi.)***	***U69***	***178***
WAKE COUNTY EMS (FORMER)	***201 W MARTIN ST***	***W 1/4 - 1/2 (0.464 mi.)***	***V71***	***184***
RALEIGH POLICE SERVICE CENTER	***110 S MCDOWELL ST***	***WNW 1/4 - 1/2 (0.476 mi.)***	***73***	***189***
WAKE DEPT OF SOCIAL SERVICES	201 W DAVIE ST	WSW 1/4 - 1/2 (0.482 mi.)	W75	194
WAKE DEPT OF SOCIAL SERVICES	***201 W DAVIE ST***	***WSW 1/4 - 1/2 (0.482 mi.)***	***W76***	***195***
DAVIDSON, MARTHA SPLAWN- HEIRS	817 COTTON ST	ENE 1/4 - 1/2 (0.485 mi.)	X77	198

Lower Elevation	Address	Direction / Distance	Map ID	Page
NW CORNER EAST & MARTIN STREET	***EAST & MARTIN ST***	***ESE 0 - 1/8 (0.086 mi.)***	***5***	***19***
KLYMAN ESTATE	***412 E DAVIE ST***	***S 1/8 - 1/4 (0.143 mi.)***	***C7***	***24***
CARLTON PLACE DEVELOPMENT, LLC	***415 SOUTH BLOODWORTH ST***	***S 1/8 - 1/4 (0.156 mi.)***	***C9***	***29***
RALEIGH WELDING WORKS (FORMER)	***414 SOUTH EAST STREET***	***SSE 1/8 - 1/4 (0.169 mi.)***	***E13***	***43***
WILKINS DETAIL AND REPAIR	***418 S EAST ST***	***SSE 1/8 - 1/4 (0.172 mi.)***	***E14***	***45***
DUNN'S SERVICE CENTER	502 S BLOODWORTH ST	S 1/8 - 1/4 (0.237 mi.)	G26	67
BLOCK A-24 PARKING DECK-CABARR	***CABARRUS AND SOUTH BLOC***	***SW 1/4 - 1/2 (0.284 mi.)***	***I35***	***87***
BLOUNT STREET SERVICE STATION	***500 S BLOUNT ST***	***SW 1/4 - 1/2 (0.285 mi.)***	***I36***	***90***
SHAW UNIVERSI NORTHEAST CAMPUS	***E LENOIR & S BLOODWORTH***	***S 1/4 - 1/2 (0.323 mi.)***	***42***	***103***
ENTERPRISE RENT-A-CAR	***431 SOUTH MCDOWELL STRE***	***WSW 1/4 - 1/2 (0.487 mi.)***	***80***	***203***

EDR HIGH RISK HISTORICAL RECORDS

EDR Exclusive Records

EDR MGP: The EDR Proprietary Manufactured Gas Plant Database includes records of coal gas plants (manufactured gas plants) compiled by EDR's researchers. Manufactured gas sites were used in the United States from the 1800's to 1950's to produce a gas that could be distributed and used as fuel. These plants used whale oil, rosin, coal, or a mixture of coal, oil, and water that also produced a significant amount of waste. Many of the byproducts of the gas production, such as coal tar (oily waste containing volatile and non-volatile chemicals), sludges, oils and other compounds are potentially hazardous to human health and the environment. The byproduct from this process was frequently disposed of directly at the plant site and can remain or spread slowly, serving as a continuous source of soil and groundwater contamination.

A review of the EDR MGP list, as provided by EDR, has revealed that there are 2 EDR MGP sites within approximately 1 mile of the target property.

Lower Elevation	Address	Direction / Distance	Map ID	Page
RALEIGH MGP NO. 1	MCDOWELL AND CABARRUS S	WSW 1/2 - 1 (0.546 mi.)	Y84	215
RALEIGH MGP NO. 2	600 WEST CABARRUS STREE	WSW 1/2 - 1 (0.810 mi.)	90	219

EXECUTIVE SUMMARY

EDR US Hist Auto Stat: EDR has searched selected national collections of business directories and has collected listings of potential gas station/filling station/service station sites that were available to EDR researchers. EDR's review was limited to those categories of sources that might, in EDR's opinion, include gas station/filling station/service station establishments. The categories reviewed included, but were not limited to gas, gas station, gasoline station, filling station, auto, automobile repair, auto service station, service station, etc. This database falls within a category of information EDR classifies as "High Risk Historical Records", or HRHR. EDR's HRHR effort presents unique and sometimes proprietary data about past sites and operations that typically create environmental concerns, but may not show up in current government records searches.

A review of the EDR US Hist Auto Stat list, as provided by EDR, has revealed that there are 3 EDR US Hist Auto Stat sites within approximately 0.25 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
Not reported	422 S PERSON ST	SSW 1/8 - 1/4 (0.176 mi.)	D17	52

Lower Elevation	Address	Direction / Distance	Map ID	Page
Not reported	502 S BLOODWORTH ST	S 1/8 - 1/4 (0.237 mi.)	G28	71
Not reported	313 E CABARRUS ST	SSW 1/8 - 1/4 (0.238 mi.)	29	72

EDR US Hist Cleaners: EDR has searched selected national collections of business directories and has collected listings of potential dry cleaner sites that were available to EDR researchers. EDR's review was limited to those categories of sources that might, in EDR's opinion, include dry cleaning establishments. The categories reviewed included, but were not limited to dry cleaners, cleaners, laundry, laundromat, cleaning/laundry, wash & dry etc. This database falls within a category of information EDR classifies as "High Risk Historical Records", or HRHR. EDR's HRHR effort presents unique and sometimes proprietary data about past sites and operations that typically create environmental concerns, but may not show up in current government records searches.

A review of the EDR US Hist Cleaners list, as provided by EDR, has revealed that there is 1 EDR US Hist Cleaners site within approximately 0.25 miles of the target property.


Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
Not reported	331 NEW BERN AVE	N 1/8 - 1/4 (0.198 mi.)	F19	53

EXECUTIVE SUMMARY

Due to poor or inadequate address information, the following sites were not mapped. Count: 43 records.

Site Name	Database(s)
INSERV DIESEL FUEL RELEASE	NC LAST
OLDE STAGE GOLF & COUNTRY CLUB	NC IMD, NC LAST
VILLAGE CONVENIENT MART	NC UST, NC Financial Assurance
RALEIGH CITY OF - LANDFILL	NC SWF/LF, NC Financial Assurance
CAROLINA POWER & LIGHT CO	NC SWF/LF, NC HIST LF
NC STATE UNIVERSITY COMPOST FACILI	NC SWF/LF, NC HIST LF
N.C. STATE FAIR LANDFILL	NC SWF/LF, NC HIST LF
CP&L DEMO SITE	NC SWF/LF, NC HIST LF
ROBUCK LANDFILL	NC SWF/LF, NC HIST LF
DOROTHEA DIX	NC SWF/LF, NC HIST LF
RALEIGH TTA-DILLON PARCEL C	NC SHWS
AUBURN CHURCH ROAD DRUM	CERC-NFRAP, NC SHWS
RALEIGH COAL GAS PLANT NO. 2	NC SHWS, NC VCP
WHITE WALL SHELL	NC SHWS, NC IMD
MEDLIN-DAVIS DRY CLEANERS-SALISBUR	NC SHWS, NC VCP
RALEIGH NEUSE RIVER WWTP METHANOL	NC SHWS
NCDOT SITE # 29	NC SHWS
NCDOT SITE-C.C. MANGUM US 64E	NC SHWS, NC IMD
BURLINGTON INDUSTRIES, INC.	NC SHWS
SIR WALTER GUN CLUB	NC SHWS
RALEIGH TTA-DILLON PARCEL B	NC SHWS
NC DEPT OF AGRICULTURE PESTICIDE P	NC SWF/LF
W E GARRISON COMPANY	NC SWF/LF
NORTH WAKE CO HHW COLLECTION FACIL	NC SWF/LF
WAKE COUNTY CDLF	NC SWF/LF
HANDEE HUGOS # 79.	NC LUST, NC LUST TRUST
FMW/MJH PROPERTY	NC LUST
WAKE OIL SERVICE	NC IMD, NC LUST
WAREHOUSE OF TIRES(FORMER)	NC LUST TRUST
AMOCO #60257	NC LUST TRUST
COUNTRY CUPBOARD 1	NC UST
DILLARDS EXXON	NC UST
N.W. POOLE WELL & PUMP CO.. I	NC UST
HOLDERS STORE	NC UST
MCEWEN LUMBER COMPANY	NC UST
SHEETZ INC 371	NC UST
EATMANS CARPETS	NC UST
PHILLIPS 66 COMPANY #023263	NC UST
PHILLIPS 66 COMPANY #023226	NC UST
SE CORNER BRANCH & BLOUNT STREET	US BROWNFIELDS, FINDS
BLOCK A-24 PARKING DECK	FINDS
BLOCK A-24 PARKING DECK	FINDS
NC DEPT. OF AGRICULTURE LF	NC OLI

OVERVIEW MAP - 3618453.2s

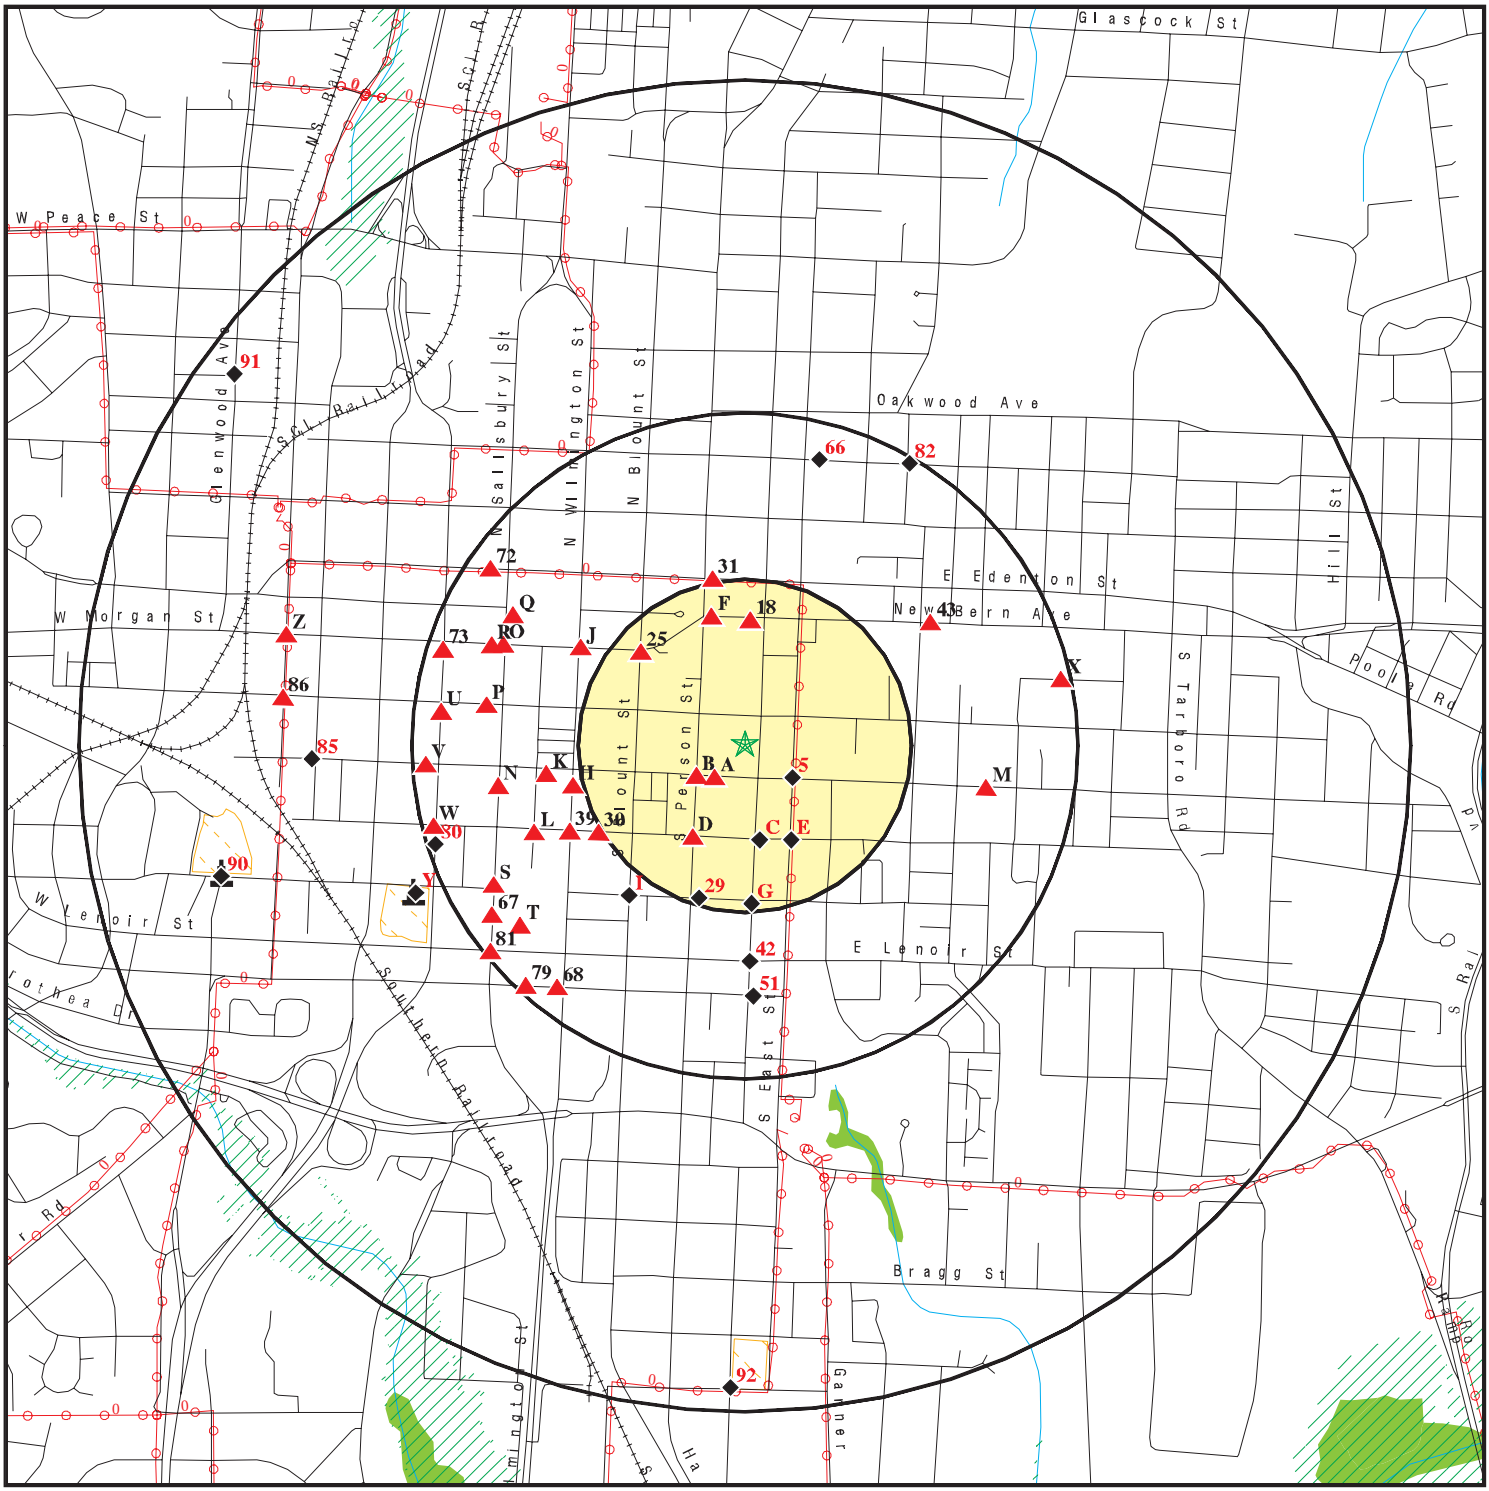

Target Property

Sites at elevations higher than or equal to the target property

Sites at elevations lower than the target property

Manufactured Gas Plants

National Priority List Sites

Dept. Defense Sites

0 1/4 1/2 1 Miles

Indian Reservations BIA

Power transmission lines

Oil & Gas pipelines from USGS

100-year flood zone

500-year flood zone

National Wetland Inventory

State Wetlands


Hazardous Substance Disposal Sites

This report includes Interactive Map Layers to display and/or hide map information. The legend includes only those icons for the default map view.

SITE NAME: Wood Pile Block A-45	CLIENT: Geologix, Inc.
ADDRESS: 218 S. Bloodworth Street Raleigh NC 27601	CONTACT: Rob Livermon
LAT/LONG: 35.7774 / 78.6337	INQUIRY #: 3618453.2s DATE: May 29, 2013 10:51 am

Copyright © 2013 EDR, Inc. © 2010 Tele Atlas Rel. 07/2009.

DETAIL MAP - 3618453.2s

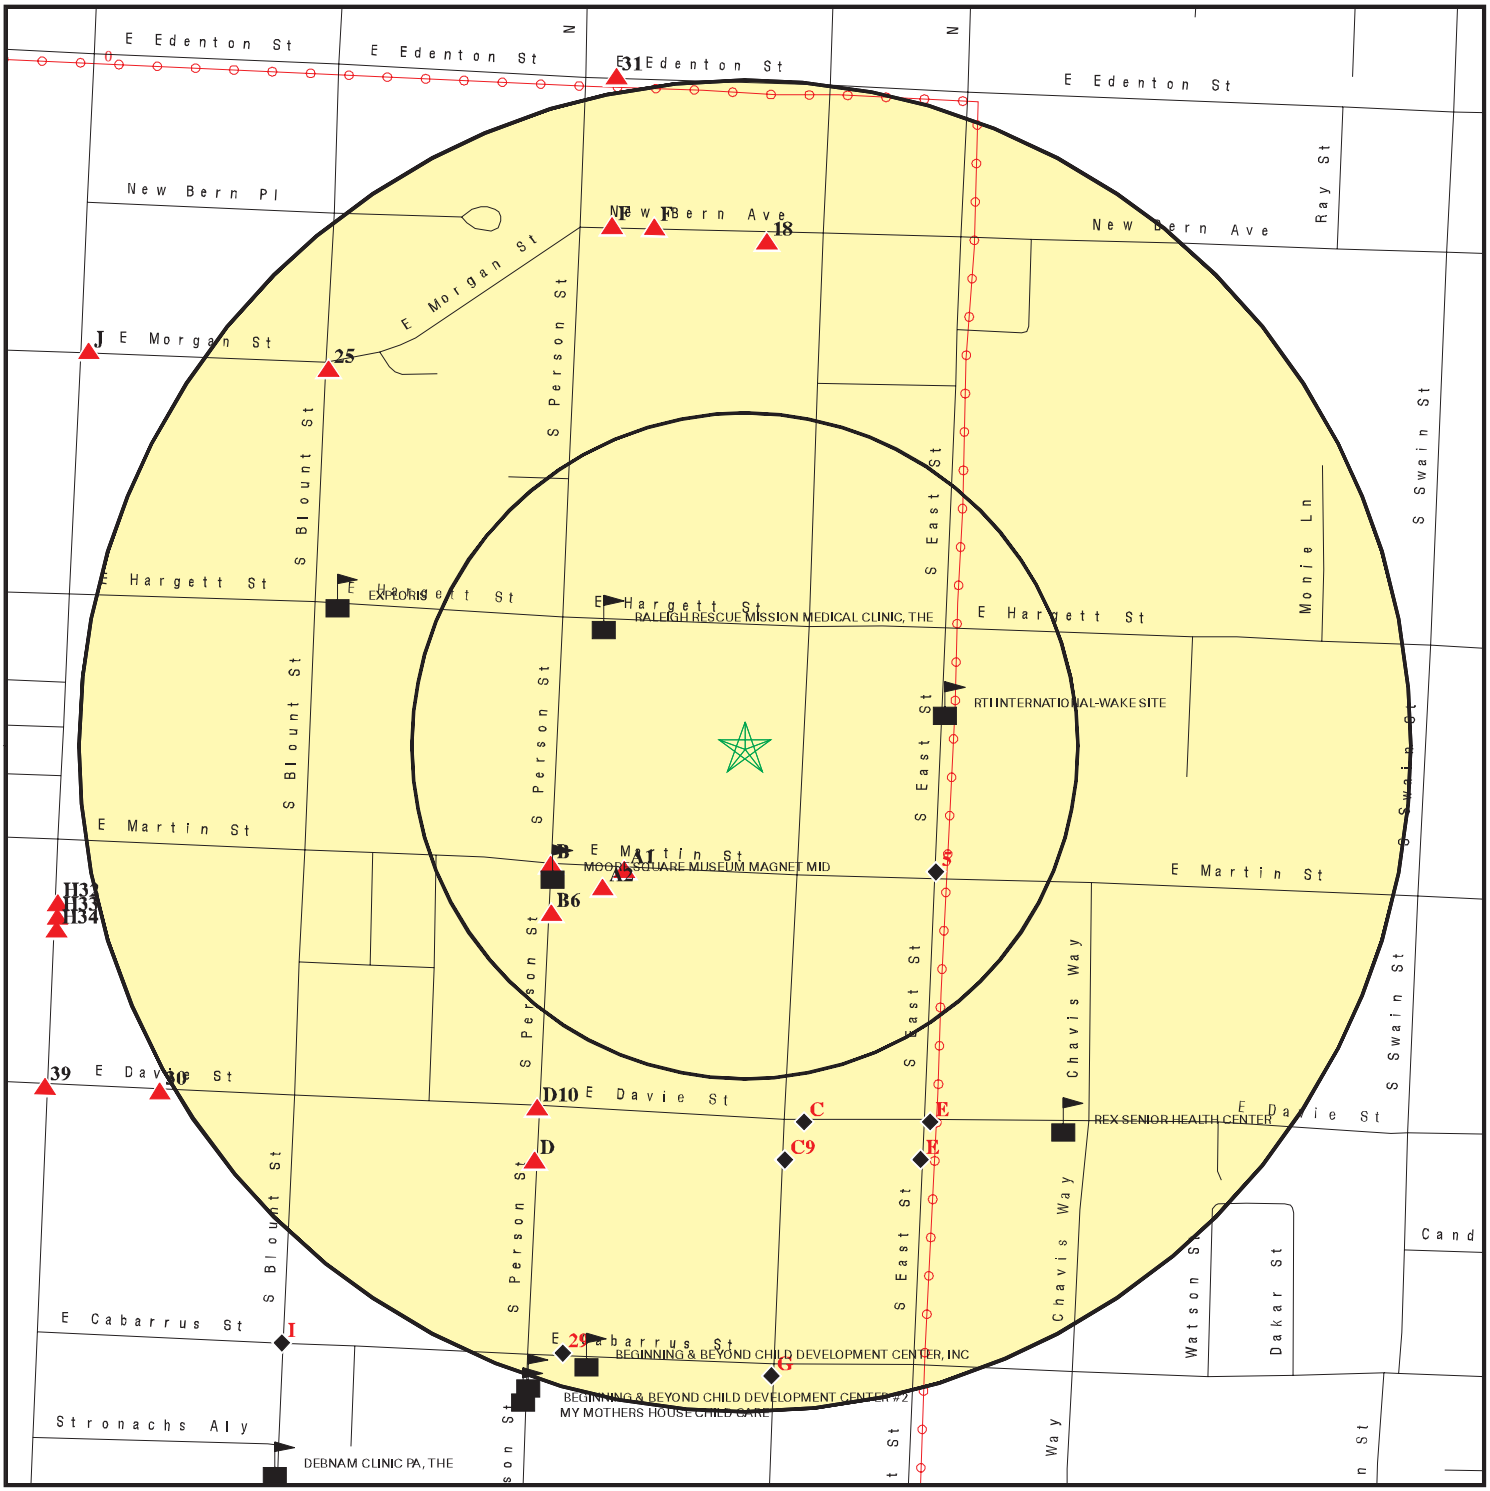

- Target Property
- Sites at elevations higher than or equal to the target property
- Sites at elevations lower than the target property
- Manufactured Gas Plants
- Sensitive Receptors
- National Priority List Sites
- Dept. Defense Sites
- Indian Reservations BIA
- Power transmission lines
- Oil & Gas pipelines from USGS
- 100-year flood zone
- 500-year flood zone
- Hazardous Substance Disposal Sites

This report includes Interactive Map Layers to display and/or hide map information. The legend includes only those icons for the default map view.

SITE NAME: Wood Pile Block A-45	CLIENT: Geologix, Inc.
ADDRESS: 218 S. Bloodworth Street Raleigh NC 27601	CONTACT: Rob Livermon INQUIRY #: 3618453.2s
LAT/LONG: 35.7774 / 78.6337	DATE: May 29, 2013 10:52 am

Copyright © 2013 EDR, Inc. © 2010 Tele Atlas Rel. 07/2009.

MAP FINDINGS SUMMARY

Database	Search Distance (Miles)	Target Property	< 1/8	1/8 - 1/4	1/4 - 1/2	1/2 - 1	> 1	Total Plotted
STANDARD ENVIRONMENTAL RECORDS								
Federal NPL site list								
NPL	1.000		0	0	0	0	NR	0
Proposed NPL	1.000		0	0	0	0	NR	0
NPL LIENS	TP		NR	NR	NR	NR	NR	0
Federal Delisted NPL site list								
Delisted NPL	1.000		0	0	0	0	NR	0
Federal CERCLIS list								
CERCLIS	0.500		0	0	0	NR	NR	0
FEDERAL FACILITY	0.500		0	0	0	NR	NR	0
Federal CERCLIS NFRAP site List								
CERC-NFRAP	0.500		0	0	0	NR	NR	0
Federal RCRA CORRACTS facilities list								
CORRACTS	1.000		0	0	0	1	NR	1
Federal RCRA non-CORRACTS TSD facilities list								
RCRA-TSDF	0.500		0	0	0	NR	NR	0
Federal RCRA generators list								
RCRA-LQG	0.250		0	0	NR	NR	NR	0
RCRA-SQG	0.250		0	0	NR	NR	NR	0
RCRA-CESQG	0.250		0	2	NR	NR	NR	2
Federal institutional controls / engineering controls registries								
US ENG CONTROLS	0.500		0	0	0	NR	NR	0
US INST CONTROL	0.500		0	0	0	NR	NR	0
LUCIS	0.500		0	0	0	NR	NR	0
Federal ERNS list								
ERNS	TP		NR	NR	NR	NR	NR	0
State- and tribal - equivalent NPL								
NC HSDS	1.000		0	0	0	3	NR	3
State- and tribal - equivalent CERCLIS								
NC SHWS	1.000		0	1	1	7	NR	9
State and tribal landfill and/or solid waste disposal site lists								
NC SWF/LF	0.500		0	0	0	NR	NR	0
NC OLI	0.500		0	0	0	NR	NR	0
State and tribal leaking storage tank lists								
NC LUST	0.500		5	8	33	NR	NR	46

MAP FINDINGS SUMMARY

Database	Search Distance (Miles)	Target Property	< 1/8	1/8 - 1/4	1/4 - 1/2	1/2 - 1	> 1	Total Plotted
NC LUST TRUST	0.500		0	1	8	NR	NR	9
NC LAST	0.500		0	1	6	NR	NR	7
INDIAN LUST	0.500		0	0	0	NR	NR	0
State and tribal registered storage tank lists								
NC UST	0.250		0	6	NR	NR	NR	6
NC AST	0.250		0	0	NR	NR	NR	0
INDIAN UST	0.250		0	0	NR	NR	NR	0
FEMA UST	0.250		0	0	NR	NR	NR	0
State and tribal institutional control / engineering control registries								
NC INST CONTROL	0.500		0	0	0	NR	NR	0
State and tribal voluntary cleanup sites								
NC VCP	0.500		0	0	0	NR	NR	0
INDIAN VCP	0.500		0	0	0	NR	NR	0
State and tribal Brownfields sites								
NC BROWNFIELDS	0.500		0	0	2	NR	NR	2
ADDITIONAL ENVIRONMENTAL RECORDS								
Local Brownfield lists								
US BROWNFIELDS	0.500		0	1	4	NR	NR	5
Local Lists of Landfill / Solid Waste Disposal Sites								
DEBRIS REGION 9	0.500		0	0	0	NR	NR	0
ODI	0.500		0	0	0	NR	NR	0
NC HIST LF	0.500		0	0	0	NR	NR	0
NC SWRCY	0.500		0	0	0	NR	NR	0
INDIAN ODI	0.500		0	0	0	NR	NR	0
Local Lists of Hazardous waste / Contaminated Sites								
US CDL	TP		NR	NR	NR	NR	NR	0
US HIST CDL	TP		NR	NR	NR	NR	NR	0
Local Land Records								
LIENS 2	TP		NR	NR	NR	NR	NR	0
Records of Emergency Release Reports								
HMIRS	TP		NR	NR	NR	NR	NR	0
NC IMD	0.500		6	8	31	NR	NR	45
NC SPILLS 90	TP		NR	NR	NR	NR	NR	0
NC SPILLS 80	TP		NR	NR	NR	NR	NR	0
Other Ascertainable Records								
RCRA NonGen / NLR	0.250		0	0	NR	NR	NR	0

MAP FINDINGS SUMMARY

Database	Search Distance (Miles)	Target Property	< 1/8	1/8 - 1/4	1/4 - 1/2	1/2 - 1	> 1	Total Plotted
DOT OPS	TP		NR	NR	NR	NR	NR	0
DOD	1.000		0	0	0	0	NR	0
FUDS	1.000		0	0	0	0	NR	0
CONSENT	1.000		0	0	0	0	NR	0
ROD	1.000		0	0	0	0	NR	0
UMTRA	0.500		0	0	0	NR	NR	0
US MINES	0.250		0	0	NR	NR	NR	0
TRIS	TP		NR	NR	NR	NR	NR	0
TSCA	TP		NR	NR	NR	NR	NR	0
FTTS	TP		NR	NR	NR	NR	NR	0
HIST FTTS	TP		NR	NR	NR	NR	NR	0
SSTS	TP		NR	NR	NR	NR	NR	0
ICIS	TP		NR	NR	NR	NR	NR	0
PADS	TP		NR	NR	NR	NR	NR	0
MLTS	TP		NR	NR	NR	NR	NR	0
RADINFO	TP		NR	NR	NR	NR	NR	0
FINDS	TP		NR	NR	NR	NR	NR	0
RAATS	TP		NR	NR	NR	NR	NR	0
RMP	TP		NR	NR	NR	NR	NR	0
NC UIC	TP		NR	NR	NR	NR	NR	0
RI MANIFEST	0.250		0	0	NR	NR	NR	0
NC DRYCLEANERS	0.250		0	0	NR	NR	NR	0
NC NPDES	TP		NR	NR	NR	NR	NR	0
INDIAN RESERV	1.000		0	0	0	0	NR	0
SCRD DRYCLEANERS	0.500		0	0	0	NR	NR	0
NC COAL ASH	0.500		0	0	0	NR	NR	0
NC Financial Assurance	TP		NR	NR	NR	NR	NR	0
US FIN ASSUR	TP		NR	NR	NR	NR	NR	0
EPA WATCH LIST	TP		NR	NR	NR	NR	NR	0
US AIRS	TP		NR	NR	NR	NR	NR	0
PRP	TP		NR	NR	NR	NR	NR	0
2020 COR ACTION	0.250		0	0	NR	NR	NR	0
PCB TRANSFORMER	TP		NR	NR	NR	NR	NR	0
COAL ASH DOE	TP		NR	NR	NR	NR	NR	0
COAL ASH EPA	0.500		0	0	0	NR	NR	0
LEAD SMELTERS	TP		NR	NR	NR	NR	NR	0
EDR HIGH RISK HISTORICAL RECORDS								
EDR Exclusive Records								
EDR MGP	1.000		0	0	0	2	NR	2
EDR US Hist Auto Stat	0.250		0	3	NR	NR	NR	3
EDR US Hist Cleaners	0.250		0	1	NR	NR	NR	1

NOTES:

TP = Target Property

NR = Not Requested at this Search Distance

Sites may be listed in more than one database

HSDS **ASHLAND CHEM CO** **NC HSDS** **S102442426**
Region **N/A**
South **, NC**
1/2-1
4702 ft.

HSDS:

Site Type:	Federal
Superfund ID:	088 560 032
Lat/Long:	35 45 49.626722 78 38 1.792780
Total area in coverage units:	9568.01953125
Total perimeter in coverage units:	398.79342651
X-value coordinate in feet:	2108631.5
Y-value coordinate in feet:	733094.6875
Sites designated as superfund cleanup sites:	330
Length of feature in internal units:	398.793418839
Area of feature in internal units squared:	9568.01956249

HSDS **RALEIGH COAL GAS PLANT NO. 1** **NC HSDS** **S102442419**
Region **N/A**
WSW **, NC**
1/2-1
2745 ft.

HSDS:

Site Type:	Federal
Superfund ID:	986 188 894
Lat/Long:	35 46 24.883278 78 38 34.570676
Total area in coverage units:	13842.1083984
Total perimeter in coverage units:	466.79360961
X-value coordinate in feet:	2105918.25
Y-value coordinate in feet:	736649.5
Sites designated as superfund cleanup sites:	325
Length of feature in internal units:	466.793658659
Area of feature in internal units squared:	13842.1108688

HSDS **RALEIGH COAL GAS PLANT NO. 2** **NC HSDS** **S102442417**
Region **N/A**
WSW **, NC**
1/2-1
4008 ft.

HSDS:

Site Type:	Federal
Superfund ID:	986 188 902
Lat/Long:	35 46 30.352184 78 38 53.054486
Total area in coverage units:	17002.3789063
Total perimeter in coverage units:	525.92114257
X-value coordinate in feet:	2104393
Y-value coordinate in feet:	737197
Sites designated as superfund cleanup sites:	324
Length of feature in internal units:	525.921240589
Area of feature in internal units squared:	17002.3818657

A1
SW
< 1/8
0.065 mi.
342 ft.

MOORE SQUARE MUSEUMS MAGNET
328 E MARTIN ST
RALEIGH, NC

Site 1 of 2 in cluster A

NC IMD **S104914634**
NC LUST **N/A**

Relative:
Higher

Actual:
311 ft.

IMD:

Region:	RAL
Facility ID:	22684
Date Occurred:	6/13/2000
Submit Date:	1/5/2000
GW Contam:	No Groundwater Contamination detected
Soil Contam:	Yes
Incident Desc:	SOIL CONTAMINATION DISCOVERED UPON UST REMOVAL
Operator:	FRANK KOONTZ
Contact Phone:	919 856-3220
Owner Company:	WAKE COUNTY PUBLIC SCHOOL SYST
Operator Address:	1551 ROCK QUARRY ROAD
Operator City:	RALEIGH
Oper City,St,Zip:	RALEIGH, NC 27610-
Ownership:	County
Operation:	Educational/Religious
Material:	Not reported
Qty Lost 1:	Not reported
Qty Recovered 1:	Not reported
Source:	Leak-underground
Type:	Gasoline/diesel
Location:	Facility
Setting:	Residential
Risk Site:	L
Site Priority:	L
Priority Code:	L
Priority Update:	1/5/2001
Dem Contact:	JFM
Wells Affected:	No
Num Affected:	Not reported
Wells Contam:	Not reported
Sampled By:	Not reported
Samples Include:	Not reported
7.5 Min Quad:	Not reported
5 Min Quad:	Not reported
Latitude:	35.78
Longitude:	-78.63027777
Latitude Number:	354648
Longitude Number:	783749
Latitude Decimal:	35.78
Longitude Decimal:	78.6302777777778
GPS:	7
Agency:	DWM
Facility ID:	22684
Last Modified:	12/29/2000
Incident Phase:	Closed Out
NOV Issued:	Not reported
NORR Issued:	Not reported
45 Day Report:	Not reported
Public Meeting Held:	Not reported
Corrective Action Planned:	Not reported
SOC Sighned:	Not reported
Reclassification Report:	Not reported

MOORE SQUARE MUSEUMS MAGNET (Continued) **S104914634**

RS Designation: Not reported
Closure Request Date: Not reported
Close-out Report: Not reported

LUST:
Facility ID: Not reported
UST Number: RA-3699
Incident Number: 22684
Contamination Type: Soil
Source Type: Leak-underground
Product Type: PETROLEUM
Date Reported: 10/09/2000
Date Occur: 06/13/2000
Cleanup: Not reported
Closure Request: Not reported
Close Out: 11/06/2000
Level Of Soil Cleanup Achieved: Not reported
Tank Regulated Status: Non Regulated
Of Supply Wells: 0
Commercial/NonCommercial UST Site: NON COMMERCIAL
Risk Classification: L
Risk Class Based On Review: L
Corrective Action Plan Type: Not reported
NOV Issue Date: Not reported
NORR Issue Date: Not reported
Site Priority: Not reported
Phase Of LSA Req: Not reported
Site Risk Reason: Not reported
Land Use: Not reported
MTBE: No
MTBE1: Unknown
Flag: No
Flag1: No
LUR Filed: Not reported
Release Detection: 0
Current Status: File Located in Archives
RBCA GW: Not reported
PETOPT: 5
RPL: False
CD Num: 137
Reel Num: 60
RPOW: False
RPOP: False
Error Flag: 0
Error Code: N
Valid: False
Lat/Long: 354648 -783749
Lat/Long Decimal: 0 0
Testlat: Not reported
Regional Officer Project Mgr: JFM
Region: Raleigh
Company: WAKE COUNTY PUBLIC SCHOOL SYST
Contact Person: FRANK KOONTZ
Telephone: 919 856-3220
RP Address: 1551 ROCK QUARRY ROAD
RP City,St,Zip: RALEIGH, NC 27610-

MOORE SQUARE MUSEUMS MAGNET (Continued) **S104914634**

RP County: WAKE
Comments: Not reported
5 Min Quad: Not reported

PIRF:
Facility Id: 22684
Date Occurred: 6/13/2000
Date Reported: 1/5/2000
Description Of Incident: SOIL CONTAMINATION DISCOVERED UPON UST REMOVAL
Owner/Operator: FRANK KOONTZ
Ownership: 6
Operation Type: 4
Type: 5
Location: 1
Site Priority: L
Priority Update: 1/5/2001
Wells Affected Y/N: N
Samples Include: Not reported
7#5 Minute Quad: Not reported
5 Minute Quad: Not reported
Pirf/Min Soil: Not reported
Release Code: Not reported
Source Code: Not reported
Err Type: 2
Cause: Not reported
Source: E
Ust Number: E

Last Modified: 12/29/2000
Incident Phase: **Closed Out**
NOV Issued: Not reported
NORR Issued: Not reported
45 Day Report: Not reported
Public Meeting Held: Not reported
Corrective Action Planned: Not reported
SOC Signed: Not reported
Reclassification Report: Not reported
RS Designation: Not reported
Closure Request Date: Not reported
Close-out Report: Not reported

Facility ID: Not reported
UST Number: RA-302
Incident Number: 33328
Contamination Type: Soil
Source Type: Leak-underground
Product Type: PETROLEUM
Date Reported: 10/09/2000
Date Occur: 06/13/2000
Cleanup: 06/13/2000
Closure Request: 2000-10-09 00:00:00
Close Out: 11/02/2000
Level Of Soil Cleanup Achieved: Not reported
Tank Regulated Status: Non Regulated
Of Supply Wells: 0
Commercial/NonCommercial UST Site: NON COMMERCIAL
Risk Classification: L
Risk Class Based On Review: L

MOORE SQUARE MUSEUMS MAGNET (Continued) **S104914634**

Corrective Action Plan Type:	Not reported
NOV Issue Date:	Not reported
NORR Issue Date:	Not reported
Site Priority:	Not reported
Phase Of LSA Req:	Not reported
Site Risk Reason:	Not reported
Land Use:	Not reported
MTBE:	No
MTBE1:	Unknown
Flag:	No
Flag1:	No
LUR Filed:	Not reported
Release Detection:	0
Current Status:	File Located in Archives
RBCA GW:	Not reported
PETOPT:	5
RPL:	False
CD Num:	133
Reel Num:	43
RPOW:	False
RPOP:	False
Error Flag:	0
Error Code:	N
Valid:	False
Lat/Long:	35h46m36s -78h38m05s
Lat/Long Decimal:	0 0
Testlat:	Not reported
Regional Officer Project Mgr:	JFM
Region:	Raleigh
Company:	WAKE COUNTY PUBLIC SCHOOL SYST
Contact Person:	FRANK KOONTZ
Telephone:	9198563720
RP Address:	1551 ROCK QUARRY RD.
RP City,St,Zip:	RALEIGH, NC 27610-
RP County:	wake
Comments:	see also 3897 and 21698
5 Min Quad:	Not reported

PIRF:

Facility Id:	33328
Date Occurred:	6/13/2000
Date Reported:	10/9/2000
Description Of Incident:	Not reported
Owner/Operator:	Not reported
Ownership:	1
Operation Type:	1
Type:	4
Location:	1
Site Priority:	Not reported
Priority Update:	Not reported
Wells Affected Y/N:	N
Samples Include:	Not reported
7#5 Minute Quad:	Y
5 Minute Quad:	Not reported
Pirf/Min Soil:	Not reported
Release Code:	Not reported
Source Code:	Not reported
Err Type:	2

MOORE SQUARE MUSEUMS MAGNET (Continued) **S104914634**

Cause:	Not reported
Source:	Not reported
Ust Number:	P
Last Modified:	Not reported
Incident Phase:	**Not reported**
NOV Issued:	Not reported
NORR Issued:	Not reported
45 Day Report:	Not reported
Public Meeting Held:	Not reported
Corrective Action Planned:	Not reported
SOC Signed:	Not reported
Reclassification Report:	Not reported
RS Designation:	Not reported
Closure Request Date:	Not reported
Close-out Report:	Not reported

A2 **ASK MART (FORMER)** **NC IMD** **S105043213**
SW **304 MARTIN ST** **NC LUST** **N/A**
< 1/8 **RALEIGH, NC**
0.075 mi.
397 ft. **Site 2 of 2 in cluster A**

Relative:
Higher

Actual:
316 ft.

IMD:

Region:	RAL
Facility ID:	22129
Date Occurred:	4/11/2000
Submit Date:	7/20/2000
GW Contam:	No Groundwater Contamination detected
Soil Contam:	Yes
Incident Desc:	(2) 550 GAL WASTE OIL/UNKNOWN UST & (1) 1000 GAL UNKNOWN UST REMOVED 4/7,11/00. SOIL CONTAM IN SAMP AT CLOSURE 408 MG/KG TPH 3550 IN SAMP "PIT-1-1."
Operator:	FRANK KOONTZ
Contact Phone:	919-856-8286
Owner Company:	WAKE COUNTY PUBLIC SCHOOLS
Operator Address:	1551 ROCK QUARRY ROAD
Operator City:	RALEIGH
Oper City,St,Zip:	RALEIGH, NC 27610-
Ownership:	County
Operation:	Educational/Religious
Material:	WASTE OIL
Qty Lost 1:	Not reported
Qty Recovered 1:	Not reported
Material:	UNKNOWN
Qty Lost:	Not reported
Qty Recovered:	Not reported
Source:	Leak-underground
Type:	Gasoline/diesel
Location:	Facility
Setting:	Residential
Risk Site:	Not reported
Site Priority:	Not reported
Priority Code:	Not reported
Priority Update:	8/18/2000
Dem Contact:	JFM
Wells Affected:	Not reported
Num Affected:	Not reported

ASK MART (FORMER) (Continued) **S105043213**

Wells Contam: Not reported
Sampled By: Responsible Parties
Samples Include: Soil Samples
7.5 Min Quad: Not reported
5 Min Quad: Not reported
Latitude: 35.7816
Longitude: -78.3764
Latitude Number: Not reported
Longitude Number: Not reported
Latitude Decimal: Not reported
Longitude Decimal: Not reported
GPS: 7
Agency: DWM
Facility ID: 22129
Last Modified: Not reported
Incident Phase: Not reported
NOV Issued: Not reported
NORR Issued: Not reported
45 Day Report: Not reported
Public Meeting Held: Not reported
Corrective Action Planned: Not reported
SOC Sighned: Not reported
Reclassification Report: Not reported
RS Designation: Not reported
Closure Request Date: Not reported
Close-out Report: Not reported

LUST:
Facility ID: Not reported
UST Number: RA-3486
Incident Number: 22129
Contamination Type: Soil
Source Type: Leak-underground
Product Type: PETROLEUM
Date Reported: 07/20/2000
Date Occur: 04/11/2000
Cleanup: 04/11/2000
Closure Request: Not reported
Close Out: Not reported
Level Of Soil Cleanup Achieved: Not reported
Tank Regulated Status: Regulated
Of Supply Wells: 0
Commercial/NonCommercial UST Site: COMMERCIAL
Risk Classification: Not reported
Risk Class Based On Review: U
Corrective Action Plan Type: Not reported
NOV Issue Date: Not reported
NORR Issue Date: Not reported
Site Priority: Not reported
Phase Of LSA Req: 1
Site Risk Reason: Not reported
Land Use: Not reported
MTBE: No
MTBE1: Unknown
Flag: No
Flag1: No

ASK MART (FORMER) (Continued) **S105043213**

LUR Filed:	Not reported
Release Detection:	0
Current Status:	File Located in House
RBCA GW:	Not reported
PETOPT:	3
RPL:	False
CD Num:	Not reported
Reel Num:	Not reported
RPOW:	False
RPOP:	False
Error Flag:	0
Error Code:	N
Valid:	False
Lat/Long:	35 46 37.98 - 78 38 37.68
Lat/Long Decimal:	35.7772 -78.6438
Testlat:	Not reported
Regional Officer Project Mgr:	JFM
Region:	Raleigh
Company:	WAKE COUNTY PUBLIC SCHOOLS
Contact Person:	FRANK KOONTZ
Telephone:	919-856-8286
RP Address:	1551 ROCK QUARRY ROAD
RP City,St,Zip:	RALEIGH, NC 27610-
RP County:	WAKE
Comments:	no file 2/3/2005///Site visit 01/31/2007, no WSW seen. 02/20/2007, JFM///
5 Min Quad:	Not reported

PIRF:

Facility Id:	22129
Date Occurred:	4/11/2000
Date Reported:	7/20/2000
Description Of Incident:	(2) 550 GAL WASTE OIL/UNKNOWN UST & (1) 1000 GAL UNKNOWN UST REMOVED 4/7,11/00. SOIL CONTAM IN SAMP AT CLOSURE 408 MG/KG TPH 3550 IN SAMP "PIT-1-1."
Owner/Operator:	FRANK KOONTZ
Ownership:	6
Operation Type:	4
Type:	4
Location:	1
Site Priority:	Not reported
Priority Update:	8/18/2000
Wells Affected Y/N:	Not reported
Samples Include:	Not reported
7#5 Minute Quad:	3
5 Minute Quad:	2
Pirf/Min Soil:	Not reported
Release Code:	Not reported
Source Code:	MIN_SOIL
Err Type:	Not reported
Cause:	Not reported
Source:	Not reported
Ust Number:	Not reported
Last Modified:	Not reported
Incident Phase:	**Not reported**
NOV Issued:	Not reported
NORR Issued:	Not reported

ASK MART (FORMER) (Continued) **S105043213**

45 Day Report:	Not reported
Public Meeting Held:	Not reported
Corrective Action Planned:	Not reported
SOC Signed:	Not reported
Reclassification Report:	Not reported
RS Designation:	Not reported
Closure Request Date:	Not reported
Close-out Report:	Not reported

B3 **ASK MART/ BLOCK A-42** **NC IMD** **S105765262**
WSW **E MARTIN ST & S PERSON ST** **NC LUST** **N/A**
< 1/8 **RALEIGH, NC**
0.085 mi.
450 ft. **Site 1 of 3 in cluster B**

Relative:
Higher

Actual:
318 ft.

IMD:

Region:	RAL
Facility ID:	21698
Date Occurred:	11/30/1998
Submit Date:	6/7/2000
GW Contam:	Yes, Groundwater Contamination has been detected
Soil Contam:	No
Incident Desc:	SOIL CONTAM. CONFIRMED. 2ND LSA REQUESTED.
Operator:	FRANK KOONTZ
Contact Phone:	Not reported
Owner Company:	WAKE COUNTY PUBLIC SCHOOL SYST
Operator Address:	1551 ROCK QUARRY ROAD
Operator City:	RALEIGH
Oper City,St,Zip:	RALEIGH, NC 27610-
Ownership:	Private
Operation:	Commercial
Material:	GASOLINE
Qty Lost 1:	Not reported
Qty Recovered 1:	Not reported
Source:	Leak-underground
Type:	Gasoline/diesel
Location:	Facility
Setting:	Urban
Risk Site:	L
Site Priority:	L
Priority Code:	L
Priority Update:	6/7/2000
Dem Contact:	WDP
Wells Affected:	No
Num Affected:	Not reported
Wells Contam:	Not reported
Sampled By:	Responsible Parties
Samples Include:	Groundwater Samples
7.5 Min Quad:	Not reported
5 Min Quad:	Not reported
Latitude:	35.77638888
Longitude:	-78.63472222
Latitude Number:	354635
Longitude Number:	783805
Latitude Decimal:	35.7763888888889
Longitude Decimal:	78.6347222222222
GPS:	NOD
Agency:	DWM

ASK MART/ BLOCK A-42 (Continued) **S105765262**

Facility ID:	21698
Last Modified:	5/3/2001
Incident Phase:	Closed Out
NOV Issued:	Not reported
NORR Issued:	Not reported
45 Day Report:	Not reported
Public Meeting Held:	Not reported
Corrective Action Planned:	Not reported
SOC Sighned:	Not reported
Reclassification Report:	Not reported
RS Designation:	Not reported
Closure Request Date:	Not reported
Close-out Report:	9/27/2000

LUST:

Facility ID:	Not reported
UST Number:	RA-3341
Incident Number:	21698
Contamination Type:	Groundwater/Both
Source Type:	Leak-underground
Product Type:	PETROLEUM
Date Reported:	11/30/1998
Date Occur:	11/30/1998
Cleanup:	11/30/1998
Closure Request:	2000-09-07 00:00:00
Close Out:	09/27/2000
Level Of Soil Cleanup Achieved:	Residential
Tank Regulated Status:	Regulated
# Of Supply Wells:	0
Commercial/NonCommercial UST Site:	COMMERCIAL
Risk Classification:	L
Risk Class Based On Review:	L
Corrective Action Plan Type:	Not reported
NOV Issue Date:	Not reported
NORR Issue Date:	05/03/2000
Site Priority:	25
Phase Of LSA Req:	2
Site Risk Reason:	Not reported
Land Use:	Residential
MTBE:	No
MTBE1:	Unknown
Flag:	No
Flag1:	No
LUR Filed:	Not reported
Release Detection:	0
Current Status:	File Located in Archives
RBCA GW:	Cleanups to 2L.0202 standards
PETOPT:	Not reported
RPL:	False
CD Num:	133
Reel Num:	42
RPOW:	False
RPOP:	False
Error Flag:	0
Error Code:	N
Valid:	False

ASK MART/ BLOCK A-42 (Continued) **S105765262**

Lat/Long:	354635 -783805	
Lat/Long Decimal:	0 0	
Testlat:	Not reported	
Regional Officer Project Mgr:		WDP
Region:		Raleigh
Company:		WAKE COUNTY PUBLIC SCHOOL SYST
Contact Person:		FRANK KOONTZ
Telephone:		Not reported
RP Address:		1551 ROCK QUARRY ROAD
RP City,St,Zip:		RALEIGH, NC 27610-
RP County:		WAKE
Comments:	CO 9/27/00	
5 Min Quad:	Not reported	

PIRF:

Facility Id:	21698
Date Occurred:	11/1/1998
Date Reported:	6/7/2000
Description Of Incident:	SOIL CONTAM. CONFIRMED. 2ND LSA REQUESTED.
Owner/Operator:	ALEX FULLER
Ownership:	4
Operation Type:	6
Type:	3
Location:	1
Site Priority:	L
Priority Update:	6/7/2000
Wells Affected Y/N:	N
Samples Include:	Not reported
7#5 Minute Quad:	3
5 Minute Quad:	1
Pirf/Min Soil:	Not reported
Release Code:	Not reported
Source Code:	PIRF
Err Type:	Not reported
Cause:	Not reported
Source:	Not reported
Ust Number:	Not reported
Last Modified:	5/3/2001
Incident Phase:	**Closed Out**
NOV Issued:	Not reported
NORR Issued:	Not reported
45 Day Report:	Not reported
Public Meeting Held:	Not reported
Corrective Action Planned:	Not reported
SOC Signed:	Not reported
Reclassification Report:	Not reported
RS Designation:	Not reported
Closure Request Date:	Not reported
Close-out Report:	9/27/2000

B4
WSW
< 1/8
0.085 mi.
450 ft.

WAKE CO. PUBLIC SCHOOLS **NC IMD** **S105912254**
S. PERSON ST. AND E. MARTIN ST **N/A**
RALEIGH, NC

Site 2 of 3 in cluster B

Relative:
Higher

Actual:
318 ft.

IMD:

Region:	RAL
Facility ID:	20791
Date Occurred:	6/24/1999
Submit Date:	11/5/1999
GW Contam:	Yes, Groundwater Contamination has been detected
Soil Contam:	Not reported
Incident Desc:	CHLORINATED SOLVENTS REPORT SHOULD BE IN WAREHOUSE OF TIRE FILE (UST Incident # 3897)
Operator:	KOONTZ, FRANK
Contact Phone:	Not reported
Owner Company:	WAKE CO SCHOOL SYSTEM
Operator Address:	1551 ROCK QUARRY ROAD
Operator City:	RALEIGH
Oper City,St,Zip:	RALEIGH, NC
Ownership:	State
Operation:	Commercial
Material:	TCE
Qty Lost 1:	Not reported
Qty Recovered 1:	Not reported
Source:	Unknown
Type:	Other organics
Location:	Facility
Setting:	Urban
Risk Site:	No
Site Priority:	Not reported
Priority Code:	E
Priority Update:	11/22/1999
Dem Contact:	JIM ROUSH
Wells Affected:	No
Num Affected:	Not reported
Wells Contam:	Not reported
Sampled By:	Other
Samples Include:	Groundwater Samples
7.5 Min Quad:	Not reported
5 Min Quad:	K39T
Latitude:	Not reported
Longitude:	Not reported
Latitude Number:	Not reported
Longitude Number:	Not reported
Latitude Decimal:	Not reported
Longitude Decimal:	Not reported
GPS:	GPS
Agency:	DWQ
Facility ID:	20791
Last Modified:	6/24/1999
Incident Phase:	Closed Out
NOV Issued:	Not reported
NORR Issued:	Not reported
45 Day Report:	Not reported
Public Meeting Held:	Not reported
Corrective Action Planned:	Not reported
SOC Sighned:	Not reported

WAKE CO. PUBLIC SCHOOLS (Continued) **S105912254**

Reclassification Report: Not reported
RS Designation: Not reported
Closure Request Date: Not reported
Close-out Report: 10/22/1999

5
ESE
< 1/8
0.086 mi.
454 ft.

NW CORNER EAST & MARTIN STREET **NC IMD** **S101643247**
EAST & MARTIN ST **NC LUST** **N/A**
RALEIGH, NC 27601

Relative:
Lower

Actual:
301 ft.

IMD:
Region: RAL
Facility ID: 14309
Date Occurred: 3/14/1995
Submit Date: 7/31/1995
GW Contam: Yes, Groundwater Contamination has been detected
Soil Contam: No
Incident Desc: UPON REMOVAL OF 2 USTS, TPH WAS FOUND IN SOIL TO BE 12,400 PPM.
Operator: DOUG BETHUNE
Contact Phone: 919-890-3170
Owner Company: CITY OF RALEIGH
Operator Address: P.O. BOX 590
Operator City: RALEIGH
Oper City,St,Zip: RALEIGH, NC 27602-
Ownership: Municipal
Operation: Commercial
Material: GASOLINE
Qty Lost 1: Not reported
Qty Recovered 1: Not reported
Source: Leak-underground
Type: Gasoline/diesel
Location: Facility
Setting: Urban
Risk Site: L
Site Priority: 20E
Priority Code: L
Priority Update: 4/16/1998
Dem Contact: WDP
Wells Affected: No
Num Affected: 0
Wells Contam: Not reported
Sampled By: Responsible Parties
Samples Include: Soil Samples
7.5 Min Quad: Not reported
5 Min Quad: K39Q
Latitude: Not reported
Longitude: Not reported
Latitude Number: Not reported
Longitude Number: Not reported
Latitude Decimal: Not reported
Longitude Decimal: Not reported
GPS: NOD
Agency: DWM
Facility ID: 14309
Last Modified: Not reported
Incident Phase: RE

NW CORNER EAST & MARTIN STREET (Continued) **S101643247**

NOV Issued: Not reported
NORR Issued: Not reported
45 Day Report: Not reported
Public Meeting Held: Not reported
Corrective Action Planned: Not reported
SOC Sighned: Not reported
Reclassification Report: Not reported
RS Designation: Not reported
Closure Request Date: Not reported
Close-out Report: Not reported

LUST:
Facility ID: Not reported
UST Number: RA-2237
Incident Number: 14309
Contamination Type: Groundwater/Both
Source Type: Leak-underground
Product Type: PETROLEUM
Date Reported: 05/15/1995
Date Occur: 03/14/1995
Cleanup: Not reported
Closure Request: Not reported
Close Out: 09/27/2007
Level Of Soil Cleanup Achieved: Residential
Tank Regulated Status: Non Regulated
Of Supply Wells: 0
Commercial/NonCommercial UST Site: COMMERCIAL
Risk Classification: L
Risk Class Based On Review: L
Corrective Action Plan Type: Not reported
NOV Issue Date: Not reported
NORR Issue Date: Not reported
Site Priority: 20E
Phase Of LSA Req: Not reported
Site Risk Reason: Not reported
Land Use: Residential
MTBE: No
MTBE1: No
Flag: No
Flag1: No
LUR Filed: 10/18/2007
Release Detection: 0
Current Status: File Located in Archives
RBCA GW: Cleanups to 2L.0202 standards
PETOPT: 3
RPL: False
CD Num: 440
Reel Num: Not reported
RPOW: False
RPOP: False
Error Flag: 0
Error Code: N
Valid: False
Lat/Long: 35 46 36.54 - 78 38 .6
Lat/Long Decimal: 35.7768 -78.6335
Testlat: Not reported

NW CORNER EAST & MARTIN STREET (Continued) **S101643247**

Regional Officer Project Mgr:	SMJ
Region:	Raleigh
Company:	CITY OF RALEIGH
Contact Person:	DOUG BETHUNE
Telephone:	919-890-3170
RP Address:	P.O. BOX 590
RP City,St,Zip:	RALEIGH, NC 27602-
RP County:	Not reported
Comments:	1/14/2003 Review indicated from adjacent incidents (BlockA42) that there are no pot. Receptors and GW was<<gcls so low risk determined. KAH
5 Min Quad:	K39q

PIRF:

Facility Id:	14309
Date Occurred:	3/14/1995
Date Reported:	7/31/1995
Description Of Incident:	UPON REMOVAL OF 2 USTS, TPH WAS FOUND IN SOIL TO BE 12,400 PPM.
Owner/Operator:	DOUG BETHONE
Ownership:	1
Operation Type:	6
Type:	3
Location:	1
Site Priority:	20E
Priority Update:	4/16/1998
Wells Affected Y/N:	N
Samples Include:	0
7#5 Minute Quad:	3
5 Minute Quad:	2
Pirf/Min Soil:	Not reported
Release Code:	K39Q
Source Code:	Pirf
Err Type:	Not reported
Cause:	Not reported
Source:	Not reported
Ust Number:	Not reported
Last Modified:	Not reported
Incident Phase:	**Closed Out**
NOV Issued:	Not reported
NORR Issued:	Not reported
45 Day Report:	Not reported
Public Meeting Held:	Not reported
Corrective Action Planned:	Not reported
SOC Signed:	Not reported
Reclassification Report:	Not reported
RS Designation:	Not reported
Closure Request Date:	Not reported
Close-out Report:	Not reported

B6 **WAREHOUSE OF TIRES** **NC IMD S106349057**
SW **319 S PERSON ST** **NC LUST N/A**
< 1/8 **RALEIGH, NC**
0.096 mi.
506 ft. **Site 3 of 3 in cluster B**

Relative:
Higher

Actual:
320 ft.

IMD:

Region:	RAL
Facility ID:	3897
Date Occurred:	1/4/1989
Submit Date:	1/25/1989
GW Contam:	Yes, Groundwater Contamination has been detected
Soil Contam:	No
Incident Desc:	CONTAM. SOIL WAS DISCOVERED DURING REMOVAL OF TANKS.
Operator:	FRANK KOONTZ, DIRECTOR
Contact Phone:	Not reported
Owner Company:	WAKE CO. PUBLIC SCHOOL SYSTEM
Operator Address:	1551 ROCK QUARRY ROAD
Operator City:	RALEIGH
Oper City,St,Zip:	RALEIGH, NC 27610-
Ownership:	Private
Operation:	Commercial
Material:	GASOLINE
Qty Lost 1:	Not reported
Qty Recovered 1:	NONE
Source:	Leak-underground
Type:	Gasoline/diesel
Location:	Facility
Setting:	Urban
Risk Site:	L
Site Priority:	85E
Priority Code:	L
Priority Update:	4/16/1998
Dem Contact:	WDP
Wells Affected:	No
Num Affected:	0
Wells Contam:	Not reported
Sampled By:	Other
Samples Include:	Not reported
7.5 Min Quad:	Not reported
5 Min Quad:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Latitude Number:	Not reported
Longitude Number:	Not reported
Latitude Decimal:	Not reported
Longitude Decimal:	Not reported
GPS:	NOD
Agency:	DWM
Facility ID:	3897
Last Modified:	11/16/2000
Incident Phase:	Closed Out
NOV Issued:	6/22/1989
NORR Issued:	Not reported
45 Day Report:	Not reported
Public Meeting Held:	Not reported
Corrective Action Planned:	Not reported
SOC Sighned:	Not reported
Reclassification Report:	Not reported

WAREHOUSE OF TIRES (Continued) **S106349057**

RS Designation: Not reported
Closure Request Date: Not reported
Close-out Report: 9/27/2000

LUST:
Facility ID: 00-0-000
UST Number: RA-633
Incident Number: 3897
Contamination Type: Groundwater/Both
Source Type: Leak-underground
Product Type: PETROLEUM
Date Reported: 01/04/1989
Date Occur: 01/04/1989
Cleanup: Not reported
Closure Request: 2000-09-15 00:00:00
Close Out: 09/27/2000
Level Of Soil Cleanup Achieved: Not reported
Tank Regulated Status: Regulated
Of Supply Wells: 0
Commercial/NonCommercial UST Site: COMMERCIAL
Risk Classification: L
Risk Class Based On Review: L
Corrective Action Plan Type: C
NOV Issue Date: Not reported
NORR Issue Date: 07/12/2000
Site Priority: 60
Phase Of LSA Req: Not reported
Site Risk Reason: Not reported
Land Use: Residential
MTBE: No
MTBE1: Unknown
Flag: No
Flag1: No
LUR Filed: Not reported
Release Detection: 0
Current Status: File Located in Archives
RBCA GW: Not reported
PETOPT: 3
RPL: False
CD Num: 155
Reel Num: 125
RPOW: False
RPOP: False
Error Flag: 0
Error Code: N
Valid: False
Lat/Long: 3546352 -7838052
Lat/Long Decimal: 0 0
Testlat: Not reported
Regional Officer Project Mgr: WDP
Region: Raleigh
Company: WAKE CO. PUBLIC SCHOOL SYSTEM
Contact Person: FRANK KOONTZ, DIRECTOR
Telephone: Not reported
RP Address: 1551 ROCK QUARRY ROAD
RP City,St,Zip: RALEIGH, NC 27610-

WAREHOUSE OF TIRES (Continued) **S106349057**

RP County: WAKE
Comments: OK FOR NFA 9/30/99 BUT REOPENED 5/00 .LAS 6/30/00. SAR rec'd 7/17/00.
5 Min Quad: K39q

PIRF:

Facility Id:	3897
Date Occurred:	1/4/1989
Date Reported:	1/25/1989
Description Of Incident:	CONTAM. SOIL WAS DISCOVERED DURING REMOVAL OF TANKS.
Owner/Operator:	DAVID M. GOURLEY
Ownership:	4
Operation Type:	6
Type:	3
Location:	1
Site Priority:	85E
Priority Update:	4/16/1998
Wells Affected Y/N:	N
Samples Include:	0
7#5 Minute Quad:	4
5 Minute Quad:	Not reported
Pirf/Min Soil:	Not reported
Release Code:	Not reported
Source Code:	Pirf
Err Type:	Not reported
Cause:	Not reported
Source:	Not reported
Ust Number:	Not reported
Last Modified:	11/16/2000
Incident Phase:	**Closed Out**
NOV Issued:	6/22/1989
NORR Issued:	Not reported
45 Day Report:	Not reported
Public Meeting Held:	Not reported
Corrective Action Planned:	Not reported
SOC Signed:	Not reported
Reclassification Report:	Not reported
RS Designation:	Not reported
Closure Request Date:	Not reported
Close-out Report:	9/27/2000

C7 **KLYMAN ESTATE** **NC IMD S105765024**
South **412 E DAVIE ST** **NC LUST N/A**
1/8-1/4 **RALEIGH, NC 27601**
0.143 mi.
755 ft. **Site 1 of 3 in cluster C**

Relative:
Lower

Actual:
295 ft.

IMD:

Region:	RAL
Facility ID:	10820
Date Occurred:	7/8/1993
Submit Date:	8/29/1993
GW Contam:	Yes, Groundwater Contamination has been detected
Soil Contam:	No
Incident Desc:	REMOVED UST AND FOUND SOIL CONTAMINATION. 2502 PPM GASOLINE.
Operator:	NELL HARAND
Contact Phone:	704-487-6506
Owner Company:	Not reported

KLYMAN ESTATE (Continued) **S105765024**

Operator Address: 102 COLUMNS CIRCLE
Operator City: SHELBY
Oper City,St,Zip: SHELBY, NC 28150-
Ownership: Private
Operation: Commercial
Material: GASOLINE
Qty Lost 1: Not reported
Qty Recovered 1: Not reported
Source: Leak-underground
Type: Gasoline/diesel
Location: Facility
Setting: Urban
Risk Site: L
Site Priority: 40E
Priority Code: L
Priority Update: 4/16/1998
Dem Contact: WDP
Wells Affected: No
Num Affected: 0
Wells Contam: Not reported
Sampled By: Responsible Parties
Samples Include: Groundwater Samples
7.5 Min Quad: Not reported
5 Min Quad: K39T
Latitude: 35.76888888
Longitude: -78.6225
Latitude Number: 354608
Longitude Number: 783721
Latitude Decimal: 35.7688888888889
Longitude Decimal: 78.6225
GPS: NOD
Agency: DWM
Facility ID: 10820
Last Modified: 1/26/1999
Incident Phase: Closed Out
NOV Issued: Not reported
NORR Issued: Not reported
45 Day Report: Not reported
Public Meeting Held: Not reported
Corrective Action Planned: 4/2/1996
SOC Sighned: Not reported
Reclassification Report: Not reported
RS Designation: Not reported
Closure Request Date: Not reported
Close-out Report: 10/19/1998

LUST:
Facility ID: 00-0-000
UST Number: RA-1777
Incident Number: 10820
Contamination Type: Groundwater/Both
Source Type: Leak-underground
Product Type: PETROLEUM
Date Reported: 07/08/1993
Date Occur: 07/08/1993
Cleanup: Not reported

KLYMAN ESTATE (Continued) **S105765024**

Closure Request:	1998-06-04 00:00:00	
Close Out:	10/19/1998	
Level Of Soil Cleanup Achieved:		Industrial/Commercial
Tank Regulated Status:		Regulated
# Of Supply Wells:	0	
Commercial/NonCommercial UST Site:		COMMERCIAL
Risk Classification:		L
Risk Class Based On Review:		L
Corrective Action Plan Type:		Not reported
NOV Issue Date:	Not reported	
NORR Issue Date:	Not reported	
Site Priority:	40E	
Phase Of LSA Req:	Not reported	
Site Risk Reason:	Not reported	
Land Use:	Residential	
MTBE:	No	
MTBE1:	Unknown	
Flag:	No	
Flag1:	No	
LUR Filed:	Not reported	
Release Detection:	0	
Current Status:	File Located in Archives	
RBCA GW:	Cleanups to alternate standards	
PETOPT:	3	
RPL:	False	
CD Num:	136	
Reel Num:	56	
RPOW:	False	
RPOP:	False	
Error Flag:	0	
Error Code:	N	
Valid:	False	
Lat/Long:	354608 -783721	
Lat/Long Decimal:	0 0	
Testlat:	Not reported	
Regional Officer Project Mgr:		WDP
Region:		Raleigh
Company:		Not reported
Contact Person:		NELL HARAND
Telephone:		704-487-6506
RP Address:		102 COLUMNS CIRCLE
RP City,St,Zip:		SHELBY, NC 28150-
RP County:		Not reported
Comments:	L-CAP recommended for approval and sent to CO on 3/12/96.APPRVD 4/2/96.-all wells on site have or had PCE or TCE contamination as high as 100 ppb-1-soil sample above the Ind/comm msccs for compounds not related to the site, but resample showed bdl.	
5 Min Quad:	K39t	

PIRF:

Facility Id:	10820
Date Occurred:	7/8/1993
Date Reported:	8/29/1993
Description Of Incident:	REMOVED UST AND FOUND SOIL CONTAMINATION. 2502 PPM GASOLINE.
Owner/Operator:	NELL HARRAND
Ownership:	4
Operation Type:	6
Type:	3

KLYMAN ESTATE (Continued) **S105765024**

Location:	1
Site Priority:	40E
Priority Update:	4/16/1998
Wells Affected Y/N:	N
Samples Include:	0
7#5 Minute Quad:	3
5 Minute Quad:	1
Pirf/Min Soil:	Not reported
Release Code:	K39T
Source Code:	Pirf
Err Type:	Not reported
Cause:	Not reported
Source:	Not reported
Ust Number:	Not reported
Last Modified:	1/26/1999
Incident Phase:	**Closed Out**
NOV Issued:	Not reported
NORR Issued:	Not reported
45 Day Report:	Not reported
Public Meeting Held:	Not reported
Corrective Action Planned:	4/2/1996
SOC Signed:	Not reported
Reclassification Report:	Not reported
RS Designation:	Not reported
Closure Request Date:	Not reported
Close-out Report:	10/19/1998

C8 **DAVIE STREET S/C** **NC LUST TRUST U003143159**
South **412 EAST DAVIE STREET** **NC UST N/A**
1/8-1/4 **RALEIGH, NC 27601**
0.143 mi.
755 ft. **Site 2 of 3 in cluster C**

Relative:
Lower

Actual:
295 ft.

LUST TRUST:

Facility ID:	0-005129
Site ID:	10820
Site Note:	Not reported
Site Eligible?:	True
Commercial Find:	100% Commercial
Priority Rank:	Low
Deductable Amount:	20000
3rd Party Deductable Amt:	100000
Sum 3rd Party Amt Applied:	0

Click this hyperlink while viewing on your computer to access additional NC LUST TRUST: detail in the EDR Site Report.

UST:

Facility Id:	00-0-0000005129
Contact:	KATHERINE K. ACTON(EXECUTRIX)
Contact Address1:	2804 WYCLIFF ROAD
Contact Address2:	Not reported
Contact City/State/Zip:	RALEIGH, NC 27607
FIPS County Desc:	Wake
Latitude:	0
Longitude:	0

DAVIE STREET S/C (Continued) **U003143159**

Tank Id:	1
Tank Status:	Removed
Installed Date:	05/15/1961
Perm Close Date:	08/02/1993
Product Key:	3
Product Name:	Gasoline, Gas Mix
Tank Capacity:	2000
Root Tank Id:	Not reported
Main Tank:	No
Compartment Tank:	No
Manifold Tank:	Not reported
Commercial:	Yes
Regulated:	Yes
Tank Construction:	Single Wall Steel
Piping Construction:	Single Wall Steel
Piping System Key:	Unknown
Other CP Tank:	Not reported

Tank Id:	2
Tank Status:	Removed
Installed Date:	05/15/1961
Perm Close Date:	08/02/1993
Product Key:	3
Product Name:	Gasoline, Gas Mix
Tank Capacity:	4000
Root Tank Id:	Not reported
Main Tank:	No
Compartment Tank:	No
Manifold Tank:	Not reported
Commercial:	Yes
Regulated:	Yes
Tank Construction:	Single Wall Steel
Piping Construction:	Single Wall Steel
Piping System Key:	Unknown
Other CP Tank:	Not reported

Tank Id:	3
Tank Status:	Removed
Installed Date:	05/15/1961
Perm Close Date:	08/02/1993
Product Key:	8
Product Name:	Kerosene, Kero Mix
Tank Capacity:	500
Root Tank Id:	Not reported
Main Tank:	No
Compartment Tank:	No
Manifold Tank:	Not reported
Commercial:	Yes
Regulated:	Yes
Tank Construction:	Single Wall Steel
Piping Construction:	Single Wall Steel
Piping System Key:	Unknown
Other CP Tank:	Not reported

C9 **CARLTON PLACE DEVELOPMENT, LLC** **NC IMD** **S107671997**
South **415 SOUTH BLOODWORTH STREET** **NC LUST** **N/A**
1/8-1/4 **RALEIGH, NC**
0.156 mi.
825 ft. **Site 3 of 3 in cluster C**

Relative:
Lower

Actual:
299 ft.

IMD:

Region:	Not reported
Facility ID:	33035
Date Occurred:	2/17/2006
Submit Date:	3/8/2006
GW Contam:	No Groundwater Contamination detected
Soil Contam:	Yes
Incident Desc:	Not reported
Operator:	NATALIE CONNELL
Contact Phone:	9198324345
Owner Company:	DHIC, INC.
Operator Address:	113 SOUTH WILMINGTON STREET
Operator City:	RALEIGH
Oper City,St,Zip:	RALEIGH, NC 27601-
Ownership:	Unknown
Operation:	Commercial
Material:	Not reported
Qty Lost 1:	Not reported
Qty Recovered 1:	Not reported
Source:	Leak-underground
Type:	Gasoline/diesel
Location:	Facility
Setting:	Not reported
Risk Site:	L
Site Priority:	Not reported
Priority Code:	Not reported
Priority Update:	Not reported
Dem Contact:	SMJ
Wells Affected:	No
Num Affected:	Not reported
Wells Contam:	Not reported
Sampled By:	y
Samples Include:	Not reported
7.5 Min Quad:	Not reported
5 Min Quad:	Not reported
Latitude:	35.775
Longitude:	-78.63305555
Latitude Number:	354630
Longitude Number:	783759
Latitude Decimal:	35.775
Longitude Decimal:	78.6330555555556
GPS:	5
Agency:	DWM
Facility ID:	33035
Last Modified:	3/29/2006
Incident Phase:	Closed Out
NOV Issued:	Not reported
NORR Issued:	Not reported
45 Day Report:	Not reported
Public Meeting Held:	Not reported
Corrective Action Planned:	Not reported
SOC Sighned:	Not reported
Reclassification Report:	Not reported

CARLTON PLACE DEVELOPMENT, LLC (Continued) **S107671997**

RS Designation: Not reported
Closure Request Date: Not reported
Close-out Report: Not reported

LUST:
Facility ID: Not reported
UST Number: RA-5495
Incident Number: 33035
Contamination Type: Soil
Source Type: Leak-underground
Product Type: PETROLEUM
Date Reported: 03/08/2006
Date Occur: 02/17/2006
Cleanup: Not reported
Closure Request: Not reported
Close Out: 03/29/2006
Level Of Soil Cleanup Achieved: Residential
Tank Regulated Status: Non Regulated
Of Supply Wells: 0
Commercial/NonCommercial UST Site: NON COMMERCIAL
Risk Classification: L
Risk Class Based On Review: L
Corrective Action Plan Type: Not reported
NOV Issue Date: Not reported
NORR Issue Date: Not reported
Site Priority: Not reported
Phase Of LSA Req: Not reported
Site Risk Reason: Not reported
Land Use: Residential
MTBE: No
MTBE1: No
Flag: No
Flag1: No
LUR Filed: Not reported
Release Detection: 0
Current Status: File Located in Archives
RBCA GW: Cleanups to 2L.0202 standards
PETOPT: 3
RPL: False
CD Num: 312
Reel Num: 224
RPOW: False
RPOP: False
Error Flag: 0
Error Code: N
Valid: False
Lat/Long: 35 46 30.24 - 78 37 59.7
Lat/Long Decimal: 35.7750 -78.6332
Testlat: Not reported
Regional Officer Project Mgr: SMJ
Region: Raleigh
Company: DHIC, INC.
Contact Person: NATALIE CONNELL
Telephone: 9198324345
RP Address: 113 SOUTH WILMINGTON STREET
RP City,St,Zip: RALEIGH, NC 27601-

CARLTON PLACE DEVELOPMENT, LLC (Continued) **S107671997**

RP County: Not reported
Comments: See LSA tab. SMJ
5 Min Quad: Not reported

PIRF:
Facility Id: 33035
Date Occurred: 2/17/2006
Date Reported: 3/8/2006
Description Of Incident: Not reported
Owner/Operator: Not reported
Ownership: 3
Operation Type: 6
Type: 3
Location: 1
Site Priority: Not reported
Priority Update: Not reported
Wells Affected Y/N: n
Samples Include: Not reported
7#5 Minute Quad: y
5 Minute Quad: Not reported
Pirf/Min Soil: Not reported
Release Code: Not reported
Source Code: Not reported
Err Type: 9
Cause: Not reported
Source: Not reported
Ust Number: P

Last Modified: 3/29/2006
Incident Phase: Closed Out
NOV Issued: Not reported
NORR Issued: Not reported
45 Day Report: Not reported
Public Meeting Held: Not reported
Corrective Action Planned: Not reported
SOC Signed: Not reported
Reclassification Report: Not reported
RS Designation: Not reported
Closure Request Date: Not reported
Close-out Report: Not reported

D10 **WAKE COUNTY PUBLIC SCHOOLS (BLOCK A-42)** **NC IMD** **S104410968**
SSW **SOUTH PERSON AND EAST DAVIE** **NC LAST** **N/A**
1/8-1/4 **RALEIGH, NC 27601**
0.156 mi.
826 ft. **Site 1 of 4 in cluster D**

Relative:
Higher

Actual:
320 ft.

IMD:
Region: RAL
Facility ID: 85016
Date Occurred: 4/1/2000
Submit Date: 11/6/2000
GW Contam: No Groundwater Contamination detected
Soil Contam: Not reported
Incident Desc: SITE CLOSED OUT 10/22/1999. IS NOW MOORE SQUARE MUSEUMS MAGNET MIDDLE SCHOOL. 6/11/2003 Closed File- Sent to State Records Center 11/12/04 Box 6 of 7 Item #2568
Operator: KOONTZ, FRANK

WAKE COUNTY PUBLIC SCHOOLS (BLOCK A-42) (Continued) **S104410968**

Contact Phone: 919-856-3720
Owner Company: WAKE COUNTY PUBLIC SCHOOL SYSTEM
Operator Address: 1551 ROCK QUARRY ROAD
Operator City: RALEIGH
Oper City,St,Zip: RALEIGH, NC 919-856-3720
Ownership: 8
Operation: Residential
Material: Not reported
Qty Lost 1: Not reported
Qty Recovered 1: Not reported
Source: Unknown
Type: Other petroleum product
Location: Not reported
Setting: Not reported
Risk Site: Not reported
Site Priority: Not reported
Priority Code: E
Priority Update: Not reported
Dem Contact: ROUSH
Wells Affected: No
Num Affected: 0
Wells Contam: Not reported
Sampled By: Not reported
Samples Include: Not reported
7.5 Min Quad: Not reported
5 Min Quad: Not reported
Latitude: Not reported
Longitude: Not reported
Latitude Number: Not reported
Longitude Number: Not reported
Latitude Decimal: Not reported
Longitude Decimal: Not reported
GPS: GPS
Agency: DWQ
Facility ID: 85016
Last Modified: 11/17/2004
Incident Phase: Closed Out
NOV Issued: Not reported
NORR Issued: Not reported
45 Day Report: Not reported
Public Meeting Held: Not reported
Corrective Action Planned: Not reported
SOC Sighned: Not reported
Reclassification Report: Not reported
RS Designation: Not reported
Closure Request Date: Not reported
Close-out Report: 11/6/2000

LAST:
Facility ID: Not reported
UST Number: RA-85016
Incident Number: 85016
Contamination Type: NO
Source Type: 1
Product Type: N
Date Reported: 04/01/2000

WAKE COUNTY PUBLIC SCHOOLS (BLOCK A-42) (Continued) **S104410968**

Date Occur:	04/01/2000	
Cleanup:	Not reported	
Closure Request:	Not reported	
Close Out:	11/17/2004	
Level Of Soil Cleanup Achieved:		Not reported
Tank Regulated Status:		Not reported
# Of Supply Wells:	0	
Commercial/NonCommercial UST Site:		Not reported
Risk Classification:		L
Risk Class Based On Review:		L
Corrective Action Plan Type:		Not reported
NOV Issue Date:	Not reported	
NORR Issue Date:	Not reported	
Site Priority:	20	
Phase Of LSA Req:	Not reported	
Site Risk Reason:	Not reported	
Land Use:	Not reported	
MTBE:	No	
MTBE1:	Unknown	
Flag:	No	
Flag1:	No	
LUR Filed:	Not reported	
Release Detection:	0	
Current Status:	C	
RBCA GW:	Not reported	
PETOPT:	Not reported	
RPL:	False	
CD Num:	0	
Reel Num:	0	
RPOW:	False	
RPOP:	False	
Error Flag:	0	
Error Code:	Not reported	
Valid:	False	
Lat/Long:	35.77666 -78.63361	
Lat/Long Decimal:	35.77666 78.633610	
Testlat:	Not reported	
Regional Officer Project Mgr:		Not reported
Region:		RAL
Company:		WAKE COUNTY PUBLIC SCHOOL SYST
Contact Person:		FRANK KOONTZ
Telephone:		Not reported
RP Address:		1551 ROCK QUARRY ROAD
RP City,St,Zip:		RALEIGH, NC
RP County:		Not reported
Comments:	SITE CLOSED OUT 10/22/1999. IS NOW MOORE SQUARE MUSEUMS MAGNET MIDDLE SCHOOL. 6/11/2003Closed File- Sent to State Records Center 11/12/04 Box 6 of 7 Item #25681	
5 Min Quad:	Not reported	

PIRF:

Facility Id:	85016
Date Occurred:	Not reported
Date Reported:	Not reported
Description Of Incident:	Not reported
Owner/Operator:	Not reported
Ownership:	8
Operation Type:	3

WAKE COUNTY PUBLIC SCHOOLS (BLOCK A-42) (Continued) **S104410968**

Type:	Not reported
Location:	Not reported
Site Priority:	20E
Priority Update:	Not reported
Wells Affected Y/N:	N
Samples Include:	0
7#5 Minute Quad:	Not reported
5 Minute Quad:	Not reported
Pirf/Min Soil:	Not reported
Release Code:	Not reported
Source Code:	Not reported
Err Type:	Not reported
Cause:	Not reported
Source:	Not reported
Ust Number:	1
Last Modified:	11/17/2004
Incident Phase:	**CO**
NOV Issued:	Not reported
NORR Issued:	Not reported
45 Day Report:	Not reported
Public Meeting Held:	Not reported
Corrective Action Planned:	Not reported
SOC Signed:	Not reported
Reclassification Report:	Not reported
RS Designation:	Not reported
Closure Request Date:	Not reported
Close-out Report:	11/6/2000

E11 **RALEIGHS 500 E. DAVIE STREET PROPERTY** **NC LUST** **S109164506**
SSE **500 E. DAVIE STREET** **N/A**
1/8-1/4 **RALEIGH, NC 27601**
0.157 mi.
831 ft. **Site 1 of 4 in cluster E**

Relative:
Lower

Actual:
296 ft.

LUST:

Facility ID:	Not reported	
UST Number:	RA-6020	
Incident Number:	33560	
Contamination Type:		Soil
Source Type:	Leak-underground	
Product Type:	PETROLEUM	
Date Reported:	08/22/2008	
Date Occur:	06/24/2008	
Cleanup:	06/24/2008	
Closure Request:	Not reported	
Close Out:	08/06/2009	
Level Of Soil Cleanup Achieved:		Soil to Groundwater
Tank Regulated Status:		Regulated
# Of Supply Wells:	0	
Commercial/NonCommercial UST Site:		NON COMMERCIAL
Risk Classification:		L
Risk Class Based On Review:		L
Corrective Action Plan Type:		Not reported
NOV Issue Date:	Not reported	
NORR Issue Date:	Not reported	
Site Priority:	Not reported	
Phase Of LSA Req:	Not reported	

RALEIGHS 500 E. DAVIE STREET PROPERTY (Continued) **S109164506**

Site Risk Reason:	Not reported
Land Use:	Not reported
MTBE:	No
MTBE1:	Unknown
Flag:	No
Flag1:	No
LUR Filed:	Not reported
Release Detection:	0
Current Status:	File Located in House
RBCA GW:	Not reported
PETOPT:	3
RPL:	False
CD Num:	0
Reel Num:	0
RPOW:	False
RPOP:	False
Error Flag:	0
Error Code:	N
Valid:	False
Lat/Long:	35 46 30 - 78 37 56.64
Lat/Long Decimal:	35.7750 -78.6324
Testlat:	Not reported
Regional Officer Project Mgr:	JFM
Region:	Raleigh
Company:	City of Raleigh
Contact Person:	Alysia Bailey-Taylor
Telephone:	9195162682
RP Address:	One Exchange Plaza, Suite 400
RP City,St,Zip:	Raleigh, NC 27602
RP County:	Not reported
Comments:	Not reported
5 Min Quad:	Not reported

PIRF:

Facility Id:	33560
Date Occurred:	6/24/2008
Date Reported:	8/25/2008
Description Of Incident:	Underground piping associated with suspect UST of N/A gal. Size.
Owner/Operator:	Not reported
Ownership:	1
Operation Type:	1
Type:	3
Location:	1
Site Priority:	Not reported
Priority Update:	Not reported
Wells Affected Y/N:	N
Samples Include:	Not reported
7#5 Minute Quad:	Y
5 Minute Quad:	Not reported
Pirf/Min Soil:	Not reported
Release Code:	Not reported
Source Code:	Not reported
Err Type:	2
Cause:	3
Source:	B
Ust Number:	P
Last Modified:	Not reported

RALEIGHS 500 E. DAVIE STREET PROPERTY (Continued) **S109164506**

Incident Phase:	**Not reported**
NOV Issued:	Not reported
NORR Issued:	Not reported
45 Day Report:	Not reported
Public Meeting Held:	Not reported
Corrective Action Planned:	Not reported
SOC Signed:	Not reported
Reclassification Report:	Not reported
RS Designation:	Not reported
Closure Request Date:	Not reported
Close-out Report:	Not reported

E12 **500 E. DAVIE STREET** **US BROWNFIELDS** **1010376324**
SSE **500 E. DAVIE STREET** **FINDS** **N/A**
1/8-1/4 **RALEIGH, NC 27601**
0.157 mi.
831 ft. **Site 2 of 4 in cluster E**

Relative:
Lower

Actual:
296 ft.

US BROWNFIELDS:

Recipient name:	Raleigh, City of
Grant type:	Assessment
Property name:	500 E. DAVIE STREET
Property #:	1703-97-1116
Parcel size:	0.83
Property Description:	The property was a former warehouse and commercial space with various operations over the years including: repossession service, automotive maintenance and repair, and laundry and dry cleaners. The property is currently vacant. The warehouse portion is in relatively good repair and the other portions are dilapidated. The City of Raleigh purchased the property in 2001. A portion of the site was potentially owned and operated by the City of Raleigh as an auto repair facility in the 1940's. It was owned by Sanders Investment Corp. from 1964 to 1981 and individual owners from 1981 to 2001.
Latitude:	35.775262
Longitude:	-78.632371
HCM label:	Unknown
Map scale:	1:24,000
Point of reference:	Center of a Facility or Station
Datum:	World Geodetic System of 1984
ACRES property ID:	21861
Start date:	Not reported
Completed date:	Not reported
Acres cleaned up:	Not reported
Cleanup funding:	Not reported
Cleanup funding source:	Not reported
Assessment funding:	11500
Assessment funding source:	US EPA - Brownfields Assessment Cooperative Agreement
Redevelopment funding:	Not reported
Redev. funding source:	Not reported
Redev. funding entity name:	Not reported
Redevelopment start date:	Not reported
Assessment funding entity:	Not reported
Cleanup funding entity:	Not reported
Grant type:	B
Accomplishment type:	Supplemental Assessment
Accomplishment count:	0
Cooperative agreement #:	96416704
Ownership entity:	Government

500 E. DAVIE STREET (Continued) **1010376324**

Current owner:	City of Raleigh
Did owner change:	N
Cleanup required:	Yes
Video available:	No
Photo available:	Yes
Institutional controls required:	Y
IC Category proprietary controls:	Not reported
IC cat. info. devices:	Y
IC cat. gov. controls:	Not reported
IC cat. enforcement permit tools:	Not reported
IC in place date:	Not reported
IC in place:	Yes
State/tribal program date:	Not reported
State/tribal program ID:	Not reported
State/tribal NFA date:	6-Aug-09
Air contaminated:	Not reported
Air cleaned:	Not reported
Asbestos found:	Not reported
Asbestos cleaned:	Not reported
Controled substance found:	Not reported
Controled substance cleaned:	Not reported
Drinking water affected:	Not reported
Drinking water cleaned:	Not reported
Groundwater affected:	Not reported
Groundwater cleaned:	Not reported
Lead contaminant found:	Not reported
Lead cleaned up:	Not reported
No media affected:	Not reported
Unknown media affected:	Not reported
Other cleaned up:	Not reported
Other metals found:	Y
Other metals cleaned:	Y
Other contaminants found:	Not reported
Other contams found description:	Not reported
PAHs found:	Y
PAHs cleaned up:	Y
PCBs found:	Not reported
PCBs cleaned up:	Not reported
Petro products found:	Y
Petro products cleaned:	Y
Sediments found:	Not reported
Sediments cleaned:	Not reported
Soil affected:	Y
Soil cleaned up:	Y
Surface water cleaned:	Not reported
Unknown found:	Not reported
VOCs found:	Y
VOCs cleaned:	Y
Cleanup other description:	Not reported
Num. of cleanup and re-dev. jobs:	Not reported
Past use greenspace acreage:	Not reported
Past use residential acreage:	Not reported
Past use commercial acreage:	0.83
Past use industrial acreage:	Not reported
Future use greenspace acreage:	Not reported
Future use residential acreage:	Not reported
Future use commercial acreage:	Not reported

500 E. DAVIE STREET (Continued) **1010376324**

Future use industrial acreage:	Not reported
Greenspace acreage and type:	Not reported
Superfund Fed. landowner flag:	N
Recipient name:	Raleigh, City of
Grant type:	Assessment
Property name:	500 E. DAVIE STREET
Property #:	1703-97-1116
Parcel size:	0.83
Property Description:	The property was a former warehouse and commercial space with various operations over the years including: repossession service, automotive maintenance and repair, and laundry and dry cleaners. The property is currently vacant. The warehouse portion is in relatively good repair and the other portions are dilapidated. The City of Raleigh purchased the property in 2001. A portion of the site was potentially owned and operated by the City of Raleigh as an auto repair facility in the 1940's. It was owned by Sanders Investment Corp. from 1964 to 1981 and individual owners from 1981 to 2001.
Latitude:	35.775262
Longitude:	-78.632371
HCM label:	Unknown
Map scale:	1:24,000
Point of reference:	Center of a Facility or Station
Datum:	World Geodetic System of 1984
ACRES property ID:	21861
Start date:	Not reported
Completed date:	Not reported
Acres cleaned up:	Not reported
Cleanup funding:	Not reported
Cleanup funding source:	Not reported
Assessment funding:	3830
Assessment funding source:	US EPA - Brownfields Assessment Cooperative Agreement
Redevelopment funding:	Not reported
Redev. funding source:	Not reported
Redev. funding entity name:	Not reported
Redevelopment start date:	Not reported
Assessment funding entity:	Not reported
Cleanup funding entity:	Not reported
Grant type:	B
Accomplishment type:	Phase I Environmental Assessment
Accomplishment count:	1
Cooperative agreement #:	96416704
Ownership entity:	Government
Current owner:	City of Raleigh
Did owner change:	N
Cleanup required:	Yes
Video available:	No
Photo available:	Yes
Institutional controls required:	Y
IC Category proprietary controls:	Not reported
IC cat. info. devices:	Y
IC cat. gov. controls:	Not reported
IC cat. enforcement permit tools:	Not reported
IC in place date:	Not reported
IC in place:	Yes
State/tribal program date:	Not reported
State/tribal program ID:	Not reported

500 E. DAVIE STREET (Continued) **1010376324**

State/tribal NFA date:	6-Aug-09
Air contaminated:	Not reported
Air cleaned:	Not reported
Asbestos found:	Not reported
Asbestos cleaned:	Not reported
Controled substance found:	Not reported
Controled substance cleaned:	Not reported
Drinking water affected:	Not reported
Drinking water cleaned:	Not reported
Groundwater affected:	Not reported
Groundwater cleaned:	Not reported
Lead contaminant found:	Not reported
Lead cleaned up:	Not reported
No media affected:	Not reported
Unknown media affected:	Not reported
Other cleaned up:	Not reported
Other metals found:	Y
Other metals cleaned:	Y
Other contaminants found:	Not reported
Other contams found description:	Not reported
PAHs found:	Y
PAHs cleaned up:	Y
PCBs found:	Not reported
PCBs cleaned up:	Not reported
Petro products found:	Y
Petro products cleaned:	Y
Sediments found:	Not reported
Sediments cleaned:	Not reported
Soil affected:	Y
Soil cleaned up:	Y
Surface water cleaned:	Not reported
Unknown found:	Not reported
VOCs found:	Y
VOCs cleaned:	Y
Cleanup other description:	Not reported
Num. of cleanup and re-dev. jobs:	Not reported
Past use greenspace acreage:	Not reported
Past use residential acreage:	Not reported
Past use commercial acreage:	0.83
Past use industrial acreage:	Not reported
Future use greenspace acreage:	Not reported
Future use residential acreage:	Not reported
Future use commercial acreage:	Not reported
Future use industrial acreage:	Not reported
Greenspace acreage and type:	Not reported
Superfund Fed. landowner flag:	N

Recipient name:	Raleigh, City of
Grant type:	Assessment
Property name:	500 E. DAVIE STREET
Property #:	1703-97-1116
Parcel size:	0.83
Property Description:	The property was a former warehouse and commercial space with various operations over the years including: repossession service, automotive maintenance and repair, and laundry and dry cleaners. The property is currently vacant. The warehouse portion is in relatively good repair and the other portions are dilapidated. The City of Raleigh purchased

500 E. DAVIE STREET (Continued) **1010376324**

	the property in 2001. A portion of the site was potentially owned and operated by the City of Raleigh as an auto repair facility in the 1940's. It was owned by Sanders Investment Corp. from 1964 to 1981 and individual owners from 1981 to 2001.
Latitude:	35.775262
Longitude:	-78.632371
HCM label:	Unknown
Map scale:	1:24,000
Point of reference:	Center of a Facility or Station
Datum:	World Geodetic System of 1984
ACRES property ID:	21861
Start date:	Not reported
Completed date:	Not reported
Acres cleaned up:	Not reported
Cleanup funding:	Not reported
Cleanup funding source:	Not reported
Assessment funding:	44170
Assessment funding source:	US EPA - Brownfields Assessment Cooperative Agreement
Redevelopment funding:	Not reported
Redev. funding source:	Not reported
Redev. funding entity name:	Not reported
Redevelopment start date:	Not reported
Assessment funding entity:	Not reported
Cleanup funding entity:	Not reported
Grant type:	B
Accomplishment type:	Phase II Environmental Assessment
Accomplishment count:	0
Cooperative agreement #:	96416704
Ownership entity:	Government
Current owner:	City of Raleigh
Did owner change:	N
Cleanup required:	Yes
Video available:	No
Photo available:	Yes
Institutional controls required:	Y
IC Category proprietary controls:	Not reported
IC cat. info. devices:	Y
IC cat. gov. controls:	Not reported
IC cat. enforcement permit tools:	Not reported
IC in place date:	Not reported
IC in place:	Yes
State/tribal program date:	Not reported
State/tribal program ID:	Not reported
State/tribal NFA date:	6-Aug-09
Air contaminated:	Not reported
Air cleaned:	Not reported
Asbestos found:	Not reported
Asbestos cleaned:	Not reported
Controled substance found:	Not reported
Controled substance cleaned:	Not reported
Drinking water affected:	Not reported
Drinking water cleaned:	Not reported
Groundwater affected:	Not reported
Groundwater cleaned:	Not reported
Lead contaminant found:	Not reported
Lead cleaned up:	Not reported
No media affected:	Not reported

500 E. DAVIE STREET (Continued) **1010376324**

Unknown media affected:	Not reported
Other cleaned up:	Not reported
Other metals found:	Y
Other metals cleaned:	Y
Other contaminants found:	Not reported
Other contams found description:	Not reported
PAHs found:	Y
PAHs cleaned up:	Y
PCBs found:	Not reported
PCBs cleaned up:	Not reported
Petro products found:	Y
Petro products cleaned:	Y
Sediments found:	Not reported
Sediments cleaned:	Not reported
Soil affected:	Y
Soil cleaned up:	Y
Surface water cleaned:	Not reported
Unknown found:	Not reported
VOCs found:	Y
VOCs cleaned:	Y
Cleanup other description:	Not reported
Num. of cleanup and re-dev. jobs:	Not reported
Past use greenspace acreage:	Not reported
Past use residential acreage:	Not reported
Past use commercial acreage:	0.83
Past use industrial acreage:	Not reported
Future use greenspace acreage:	Not reported
Future use residential acreage:	Not reported
Future use commercial acreage:	Not reported
Future use industrial acreage:	Not reported
Greenspace acreage and type:	Not reported
Superfund Fed. landowner flag:	N

Recipient name:	Raleigh, City of
Grant type:	BCRLF
Property name:	500 E. DAVIE STREET
Property #:	1703-97-1116
Parcel size:	0.83
Property Description:	The property was a former warehouse and commercial space with various operations over the years including: repossession service, automotive maintenance and repair, and laundry and dry cleaners. The property is currently vacant. The warehouse portion is in relatively good repair and the other portions are dilapidated. The City of Raleigh purchased the property in 2001. A portion of the site was potentially owned and operated by the City of Raleigh as an auto repair facility in the 1940's. It was owned by Sanders Investment Corp. from 1964 to 1981 and individual owners from 1981 to 2001.
Latitude:	35.775262
Longitude:	-78.632371
HCM label:	Unknown
Map scale:	1:24,000
Point of reference:	Center of a Facility or Station
Datum:	World Geodetic System of 1984
ACRES property ID:	21861
Start date:	1-Jun-08
Completed date:	1-Jul-09
Acres cleaned up:	Not reported

500 E. DAVIE STREET (Continued) **1010376324**

Cleanup funding:	45207
Cleanup funding source:	US EPA - Brownfields RLF Loan
Assessment funding:	Not reported
Assessment funding source:	Not reported
Redevelopment funding:	Not reported
Redev. funding source:	Not reported
Redev. funding entity name:	Not reported
Redevelopment start date:	Not reported
Assessment funding entity:	Not reported
Cleanup funding entity:	EPA
Grant type:	B
Accomplishment type:	Not reported
Accomplishment count:	0
Cooperative agreement #:	97432901
Ownership entity:	Government
Current owner:	City of Raleigh
Did owner change:	N
Cleanup required:	Yes
Video available:	No
Photo available:	Yes
Institutional controls required:	Y
IC Category proprietary controls:	Not reported
IC cat. info. devices:	Y
IC cat. gov. controls:	Not reported
IC cat. enforcement permit tools:	Not reported
IC in place date:	Not reported
IC in place:	Yes
State/tribal program date:	Not reported
State/tribal program ID:	Not reported
State/tribal NFA date:	6-Aug-09
Air contaminated:	Not reported
Air cleaned:	Not reported
Asbestos found:	Not reported
Asbestos cleaned:	Not reported
Controled substance found:	Not reported
Controled substance cleaned:	Not reported
Drinking water affected:	Not reported
Drinking water cleaned:	Not reported
Groundwater affected:	Not reported
Groundwater cleaned:	Not reported
Lead contaminant found:	Not reported
Lead cleaned up:	Not reported
No media affected:	Not reported
Unknown media affected:	Not reported
Other cleaned up:	Not reported
Other metals found:	Y
Other metals cleaned:	Y
Other contaminants found:	Not reported
Other contams found description:	Not reported
PAHs found:	Y
PAHs cleaned up:	Y
PCBs found:	Not reported
PCBs cleaned up:	Not reported
Petro products found:	Y
Petro products cleaned:	Y
Sediments found:	Not reported
Sediments cleaned:	Not reported

500 E. DAVIE STREET (Continued) **1010376324**

Soil affected:	Y
Soil cleaned up:	Y
Surface water cleaned:	Not reported
Unknown found:	Not reported
VOCs found:	Y
VOCs cleaned:	Y
Cleanup other description:	Not reported
Num. of cleanup and re-dev. jobs:	Not reported
Past use greenspace acreage:	Not reported
Past use residential acreage:	Not reported
Past use commercial acreage:	0.83
Past use industrial acreage:	Not reported
Future use greenspace acreage:	Not reported
Future use residential acreage:	Not reported
Future use commercial acreage:	Not reported
Future use industrial acreage:	Not reported
Greenspace acreage and type:	Not reported
Superfund Fed. landowner flag:	N

FINDS:

Registry ID: 110038697407

Environmental Interest/Information System
US EPA Assessment, Cleanup and Redevelopment Exchange System (ACRES) is an federal online database for Brownfields Grantees to electronically submit data directly to EPA.

E13 **RALEIGH WELDING WORKS (FORMER)** **NC SHWS S105807434**
SSE **414 SOUTH EAST STREET** **NC IMD N/A**
1/8-1/4 **RALEIGH, NC**
0.169 mi.
891 ft. **Site 3 of 4 in cluster E**

Relative:
Lower

Actual:
294 ft.

SHWS:

Facility ID:	NONCD0002365
Lat/Longitude:	35.7749 / -78.6326
Geolocation Method:	UNKNOWN

IMD:

Region:	RAL
Facility ID:	86541
Date Occurred:	1/22/2003
Submit Date:	3/17/2003
GW Contam:	Groundwater Contamination status unknown
Soil Contam:	Not reported
Incident Desc:	CONDUCTING ADDITIONAL SAMPLING AS OF 3/17/03. ALSO A UST SITE.
Operator:	WARREN, GREGG
Contact Phone:	919-833-0830
Owner Company:	DHIC INC.
Operator Address:	PO BOX 2185
Operator City:	RALEIGH
Oper City,St,Zip:	RALEIGH 919-833-0830
Ownership:	Federal
Operation:	8
Material:	Not reported

RALEIGH WELDING WORKS (FORMER) (Continued) **S105807434**

Qty Lost 1: Not reported
Qty Recovered 1: Not reported
Source: Spill-surface
Type: Metals
Location: Not reported
Setting: Not reported
Risk Site: Not reported
Site Priority: 30
Priority Code: E
Priority Update: Not reported
Dem Contact: J. ROUSH
Wells Affected: No
Num Affected: 0
Wells Contam: Not reported
Sampled By: Not reported
Samples Include: Not reported
7.5 Min Quad: Not reported
5 Min Quad: Not reported
Latitude: 35.774166
Longitude: -78.633333
Latitude Number: Not reported
Longitude Number: Not reported
Latitude Decimal: Not reported
Longitude Decimal: Not reported
GPS: GPS
Agency: DWQ
Facility ID: 86541
Last Modified: 3/17/2003
Incident Phase: Assessment
NOV Issued: Not reported
NORR Issued: Not reported
45 Day Report: Not reported
Public Meeting Held: Not reported
Corrective Action Planned: Not reported
SOC Sighned: Not reported
Reclassification Report: Not reported
RS Designation: Not reported
Closure Request Date: Not reported
Close-out Report: Not reported

Region: RAL
Facility ID: 87307
Date Occurred: 2/18/2005
Submit Date: 4/5/2005
GW Contam: Groundwater Contamination status unknown
Soil Contam: Not reported
Incident Desc: Not reported
Operator: ,
Contact Phone: 919-876-9799
Owner Company: Not reported
Operator Address: Not reported
Operator City: Not reported
Oper City,St,Zip: NC 919-876-9799
Ownership: Not Reported
Operation: Not Reported
Material: Not reported

RALEIGH WELDING WORKS (FORMER) (Continued) **S105807434**

Qty Lost 1:	Not reported
Qty Recovered 1:	Not reported
Source:	Unknown
Type:	Metals
Location:	Not reported
Setting:	Not reported
Risk Site:	Not reported
Site Priority:	40
Priority Code:	D
Priority Update:	Not reported
Dem Contact:	J. ROUSH
Wells Affected:	No
Num Affected:	Not reported
Wells Contam:	Not reported
Sampled By:	Not reported
Samples Include:	Not reported
7.5 Min Quad:	Not reported
5 Min Quad:	Not reported
Latitude:	35.7749
Longitude:	-78.6326
Latitude Number:	Not reported
Longitude Number:	Not reported
Latitude Decimal:	Not reported
Longitude Decimal:	Not reported
GPS:	GPS
Agency:	DWQ
Facility ID:	87307
Last Modified:	4/5/2005
Incident Phase:	Discovery
NOV Issued:	4/14/2005
NORR Issued:	Not reported
45 Day Report:	Not reported
Public Meeting Held:	Not reported
Corrective Action Planned:	Not reported
SOC Sighned:	Not reported
Reclassification Report:	Not reported
RS Designation:	Not reported
Closure Request Date:	Not reported
Close-out Report:	Not reported

E14 **WILKINS DETAIL AND REPAIR** **NC IMD** **S104482972**
SSE **418 S EAST ST** **NC LUST** **N/A**
1/8-1/4 **RALEIGH, NC**
0.172 mi.
907 ft. **Site 4 of 4 in cluster E**

Relative:
Lower

Actual:
294 ft.

IMD:

Region:	RAL
Facility ID:	20846
Date Occurred:	7/6/1999
Submit Date:	11/22/1999
GW Contam:	No Groundwater Contamination detected
Soil Contam:	Yes
Incident Desc:	TPH 960 PPM AT TANK PIT AND 420 PPM AT DEPENSER ISALND.
Operator:	W D PARKER
Contact Phone:	Not reported
Owner Company:	Not reported

WILKINS DETAIL AND REPAIR (Continued) **S104482972**

Operator Address: Not reported
Operator City: Not reported
Oper City,St,Zip: Not reported
Ownership: Private
Operation: Commercial
Material: GASOLINE
Qty Lost 1: Not reported
Qty Recovered 1: Not reported
Source: Leak-underground
Type: Gasoline/diesel
Location: Facility
Setting: Urban
Risk Site: L
Site Priority: Not reported
Priority Code: Not reported
Priority Update: 11/22/1999
Dem Contact: WDP
Wells Affected: No
Num Affected: Not reported
Wells Contam: Not reported
Sampled By: Responsible Parties
Samples Include: Soil Samples
7.5 Min Quad: Not reported
5 Min Quad: Not reported
Latitude: 35.775
Longitude: -78.6325
Latitude Number: 354630
Longitude Number: 783757
Latitude Decimal: 35.775
Longitude Decimal: 78.6325
GPS: NOD
Agency: DWM
Facility ID: 20846
Last Modified: Not reported
Incident Phase: Closed Out
NOV Issued: Not reported
NORR Issued: Not reported
45 Day Report: Not reported
Public Meeting Held: Not reported
Corrective Action Planned: Not reported
SOC Sighned: Not reported
Reclassification Report: Not reported
RS Designation: Not reported
Closure Request Date: Not reported
Close-out Report: Not reported

LUST:
Facility ID: Not reported
UST Number: RA-3174
Incident Number: 20846
Contamination Type: Soil
Source Type: Leak-underground
Product Type: PETROLEUM
Date Reported: 07/15/1999
Date Occur: 07/06/1999
Cleanup: 07/06/1999

WILKINS DETAIL AND REPAIR (Continued) **S104482972**

Closure Request:	Not reported	
Close Out:	03/08/2005	
Level Of Soil Cleanup Achieved:		Residential
Tank Regulated Status:		Regulated
# Of Supply Wells:	0	
Commercial/NonCommercial UST Site:		COMMERCIAL
Risk Classification:		L
Risk Class Based On Review:		L
Corrective Action Plan Type:		Not reported
NOV Issue Date:	Not reported	
NORR Issue Date:	Not reported	
Site Priority:	E	
Phase Of LSA Req:	Not reported	
Site Risk Reason:	Not reported	
Land Use:	Residential	
MTBE:	No	
MTBE1:	No	
Flag:	No	
Flag1:	No	
LUR Filed:	Not reported	
Release Detection:	0	
Current Status:	File Located in House	
RBCA GW:	Cleanups to 2L.0202 standards	
PETOPT:	3	
RPL:	False	
CD Num:	Not reported	
Reel Num:	Not reported	
RPOW:	False	
RPOP:	False	
Error Flag:	0	
Error Code:	N	
Valid:	True	
Lat/Long:	35 46 30 - 78 37 57.96	
Lat/Long Decimal:	35.7749 -78.6327	
Testlat:	Not reported	
Regional Officer Project Mgr:		WDP
Region:		Raleigh
Company:		Not reported
Contact Person:		W D PARKER
Telephone:		Not reported
RP Address:		Not reported
RP City,St,Zip:		Not reported
RP County:		Not reported
Comments:	-see also Klyman Estate as it is in the same block and whole block is up for redevelopment-MR. WILKINS IS NOT THE RP THE TANKS WERE THERE WHEN HE BOUGHT THE PLACE 20 YEARS AGO AND HE NEVER	
5 Min Quad:	Not reported	

PIRF:

Facility Id:	20846
Date Occurred:	7/15/1999
Date Reported:	11/22/1999
Description Of Incident:	TPH 960 PPM AT TANK PIT AND 420 PPM AT DEPENSER ISALND.
Owner/Operator:	WILLIAM WILKINS
Ownership:	4
Operation Type:	6
Type:	3
Location:	1

WILKINS DETAIL AND REPAIR (Continued) **S104482972**

Site Priority:	Not reported
Priority Update:	11/22/1999
Wells Affected Y/N:	N
Samples Include:	Not reported
7#5 Minute Quad:	3
5 Minute Quad:	2
Pirf/Min Soil:	Not reported
Release Code:	Not reported
Source Code:	PIRF
Err Type:	Not reported
Cause:	Not reported
Source:	Not reported
Ust Number:	Not reported
Last Modified:	Not reported
Incident Phase:	**Closed Out**
NOV Issued:	Not reported
NORR Issued:	Not reported
45 Day Report:	Not reported
Public Meeting Held:	Not reported
Corrective Action Planned:	Not reported
SOC Signed:	Not reported
Reclassification Report:	Not reported
RS Designation:	Not reported
Closure Request Date:	Not reported
Close-out Report:	Not reported

D15 **GENERAL SERVICES ADMIN.** **NC IMD** **S102868839**
SSW **420 S PERSON ST** **NC LUST** **N/A**
1/8-1/4 **RALEIGH, NC 27601**
0.174 mi.
920 ft. **Site 2 of 4 in cluster D**

Relative:
Higher

Actual:
315 ft.

IMD:

Region:	RAL
Facility ID:	12590
Date Occurred:	3/23/1994
Submit Date:	8/24/1994
GW Contam:	No Groundwater Contamination detected
Soil Contam:	Yes
Incident Desc:	SOIL SAMPLES CONFIRMED MINOR CONTAMINATION.
Operator:	MATTHEW PONTON
Contact Phone:	Not reported
Owner Company:	PRIVATE RES.
Operator Address:	RT. 1, BOX 177
Operator City:	SEABOARD
Oper City,St,Zip:	SEABOARD, NC 27876-
Ownership:	Private
Operation:	Commercial
Material:	GASOLINE
Qty Lost 1:	Not reported
Qty Recovered 1:	Not reported
Material:	DIESEL
Qty Lost:	Not reported
Qty Recovered:	Not reported
Source:	Leak-underground
Type:	Gasoline/diesel
Location:	Facility

GENERAL SERVICES ADMIN. (Continued) **S102868839**

Setting: Urban
Risk Site: H
Site Priority: 110B
Priority Code: H
Priority Update: 12/4/1998
Dem Contact: Not reported
Wells Affected: Not reported
Num Affected: 0
Wells Contam: Not reported
Sampled By: Not reported
Samples Include: Not reported
7.5 Min Quad: Not reported
5 Min Quad: Not reported
Latitude: 35.775
Longitude: -78.635
Latitude Number: 354630
Longitude Number: 783806
Latitude Decimal: 35.775
Longitude Decimal: 78.635
GPS: 7
Agency: DWM
Facility ID: 12590
Last Modified: 12/27/1994
Incident Phase: Closed Out
NOV Issued: Not reported
NORR Issued: Not reported
45 Day Report: Not reported
Public Meeting Held: Not reported
Corrective Action Planned: Not reported
SOC Sighned: Not reported
Reclassification Report: Not reported
RS Designation: Not reported
Closure Request Date: Not reported
Close-out Report: 8/15/1994

LUST:
Facility ID: 00-0-000
UST Number: RA-2050
Incident Number: 12590
Contamination Type: Soil
Source Type: Leak-underground
Product Type: PETROLEUM
Date Reported: 05/13/1994
Date Occur: 03/23/1994
Cleanup: Not reported
Closure Request: Not reported
Close Out: 08/15/1994
Level Of Soil Cleanup Achieved: Not reported
Tank Regulated Status: Regulated
Of Supply Wells: 0
Commercial/NonCommercial UST Site: COMMERCIAL
Risk Classification: H
Risk Class Based On Review: Not reported
Corrective Action Plan Type: Not reported
NOV Issue Date: Not reported
NORR Issue Date: Not reported

GENERAL SERVICES ADMIN. (Continued) **S102868839**

Site Priority:	Not reported
Phase Of LSA Req:	Not reported
Site Risk Reason:	Not reported
Land Use:	Not reported
MTBE:	No
MTBE1:	Unknown
Flag:	No
Flag1:	No
LUR Filed:	Not reported
Release Detection:	0
Current Status:	File Located in Archives
RBCA GW:	Not reported
PETOPT:	3
RPL:	False
CD Num:	27
Reel Num:	60
RPOW:	False
RPOP:	False
Error Flag:	0
Error Code:	N
Valid:	False
Lat/Long:	354630 -783806
Lat/Long Decimal:	0 0
Testlat:	Not reported
Regional Officer Project Mgr:	Not reported
Region:	Raleigh
Company:	PRIVATE RES.
Contact Person:	MATTHEW PONTON
Telephone:	Not reported
RP Address:	RT. 1, BOX 177
RP City,St,Zip:	SEABOARD, NC 27876-
RP County:	WAKE
Comments:	Not reported
5 Min Quad:	Not reported

PIRF:

Facility Id:	12590
Date Occurred:	3/23/1994
Date Reported:	8/24/1994
Description Of Incident:	SOIL SAMPLES CONFIRMED MINOR CONTAMINATION.
Owner/Operator:	MATTHEW PONTON
Ownership:	4
Operation Type:	6
Type:	3
Location:	1
Site Priority:	110B
Priority Update:	12/4/1998
Wells Affected Y/N:	Not reported
Samples Include:	0
7#5 Minute Quad:	Not reported
5 Minute Quad:	Not reported
Pirf/Min Soil:	Not reported
Release Code:	Not reported
Source Code:	Min_Soil
Err Type:	Not reported
Cause:	Not reported
Source:	Not reported
Ust Number:	Not reported

GENERAL SERVICES ADMIN. (Continued) **S102868839**

Last Modified:	12/27/1994
Incident Phase:	**Closed Out**
NOV Issued:	Not reported
NORR Issued:	Not reported
45 Day Report:	Not reported
Public Meeting Held:	Not reported
Corrective Action Planned:	Not reported
SOC Signed:	Not reported
Reclassification Report:	Not reported
RS Designation:	Not reported
Closure Request Date:	Not reported
Close-out Report:	8/15/1994

D16 **GENERAL SERVICES ADMINISTRATION** **NC UST** **U001439475**
SSW **420 S PERSON STREEET** **N/A**
1/8-1/4 **RALEIGH, NC 27601**
0.174 mi.
920 ft. **Site 3 of 4 in cluster D**

Relative:
Higher

Actual:
315 ft.

UST:

Facility Id:	00-0-0000031149
Contact:	W M SANDERS HEIRS
Contact Address1:	3328 GRANVILLE DR
Contact Address2:	Not reported
Contact City/State/Zip:	RALEIGH, NC 27609
FIPS County Desc:	Wake
Latitude:	0
Longitude:	0

Tank Id:	1
Tank Status:	Removed
Installed Date:	09/24/1977
Perm Close Date:	03/23/1994
Product Key:	3
Product Name:	Gasoline, Gas Mix
Tank Capacity:	10000
Root Tank Id:	Not reported
Main Tank:	No
Compartment Tank:	No
Manifold Tank:	Not reported
Commercial:	No
Regulated:	Yes
Tank Construction:	Single Wall Steel
Piping Construction:	Single Wall Steel
Piping System Key:	Unknown
Other CP Tank:	Not reported

Tank Id:	2
Tank Status:	Removed
Installed Date:	09/24/1977
Perm Close Date:	03/23/1994
Product Key:	3
Product Name:	Gasoline, Gas Mix
Tank Capacity:	10000
Root Tank Id:	Not reported
Main Tank:	No
Compartment Tank:	No

GENERAL SERVICES ADMINISTRATION (Continued) **U001439475**

Manifold Tank:	Not reported
Commercial:	No
Regulated:	Yes
Tank Construction:	Single Wall Steel
Piping Construction:	Single Wall Steel
Piping System Key:	Unknown
Other CP Tank:	Not reported

Tank Id:	3
Tank Status:	Removed
Installed Date:	09/24/1977
Perm Close Date:	03/24/1994
Product Key:	14
Product Name:	Oil, New/Used/Mix
Tank Capacity:	550
Root Tank Id:	Not reported
Main Tank:	No
Compartment Tank:	No
Manifold Tank:	Not reported
Commercial:	Yes
Regulated:	Yes
Tank Construction:	Single Wall Steel
Piping Construction:	Single Wall Steel
Piping System Key:	Unknown
Other CP Tank:	Not reported

D17
SSW
1/8-1/4
0.176 mi.
929 ft.

Relative:
Higher

Actual:
314 ft.

422 S PERSON ST **EDR US Hist Auto Stat** **1015487704**
RALEIGH, NC 27601 **N/A**

Site 4 of 4 in cluster D

EDR Historical Auto Stations:

Name:	NEIGHBORHOOD AUTO CTR INC
Year:	2003
Address:	422 S PERSON ST

Name:	CAPITAL AUTO WORKS INC
Year:	2004
Address:	422 S PERSON ST

18
North
1/8-1/4
0.190 mi.
1002 ft.

Relative:
Higher

Actual:
343 ft.

FLOYD S PIKE ELEC CONTRACTOR INC **NC UST** **U001439045**
430 NEWBURN AVE PO BOX 40325 **N/A**
RALEIGH, NC 27629

UST:

Facility Id:	00-0-0000027996
Contact:	PIKE ELECTRIC, INC.
Contact Address1:	PO BOX 868 - 100 PIKE WAY
Contact Address2:	Not reported
Contact City/State/Zip:	MOUNT AIRY, NC 27030-0868
FIPS County Desc:	Wake
Latitude:	0

FLOYD S PIKE ELEC CONTRACTOR INC (Continued) **U001439045**

Longitude: 0

Tank Id: 1
Tank Status: Removed
Installed Date: 09/23/1980
Perm Close Date: 12/20/1988
Product Key: 1
Product Name: Diesel
Tank Capacity: 10000
Root Tank Id: Not reported
Main Tank: No
Compartment Tank: No
Manifold Tank: Not reported
Commercial: Yes
Regulated: Yes
Tank Construction: Single Wall Steel
Piping Construction: Single Wall Steel
Piping System Key: Unknown
Other CP Tank: Not reported

Tank Id: 2
Tank Status: Removed
Installed Date: 09/23/1980
Perm Close Date: 12/20/1988
Product Key: 3
Product Name: Gasoline, Gas Mix
Tank Capacity: 550
Root Tank Id: Not reported
Main Tank: No
Compartment Tank: No
Manifold Tank: Not reported
Commercial: Yes
Regulated: Yes
Tank Construction: Single Wall Steel
Piping Construction: Single Wall Steel
Piping System Key: Unknown
Other CP Tank: Not reported

F19 **EDR US Hist Cleaners** **1015044676**
North **331 NEW BERN AVE** **N/A**
1/8-1/4 **RALEIGH, NC 27601**
0.198 mi.
1045 ft. **Site 1 of 6 in cluster F**

Relative:
Higher

Actual:
343 ft.

EDR Historical Cleaners:
Name: ACME CLEANERS
Year: 2002
Address: 331 NEW BERN AVE

Name: ACME CLEANERS
Year: 2012
Address: 331 NEW BERN AVE

F20 **ACME CLEANERS** **RCRA-CESQG** **1000195893**
North **331 NEW BERN AVE** **FINDS** **NCD981746282**
1/8-1/4 **RALEIGH, NC 27601**
0.198 mi.
1045 ft. **Site 2 of 6 in cluster F**

Relative:
Higher

Actual:
343 ft.

RCRA-CESQG:

Date form received by agency:	08/28/2012
Facility name:	ACME CLEANERS
Facility address:	331 NEW BERN AVE RALEIGH, NC 27601
EPA ID:	NCD981746282
Mailing address:	NEW BERN AVE RALEIGH, NC 27601
Contact:	PAUL S TRACY
Contact address:	BROWN BARK PLACE RALEIGH, NC 27615
Contact country:	US
Contact telephone:	919-848-0023
Contact email:	Not reported
EPA Region:	04
Land type:	Private
Classification:	Conditionally Exempt Small Quantity Generator
Description:	Handler: generates 100 kg or less of hazardous waste per calendar month, and accumulates 1000 kg or less of hazardous waste at any time; or generates 1 kg or less of acutely hazardous waste per calendar month, and accumulates at any time: 1 kg or less of acutely hazardous waste; or 100 kg or less of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste; or generates 100 kg or less of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste during any calendar month, and accumulates at any time: 1 kg or less of acutely hazardous waste; or 100 kg or less of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste

Owner/Operator Summary:

Owner/operator name:	SMITH-DIXON, INC.
Owner/operator address:	331 NEW BERN AVE RALEIGH, NC 27601
Owner/operator country:	Not reported
Owner/operator telephone:	(919) 828-1379
Legal status:	Private
Owner/Operator Type:	Owner
Owner/Op start date:	Not reported
Owner/Op end date:	Not reported

Handler Activities Summary:

U.S. importer of hazardous waste:	No
Mixed waste (haz. and radioactive):	No
Recycler of hazardous waste:	No
Transporter of hazardous waste:	No
Treater, storer or disposer of HW:	No
Underground injection activity:	No
On-site burner exemption:	No
Furnace exemption:	No

ACME CLEANERS (Continued) **1000195893**

Used oil fuel burner: No
Used oil processor: No
User oil refiner: No
Used oil fuel marketer to burner: No
Used oil Specification marketer: No
Used oil transfer facility: No
Used oil transporter: No

Historical Generators:
Date form received by agency: 09/23/2008
Facility name: ACME CLEANERS
Classification: Small Quantity Generator

Date form received by agency: 10/26/1989
Facility name: ACME CLEANERS
Classification: Small Quantity Generator

Hazardous Waste Summary:
Waste code: F002
Waste name: THE FOLLOWING SPENT HALOGENATED SOLVENTS: TETRACHLOROETHYLENE, METHYLENE CHLORIDE, TRICHLOROETHYLENE, 1,1,1-TRICHLOROETHANE, CHLOROBENZENE, 1,1,2-TRICHLORO-1,2,2-TRIFLUOROETHANE, ORTHO-DICHLOROBENZENE, TRICHLOROFLUOROMETHANE, AND 1,1,2-TRICHLOROETHANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE HALOGENATED SOLVENTS OR THOSE LISTED IN F001, F004, OR F005, AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

Violation Status: No violations found

Evaluation Action Summary:
Evaluation date: 04/22/1997
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: State

FINDS:

Registry ID: 110002358430

Environmental Interest/Information System
AFS (Aerometric Information Retrieval System (AIRS) Facility Subsystem) replaces the former Compliance Data System (CDS), the National Emission Data System (NEDS), and the Storage and Retrieval of Aerometric Data (SAROAD). AIRS is the national repository for information concerning airborne pollution in the United States. AFS is used to track emissions and compliance data from industrial plants. AFS data are utilized by states to prepare State Implementation Plans to comply with regulatory programs and by EPA as an input for the estimation of total national emissions. AFS is undergoing a major redesign to support facility operating permits required under Title V of the Clean Air Act.

NC-FITS (North Carolina - Facility Identification Template For States)

ACME CLEANERS (Continued) **1000195893**

is North Carolina Department of Environment and Natural Resources' (NCDENR) Facility Identification Template for States that provides a common facility identifier in order to improve accessibility to comprehensive information about environmental regulated entities in the state of North Carolina.

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

F21 **US POST OFFICE VMF** **NC IMD** **S100048340**
NNW **310 NEW BERN AVE** **N/A**
1/8-1/4 **RALEIGH, NC**
0.200 mi.
1057 ft. **Site 3 of 6 in cluster F**

Relative:
Higher

Actual:
344 ft.

IMD:

Region:	RAL
Facility ID:	16358
Date Occurred:	1/12/1995
Submit Date:	10/10/1996
GW Contam:	No Groundwater Contamination detected
Soil Contam:	Yes
Incident Desc:	UPON REMOVAL OF UST, SOIL CONTAM. WAS 9,610 PPM.
Operator:	MS. COURTNEY DEBORD
Contact Phone:	6785750772
Owner Company:	GENERAL SERVICESADMINISTRATION
Operator Address:	401 W PEACHTREE ST
Operator City:	ATLANTA
Oper City,St,Zip:	ATLANTA, GA 30308-
Ownership:	Private
Operation:	Commercial
Material:	FUEL OIL
Qty Lost 1:	Not reported
Qty Recovered 1:	Not reported
Source:	Leak-underground
Type:	Gasoline/diesel
Location:	Facility
Setting:	Urban
Risk Site:	L
Site Priority:	20E
Priority Code:	E
Priority Update:	9/25/2001
Dem Contact:	WDP
Wells Affected:	No
Num Affected:	0
Wells Contam:	Not reported
Sampled By:	Responsible Parties
Samples Include:	Soil Samples
7.5 Min Quad:	Not reported
5 Min Quad:	K39Q
Latitude:	35.78
Longitude:	-78.63444444
Latitude Number:	354648

US POST OFFICE VMF (Continued) **S100048340**

Longitude Number:	783804
Latitude Decimal:	35.78
Longitude Decimal:	78.6344444444444
GPS:	NOD
Agency:	DWM
Facility ID:	16358
Last Modified:	Not reported
Incident Phase:	RE
NOV Issued:	Not reported
NORR Issued:	Not reported
45 Day Report:	Not reported
Public Meeting Held:	Not reported
Corrective Action Planned:	Not reported
SOC Sighned:	Not reported
Reclassification Report:	Not reported
RS Designation:	Not reported
Closure Request Date:	Not reported
Close-out Report:	Not reported

Region:	RAL
Facility ID:	5661
Date Occurred:	5/16/1990
Submit Date:	6/8/1990
GW Contam:	No Groundwater Contamination detected
Soil Contam:	Yes
Incident Desc:	ANONYMOUS PHONE CALL; MOTOR OIL WAS BUBBLING UP BETWEEN CRACKS IN PARKING LOT.
Operator:	MIKE BENZ
Contact Phone:	919 665-2818
Owner Company:	US POSTAL SERVICE
Operator Address:	P. O. BOX 27497
Operator City:	GREENSBORO
Oper City,St,Zip:	GREENSBORO, NC 27495-1103
Ownership:	Federal
Operation:	Public Service
Material:	MOTOR OIL
Qty Lost 1:	Not reported
Qty Recovered 1:	NONE
Source:	Leak-underground
Type:	Gasoline/diesel
Location:	Facility
Setting:	Urban
Risk Site:	L
Site Priority:	40E
Priority Code:	L
Priority Update:	4/16/1998
Dem Contact:	WDP
Wells Affected:	No
Num Affected:	0
Wells Contam:	Not reported
Sampled By:	Not reported
Samples Include:	Not reported
7.5 Min Quad:	Not reported
5 Min Quad:	Not reported
Latitude:	35.77833333
Longitude:	-78.63388888

US POST OFFICE VMF (Continued) **S100048340**

Latitude Number:	354642
Longitude Number:	783802
Latitude Decimal:	35.7783333333333
Longitude Decimal:	78.6338888888889
GPS:	NOD
Agency:	DWM
Facility ID:	5661
Last Modified:	Not reported
Incident Phase:	RE
NOV Issued:	Not reported
NORR Issued:	Not reported
45 Day Report:	Not reported
Public Meeting Held:	Not reported
Corrective Action Planned:	Not reported
SOC Sighned:	Not reported
Reclassification Report:	Not reported
RS Designation:	Not reported
Closure Request Date:	Not reported
Close-out Report:	Not reported

F22 **FEDERAL COURTHOUSE BLDG** **RCRA-CESQG** **1004744462**
NNW **310 NEW BERN AVE** **FINDS** **NC6690308261**
1/8-1/4 **RALEIGH, NC 27601**
0.200 mi.
1057 ft. **Site 4 of 6 in cluster F**

Relative:
Higher

Actual:
344 ft.

RCRA-CESQG:

Date form received by agency:	11/09/1992
Facility name:	FEDERAL COURTHOUSE BLDG
Facility address:	310 NEW BERN AVE RALEIGH, NC 27601
EPA ID:	NC6690308261
Mailing address:	NEW BERN AVE RALEIGH, NC 27601
Contact:	STEVE GRANT
Contact address:	310 NEW BERN AVE RALEIGH, NC 27601
Contact country:	US
Contact telephone:	(919) 856-4680
Contact email:	Not reported
EPA Region:	04
Classification:	Conditionally Exempt Small Quantity Generator
Description:	Handler: generates 100 kg or less of hazardous waste per calendar month, and accumulates 1000 kg or less of hazardous waste at any time; or generates 1 kg or less of acutely hazardous waste per calendar month, and accumulates at any time: 1 kg or less of acutely hazardous waste; or 100 kg or less of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste; or generates 100 kg or less of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste during any calendar month, and accumulates at any time: 1 kg or less of acutely hazardous waste; or 100 kg or less of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste

FEDERAL COURTHOUSE BLDG (Continued) **1004744462**

Owner/Operator Summary:
Owner/operator name: US GOVERNMENT (GSA)
Owner/operator address: 310 NEW BERN AVENUE
RALEIGH, NC 27601
Owner/operator country: Not reported
Owner/operator telephone: (919) 856-4680
Legal status: Federal
Owner/Operator Type: Owner
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Handler Activities Summary:
U.S. importer of hazardous waste: No
Mixed waste (haz. and radioactive): No
Recycler of hazardous waste: No
Transporter of hazardous waste: No
Treater, storer or disposer of HW: No
Underground injection activity: No
On-site burner exemption: No
Furnace exemption: No
Used oil fuel burner: No
Used oil processor: No
User oil refiner: No
Used oil fuel marketer to burner: No
Used oil Specification marketer: No
Used oil transfer facility: No
Used oil transporter: No

Hazardous Waste Summary:
Waste code: D000
Waste name: Not Defined

Waste code: D018
Waste name: BENZENE

Violation Status: No violations found

FINDS:

Registry ID: 110004015039

Environmental Interest/Information System
RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

F23 **U.S. GENERAL SERVICES ADMIN.** **NC LUST** **U001434881**
NNW **310 NEW BERN AVENUE** **NC UST** **N/A**
1/8-1/4 **RALEIGH, NC 27601**
0.200 mi.
1057 ft. **Site 5 of 6 in cluster F**

Relative:
Higher

Actual:
344 ft.

LUST:

Facility ID:	Not reported	
UST Number:	RA-2625	
Incident Number:	16358	
Contamination Type:		Soil
Source Type:	Leak-underground	
Product Type:	PETROLEUM	
Date Reported:	03/07/1995	
Date Occur:	01/12/1995	
Cleanup:	01/12/1995	
Closure Request:	Not reported	
Close Out:	Not reported	
Level Of Soil Cleanup Achieved:		Not reported
Tank Regulated Status:		Non Regulated
# Of Supply Wells:	0	
Commercial/NonCommercial UST Site:		NON COMMERCIAL
Risk Classification:		L
Risk Class Based On Review:		L
Corrective Action Plan Type:		Not reported
NOV Issue Date:	Not reported	
NORR Issue Date:	Not reported	
Site Priority:	20E	
Phase Of LSA Req:	Not reported	
Site Risk Reason:	Not reported	
Land Use:	Residential	
MTBE:	No	
MTBE1:	Unknown	
Flag:	No	
Flag1:	No	
LUR Filed:	Not reported	
Release Detection:	0	
Current Status:	File Located in House	
RBCA GW:	Not reported	
PETOPT:	4	
RPL:	False	
CD Num:	Not reported	
Reel Num:	Not reported	
RPOW:	False	
RPOP:	False	
Error Flag:	0	
Error Code:	N	
Valid:	False	
Lat/Long:	35 46 44.82 - 78 38 2.58	
Lat/Long Decimal:	35.7791 -78.6340	
Testlat:	Not reported	
Regional Officer Project Mgr:		WDP
Region:		Raleigh
Company:		GENERAL SERVICESADMINISTRATION
Contact Person:		MS. COURTNEY DEBORD
Telephone:		6785750772
RP Address:		401 W PEACHTREE ST
RP City,St,Zip:		ATLANTA, GA 30308-
RP County:		Not reported

U.S. GENERAL SERVICES ADMIN. (Continued) **U001434881**

Comments: MAJOR SOIL CONTAM IN WEST OF TANK PIT..//1/21/03 review determined"u" risk. 2000gal heating oil USYT reoved from US post office building on east side of bldg. Facing Bloodworth St./ Max cont. in soil-9610ppm TPH-DRO at west side of pit. No gw sample no po
5 Min Quad: Not reported

PIRF:
Facility Id: 16358
Date Occurred: 1/12/1995
Date Reported: 10/10/1996
Description Of Incident: UPON REMOVAL OF UST, SOIL CONTAM. WAS 9,610 PPM.
Owner/Operator: MR. GREG MAY
Ownership: 4
Operation Type: 6
Type: 5
Location: 1
Site Priority: 20E
Priority Update: 9/25/2001
Wells Affected Y/N: N
Samples Include: 0
7#5 Minute Quad: 3
5 Minute Quad: 2
Pirf/Min Soil: Not reported
Release Code: K39Q
Source Code: Pirf
Err Type: Not reported
Cause: Not reported
Source: Not reported
Ust Number: Not reported

Last Modified: Not reported
Incident Phase: **Response**
NOV Issued: Not reported
NORR Issued: Not reported
45 Day Report: Not reported
Public Meeting Held: Not reported
Corrective Action Planned: Not reported
SOC Signed: Not reported
Reclassification Report: Not reported
RS Designation: Not reported
Closure Request Date: Not reported
Close-out Report: Not reported

Facility ID: Not reported
UST Number: RA-830
Incident Number: 5661
Contamination Type: Soil
Source Type: Leak-underground
Product Type: PETROLEUM
Date Reported: 04/20/1990
Date Occur: 05/16/1990
Cleanup: 05/16/1990
Closure Request: Not reported
Close Out: Not reported
Level Of Soil Cleanup Achieved: Not reported
Tank Regulated Status: Both at same site
Of Supply Wells: 0
Commercial/NonCommercial UST Site: BOTH

U.S. GENERAL SERVICES ADMIN. (Continued) **U001434881**

Risk Classification:	L
Risk Class Based On Review:	L
Corrective Action Plan Type:	Not reported
NOV Issue Date:	Not reported
NORR Issue Date:	Not reported
Site Priority:	40E
Phase Of LSA Req:	Not reported
Site Risk Reason:	Not reported
Land Use:	Not reported
MTBE:	No
MTBE1:	Unknown
Flag:	No
Flag1:	No
LUR Filed:	Not reported
Release Detection:	0
Current Status:	File Located in House
RBCA GW:	Not reported
PETOPT:	5
RPL:	False
CD Num:	Not reported
Reel Num:	Not reported
RPOW:	False
RPOP:	False
Error Flag:	0
Error Code:	N
Valid:	False
Lat/Long:	35 46 42.54 - 78 38 2.1
Lat/Long Decimal:	35.7784 -78.6339
Testlat:	Not reported
Regional Officer Project Mgr:	WDP
Region:	Raleigh
Company:	US POSTAL SERVICE
Contact Person:	MIKE BENZ
Telephone:	919 665-2818
RP Address:	P. O. BOX 27497
RP City,St,Zip:	GREENSBORO, NC 27495-1103
RP County:	Not reported
Comments:	112/02 Review of file determined u risk from motor oil UST at person and New Bern . See also inc 16358. KAH
5 Min Quad:	K39q

PIRF:

Facility Id:	5661
Date Occurred:	4/20/1990
Date Reported:	6/8/1990
Description Of Incident:	ANONYMOUS PHONE CALL; MOTOR OIL WAS BUBBLING UP BETWEEN CRACKS IN PARKING LOT.
Owner/Operator:	MIKE BENZ
Ownership:	5
Operation Type:	1
Type:	5
Location:	1
Site Priority:	40E
Priority Update:	4/16/1998
Wells Affected Y/N:	N
Samples Include:	0
7#5 Minute Quad:	Not reported
5 Minute Quad:	Not reported

U.S. GENERAL SERVICES ADMIN. (Continued) **U001434881**

Pirf/Min Soil:	Not reported
Release Code:	Not reported
Source Code:	Pirf
Err Type:	Not reported
Cause:	Not reported
Source:	Not reported
Ust Number:	Not reported
Last Modified:	Not reported
Incident Phase:	**Response**
NOV Issued:	Not reported
NORR Issued:	Not reported
45 Day Report:	Not reported
Public Meeting Held:	Not reported
Corrective Action Planned:	Not reported
SOC Signed:	Not reported
Reclassification Report:	Not reported
RS Designation:	Not reported
Closure Request Date:	Not reported
Close-out Report:	Not reported

UST:

Facility Id:	00-0-0000005419
Contact:	U.S. GENERAL SERVICES ADMIN.
Contact Address1:	310 NEW BERN AVENUE
Contact Address2:	Not reported
Contact City/State/Zip:	RALEIGH, NC 27601
FIPS County Desc:	Wake
Latitude:	0
Longitude:	0
Tank Id:	01
Tank Status:	Removed
Installed Date:	05/09/1969
Perm Close Date:	04/15/1998
Product Key:	3
Product Name:	Gasoline, Gas Mix
Tank Capacity:	5000
Root Tank Id:	Not reported
Main Tank:	No
Compartment Tank:	No
Manifold Tank:	Not reported
Commercial:	Yes
Regulated:	Yes
Tank Construction:	Single Wall Steel
Piping Construction:	Single Wall Steel
Piping System Key:	Unknown
Other CP Tank:	Not reported
Tank Id:	02
Tank Status:	Removed
Installed Date:	05/09/1969
Perm Close Date:	04/15/1998
Product Key:	3
Product Name:	Gasoline, Gas Mix
Tank Capacity:	5000

U.S. GENERAL SERVICES ADMIN. (Continued) **U001434881**

Root Tank Id:	Not reported
Main Tank:	No
Compartment Tank:	No
Manifold Tank:	Not reported
Commercial:	Yes
Regulated:	Yes
Tank Construction:	Single Wall Steel
Piping Construction:	Single Wall Steel
Piping System Key:	Unknown
Other CP Tank:	Not reported

Tank Id:	5
Tank Status:	Removed
Installed Date:	05/09/1969
Perm Close Date:	01/12/1995
Product Key:	1
Product Name:	Diesel
Tank Capacity:	2000
Root Tank Id:	Not reported
Main Tank:	No
Compartment Tank:	No
Manifold Tank:	Not reported
Commercial:	Yes
Regulated:	Yes
Tank Construction:	Single Wall Steel
Piping Construction:	Unknown
Piping System Key:	Unknown
Other CP Tank:	Not reported

F24 **TRAILWAYS TERMINAL** **NC UST** **U001435664**
NNW **313 NEW BERN AVENUE** **N/A**
1/8-1/4 **RALEIGH, NC 27601**
0.202 mi.
1064 ft. **Site 6 of 6 in cluster F**

Relative:
Higher

Actual:
344 ft.

UST:

Facility Id:	00-0-0000006818
Contact:	CAROLINA COACH COMPANY
Contact Address1:	1201 SOUTH BLOUNT STREET
Contact Address2:	Not reported
Contact City/State/Zip:	RALEIGH, NC 27601-2622
FIPS County Desc:	Wake
Latitude:	0
Longitude:	0

Tank Id:	1
Tank Status:	Removed
Installed Date:	05/10/1981
Perm Close Date:	04/19/1990
Product Key:	1
Product Name:	Diesel
Tank Capacity:	10000
Root Tank Id:	Not reported
Main Tank:	No
Compartment Tank:	No
Manifold Tank:	Not reported
Commercial:	Yes

TRAILWAYS TERMINAL (Continued) **U001435664**

Regulated:	Yes
Tank Construction:	Single Wall Steel
Piping Construction:	Single Wall Steel
Piping System Key:	Unknown
Other CP Tank:	Not reported

---

25 **BRADLEY SPEEDOMETER SHOP** **NC LUST** **S108231248**
NW **101 S. BLOUNT STREET** **N/A**
1/8-1/4 **RALEIGH, NC 27606**
0.211 mi.
1114 ft.

Relative:
Higher

Actual:
335 ft.

LUST:

Facility ID:	Not reported	
UST Number:	RA-5601	
Incident Number:	33135	
Contamination Type:		Groundwater/Both
Source Type:	Leak-underground	
Product Type:	PETROLEUM	
Date Reported:	09/11/2006	
Date Occur:	06/16/2006	
Cleanup:	06/16/2006	
Closure Request:	Not reported	
Close Out:	10/30/2006	
Level Of Soil Cleanup Achieved:		Industrial/Commercial
Tank Regulated Status:		Regulated
# Of Supply Wells:	0	
Commercial/NonCommercial UST Site:		COMMERCIAL
Risk Classification:		L
Risk Class Based On Review:		L
Corrective Action Plan Type:		Not reported
NOV Issue Date:	Not reported	
NORR Issue Date:	Not reported	
Site Priority:	Not reported	
Phase Of LSA Req:	1	
Site Risk Reason:	Not reported	
Land Use:	Residential	
MTBE:	No	
MTBE1:	No	
Flag:	No	
Flag1:	No	
LUR Filed:	10/31/2006	
Release Detection:	0	
Current Status:	File Located in Archives	
RBCA GW:	Cleanups to alternate standards	
PETOPT:	3	
RPL:	False	
CD Num:	350	
Reel Num:	318	
RPOW:	False	
RPOP:	False	
Error Flag:	0	
Error Code:	N	
Valid:	False	
Lat/Long:	35 46 45.06 - 78 38 8.04	
Lat/Long Decimal:	35.7791 -78.6355	
Testlat:	Not reported	
Regional Officer Project Mgr:		JFM

BRADLEY SPEEDOMETER SHOP (Continued) **S108231248**

Region:	Raleigh
Company:	Bradley Speedometer Shop
Contact Person:	Mike Bradley
Telephone:	9198346526
RP Address:	5014 Forest Creek Road
RP City,St,Zip:	Raleigh, NC 27606
RP County:	Not reported
Comments:	One (01) 550-gallon heating oil UST, one (01) 550-gallon kerosene USTand three (03) 1K-gallon gasoline USTs. 09/14/2006, tanks pulled 6/15/06, JFM///
5 Min Quad:	Not reported

PIRF:

Facility Id:	33135
Date Occurred:	6/16/2006
Date Reported:	9/14/2006
Description Of Incident:	One (01) 550-gallon heating oil UST, one (01) 550-gallon kerosene USTand three (03) 1K-gallon gasoline USTs. 09/14/2006, JFM///
Owner/Operator:	Not reported
Ownership:	4
Operation Type:	6
Type:	3
Location:	1
Site Priority:	Not reported
Priority Update:	Not reported
Wells Affected Y/N:	Y
Samples Include:	Not reported
7#5 Minute Quad:	Y
5 Minute Quad:	Not reported
Pirf/Min Soil:	Not reported
Release Code:	Not reported
Source Code:	Not reported
Err Type:	2
Cause:	Not reported
Source:	Not reported
Ust Number:	P
Last Modified:	10/30/2006
Incident Phase:	**Closed Out**
NOV Issued:	Not reported
NORR Issued:	Not reported
45 Day Report:	Not reported
Public Meeting Held:	Not reported
Corrective Action Planned:	Not reported
SOC Signed:	Not reported
Reclassification Report:	Not reported
RS Designation:	Not reported
Closure Request Date:	Not reported
Close-out Report:	Not reported

G26 **DUNN'S SERVICE CENTER** **NC IMD** **S106074865**
South **502 S BLOODWORTH ST** **N/A**
1/8-1/4 **RALEIGH, NC**
0.237 mi.
1250 ft. **Site 1 of 3 in cluster G**

Relative:
Lower

Actual:
304 ft.

IMD:

Region:	RAL
Facility ID:	26398
Date Occurred:	7/17/2003
Submit Date:	10/3/2003
GW Contam:	No Groundwater Contamination detected
Soil Contam:	Yes
Incident Desc:	One (1) 4,000-gallon gasoline UST, One(1) 560-gallon used oil UST and One (1) 550-gallon kerosene UST
Operator:	EUGENE DUNN
Contact Phone:	Not reported
Owner Company:	DUNN EXXON
Operator Address:	2121 GARNER ROAD
Operator City:	RALEIGH
Oper City,St,Zip:	RALEIGH, NC 27601-
Ownership:	Municipal
Operation:	Commercial
Material:	Not reported
Qty Lost 1:	Not reported
Qty Recovered 1:	Not reported
Source:	Leak-underground
Type:	Gasoline/diesel
Location:	Facility
Setting:	Not reported
Risk Site:	Not reported
Site Priority:	Not reported
Priority Code:	Not reported
Priority Update:	Not reported
Dem Contact:	JFM
Wells Affected:	No
Num Affected:	Not reported
Wells Contam:	Not reported
Sampled By:	9
Samples Include:	Not reported
7.5 Min Quad:	Not reported
5 Min Quad:	Not reported
Latitude:	35.77361111
Longitude:	-78.63361111
Latitude Number:	354625
Longitude Number:	783801
Latitude Decimal:	35.7736111111111
Longitude Decimal:	78.6336111111111
GPS:	2
Agency:	DWM
Facility ID:	Not reported
Last Modified:	Not reported
Incident Phase:	Not reported
NOV Issued:	Not reported
NORR Issued:	Not reported
45 Day Report:	Not reported
Public Meeting Held:	Not reported
Corrective Action Planned:	Not reported
SOC Sighned:	Not reported

DUNN'S SERVICE CENTER (Continued) **S106074865**

Reclassification Report: Not reported
RS Designation: Not reported
Closure Request Date: Not reported
Close-out Report: Not reported

G27 **DUNNS TEXACO SERVICE** **NC LUST U003160518**
South **502 S BLOODWORTH STREET** **NC UST N/A**
1/8-1/4 **RALEIGH, NC 27601**
0.237 mi.
1250 ft. **Site 2 of 3 in cluster G**

Relative:
Lower

Actual:
304 ft.

LUST:

Facility ID:	00-0-000	
UST Number:	RA-4759	
Incident Number:	26398	
Contamination Type:		Groundwater/Both
Source Type:	Leak-underground	
Product Type:	PETROLEUM	
Date Reported:	10/03/2003	
Date Occur:	07/17/2003	
Cleanup:	07/17/2003	
Closure Request:	Not reported	
Close Out:	Not reported	
Level Of Soil Cleanup Achieved:		Not reported
Tank Regulated Status:		Regulated
# Of Supply Wells:	0	
Commercial/NonCommercial UST Site:		COMMERCIAL
Risk Classification:		L
Risk Class Based On Review:		L
Corrective Action Plan Type:		Not reported
NOV Issue Date:	Not reported	
NORR Issue Date:	Not reported	
Site Priority:	Not reported	
Phase Of LSA Req:	1	
Site Risk Reason:	Not reported	
Land Use:	Residential	
MTBE:	No	
MTBE1:	No	
Flag:	Yes	
Flag1:	No	
LUR Filed:	Not reported	
Release Detection:	0	
Current Status:	File Located in House	
RBCA GW:	Not reported	
PETOPT:	3	
RPL:	False	
CD Num:	0	
Reel Num:	0	
RPOW:	False	
RPOP:	False	
Error Flag:	0	
Error Code:	N	
Valid:	False	
Lat/Long:	35 46 25.68 - 78 38 1.26	
Lat/Long Decimal:	35.7738 -78.6336	
Testlat:	Not reported	
Regional Officer Project Mgr:		JFM

DUNNS TEXACO SERVICE (Continued) **U003160518**

Region: Raleigh
Company: DUNN EXXON
Contact Person: EUGENE DUNN
Telephone: Not reported
RP Address: 2121 GARNER ROAD
RP City,St,Zip: RALEIGH, NC 27601-
RP County: Not reported
Comments: Notice of Violation of 15A NCAC 2L.0405 [LSA] by Sheriff of Wake County. 06/21/2006, JFM/// Wake County Sheriff's office delivered NOV on 8/09/06, per Notice of Service rec'd on 8/17/06, RKD.Site visit 10/25/2006, no WSW seen. 10/26/2006/// NORR sent to City of Raleigh, The subject UST systems were in use on or after November 8, 1984, therefore, they pass with the real estate unless specifically excluded from the deed. 04/25/2007, JFM///
5 Min Quad: Not reported

PIRF:
Facility Id: 26398
Date Occurred: 7/17/2003
Date Reported: 10/3/2003
Description Of Incident: One (1) 4,000-gallon gasoline UST, One(1) 560-gallon used oil UST and One (1) 550-gallon kerosene UST
Owner/Operator: Not reported
Ownership: 1
Operation Type: 6
Type: 3
Location: 1
Site Priority: Not reported
Priority Update: Not reported
Wells Affected Y/N: N
Samples Include: Not reported
7#5 Minute Quad: 9
5 Minute Quad: Not reported
Pirf/Min Soil: Not reported
Release Code: Not reported
Source Code: Not reported
Err Type: 2
Cause: Not reported
Source: C
Ust Number: C

Last Modified: Not reported
Incident Phase: **Not reported**
NOV Issued: Not reported
NORR Issued: Not reported
45 Day Report: Not reported
Public Meeting Held: Not reported
Corrective Action Planned: Not reported
SOC Signed: Not reported
Reclassification Report: Not reported
RS Designation: Not reported
Closure Request Date: Not reported
Close-out Report: Not reported

UST:
Facility Id: 00-0-0000035269
Contact: DUNNS TEXACO SERVICE

DUNNS TEXACO SERVICE (Continued) **U003160518**

Contact Address1: 2121 GARNER ROAD
Contact Address2: Not reported
Contact City/State/Zip: RALEIGH, NC 27610-4607
FIPS County Desc: Wake
Latitude: 35.77386
Longitude: -78.63372

Tank Id: 1
Tank Status: Removed
Installed Date: 09/01/1984
Perm Close Date: 07/09/2003
Product Key: 3
Product Name: Gasoline, Gas Mix
Tank Capacity: 4000
Root Tank Id: Not reported
Main Tank: No
Compartment Tank: No
Manifold Tank: Not reported
Commercial: Yes
Regulated: Yes
Tank Construction: Single Wall FRP
Piping Construction: Single Wall FRP
Piping System Key: Unknown
Other CP Tank: Not reported

Tank Id: 2
Tank Status: Removed
Installed Date: 09/01/1984
Perm Close Date: 07/09/2003
Product Key: 3
Product Name: Gasoline, Gas Mix
Tank Capacity: 4000
Root Tank Id: Not reported
Main Tank: No
Compartment Tank: No
Manifold Tank: Not reported
Commercial: Yes
Regulated: Yes
Tank Construction: Single Wall FRP
Piping Construction: Single Wall FRP
Piping System Key: Unknown
Other CP Tank: Not reported

Tank Id: 3
Tank Status: Removed
Installed Date: 09/01/1984
Perm Close Date: 07/09/2003
Product Key: 3
Product Name: Gasoline, Gas Mix
Tank Capacity: 4000
Root Tank Id: Not reported
Main Tank: No
Compartment Tank: No
Manifold Tank: Not reported
Commercial: Yes

DUNNS TEXACO SERVICE (Continued) **U003160518**

Regulated:	Yes
Tank Construction:	Single Wall FRP
Piping Construction:	Single Wall FRP
Piping System Key:	Unknown
Other CP Tank:	Not reported

Tank Id:	4
Tank Status:	Removed
Installed Date:	01/01/1964
Perm Close Date:	07/10/2003
Product Key:	14
Product Name:	Oil, New/Used/Mix
Tank Capacity:	560
Root Tank Id:	Not reported
Main Tank:	No
Compartment Tank:	No
Manifold Tank:	Not reported
Commercial:	Yes
Regulated:	Yes
Tank Construction:	Double Wall FRP/Steel
Piping Construction:	DW Steel/FRP
Piping System Key:	Unknown
Other CP Tank:	Not reported

Tank Id:	5
Tank Status:	Removed
Installed Date:	01/01/1964
Perm Close Date:	07/10/2003
Product Key:	8
Product Name:	Kerosene, Kero Mix
Tank Capacity:	550
Root Tank Id:	Not reported
Main Tank:	No
Compartment Tank:	No
Manifold Tank:	Not reported
Commercial:	Yes
Regulated:	Yes
Tank Construction:	Double Wall FRP/Steel
Piping Construction:	DW Steel/FRP
Piping System Key:	Unknown
Other CP Tank:	Not reported

G28 **EDR US Hist Auto Stat** **1015525512**
South **502 S BLOODWORTH ST** **N/A**
1/8-1/4 **RALEIGH, NC 27601**
0.237 mi.
1250 ft. **Site 3 of 3 in cluster G**

Relative:
Lower

Actual:
304 ft.

EDR Historical Auto Stations:

Name:	DUNNS TEXACO SERVICE CENTER
Year:	1999
Address:	502 S BLOODWORTH ST
Name:	DUNNS TEXACO SERVICE CENTER
Year:	2000
Address:	502 S BLOODWORTH ST

(Continued) **1015525512**

Name: DUNNS TEXACO SERVICE CENTER
Year: 2001
Address: 502 S BLOODWORTH ST

Name: DUNNS EXXON
Year: 2003
Address: 502 S BLOODWORTH ST

29
SSW
1/8-1/4
0.238 mi.
1257 ft.

313 E CABARRUS ST
RALEIGH, NC 27601

EDR US Hist Auto Stat **1015416156**
N/A

Relative:
Lower

Actual:
300 ft.

EDR Historical Auto Stations:
Name: BIG DADDYS TWNG SRVC & AUTO
Year: 2002
Address: 313 E CABARRUS ST

30
WSW
1/4-1/2
0.255 mi.
1346 ft.

MCLAURIN CO PARKER LOT
120 EAST DAVIE STREET
RALEIGH, NC 27502

NC IMD **U003698353**
NC LUST **N/A**
NC LUST TRUST
NC UST

Relative:
Higher

Actual:
320 ft.

IMD:
Region: RAL
Facility ID: 21008
Date Occurred: 10/21/1999
Submit Date: 12/1/1999
GW Contam: Yes, Groundwater Contamination has been detected
Soil Contam: No
Incident Desc: TWO 1000 GALLON GASOLINE AND ONE 1000 GALLON STODDARD SOLVENT UST REMOVED FROM SITE SOIL CONTA DETECTED IN SAMPLE SW-1 2500PPM(EPA 5030) IN SAMPLE WW-1
Operator: SCOTT TOWNSEND
Contact Phone: 919-890-3162
Owner Company: CITY OF RALEIGH
Operator Address: 222 W. HARGETT ST./ PO BOX 590
Operator City: RALEIGH
Oper City,St,Zip: RALEIGH, NC 27601-
Ownership: Municipal
Operation: Commercial
Material: GASOLINE
Qty Lost 1: Not reported
Qty Recovered 1: Not reported
Material: STODDARD SOLVENT
Qty Lost: Not reported
Qty Recovered: Not reported
Source: Leak-underground
Type: Gasoline/diesel
Location: Facility
Setting: Urban
Risk Site: L
Site Priority: Not reported
Priority Code: Not reported

MCLAURIN CO PARKER LOT (Continued) **U003698353**

Priority Update:	12/1/1999
Dem Contact:	WDP
Wells Affected:	Not reported
Num Affected:	Not reported
Wells Contam:	Not reported
Sampled By:	Not reported
Samples Include:	Not reported
7.5 Min Quad:	Not reported
5 Min Quad:	Not reported
Latitude:	35.77527777
Longitude:	-78.63694444
Latitude Number:	354631
Longitude Number:	783813
Latitude Decimal:	35.7752777777778
Longitude Decimal:	78.6369444444444
GPS:	NOD
Agency:	DWM
Facility ID:	21008
Last Modified:	Not reported
Incident Phase:	Closed Out
NOV Issued:	Not reported
NORR Issued:	Not reported
45 Day Report:	Not reported
Public Meeting Held:	Not reported
Corrective Action Planned:	Not reported
SOC Sighned:	Not reported
Reclassification Report:	Not reported
RS Designation:	Not reported
Closure Request Date:	Not reported
Close-out Report:	Not reported

Region:	RAL
Facility ID:	26274
Date Occurred:	5/22/2003
Submit Date:	5/30/2003
GW Contam:	No Groundwater Contamination detected
Soil Contam:	Yes
Incident Desc:	N/A -gallon heating oil UST
Operator:	SCOTT TOWNSEND
Contact Phone:	Not reported
Owner Company:	CITY OF RALEIGH
Operator Address:	222 W. HARGETT ST./ PO BOX 590
Operator City:	RALEIGH
Oper City,St,Zip:	RALEIGH, NC 27502-
Ownership:	Municipal
Operation:	Public Service
Material:	Not reported
Qty Lost 1:	Not reported
Qty Recovered 1:	Not reported
Source:	Leak-underground
Type:	Gasoline/diesel
Location:	8
Setting:	Not reported
Risk Site:	Not reported
Site Priority:	Not reported
Priority Code:	Not reported

MCLAURIN CO PARKER LOT (Continued) **U003698353**

Priority Update: Not reported
Dem Contact: WDP
Wells Affected: No
Num Affected: Not reported
Wells Contam: Not reported
Sampled By: Dept. of Env. Management
Samples Include: Not reported
7.5 Min Quad: Not reported
5 Min Quad: Not reported
Latitude: 35.775
Longitude: -78.6375
Latitude Number: 354630
Longitude Number: 783815
Latitude Decimal: 35.775
Longitude Decimal: 78.6375
GPS: 7
Agency: DWM
Facility ID: 26274
Last Modified: 7/14/2004
Incident Phase: Closed Out
NOV Issued: Not reported
NORR Issued: Not reported
45 Day Report: Not reported
Public Meeting Held: Not reported
Corrective Action Planned: Not reported
SOC Sighned: Not reported
Reclassification Report: Not reported
RS Designation: Not reported
Closure Request Date: Not reported
Close-out Report: Not reported

LUST:
Facility ID: 00-0-000
UST Number: RA-3217
Incident Number: 21008
Contamination Type: Groundwater/Both
Source Type: Leak-underground
Product Type: PETROLEUM
Date Reported: 11/22/1999
Date Occur: 10/21/1999
Cleanup: 09/19/2002
Closure Request: Not reported
Close Out: 07/14/2004
Level Of Soil Cleanup Achieved: Industrial/Commercial
Tank Regulated Status: Regulated
Of Supply Wells: 0
Commercial/NonCommercial UST Site: COMMERCIAL
Risk Classification: L
Risk Class Based On Review: L
Corrective Action Plan Type: AE
NOV Issue Date: Not reported
NORR Issue Date: 06/26/2000
Site Priority: Not reported
Phase Of LSA Req: 2
Site Risk Reason: Not reported
Land Use: Residential

MCLAURIN CO PARKER LOT (Continued) **U003698353**

MTBE:	No
MTBE1:	No
Flag:	No
Flag1:	No
LUR Filed:	07/29/2004
Release Detection:	0
Current Status:	File Located in Archives
RBCA GW:	Cleanups to alternate standards
PETOPT:	3
RPL:	False
CD Num:	263
Reel Num:	33
RPOW:	False
RPOP:	False
Error Flag:	0
Error Code:	N
Valid:	False
Lat/Long:	35 46 31.98 - 78 38 13.98
Lat/Long Decimal:	35.7755 -78.6372
Testlat:	Not reported
Regional Officer Project Mgr:	WDP
Region:	Raleigh
Company:	CITY OF RALEIGH
Contact Person:	SCOTT TOWNSEND
Telephone:	919-890-3162
RP Address:	222 W. HARGETT ST./ PO BOX 590
RP City,St,Zip:	RALEIGH, NC 27601-
RP County:	wake
Comments:	9/4/02 interim CSA received but no data tables for soil and gw, no lab data to confirm , gw isocmaps show full lateral and acceptable vertical delineation, but soil contamination is not adequately presented in map or cross-sectional view. 9/18/02 INTER
5 Min Quad:	Not reported

PIRF:

Facility Id:	21008
Date Occurred:	10/21/1999
Date Reported:	12/1/1999
Description Of Incident:	TWO 1000 GALLON GASOLINE AND ONE 1000 GALLON STODDARD SOLVENT UST REMOVED FROM SITE SOIL CONTA DETECTED IN SAMPLE SW-1 2500PPM(EPA 5030) IN SAMPLE WW-1
Owner/Operator:	MR SCOTT TOWNSEND
Ownership:	1
Operation Type:	6
Type:	3
Location:	1
Site Priority:	Not reported
Priority Update:	12/1/1999
Wells Affected Y/N:	Not reported
Samples Include:	Not reported
7#5 Minute Quad:	Not reported
5 Minute Quad:	Not reported
Pirf/Min Soil:	Not reported
Release Code:	Not reported
Source Code:	MIN_SOIL
Err Type:	Not reported
Cause:	Not reported
Source:	Not reported

MCLAURIN CO PARKER LOT (Continued) **U003698353**

Ust Number:	Not reported
Last Modified:	Not reported
Incident Phase:	**Closed Out**
NOV Issued:	Not reported
NORR Issued:	Not reported
45 Day Report:	Not reported
Public Meeting Held:	Not reported
Corrective Action Planned:	Not reported
SOC Signed:	Not reported
Reclassification Report:	Not reported
RS Designation:	Not reported
Closure Request Date:	Not reported
Close-out Report:	Not reported

Facility ID:	Not reported
UST Number:	RA-4518
Incident Number:	26274
Contamination Type:	Soil
Source Type:	Leak-underground
Product Type:	PETROLEUM
Date Reported:	05/30/2003
Date Occur:	05/22/2003
Cleanup:	05/22/2003
Closure Request:	Not reported
Close Out:	07/14/2004
Level Of Soil Cleanup Achieved:	Residential
Tank Regulated Status:	Non Regulated
# Of Supply Wells:	0
Commercial/NonCommercial UST Site:	NON COMMERCIAL
Risk Classification:	Not reported
Risk Class Based On Review:	L
Corrective Action Plan Type:	Not reported
NOV Issue Date:	Not reported
NORR Issue Date:	Not reported
Site Priority:	Not reported
Phase Of LSA Req:	1
Site Risk Reason:	Not reported
Land Use:	Residential
MTBE:	No
MTBE1:	No
Flag:	No
Flag1:	No
LUR Filed:	07/29/2004
Release Detection:	0
Current Status:	File Located in Archives
RBCA GW:	Cleanups to alternate standards
PETOPT:	4
RPL:	False
CD Num:	262
Reel Num:	33
RPOW:	False
RPOP:	False
Error Flag:	0
Error Code:	N
Valid:	False
Lat/Long:	35 46 30 - 78 38 15.96

MCLAURIN CO PARKER LOT (Continued) **U003698353**

Lat/Long Decimal:	35.7749 -78.6377
Testlat:	Not reported
Regional Officer Project Mgr:	WDP
Region:	Raleigh
Company:	CITY OF RALEIGH
Contact Person:	SCOTT TOWNSEND
Telephone:	Not reported
RP Address:	222 W. HARGETT ST./ PO BOX 590
RP City,St,Zip:	RALEIGH, NC 27502-
RP County:	Not reported
Comments:	see 21008-NRP for GW will be reflected for this incidnet as it is very close on same property just about 100 ft or so away from the other site-NFA should be the same for both sites
5 Min Quad:	Not reported

PIRF:

Facility Id:	26274
Date Occurred:	5/22/2003
Date Reported:	5/30/2003
Description Of Incident:	N/A -gallon heating oil UST
Owner/Operator:	Not reported
Ownership:	1
Operation Type:	1
Type:	4
Location:	8
Site Priority:	Not reported
Priority Update:	Not reported
Wells Affected Y/N:	N
Samples Include:	Not reported
7#5 Minute Quad:	1
5 Minute Quad:	Not reported
Pirf/Min Soil:	Not reported
Release Code:	Not reported
Source Code:	Not reported
Err Type:	4
Cause:	Not reported
Source:	C
Ust Number:	C
Last Modified:	7/14/2004
Incident Phase:	**Closed Out**
NOV Issued:	Not reported
NORR Issued:	Not reported
45 Day Report:	Not reported
Public Meeting Held:	Not reported
Corrective Action Planned:	Not reported
SOC Signed:	Not reported
Reclassification Report:	Not reported
RS Designation:	Not reported
Closure Request Date:	Not reported
Close-out Report:	Not reported

LUST TRUST:

Facility ID:	Not reported
Site ID:	21008
Site Note:	Not reported
Site Eligible?:	True

MCLAURIN CO PARKER LOT (Continued) **U003698353**

Commercial Find: 100% Commercial
Priority Rank: Not reported
Deductable Amount: 75000
3rd Party Deductable Amt: 0
Sum 3rd Party Amt Applied: 0

Click this hyperlink while viewing on your computer to access additional NC LUST TRUST: detail in the EDR Site Report.

UST:
Facility Id: 00-0-0000036088
Contact: CITY OF RALEIGH
Contact Address1: PO BOX 590/ATTN:M.MOLNAR
Contact Address2: Not reported
Contact City/State/Zip: RALEIGH, NC 27602-0590
FIPS County Desc: Wake
Latitude: 0
Longitude: 0

Tank Id: 1
Tank Status: Removed
Installed Date: 01/01/1954
Perm Close Date: 10/21/1999
Product Key: 3
Product Name: Gasoline, Gas Mix
Tank Capacity: 1000
Root Tank Id: Not reported
Main Tank: No
Compartment Tank: No
Manifold Tank: Not reported
Commercial: No
Regulated: Yes
Tank Construction: Single Wall Steel
Piping Construction: Single Wall Steel
Piping System Key: Unknown
Other CP Tank: Not reported

Tank Id: 2
Tank Status: Removed
Installed Date: 01/01/1954
Perm Close Date: 10/21/1999
Product Key: 3
Product Name: Gasoline, Gas Mix
Tank Capacity: 1000
Root Tank Id: Not reported
Main Tank: No
Compartment Tank: No
Manifold Tank: Not reported
Commercial: No
Regulated: Yes
Tank Construction: Single Wall Steel
Piping Construction: Single Wall Steel
Piping System Key: Unknown
Other CP Tank: Not reported

MCLAURIN CO PARKER LOT (Continued) **U003698353**

Tank Id:	3
Tank Status:	Removed
Installed Date:	01/01/1954
Perm Close Date:	10/21/1999
Product Key:	16
Product Name:	Other, Hazardous
Tank Capacity:	1000
Root Tank Id:	Not reported
Main Tank:	No
Compartment Tank:	No
Manifold Tank:	Not reported
Commercial:	No
Regulated:	Yes
Tank Construction:	Single Wall Steel
Piping Construction:	Single Wall Steel
Piping System Key:	Unknown
Other CP Tank:	Not reported

---

31 **NC SCHOOL BOARD ASSOCIATION** **NC IMD** **S101168100**
North **311 E EDENTON ST** **NC LUST** **N/A**
1/4-1/2 **RALEIGH, NC** **NC LUST TRUST**
0.256 mi.
1352 ft.

Relative:
Higher

Actual:
348 ft.

IMD:

Region:	RAL
Facility ID:	6570
Date Occurred:	4/10/1991
Submit Date:	5/17/1991
GW Contam:	No Groundwater Contamination detected
Soil Contam:	Yes
Incident Desc:	CONTAM. SOIL FOUND DURING TANK REMOVAL.
Operator:	NC SCHOOL BOARD ASSOCIATION
Contact Phone:	9198414040
Owner Company:	DR. ED DUNLAP
Operator Address:	PO BOX 97877
Operator City:	RALEIGH
Oper City,St,Zip:	RALEIGH, NC 27624-
Ownership:	Private
Operation:	Residential
Material:	#2 FUEL OIL
Qty Lost 1:	Not reported
Qty Recovered 1:	Not reported
Source:	Leak-underground
Type:	Gasoline/diesel
Location:	Residence
Setting:	Residential
Risk Site:	L
Site Priority:	30E
Priority Code:	L
Priority Update:	4/16/1998
Dem Contact:	SMJ
Wells Affected:	No
Num Affected:	0
Wells Contam:	Not reported
Sampled By:	Dept. of Health Services
Samples Include:	Not reported
7.5 Min Quad:	Not reported

NC SCHOOL BOARD ASSOCIATION (Continued) **S101168100**

5 Min Quad:	Not reported
Latitude:	35.78111111
Longitude:	-78.63388888
Latitude Number:	354652
Longitude Number:	783802
Latitude Decimal:	35.7811111111111
Longitude Decimal:	78.6338888888889
GPS:	3
Agency:	DWM
Facility ID:	6570
Last Modified:	Not reported
Incident Phase:	Closed Out
NOV Issued:	Not reported
NORR Issued:	Not reported
45 Day Report:	Not reported
Public Meeting Held:	Not reported
Corrective Action Planned:	Not reported
SOC Sighned:	Not reported
Reclassification Report:	Not reported
RS Designation:	Not reported
Closure Request Date:	Not reported
Close-out Report:	Not reported

LUST:

Facility ID:	Not reported
UST Number:	RA-998
Incident Number:	6570
Contamination Type:	Soil
Source Type:	Leak-underground
Product Type:	PETROLEUM
Date Reported:	04/10/1991
Date Occur:	04/10/1991
Cleanup:	Not reported
Closure Request:	Not reported
Close Out:	11/17/2005
Level Of Soil Cleanup Achieved:	Residential
Tank Regulated Status:	Non Regulated
# Of Supply Wells:	0
Commercial/NonCommercial UST Site:	NON COMMERCIAL
Risk Classification:	L
Risk Class Based On Review:	L
Corrective Action Plan Type:	Not reported
NOV Issue Date:	Not reported
NORR Issue Date:	Not reported
Site Priority:	30E
Phase Of LSA Req:	Not reported
Site Risk Reason:	Not reported
Land Use:	Residential
MTBE:	No
MTBE1:	Unknown
Flag:	No
Flag1:	No
LUR Filed:	Not reported
Release Detection:	0
Current Status:	File Located in Archives
RBCA GW:	Cleanups to 2L.0202 standards

NC SCHOOL BOARD ASSOCIATION (Continued) **S101168100**

PETOPT:	4
RPL:	False
CD Num:	313
Reel Num:	227
RPOW:	False
RPOP:	False
Error Flag:	0
Error Code:	N
Valid:	False
Lat/Long:	35 46 52.56 - 78 38 2.7
Lat/Long Decimal:	35.7812 -78.6340
Testlat:	Not reported
Regional Officer Project Mgr:	SMJ
Region:	Raleigh
Company:	DR. ED DUNLAP
Contact Person:	NC SCHOOL BOARD ASSOCIATION
Telephone:	9198414040
RP Address:	PO BOX 97877
RP City,St,Zip:	RALEIGH, NC 27624-
RP County:	Not reported
Comments:	1/17/03 review of file indicates U risk. 550 gal HO UST removed 4/16/91 and pit overexcavated in 4/91, removing 250 cuyds.. Max. confirmatory soil sample 15000ppm TPH. No gw sample, no rec. survey. Require LSA. KAH. Neighbor not responding to access agre
5 Min Quad:	K39r

PIRF:

Facility Id:	6570
Date Occurred:	4/10/1991
Date Reported:	5/17/1991
Description Of Incident:	CONTAM. SOIL FOUND DURING TANK REMOVAL.
Owner/Operator:	NITA HANFORD/N.C. SCHOOL BD. A
Ownership:	4
Operation Type:	3
Type:	4
Location:	7
Site Priority:	30E
Priority Update:	4/16/1998
Wells Affected Y/N:	N
Samples Include:	0
7#5 Minute Quad:	2
5 Minute Quad:	Not reported
Pirf/Min Soil:	Not reported
Release Code:	Not reported
Source Code:	Pirf
Err Type:	Not reported
Cause:	Not reported
Source:	Not reported
Ust Number:	Not reported
Last Modified:	Not reported
Incident Phase:	**Closed Out**
NOV Issued:	Not reported
NORR Issued:	Not reported
45 Day Report:	Not reported
Public Meeting Held:	Not reported
Corrective Action Planned:	Not reported
SOC Signed:	Not reported

NC SCHOOL BOARD ASSOCIATION (Continued) **S101168100**

Reclassification Report: Not reported
RS Designation: Not reported
Closure Request Date: Not reported
Close-out Report: Not reported

LUST TRUST:
Facility ID: Not reported
Site ID: 6570
Site Note: Not reported
Site Eligible?: True
Commercial Find: 100% Non-Commercial
Priority Rank: Low
Deductable Amount: 0
3rd Party Deductable Amt: 0
Sum 3rd Party Amt Applied: 0

Click this hyperlink while viewing on your computer to access additional NC LUST TRUST: detail in the EDR Site Report.

H32 **GODWIN ELEVATOR BLDG. (FORMER)** **NC LUST** **S109567417**
WSW **325 S. WILMINGTON STREET** **N/A**
1/4-1/2 **RALEIGH, NC 27601**
0.265 mi.
1397 ft. **Site 1 of 3 in cluster H**

Relative:
Higher

Actual:
333 ft.

LUST:
Facility ID: Not reported
UST Number: RA-6108
Incident Number: 33651
Contamination Type: Soil
Source Type: Leak-underground
Product Type: PETROLEUM
Date Reported: 02/27/2007
Date Occur: 02/27/2007
Cleanup: Not reported
Closure Request: Not reported
Close Out: 04/22/2009
Level Of Soil Cleanup Achieved: Soil to Groundwater
Tank Regulated Status: Non Regulated
Of Supply Wells: 0
Commercial/NonCommercial UST Site: COMMERCIAL
Risk Classification: L
Risk Class Based On Review: L
Corrective Action Plan Type: Not reported
NOV Issue Date: Not reported
NORR Issue Date: Not reported
Site Priority: Not reported
Phase Of LSA Req: Not reported
Site Risk Reason: Not reported
Land Use: Industrial/commercial
MTBE: No
MTBE1: No
Flag: No
Flag1: No
LUR Filed: Not reported
Release Detection: 0
Current Status: File Located in House

GODWIN ELEVATOR BLDG. (FORMER) (Continued) **S109567417**

RBCA GW:	Cleanups to 2L.0202 standards
PETOPT:	4
RPL:	False
CD Num:	0
Reel Num:	0
RPOW:	False
RPOP:	False
Error Flag:	0
Error Code:	N
Valid:	False
Lat/Long:	35 27 54.72 - 78 22 56.64
Lat/Long Decimal:	35.4652 -78.3824
Testlat:	Not reported
Regional Officer Project Mgr:	SMJ
Region:	Raleigh
Company:	Not reported
Contact Person:	Progress Energy
Telephone:	9195464505
RP Address:	410 South Wilmington Street
RP City,St,Zip:	raleigh, NC 27601
RP County:	Not reported
Comments:	Not reported
5 Min Quad:	Not reported

PIRF:

Facility Id:	33651
Date Occurred:	2/27/2007
Date Reported:	2/27/2007
Description Of Incident:	Not reported
Owner/Operator:	Not reported
Ownership:	4
Operation Type:	6
Type:	4
Location:	1
Site Priority:	Not reported
Priority Update:	Not reported
Wells Affected Y/N:	N
Samples Include:	Not reported
7#5 Minute Quad:	Y
5 Minute Quad:	Not reported
Pirf/Min Soil:	Not reported
Release Code:	Not reported
Source Code:	Not reported
Err Type:	2
Cause:	7
Source:	G
Ust Number:	P
Last Modified:	4/22/2009
Incident Phase:	**Closed Out**
NOV Issued:	Not reported
NORR Issued:	Not reported
45 Day Report:	Not reported
Public Meeting Held:	Not reported
Corrective Action Planned:	Not reported
SOC Signed:	Not reported
Reclassification Report:	Not reported
RS Designation:	Not reported

GODWIN ELEVATOR BLDG. (FORMER) (Continued) **S109567417**

Closure Request Date: Not reported
Close-out Report: Not reported

H33 **RBC TOWER PARKING DECK** **NC BROWNFIELDS** **S108852125**
WSW **331 S. WILMINGTON STREET** **N/A**
1/4-1/2 **RALEIGH, NC**
0.266 mi.
1404 ft. **Site 2 of 3 in cluster H**

Relative:
Higher

BROWNFIELDS:
Project Type: FINALIZED BROWNFIELD AGREEMENTS

Actual:
333 ft.

H34 **PARKING DECK CONSTRUCTION SITE** **NC LUST** **S108852022**
WSW **331 SOUTH WILMINGTON STREET** **NC LAST** **N/A**
1/4-1/2 **RALEIGH, NC 27604**
0.267 mi.
1412 ft. **Site 3 of 3 in cluster H**

Relative:
Higher

Actual:
332 ft.

LUST:

Facility ID:	Not reported
UST Number:	RA-5850
Incident Number:	33406
Contamination Type:	Soil
Source Type:	Leak-underground
Product Type:	PETROLEUM
Date Reported:	10/29/2007
Date Occur:	10/18/2007
Cleanup:	10/18/2007
Closure Request:	Not reported
Close Out:	06/05/2009
Level Of Soil Cleanup Achieved:	Soil to Groundwater
Tank Regulated Status:	Regulated
# Of Supply Wells:	0
Commercial/NonCommercial UST Site:	NON COMMERCIAL
Risk Classification:	L
Risk Class Based On Review:	L
Corrective Action Plan Type:	Not reported
NOV Issue Date:	Not reported
NORR Issue Date:	Not reported
Site Priority:	Not reported
Phase Of LSA Req:	Not reported
Site Risk Reason:	Not reported
Land Use:	Not reported
MTBE:	No
MTBE1:	Unknown
Flag:	No
Flag1:	No
LUR Filed:	Not reported
Release Detection:	0
Current Status:	File Located in House
RBCA GW:	Not reported
PETOPT:	5
RPL:	False
CD Num:	0
Reel Num:	0
RPOW:	False

PARKING DECK CONSTRUCTION SITE (Continued) **S108852022**

RPOP:	False
Error Flag:	0
Error Code:	N
Valid:	False
Lat/Long:	35 45 59.94 - 78 37 59.94
Lat/Long Decimal:	35.7666 -78.6333
Testlat:	Not reported
Regional Officer Project Mgr:	JFM
Region:	Raleigh
Company:	Highwoods Properties
Contact Person:	Randy Roberson
Telephone:	9198756611
RP Address:	3100 Smoketree Court Suit 1100
RP City,St,Zip:	Raleigh, NC 27604
RP County:	Not reported
Comments:	Same as non-UST Incident #92022. NFA copy is in #92022 file. -MRP..pending archive 1/31/2012..tw
5 Min Quad:	Not reported

PIRF:

Facility Id:	33406
Date Occurred:	10/18/2007
Date Reported:	10/29/2007
Description Of Incident:	Not reported
Owner/Operator:	Not reported
Ownership:	4
Operation Type:	6
Type:	5
Location:	1
Site Priority:	Not reported
Priority Update:	Not reported
Wells Affected Y/N:	N
Samples Include:	Not reported
7#5 Minute Quad:	Y
5 Minute Quad:	Not reported
Pirf/Min Soil:	Not reported
Release Code:	Not reported
Source Code:	Not reported
Err Type:	9
Cause:	1
Source:	F
Ust Number:	P
Last Modified:	6/5/2009
Incident Phase:	**Closed Out**
NOV Issued:	Not reported
NORR Issued:	Not reported
45 Day Report:	Not reported
Public Meeting Held:	Not reported
Corrective Action Planned:	Not reported
SOC Signed:	Not reported
Reclassification Report:	Not reported
RS Designation:	Not reported
Closure Request Date:	Not reported
Close-out Report:	Not reported

LAST:

PARKING DECK CONSTRUCTION SITE (Continued) **S108852022**

Facility ID:	N/A	
UST Number:	RA-92022	
Incident Number:	92022	
Contamination Type:		SL
Source Type:	14	
Product Type:	P	
Date Reported:	10/29/2007	
Date Occur:	10/18/2007	
Cleanup:	10/18/2007	
Closure Request:	Not reported	
Close Out:	11/08/2007	
Level Of Soil Cleanup Achieved:		S3
Tank Regulated Status:		R
# Of Supply Wells:	0	
Commercial/NonCommercial UST Site:		N
Risk Classification:		L
Risk Class Based On Review:		L
Corrective Action Plan Type:		Not reported
NOV Issue Date:	Not reported	
NORR Issue Date:	Not reported	
Site Priority:	Not reported	
Phase Of LSA Req:	Not reported	
Site Risk Reason:	Not reported	
Land Use:	Not reported	
MTBE:	No	
MTBE1:	Unknown	
Flag:	Yes	
Flag1:	No	
LUR Filed:	Not reported	
Release Detection:	0	
Current Status:	C	
RBCA GW:	Not reported	
PETOPT:	5	
RPL:	False	
CD Num:	0	
Reel Num:	0	
RPOW:	False	
RPOP:	False	
Error Flag:	0	
Error Code:	N	
Valid:	False	
Lat/Long:	35 45 78 37	
Lat/Long Decimal:	35.76666 78.633332	
Testlat:	Not reported	
Regional Officer Project Mgr:		JFM
Region:		RAL
Company:		HIGHWOODS PROPERTIES
Contact Person:		RANDY ROBERSON
Telephone:		9198756611
RP Address:		3100 SMOKETREE COURT SUIT 1100
RP City,St,Zip:		RALEIGH, NC 27604
RP County:		Not reported
Comments:	Notification of Discharge Report, Hydraulic Cylinder contact with soil thus an UST. 11/08/2007, JFM/// Hydraulic Cylinder was breached with a trackhoe bucket. 11/08/20007, JFM///pending UST archive #33406//1/31/2012tw	
5 Min Quad:	Not reported	

PARKING DECK CONSTRUCTION SITE (Continued) **S108852022**

PIRF:

Facility Id:	92022
Date Occurred:	10/18/2007
Date Reported:	10/29/2007
Description Of Incident:	Notification of Discharge Report, 11/08/2007, JFM/// Hydraulic Cylinder was breached with a trackhoe bucket. 11/08/20007, JFM///
Owner/Operator:	Not reported
Ownership:	4
Operation Type:	3
Type:	5
Location:	1
Site Priority:	Not reported
Priority Update:	Not reported
Wells Affected Y/N:	N
Samples Include:	Not reported
7#5 Minute Quad:	Y
5 Minute Quad:	Not reported
Pirf/Min Soil:	Not reported
Release Code:	Not reported
Source Code:	Not reported
Err Type:	9
Cause:	Not reported
Source:	Not reported
Ust Number:	D
Last Modified:	Not reported
Incident Phase:	**Not reported**
NOV Issued:	Not reported
NORR Issued:	Not reported
45 Day Report:	Not reported
Public Meeting Held:	Not reported
Corrective Action Planned:	Not reported
SOC Signed:	Not reported
Reclassification Report:	Not reported
RS Designation:	Not reported
Closure Request Date:	Not reported
Close-out Report:	Not reported

I35 SW 1/4-1/2 0.284 mi. 1498 ft. **BLOCK A-24 PARKING DECK-CABARRUS STREET** **NC IMD S104914096**
CABARRUS AND SOUTH BLOUNT **NC LAST N/A**
RALEIGH, NC 27603

Site 1 of 2 in cluster I

Relative: Lower

Actual: 309 ft.

IMD:

Region:	RAL
Facility ID:	85631
Date Occurred:	10/28/1997
Submit Date:	5/3/2001
GW Contam:	No Groundwater Contamination detected
Soil Contam:	Not reported
Incident Desc:	STAINED SOIL IN VICINITY OF FORMER AUTOMOTIVE REPAIR FACILITIES TO BE PARTIALLY OR FULLY EXCAVATED FOR PARKING DECK.
Operator:	BAKER, WAYNE
Contact Phone:	677-2000
Owner Company:	CITY OF RALEIGH
Operator Address:	222 WEST HARGETT STREET

BLOCK A-24 PARKING DECK-CABARRUS STREET (Continued) **S104914096**

Operator City: RALEIGH
Oper City,St,Zip: RALEIGH 677-2000
Ownership: Unknown
Operation: Residential
Material: Not reported
Qty Lost 1: Not reported
Qty Recovered 1: Not reported
Source: Unknown
Type: Other petroleum product
Location: Not reported
Setting: Not reported
Risk Site: Not reported
Site Priority: Not reported
Priority Code: E
Priority Update: Not reported
Dem Contact: JIM ROUSH
Wells Affected: No
Num Affected: 0
Wells Contam: Not reported
Sampled By: Not reported
Samples Include: Not reported
7.5 Min Quad: Not reported
5 Min Quad: Not reported
Latitude: Not reported
Longitude: Not reported
Latitude Number: Not reported
Longitude Number: Not reported
Latitude Decimal: Not reported
Longitude Decimal: Not reported
GPS: CALC
Agency: DWQ
Facility ID: 85631
Last Modified: 5/3/2001
Incident Phase: Assessment
NOV Issued: Not reported
NORR Issued: Not reported
45 Day Report: Not reported
Public Meeting Held: Not reported
Corrective Action Planned: Not reported
SOC Sighned: Not reported
Reclassification Report: Not reported
RS Designation: Not reported
Closure Request Date: Not reported
Close-out Report: Not reported

LAST:
Facility ID: Not reported
UST Number: RA-85631
Incident Number: 85631
Contamination Type: SL
Source Type: 1
Product Type: P
Date Reported: 10/28/1997
Date Occur: 10/28/1997
Cleanup: Not reported
Closure Request: Not reported

BLOCK A-24 PARKING DECK-CABARRUS STREET (Continued) **S104914096**

Close Out: Not reported
Level Of Soil Cleanup Achieved: Not reported
Tank Regulated Status: Not reported
Of Supply Wells: 0
Commercial/NonCommercial UST Site: Not reported
Risk Classification: L
Risk Class Based On Review: L
Corrective Action Plan Type: Not reported
NOV Issue Date: Not reported
NORR Issue Date: Not reported
Site Priority: 40
Phase Of LSA Req: Not reported
Site Risk Reason: Not reported
Land Use: Not reported
MTBE: No
MTBE1: No
Flag: No
Flag1: No
LUR Filed: Not reported
Release Detection: 0
Current Status: C
RBCA GW: Not reported
PETOPT: 5
RPL: False
CD Num: 0
Reel Num: 0
RPOW: False
RPOP: False
Error Flag: 0
Error Code: Not reported
Valid: False
Lat/Long: 35 46 78 38
Lat/Long Decimal: 35.77400 78.637330
Testlat: Not reported
Regional Officer Project Mgr: SMJ
Region: RAL
Company: CITY OF RALEIGH
Contact Person: WAYNE BAKER
Telephone: Not reported
RP Address: 222 WEST HARGETT STREET
RP City,St,Zip: RALEIGH, NC
RP County: Not reported
Comments: STAINED SOIL IN VICINITY OF FORMER AUTOMOTIVE REPAIR FACILITIES TO BE PARTIALLY OR FULLY EXCAVATED FOR PARKING DECK.
5 Min Quad: Not reported

PIRF:
Facility Id: 85631
Date Occurred: Not reported
Date Reported: Not reported
Description Of Incident: Not reported
Owner/Operator: Not reported
Ownership: 3
Operation Type: 3
Type: Not reported
Location: Not reported
Site Priority: 40E
Priority Update: Not reported

BLOCK A-24 PARKING DECK-CABARRUS STREET (Continued) **S104914096**

Wells Affected Y/N:	N
Samples Include:	0
7#5 Minute Quad:	Not reported
5 Minute Quad:	Not reported
Pirf/Min Soil:	Not reported
Release Code:	Not reported
Source Code:	Not reported
Err Type:	Not reported
Cause:	Not reported
Source:	Not reported
Ust Number:	0
Last Modified:	5/3/2001
Incident Phase:	**AS**
NOV Issued:	Not reported
NORR Issued:	Not reported
45 Day Report:	Not reported
Public Meeting Held:	Not reported
Corrective Action Planned:	Not reported
SOC Signed:	Not reported
Reclassification Report:	Not reported
RS Designation:	Not reported
Closure Request Date:	Not reported
Close-out Report:	Not reported

I36 **BLOUNT STREET SERVICE STATION** **NC IMD** **S106074872**
SW **500 S BLOUNT ST** **NC LUST** **N/A**
1/4-1/2 **RALEIGH, NC**
0.285 mi.
1506 ft. **Site 2 of 2 in cluster I**

Relative:
Lower

Actual:
309 ft.

IMD:

Region:	RAL
Facility ID:	26404
Date Occurred:	7/28/2003
Submit Date:	10/13/2003
GW Contam:	No Groundwater Contamination detected
Soil Contam:	Yes
Incident Desc:	Two (2) 2K-gallon gasoine UST, one (1) 1K-gallon used motor oil UST and one 275-gallon kerosene UST
Operator:	GREG PITTMAN
Contact Phone:	9198903087
Owner Company:	CITY OF RALEIGH
Operator Address:	P.O. BOX 590
Operator City:	RALEIGH
Oper City,St,Zip:	RALEIGH, NC 27602-
Ownership:	Private
Operation:	Public Service
Material:	Not reported
Qty Lost 1:	Not reported
Qty Recovered 1:	Not reported
Source:	Leak-underground
Type:	Gasoline/diesel
Location:	Facility
Setting:	Not reported
Risk Site:	Not reported
Site Priority:	Not reported
Priority Code:	Not reported

BLOUNT STREET SERVICE STATION (Continued) **S106074872**

Priority Update: Not reported
Dem Contact: STF
Wells Affected: No
Num Affected: Not reported
Wells Contam: Not reported
Sampled By: 7
Samples Include: Not reported
7.5 Min Quad: Not reported
5 Min Quad: Not reported
Latitude: 35.77388888
Longitude: -78.63666666
Latitude Number: 354626
Longitude Number: 783812
Latitude Decimal: 35.7738888888889
Longitude Decimal: 78.6366666666667
GPS: 7
Agency: DWM
Facility ID: Not reported
Last Modified: Not reported
Incident Phase: Not reported
NOV Issued: Not reported
NORR Issued: Not reported
45 Day Report: Not reported
Public Meeting Held: Not reported
Corrective Action Planned: Not reported
SOC Sighned: Not reported
Reclassification Report: Not reported
RS Designation: Not reported
Closure Request Date: Not reported
Close-out Report: Not reported

LUST:
Facility ID: Not reported
UST Number: RA-4766
Incident Number: 26404
Contamination Type: Soil
Source Type: Leak-underground
Product Type: PETROLEUM
Date Reported: 10/13/2003
Date Occur: 07/28/2003
Cleanup: 07/28/2003
Closure Request: Not reported
Close Out: 02/16/2009
Level Of Soil Cleanup Achieved: Industrial/Commercial
Tank Regulated Status: Regulated
Of Supply Wells: 0
Commercial/NonCommercial UST Site: COMMERCIAL
Risk Classification: L
Risk Class Based On Review: L
Corrective Action Plan Type: Not reported
NOV Issue Date: Not reported
NORR Issue Date: Not reported
Site Priority: Not reported
Phase Of LSA Req: 1
Site Risk Reason: Not reported
Land Use: Not reported

BLOUNT STREET SERVICE STATION (Continued) **S106074872**

MTBE:	No
MTBE1:	Unknown
Flag:	No
Flag1:	No
LUR Filed:	Not reported
Release Detection:	0
Current Status:	File Located in House
RBCA GW:	Cleanups to alternate standards
PETOPT:	3
RPL:	False
CD Num:	0
Reel Num:	0
RPOW:	False
RPOP:	False
Error Flag:	0
Error Code:	N
Valid:	False
Lat/Long:	35 46 26.64 - 78 38 12.9
Lat/Long Decimal:	35.7740 -78.6369
Testlat:	Not reported
Regional Officer Project Mgr:	STF
Region:	Raleigh
Company:	CITY OF RALEIGH
Contact Person:	GREG PITTMAN
Telephone:	9198903087
RP Address:	P.O. BOX 590
RP City,St,Zip:	RALEIGH, NC 27602-
RP County:	Not reported
Comments:	Sent site to Rob for recommendation for State Lead on 2/16/04, RKD.// Site accepted as STF lead site per letter dated 3/3/04, RKD. Sent to CO on 02/06/2006
5 Min Quad:	Not reported

PIRF:

Facility Id:	26404
Date Occurred:	7/28/2003
Date Reported:	10/13/2003
Description Of Incident:	Two (2) 2K-gallon gasoine UST, one (1) 1K-gallon used motor oil UST and one 275-gallon kerosene UST
Owner/Operator:	Not reported
Ownership:	4
Operation Type:	1
Type:	3
Location:	1
Site Priority:	Not reported
Priority Update:	Not reported
Wells Affected Y/N:	N
Samples Include:	Not reported
7#5 Minute Quad:	7
5 Minute Quad:	Not reported
Pirf/Min Soil:	Not reported
Release Code:	Not reported
Source Code:	Not reported
Err Type:	2
Cause:	Not reported
Source:	C
Ust Number:	C

BLOUNT STREET SERVICE STATION (Continued) **S106074872**

Last Modified:	2/16/2009
Incident Phase:	**Closed Out**
NOV Issued:	Not reported
NORR Issued:	Not reported
45 Day Report:	Not reported
Public Meeting Held:	Not reported
Corrective Action Planned:	Not reported
SOC Signed:	Not reported
Reclassification Report:	Not reported
RS Designation:	Not reported
Closure Request Date:	Not reported
Close-out Report:	Not reported

J37 **FIRST BAPTIST CHURCH** **NC IMD** **S106896235**
WNW **101 S. WILMINGTON STREET** **NC LUST** **N/A**
1/4-1/2 **RALEIGH, NC**
0.287 mi.
1517 ft. **Site 1 of 2 in cluster J**

Relative:
Higher

Actual:
346 ft.

IMD:

Region:	Not reported
Facility ID:	26845
Date Occurred:	3/23/2005
Submit Date:	5/27/2005
GW Contam:	No Groundwater Contamination detected
Soil Contam:	Yes
Incident Desc:	Two [02] 1K-gallon UST and one [01] 550-gallon UST contents unknown.
Operator:	HARVEY HEARTLEY, JR.
Contact Phone:	Not reported
Owner Company:	FIRST BAPTIST CHURCH BOARD
Operator Address:	101 S. WILMINGTON STREET
Operator City:	RALEIGH
Oper City,St,Zip:	RALEIGH, NC 27601-
Ownership:	Private
Operation:	Educational/Religious
Material:	Not reported
Qty Lost 1:	Not reported
Qty Recovered 1:	Not reported
Source:	Leak-underground
Type:	Gasoline/diesel
Location:	Facility
Setting:	Not reported
Risk Site:	Not reported
Site Priority:	Not reported
Priority Code:	Not reported
Priority Update:	Not reported
Dem Contact:	JFM
Wells Affected:	No
Num Affected:	Not reported
Wells Contam:	Not reported
Sampled By:	Y
Samples Include:	Not reported
7.5 Min Quad:	Not reported
5 Min Quad:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Latitude Number:	Not reported
Longitude Number:	Not reported

FIRST BAPTIST CHURCH (Continued) **S106896235**

Latitude Decimal:	Not reported
Longitude Decimal:	Not reported
GPS:	4
Agency:	DWM
Facility ID:	Not reported
Last Modified:	Not reported
Incident Phase:	Not reported
NOV Issued:	Not reported
NORR Issued:	Not reported
45 Day Report:	Not reported
Public Meeting Held:	Not reported
Corrective Action Planned:	Not reported
SOC Sighned:	Not reported
Reclassification Report:	Not reported
RS Designation:	Not reported
Closure Request Date:	Not reported
Close-out Report:	Not reported

LUST:

Facility ID:	Not reported
UST Number:	RA-5300
Incident Number:	26845
Contamination Type:	Soil
Source Type:	Leak-underground
Product Type:	PETROLEUM
Date Reported:	05/27/2005
Date Occur:	03/23/2005
Cleanup:	03/23/2005
Closure Request:	Not reported
Close Out:	Not reported
Level Of Soil Cleanup Achieved:	Not reported
Tank Regulated Status:	Regulated
# Of Supply Wells:	0
Commercial/NonCommercial UST Site:	COMMERCIAL
Risk Classification:	Not reported
Risk Class Based On Review:	U
Corrective Action Plan Type:	Not reported
NOV Issue Date:	Not reported
NORR Issue Date:	Not reported
Site Priority:	Not reported
Phase Of LSA Req:	1
Site Risk Reason:	Not reported
Land Use:	Not reported
MTBE:	No
MTBE1:	Unknown
Flag:	No
Flag1:	No
LUR Filed:	Not reported
Release Detection:	0
Current Status:	File Located in House
RBCA GW:	Not reported
PETOPT:	3
RPL:	False
CD Num:	0
Reel Num:	0
RPOW:	False

FIRST BAPTIST CHURCH (Continued) **S106896235**

RPOP:	False
Error Flag:	0
Error Code:	N
Valid:	False
Lat/Long:	35 46 41.94 - 78 38 3.96
Lat/Long Decimal:	35.7783 -78.6344
Testlat:	Not reported
Regional Officer Project Mgr:	FTF
Region:	Raleigh
Company:	FIRST BAPTIST CHURCH BOARD
Contact Person:	HARVEY HEARTLEY, JR.
Telephone:	Not reported
RP Address:	101 S. WILMINGTON STREET
RP City,St,Zip:	RALEIGH, NC 27601-
RP County:	Not reported
Comments:	State Lead Site needed since Bob said that the church not responsible for the UST {very old}. 01/11/2006, JFM/// Sent up for State Lead 6/06/06, RKD. // Accepted as Federal lead site per letter dated 11/13/06, RKD.///Site visit 01/31/2007, no WSW seen. 02/20/2007, JFM///
5 Min Quad:	Not reported

PIRF:

Facility Id:	26845
Date Occurred:	3/23/2005
Date Reported:	5/27/2005
Description Of Incident:	Two [02] 1K-gallon UST and one [01] 550-gallon UST contents unknown.
Owner/Operator:	Not reported
Ownership:	4
Operation Type:	4
Type:	3
Location:	1
Site Priority:	Not reported
Priority Update:	Not reported
Wells Affected Y/N:	N
Samples Include:	Not reported
7#5 Minute Quad:	Y
5 Minute Quad:	Not reported
Pirf/Min Soil:	Not reported
Release Code:	Not reported
Source Code:	Not reported
Err Type:	2
Cause:	Not reported
Source:	Not reported
Ust Number:	P
Last Modified:	Not reported
Incident Phase:	**Not reported**
NOV Issued:	Not reported
NORR Issued:	Not reported
45 Day Report:	Not reported
Public Meeting Held:	Not reported
Corrective Action Planned:	Not reported
SOC Signed:	Not reported
Reclassification Report:	Not reported
RS Designation:	Not reported
Closure Request Date:	Not reported
Close-out Report:	Not reported

J38 **RALEIGH, CITY OF** **NC IMD** **S106799721**
WNW **101 E MORGAN ST** **N/A**
1/4-1/2 **RALEIGH, NC**
0.287 mi.
1518 ft. **Site 2 of 2 in cluster J**

Relative:
Higher

Actual:
346 ft.

IMD:

Region:	RAL
Facility ID:	5289
Date Occurred:	3/30/1990
Submit Date:	12/1/1989
GW Contam:	No Groundwater Contamination detected
Soil Contam:	Yes
Incident Desc:	Not reported
Operator:	MARTY MOLNAR
Contact Phone:	919-890-3095
Owner Company:	CITY OF RALEIGH-RE DIVISION
Operator Address:	P.O. BOX 590
Operator City:	RALEIGH
Oper City,St,Zip:	RALEIGH, NC 27602-
Ownership:	Municipal
Operation:	Public Service
Material:	GASOLINE
Qty Lost 1:	Not reported
Qty Recovered 1:	NONE
Source:	Leak-underground
Type:	Gasoline/diesel
Location:	8
Setting:	Urban
Risk Site:	L
Site Priority:	75E
Priority Code:	L
Priority Update:	4/16/1998
Dem Contact:	SMJ
Wells Affected:	No
Num Affected:	0
Wells Contam:	Not reported
Sampled By:	Responsible Parties
Samples Include:	Not reported
7.5 Min Quad:	Not reported
5 Min Quad:	Not reported
Latitude:	35.77805555
Longitude:	-78.63416666
Latitude Number:	354641
Longitude Number:	783803
Latitude Decimal:	35.7780555555556
Longitude Decimal:	78.6341666666667
GPS:	4
Agency:	DWM
Facility ID:	5289
Last Modified:	Not reported
Incident Phase:	RE
NOV Issued:	Not reported
NORR Issued:	Not reported
45 Day Report:	Not reported
Public Meeting Held:	Not reported
Corrective Action Planned:	Not reported
SOC Sighned:	Not reported
Reclassification Report:	Not reported

RALEIGH, CITY OF (Continued) **S106799721**

RS Designation: Not reported
Closure Request Date: Not reported
Close-out Report: Not reported

---

39 **CP&L-WILMINGTON & DAVIE ST.** **NC IMD** **S10152405**
WSW **WILMINGTON & DAVIE ST** **NC LUST** **N/A**
1/4-1/2 **RALEIGH, NC 27601**
0.292 mi.
1542 ft.

Relative:
Higher

Actual:
326 ft.

IMD:
Region: RAL
Facility ID: 10111
Date Occurred: 4/1/1993
Submit Date: 4/20/1993
GW Contam: No Groundwater Contamination detected
Soil Contam: Yes
Incident Desc: UPON EXCAVATION OF 4 OLD USTS, SOIL CONTAM. WAS DISCOVERED.
Operator: GEORGE J. OLIVER
Contact Phone: Not reported
Owner Company: CP&L
Operator Address: 411 FAYETTEVILLE ST. MALL
Operator City: RALEIGH
Oper City,St,Zip: RALEIGH, NC 27602-
Ownership: Private
Operation: Commercial
Material: DIESEL
Qty Lost 1: Not reported
Qty Recovered 1: Not reported
Material: WASTE OIL
Qty Lost: Not reported
Qty Recovered: Not reported
Source: Leak-underground
Type: Gasoline/diesel
Location: Facility
Setting: Urban
Risk Site: L
Site Priority: 10E
Priority Code: L
Priority Update: 4/16/1998
Dem Contact: WDP
Wells Affected: No
Num Affected: 0
Wells Contam: Not reported
Sampled By: Responsible Parties
Samples Include: Soil Samples
7.5 Min Quad: Not reported
5 Min Quad: K39Q
Latitude: 35.775
Longitude: -78.63861111
Latitude Number: 354630
Longitude Number: 783819
Latitude Decimal: 35.775
Longitude Decimal: 78.6386111111111
GPS: NOD
Agency: DWM
Facility ID: 10111

CP&L-WILMINGTON & DAVIE ST. (Continued) **S10152405**

Last Modified:	Not reported
Incident Phase:	Closed Out
NOV Issued:	Not reported
NORR Issued:	Not reported
45 Day Report:	Not reported
Public Meeting Held:	Not reported
Corrective Action Planned:	Not reported
SOC Sighned:	Not reported
Reclassification Report:	Not reported
RS Designation:	Not reported
Closure Request Date:	Not reported
Close-out Report:	Not reported

LUST:

Facility ID:	Not reported
UST Number:	RA-1587
Incident Number:	10111
Contamination Type:	Soil
Source Type:	Leak-underground
Product Type:	PETROLEUM
Date Reported:	05/12/1993
Date Occur:	04/01/1993
Cleanup:	Not reported
Closure Request:	Not reported
Close Out:	07/01/2004
Level Of Soil Cleanup Achieved:	Soil to Groundwater
Tank Regulated Status:	Regulated
# Of Supply Wells:	0
Commercial/NonCommercial UST Site:	COMMERCIAL
Risk Classification:	L
Risk Class Based On Review:	L
Corrective Action Plan Type:	Not reported
NOV Issue Date:	Not reported
NORR Issue Date:	Not reported
Site Priority:	10E
Phase Of LSA Req:	Not reported
Site Risk Reason:	Not reported
Land Use:	Residential
MTBE:	No
MTBE1:	No
Flag:	No
Flag1:	No
LUR Filed:	Not reported
Release Detection:	0
Current Status:	File Located in Archives
RBCA GW:	Not reported
PETOPT:	3
RPL:	False
CD Num:	262
Reel Num:	28
RPOW:	False
RPOP:	False
Error Flag:	0
Error Code:	N
Valid:	False
Lat/Long:	35 46 30.96 - 78 38 19.92

CP&L-WILMINGTON & DAVIE ST. (Continued) **S10152405**

Lat/Long Decimal: 35.7752 -78.6388
Testlat: Not reported
Regional Officer Project Mgr: WDP
Region: Raleigh
Company: CP&L
Contact Person: GEORGE J. OLIVER
Telephone: Not reported
RP Address: 411 FAYETTEVILLE ST. MALL
RP City,St,Zip: RALEIGH, NC 27602-
RP County: Not reported
Comments: 1/15/03 Review showed no pot. Receptor survey, but known from surveys in area that no ws wellls or streams exist in area. GW was <2L Low risk to apply.KAHhad only one TPH hit of 1.96 for samples of ss-5 through SS-12 and voc or svoc or o and g hits from
5 Min Quad: Not reported

PIRF:
Facility Id: 10111
Date Occurred: 3/29/1993
Date Reported: 4/20/1993
Description Of Incident: UPON EXCAVATION OF 4 OLD USTS, SOIL CONTAM. WAS DISCOVERED.
Owner/Operator: GEORGE J. OLIVER
Ownership: 4
Operation Type: 6
Type: 3
Location: 1
Site Priority: 10E
Priority Update: 4/16/1998
Wells Affected Y/N: N
Samples Include: 0
7#5 Minute Quad: 3
5 Minute Quad: 2
Pirf/Min Soil: Not reported
Release Code: K39Q
Source Code: Pirf
Err Type: Not reported
Cause: Not reported
Source: Not reported
Ust Number: Not reported

Last Modified: Not reported
Incident Phase: **Closed Out**
NOV Issued: Not reported
NORR Issued: Not reported
45 Day Report: Not reported
Public Meeting Held: Not reported
Corrective Action Planned: Not reported
SOC Signed: Not reported
Reclassification Report: Not reported
RS Designation: Not reported
Closure Request Date: Not reported
Close-out Report: Not reported

K40 **301 FAYETTEVILLE STREET** **NC BROWNFIELDS** **S108233741**
West **301 FAYETTEVILLE STREET** **N/A**
1/4-1/2 **RALEIGH, NC**
0.301 mi.
1588 ft. **Site 1 of 2 in cluster K**

Relative:
Higher

BROWNFIELDS:
Project Type: FINALIZED BROWNFIELD AGREEMENTS

Actual:
336 ft.

K41 **HUDSON BELK CO.** **NC IMD** **U001439602**
West **319 FAYETTEVILLE ST. MALL** **NC LUST** **N/A**
1/4-1/2 **RALEIGH, NC 27602** **NC UST**
0.317 mi.
1675 ft. **Site 2 of 2 in cluster K**

Relative:
Higher

Actual:
337 ft.

IMD:
Region: RAL
Facility ID: 21247
Date Occurred: 11/30/1999
Submit Date: 1/13/2000
GW Contam: Yes, Groundwater Contamination has been detected
Soil Contam: No
Incident Desc: LIMITED UST ASSESSMENT WAS PERFORMED ON 1 8000 GALLON HEATING OIL UST SOIL CONT DETECTED IN SAMPLES COLLECTED 1640 MG/KG TPH DRO IN SAMPLE SB-1(6-8)
Operator: SCOTT TOWNSEND
Contact Phone: 919-890-3162
Owner Company: CITY OF RALEIGH
Operator Address: P.O. BOX 590
Operator City: RALEIGH
Oper City,St,Zip: RALEIGH, NC 27602-
Ownership: Private
Operation: Commercial
Material: HEATING OIL
Qty Lost 1: Not reported
Qty Recovered 1: Not reported
Source: Leak-underground
Type: Gasoline/diesel
Location: Facility
Setting: Urban
Risk Site: L
Site Priority: Not reported
Priority Code: Not reported
Priority Update: 1/13/2000
Dem Contact: WDP
Wells Affected: Not reported
Num Affected: Not reported
Wells Contam: Not reported
Sampled By: Not reported
Samples Include: Not reported
7.5 Min Quad: Not reported
5 Min Quad: Not reported
Latitude: 35.77555555
Longitude: -78.63805555
Latitude Number: 354632
Longitude Number: 783817
Latitude Decimal: 35.7755555555556
Longitude Decimal: 78.6380555555556
GPS: NOD
Agency: DWM

HUDSON BELK CO. (Continued) **U001439602**

Facility ID:	21247
Last Modified:	Not reported
Incident Phase:	RE
NOV Issued:	Not reported
NORR Issued:	Not reported
45 Day Report:	Not reported
Public Meeting Held:	Not reported
Corrective Action Planned:	Not reported
SOC Sighned:	Not reported
Reclassification Report:	Not reported
RS Designation:	Not reported
Closure Request Date:	Not reported
Close-out Report:	Not reported

LUST:

Facility ID:	00-0-000
UST Number:	RA-3245
Incident Number:	21247
Contamination Type:	Groundwater/Both
Source Type:	Leak-underground
Product Type:	PETROLEUM
Date Reported:	12/17/1999
Date Occur:	11/30/1999
Cleanup:	11/30/1999
Closure Request:	2002-02-04 00:00:00
Close Out:	Not reported
Level Of Soil Cleanup Achieved:	Residential
Tank Regulated Status:	Regulated
# Of Supply Wells:	0
Commercial/NonCommercial UST Site:	COMMERCIAL
Risk Classification:	L
Risk Class Based On Review:	L
Corrective Action Plan Type:	Not reported
NOV Issue Date:	Not reported
NORR Issue Date:	02/11/2002
Site Priority:	Not reported
Phase Of LSA Req:	1
Site Risk Reason:	Not reported
Land Use:	Residential
MTBE:	No
MTBE1:	No
Flag:	No
Flag1:	No
LUR Filed:	Not reported
Release Detection:	0
Current Status:	File Located in House
RBCA GW:	Not reported
PETOPT:	4
RPL:	False
CD Num:	Not reported
Reel Num:	Not reported
RPOW:	False
RPOP:	False
Error Flag:	0
Error Code:	N
Valid:	False

HUDSON BELK CO. (Continued) **U001439602**

Lat/Long:	35 46 34.92 - 78 38 21.84
Lat/Long Decimal:	35.7763 -78.6394
Testlat:	Not reported
Regional Officer Project Mgr:	WDP
Region:	Raleigh
Company:	CITY OF RALEIGH
Contact Person:	SCOTT TOWNSEND
Telephone:	919-890-3162
RP Address:	P.O. BOX 590
RP City,St,Zip:	RALEIGH, NC 27602-
RP County:	wake
Comments:	Closure Report (12/18/2001) showed 469 mg/kg C9-C22 Aromatics in samples collected at closure. 12/19/2001, JFM/////LUR for GW sent out 02/11/2002. 02/07/2002, JFM ////Needs LUR for GW only, RKD///wsw located at county courthouse
5 Min Quad:	Not reported

PIRF:

Facility Id:	21247
Date Occurred:	11/30/1999
Date Reported:	1/13/2000
Description Of Incident:	LIMITED UST ASSESSMENT WAS PERFORMED ON 1 8000 GALLON HEATING OIL UST SOIL CONT DETECTED IN SAMPLES COLLECTED 1640 MG/KG TPH DRO IN SAMPLE SB-1(6-8)
Owner/Operator:	MR SCOTT TOWNSEND ADMINISTRATIVE SE
Ownership:	4
Operation Type:	6
Type:	4
Location:	1
Site Priority:	Not reported
Priority Update:	1/13/2000
Wells Affected Y/N:	Not reported
Samples Include:	Not reported
7#5 Minute Quad:	Not reported
5 Minute Quad:	Not reported
Pirf/Min Soil:	Not reported
Release Code:	Not reported
Source Code:	PIRF
Err Type:	Not reported
Cause:	Not reported
Source:	Not reported
Ust Number:	Not reported
Last Modified:	Not reported
Incident Phase:	**Response**
NOV Issued:	Not reported
NORR Issued:	Not reported
45 Day Report:	Not reported
Public Meeting Held:	Not reported
Corrective Action Planned:	Not reported
SOC Signed:	Not reported
Reclassification Report:	Not reported
RS Designation:	Not reported
Closure Request Date:	Not reported
Close-out Report:	Not reported

UST:

HUDSON BELK CO. (Continued) **U001439602**

Facility Id:	00-0-0000031866
Contact:	CITY OF RALEIGH
Contact Address1:	PO BOX 590/ATTN:M.MOLNAR
Contact Address2:	Not reported
Contact City/State/Zip:	RALEIGH, NC 27602-0590
FIPS County Desc:	Wake
Latitude:	0
Longitude:	0
Tank Id:	1
Tank Status:	Current
Installed Date:	09/20/1960
Perm Close Date:	Not reported
Product Key:	6
Product Name:	Heating Oil/Fuel
Tank Capacity:	8000
Root Tank Id:	Not reported
Main Tank:	No
Compartment Tank:	No
Manifold Tank:	0
Commercial:	Yes
Regulated:	No
Tank Construction:	Single Wall Steel
Piping Construction:	Unknown
Piping System Key:	Unknown
Other CP Tank:	Not reported

---

42 **SHAW UNIVERSI NORTHEAST CAMPUS** **NC IMD** **S101573865**
South **E LENOIR & S BLOODWORTH ST** **NC LUST** **N/A**
1/4-1/2 **RALEIGH, NC 27601**
0.323 mi.
1707 ft.

Relative:
Lower

Actual:
295 ft.

IMD:

Region:	RAL
Facility ID:	13077
Date Occurred:	6/15/1994
Submit Date:	12/28/1994
GW Contam:	No Groundwater Contamination detected
Soil Contam:	Yes
Incident Desc:	DURING BUILDING ACTIVITIES, SOME SOIL CON. WAS FOUND
Operator:	Not reported
Contact Phone:	Not reported
Owner Company:	SHAW UNIVERSITY
Operator Address:	118 E SOUTH ST
Operator City:	RALEIGH
Oper City,St,Zip:	RALEIGH, NC 27610-
Ownership:	State
Operation:	Educational/Religious
Material:	HEATER OIL
Qty Lost 1:	Not reported
Qty Recovered 1:	Not reported
Source:	Leak-underground
Type:	Gasoline/diesel
Location:	Facility
Setting:	Urban
Risk Site:	Not reported
Site Priority:	Not reported

SHAW UNIVERSI NORTHEAST CAMPUS (Continued) **S101573865**

Priority Code: Not reported
Priority Update: Not reported
Dem Contact: WDP
Wells Affected: Not reported
Num Affected: 0
Wells Contam: Not reported
Sampled By: Not reported
Samples Include: Not reported
7.5 Min Quad: Not reported
5 Min Quad: Not reported
Latitude: 35.77277777
Longitude: -78.63333333
Latitude Number: 354622
Longitude Number: 783800
Latitude Decimal: 35.7727777777778
Longitude Decimal: 78.6333333333333
GPS: NOD
Agency: DWM
Facility ID: 13077
Last Modified: 5/3/2001
Incident Phase: Closed Out
NOV Issued: Not reported
NORR Issued: Not reported
45 Day Report: Not reported
Public Meeting Held: Not reported
Corrective Action Planned: Not reported
SOC Sighned: Not reported
Reclassification Report: Not reported
RS Designation: Not reported
Closure Request Date: Not reported
Close-out Report: 12/22/1994

LUST:
Facility ID: Not reported
UST Number: RA-2152
Incident Number: 13077
Contamination Type: Soil
Source Type: Leak-underground
Product Type: PETROLEUM
Date Reported: 06/15/1994
Date Occur: 06/15/1994
Cleanup: Not reported
Closure Request: Not reported
Close Out: 12/21/1994
Level Of Soil Cleanup Achieved: Not reported
Tank Regulated Status: Non Regulated
Of Supply Wells: 0
Commercial/NonCommercial UST Site: NON COMMERCIAL
Risk Classification: Not reported
Risk Class Based On Review: L
Corrective Action Plan Type: Not reported
NOV Issue Date: Not reported
NORR Issue Date: Not reported
Site Priority: 0
Phase Of LSA Req: Not reported
Site Risk Reason: Not reported

SHAW UNIVERSI NORTHEAST CAMPUS (Continued) **S101573865**

Land Use:	Not reported
MTBE:	No
MTBE1:	Unknown
Flag:	No
Flag1:	No
LUR Filed:	Not reported
Release Detection:	0
Current Status:	File Located in Archives
RBCA GW:	Not reported
PETOPT:	4
RPL:	False
CD Num:	26
Reel Num:	57
RPOW:	False
RPOP:	False
Error Flag:	0
Error Code:	N
Valid:	False
Lat/Long:	354622 -783800
Lat/Long Decimal:	0 0
Testlat:	Not reported
Regional Officer Project Mgr:	WDP
Region:	Raleigh
Company:	SHAW UNIVERSITY
Contact Person:	Not reported
Telephone:	Not reported
RP Address:	118 E SOUTH ST
RP City,St,Zip:	RALEIGH, NC 27610-
RP County:	Not reported
Comments:	Cont. soil dumped on site called "Adcock Property (CMM #12)"
5 Min Quad:	Not reported

PIRF:

Facility Id:	13077
Date Occurred:	6/1/1994
Date Reported:	12/28/1994
Description Of Incident:	DURING BUILDING ACTIVITIES, SOME SOIL CON. WAS FOUND
Owner/Operator:	Not reported
Ownership:	7
Operation Type:	4
Type:	4
Location:	1
Site Priority:	Not reported
Priority Update:	Not reported
Wells Affected Y/N:	Not reported
Samples Include:	0
7#5 Minute Quad:	Not reported
5 Minute Quad:	Not reported
Pirf/Min Soil:	Not reported
Release Code:	Not reported
Source Code:	Min_Soil
Err Type:	Not reported
Cause:	Not reported
Source:	Not reported
Ust Number:	Not reported
Last Modified:	5/3/2001
Incident Phase:	**Closed Out**

SHAW UNIVERSI NORTHEAST CAMPUS (Continued) **S101573865**

NOV Issued:	Not reported
NORR Issued:	Not reported
45 Day Report:	Not reported
Public Meeting Held:	Not reported
Corrective Action Planned:	Not reported
SOC Signed:	Not reported
Reclassification Report:	Not reported
RS Designation:	Not reported
Closure Request Date:	Not reported
Close-out Report:	12/22/1994

43
NE
1/4-1/2
0.335 mi.
1769 ft.

Relative:
Higher

Actual:
321 ft.

HONEYCUTT CLEANERS **RCRA-SQG** **1000226296**
605 NEW BERN AVE **FINDS** **NCD024751281**
RALEIGH, NC 27601 **NC IMD**
NC LUST
NC UST
RI MANIFEST

RCRA-SQG:

Date form received by agency:	10/31/1989
Facility name:	HONEYCUTT CLEANERS
Facility address:	605 NEW BERN AVE RALEIGH, NC 27601
EPA ID:	NCD024751281
Mailing address:	NEW BERN AVE RALEIGH, NC 27601
Contact:	A.C. HONEYCUTT
Contact address:	Not reported Not reported
Contact country:	Not reported
Contact telephone:	(919) 834-2080
Contact email:	Not reported
EPA Region:	04
Land type:	Private
Classification:	Small Small Quantity Generator
Description:	Handler: generates more than 100 and less than 1000 kg of hazardous waste during any calendar month and accumulates less than 6000 kg of hazardous waste at any time; or generates 100 kg or less of hazardous waste during any calendar month, and accumulates more than 1000 kg of hazardous waste at any time

Owner/Operator Summary:

Owner/operator name:	HONEYCUTT A.C.
Owner/operator address:	Not reported Not reported
Owner/operator country:	Not reported
Owner/operator telephone:	Not reported
Legal status:	Private
Owner/Operator Type:	Owner
Owner/Op start date:	Not reported
Owner/Op end date:	Not reported

Handler Activities Summary:

U.S. importer of hazardous waste:	No
Mixed waste (haz. and radioactive):	No
Recycler of hazardous waste:	No
Transporter of hazardous waste:	No

HONEYCUTT CLEANERS (Continued) **1000226296**

Treater, storer or disposer of HW: No
Underground injection activity: No
On-site burner exemption: No
Furnace exemption: No
Used oil fuel burner: No
Used oil processor: No
User oil refiner: No
Used oil fuel marketer to burner: No
Used oil Specification marketer: No
Used oil transfer facility: No
Used oil transporter: No

Violation Status: No violations found

Evaluation Action Summary:
Evaluation date: 04/22/1997
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: State

FINDS:

Registry ID: 110004017661

Environmental Interest/Information System
NC-FITS (North Carolina - Facility Identification Template For States) is North Carolina Department of Environment and Natural Resources' (NCDENR) Facility Identification Template for States that provides a common facility identifier in order to improve accessibility to comprehensive information about environmental regulated entities in the state of North Carolina.

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

IMD:
Region: RAL
Facility ID: 10430
Date Occurred: 3/18/1992
Submit Date: 7/1/1993
GW Contam: No Groundwater Contamination detected
Soil Contam: Yes
Incident Desc: RELEASE DISCOVERED DURING UST CLOSURES.
Operator: TIM HONEYCUTT
Contact Phone: 919-833-1696
Owner Company: HONEYCUTT CLEANERS
Operator Address: 605 NEW BERN AVE.
Operator City: RALEIGH
Oper City,St,Zip: RALEIGH, NC 27601-
Ownership: Private
Operation: Commercial

HONEYCUTT CLEANERS (Continued) **1000226296**

Material: VARSOL
Qty Lost 1: Not reported
Qty Recovered 1: Not reported
Source: Leak-underground
Type: Gasoline/diesel
Location: Facility
Setting: Urban
Risk Site: L
Site Priority: 30E
Priority Code: L
Priority Update: 4/16/1998
Dem Contact: FTF
Wells Affected: No
Num Affected: 0
Wells Contam: Not reported
Sampled By: Other
Samples Include: Soil Samples
7.5 Min Quad: Not reported
5 Min Quad: K39R
Latitude: 35.78
Longitude: -78.62888888
Latitude Number: 354648
Longitude Number: 783744
Latitude Decimal: 35.78
Longitude Decimal: 78.6288888888889
GPS: 5
Agency: DWM
Facility ID: 10430
Last Modified: Not reported
Incident Phase: RE
NOV Issued: Not reported
NORR Issued: Not reported
45 Day Report: Not reported
Public Meeting Held: Not reported
Corrective Action Planned: Not reported
SOC Sighned: Not reported
Reclassification Report: Not reported
RS Designation: Not reported
Closure Request Date: Not reported
Close-out Report: Not reported

LUST:
Facility ID: 00-0-000
UST Number: RA-1690
Incident Number: 10430
Contamination Type: Soil
Source Type: Leak-underground
Product Type: PETROLEUM
Date Reported: 10/17/1991
Date Occur: 03/18/1992
Cleanup: Not reported
Closure Request: Not reported
Close Out: Not reported
Level Of Soil Cleanup Achieved: Not reported
Tank Regulated Status: Regulated
Of Supply Wells: 0

HONEYCUTT CLEANERS (Continued) **1000226296**

Commercial/NonCommercial UST Site: COMMERCIAL
Risk Classification: L
Risk Class Based On Review: U
Corrective Action Plan Type: Not reported
NOV Issue Date: Not reported
NORR Issue Date: Not reported
Site Priority: 30E
Phase Of LSA Req: Not reported
Site Risk Reason: Not reported
Land Use: Residential
MTBE: No
MTBE1: Unknown
Flag: No
Flag1: No
LUR Filed: Not reported
Release Detection: 0
Current Status: File Located in House
RBCA GW: Not reported
PETOPT: 5
RPL: False
CD Num: Not reported
Reel Num: Not reported
RPOW: False
RPOP: False
Error Flag: 0
Error Code: N
Valid: False
Lat/Long: 35 46 48 - 78 37 44.94
Lat/Long Decimal: 35.7800 -78.6291
Testlat: Not reported
Regional Officer Project Mgr: FTF
Region: Raleigh
Company: HONEYCUTT CLEANERS
Contact Person: TIM HONEYCUTT
Telephone: 919-833-1696
RP Address: 605 NEW BERN AVE.
RP City,St,Zip: RALEIGH, NC 27601-
RP County: Not reported
Comments: 1/16/03 U risk assigned. Cont. soil from naphtha UST releases: max. soil cont. remaininig afterin place closure 8/91 was 4200ppm TPH-DRO in sample b-1 (7/92). No gw analyses or receptor survey.LSA required. KAH. Responsible party has hired a consultant a
5 Min Quad: K39r

PIRF:
Facility Id: 10430
Date Occurred: 8/14/1991
Date Reported: 7/1/1993
Description Of Incident: RELEASE DISCOVERED DURING UST CLOSURES.
Owner/Operator: TIM HONEYCUTT
Ownership: 4
Operation Type: 6
Type: 5
Location: 1
Site Priority: 30E
Priority Update: 4/16/1998
Wells Affected Y/N: N
Samples Include: 0

HONEYCUTT CLEANERS (Continued) **1000226296**

7#5 Minute Quad:	4
5 Minute Quad:	2
Pirf/Min Soil:	Not reported
Release Code:	K39R
Source Code:	Pirf
Err Type:	Not reported
Cause:	Not reported
Source:	Not reported
Ust Number:	Not reported
Last Modified:	Not reported
Incident Phase:	**Response**
NOV Issued:	Not reported
NORR Issued:	Not reported
45 Day Report:	Not reported
Public Meeting Held:	Not reported
Corrective Action Planned:	Not reported
SOC Signed:	Not reported
Reclassification Report:	Not reported
RS Designation:	Not reported
Closure Request Date:	Not reported
Close-out Report:	Not reported

UST:

Facility Id:	00-0-0000005338
Contact:	HONEYCUTT CLEANERS INC
Contact Address1:	605 NEW BERN AVENUE
Contact Address2:	Not reported
Contact City/State/Zip:	RALEIGH, NC 27601-1599
FIPS County Desc:	Wake
Latitude:	35.7806
Longitude:	-78.62859
Tank Id:	1
Tank Status:	Current
Installed Date:	04/15/1958
Perm Close Date:	Not reported
Product Key:	16
Product Name:	Other, Hazardous
Tank Capacity:	150
Root Tank Id:	Not reported
Main Tank:	No
Compartment Tank:	No
Manifold Tank:	Not reported
Commercial:	Yes
Regulated:	Yes
Tank Construction:	Single Wall Steel
Piping Construction:	Single Wall Steel
Piping System Key:	Unknown
Other CP Tank:	Not reported
Tank Id:	2
Tank Status:	Removed
Installed Date:	04/15/1958
Perm Close Date:	01/01/1965
Product Key:	16

HONEYCUTT CLEANERS (Continued) **1000226296**

Product Name: Other, Hazardous
Tank Capacity: 150
Root Tank Id: Not reported
Main Tank: No
Compartment Tank: No
Manifold Tank: Not reported
Commercial: Yes
Regulated: Yes
Tank Construction: Single Wall Steel
Piping Construction: Single Wall Steel
Piping System Key: Unknown
Other CP Tank: Not reported

Tank Id: 3
Tank Status: Current
Installed Date: 04/17/1951
Perm Close Date: Not reported
Product Key: 6
Product Name: Heating Oil/Fuel
Tank Capacity: 6000
Root Tank Id: Not reported
Main Tank: No
Compartment Tank: No
Manifold Tank: 0
Commercial: Yes
Regulated: No
Tank Construction: Single Wall Steel
Piping Construction: Single Wall Steel
Piping System Key: Unknown
Other CP Tank: Not reported

RI MANIFEST:
GEN Cert Date: 2/10/2011
Transporter Receipt Date: 2/10/2011
Number Of Containers: 14
Container Type: DF
Waste Code1: D001
Waste Code2: D007
Waste Code3: D039
Comment: Not reported
Fee Exempt Code: Not reported
TSDF Name: SAFETY KLEEN
TSDF ID: RID084802842
TSDF Date: 2/23/2011
Transporter 2 Name: 2/23/2011
Transporter 2 ID: NJD071629976
Manifest Docket Number: 002572064SKS
Waste Description: COMBUSTIBLE LIQUID NOS
Quantity: 420
WT/Vol Units: P
Item Number: 2
Transporter Name: SAFETY KLEEN
Transporter EPA ID: TXR000050930
GEN Cert Date: 2/10/2011
Transporter Recpt Date: 2/10/2011
Transporter 2 Recpt Date: 2/23/2011

HONEYCUTT CLEANERS (Continued) **1000226296**

TSDF Recpt Date: 2/23/2011
EPA ID: NCD024751281
Transporter 2 ID: NJD071629976

L44 **CAROLINA POWER & LIGHT** **FINDS** **1006036622**
WSW **411 FAYETTEVILLE STREET** **NC IMD** **N/A**
1/4-1/2 **RALEIGH, NC** **NC LAST**
0.341 mi. **US AIRS**
1803 ft. **Site 1 of 3 in cluster L**

Relative: Higher

Actual: 334 ft.

FINDS:

Registry ID: 110001502053

Environmental Interest/Information System

AFS (Aerometric Information Retrieval System (AIRS) Facility Subsystem) replaces the former Compliance Data System (CDS), the National Emission Data System (NEDS), and the Storage and Retrieval of Aerometric Data (SAROAD). AIRS is the national repository for information concerning airborne pollution in the United States. AFS is used to track emissions and compliance data from industrial plants. AFS data are utilized by states to prepare State Implementation Plans to comply with regulatory programs and by EPA as an input for the estimation of total national emissions. AFS is undergoing a major redesign to support facility operating permits required under Title V of the Clean Air Act.

The NEI (National Emissions Inventory) database contains information on stationary and mobile sources that emit criteria air pollutants and their precursors, as well as hazardous air pollutants (HAPs).

NC-FITS (North Carolina - Facility Identification Template For States) is North Carolina Department of Environment and Natural Resources' (NCDENR) Facility Identification Template for States that provides a common facility identifier in order to improve accessibility to comprehensive information about environmental regulated entities in the state of North Carolina.

ICIS (Integrated Compliance Information System) is the Integrated Compliance Information System and provides a database that, when complete, will contain integrated Enforcement and Compliance information across most of EPA's programs. The vision for ICIS is to replace EPA's independent databases that contain Enforcement data with a single repository for that information. Currently, ICIS contains all Federal Administrative and Judicial enforcement actions. This information is maintained in ICIS by EPA in the Regional offices and it Headquarters. A future release of ICIS will replace the Permit Compliance System (PCS) which supports the NPDES and will integrate that information with Federal actions already in the system. ICIS also has the capability to track other activities occurring in the Region that support Compliance and Enforcement programs. These include; Incident Tracking, Compliance Assistance, and Compliance Monitoring.

IMD:
Region: WAS

CAROLINA POWER & LIGHT (Continued) **1006036622**

Facility ID:	7591
Date Occurred:	1/15/1992
Submit Date:	1/30/2001
GW Contam:	No data entered (data entry person submitted a blank field
Soil Contam:	Yes
Incident Desc:	Not reported
Operator:	COOKE, JOANIE
Contact Phone:	Not reported
Owner Company:	CAROLINA POWER AND LIGHT
Operator Address:	411 FAYETTEVILLE STREET
Operator City:	FAYETTEVILLE
Oper City,St,Zip:	FAYETTEVILLE
Ownership:	Federal
Operation:	8
Material:	TURBINE LUBE OIL
Qty Lost 1:	Not reported
Qty Recovered 1:	50 GALS.
Source:	Unknown
Type:	Other petroleum product
Location:	Facility
Setting:	Rural
Risk Site:	Not reported
Site Priority:	Not reported
Priority Code:	D
Priority Update:	Not reported
Dem Contact:	JOANIE COOKE
Wells Affected:	No
Num Affected:	0
Wells Contam:	Not reported
Sampled By:	Not reported
Samples Include:	Not reported
7.5 Min Quad:	Not reported
5 Min Quad:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Latitude Number:	Not reported
Longitude Number:	Not reported
Latitude Decimal:	Not reported
Longitude Decimal:	Not reported
GPS:	NOD
Agency:	DWQ
Facility ID:	7591
Last Modified:	1/31/2001
Incident Phase:	Follow Up
NOV Issued:	4/27/1997
NORR Issued:	Not reported
45 Day Report:	Not reported
Public Meeting Held:	Not reported
Corrective Action Planned:	Not reported
SOC Sighned:	Not reported
Reclassification Report:	Not reported
RS Designation:	Not reported
Closure Request Date:	Not reported
Close-out Report:	Not reported

CAROLINA POWER & LIGHT (Continued) **1006036622**

LAST:

Facility ID:	Not reported	
UST Number:	FA-7591	
Incident Number:	7591	
Contamination Type:		NO
Source Type:	17	
Product Type:	N	
Date Reported:	04/27/1992	
Date Occur:	04/15/1992	
Cleanup:	Not reported	
Closure Request:	Not reported	
Close Out:	Not reported	
Level Of Soil Cleanup Achieved:		Not reported
Tank Regulated Status:		Not reported
# Of Supply Wells:	0	
Commercial/NonCommercial UST Site:		Not reported
Risk Classification:		Not reported
Risk Class Based On Review:		U
Corrective Action Plan Type:		Not reported
NOV Issue Date:	Not reported	
NORR Issue Date:	Not reported	
Site Priority:	0	
Phase Of LSA Req:	Not reported	
Site Risk Reason:	Not reported	
Land Use:	Not reported	
MTBE:	No	
MTBE1:	Unknown	
Flag:	No	
Flag1:	No	
LUR Filed:	Not reported	
Release Detection:	0	
Current Status:	C	
RBCA GW:	Not reported	
PETOPT:	Not reported	
RPL:	False	
CD Num:	0	
Reel Num:	0	
RPOW:	False	
RPOP:	False	
Error Flag:	0	
Error Code:	Not reported	
Valid:	False	
Lat/Long:	Not reported	
Lat/Long Decimal:	0 0	
Testlat:	Not reported	
Regional Officer Project Mgr:		Not reported
Region:		FAY
Company:		CAROLINA POWER AND LIGHT
Contact Person:		JOANIE COOKE
Telephone:		Not reported
RP Address:		411 FAYETTEVILLE STREET
RP City,St,Zip:		FAYETTEVILLE, NC
RP County:		Not reported
Comments:	Not reported	
5 Min Quad:	Not reported	

PIRF:

CAROLINA POWER & LIGHT (Continued) **1006036622**

Facility Id:	7591
Date Occurred:	Not reported
Date Reported:	Not reported
Description Of Incident:	Not reported
Owner/Operator:	Not reported
Ownership:	5
Operation Type:	8
Type:	Not reported
Location:	Not reported
Site Priority:	0D
Priority Update:	Not reported
Wells Affected Y/N:	N
Samples Include:	0
7#5 Minute Quad:	Not reported
5 Minute Quad:	Not reported
Pirf/Min Soil:	Not reported
Release Code:	Not reported
Source Code:	Not reported
Err Type:	Not reported
Cause:	Not reported
Source:	Not reported
Ust Number:	0
Last Modified:	1/31/2001
Incident Phase:	**FU**
NOV Issued:	Not reported
NORR Issued:	Not reported
45 Day Report:	Not reported
Public Meeting Held:	Not reported
Corrective Action Planned:	Not reported
SOC Signed:	Not reported
Reclassification Report:	Not reported
RS Designation:	Not reported
Closure Request Date:	Not reported
Close-out Report:	Not reported

AIRS (AFS):

Airs Minor Details:

EPA plant ID:	110001502053
Plant name:	CAROLINA POWER & LIGHT
Plant address:	411 FAYETTEVILLE STREET RALEIGH, NC
County:	WAKE
Region code:	04
Dunn & Bradst #:	Not reported
Air quality cntrl region:	166
Sic code:	4911
Sic code desc:	ELECTRIC SERVICES
North Am. industrial classf:	221119
NAIC code description:	Other Electric Power Generation
Default compliance status:	IN COMPLIANCE WITH PROCEDURAL REQUIREMENTS
Default classification:	MAJOR SOURCE THRESHOLDS ARE NOT DEFINED
Govt facility:	ALL OTHER FACILITIES NOT OWNED OR OPERATED BY A FEDERAL, STATE, OR LOCAL GOVERNMENT
Current HPV:	Not reported

CAROLINA POWER & LIGHT (Continued) **1006036622**

Historical Compliance Minor Sources:
State compliance status: IN COMPLIANCE - INSPECTION
Hist compliance date: 1001
Air prog code hist file: 7

State compliance status: IN COMPLIANCE - INSPECTION
Hist compliance date: 1002
Air prog code hist file: 7

State compliance status: IN COMPLIANCE - INSPECTION
Hist compliance date: 1003
Air prog code hist file: 7

State compliance status: IN COMPLIANCE - INSPECTION
Hist compliance date: 1003
Air prog code hist file: 9

State compliance status: IN COMPLIANCE - INSPECTION
Hist compliance date: 1004
Air prog code hist file: 9

State compliance status: IN COMPLIANCE - INSPECTION
Hist compliance date: 1101
Air prog code hist file: 9

State compliance status: IN COMPLIANCE - INSPECTION
Hist compliance date: 1102
Air prog code hist file: 7

State compliance status: IN COMPLIANCE - INSPECTION
Hist compliance date: 1103
Air prog code hist file: 7

State compliance status: IN COMPLIANCE - INSPECTION
Hist compliance date: 1104
Air prog code hist file: 7

State compliance status: IN COMPLIANCE - INSPECTION
Hist compliance date: 1201
Air prog code hist file: 7

State compliance status: IN COMPLIANCE - INSPECTION
Hist compliance date: 1201
Air prog code hist file: 9

State compliance status: IN COMPLIANCE - INSPECTION
Hist compliance date: 1202
Air prog code hist file: 9

State compliance status: IN COMPLIANCE - INSPECTION
Hist compliance date: 1203
Air prog code hist file: 9

State compliance status: IN COMPLIANCE - INSPECTION
Hist compliance date: 1204
Air prog code hist file: 7

CAROLINA POWER & LIGHT (Continued) **1006036622**

State compliance status: IN COMPLIANCE WITH PROCEDURAL REQUIREMENTS
Hist compliance date: 1001
Air prog code hist file: 0

State compliance status: IN COMPLIANCE WITH PROCEDURAL REQUIREMENTS
Hist compliance date: 1003
Air prog code hist file: 0

State compliance status: IN COMPLIANCE WITH PROCEDURAL REQUIREMENTS
Hist compliance date: 1004
Air prog code hist file: 0

State compliance status: IN COMPLIANCE WITH PROCEDURAL REQUIREMENTS
Hist compliance date: 1102
Air prog code hist file: 0

State compliance status: IN COMPLIANCE WITH PROCEDURAL REQUIREMENTS
Hist compliance date: 1104
Air prog code hist file: 0

State compliance status: IN COMPLIANCE WITH PROCEDURAL REQUIREMENTS
Hist compliance date: 1201
Air prog code hist file: 0

State compliance status: IN COMPLIANCE WITH PROCEDURAL REQUIREMENTS
Hist compliance date: 1203
Air prog code hist file: 0

State compliance status: IN COMPLIANCE - INSPECTION
Hist compliance date: 1001
Air prog code hist file: 9

State compliance status: IN COMPLIANCE - INSPECTION
Hist compliance date: 1002
Air prog code hist file: 9

State compliance status: IN COMPLIANCE - INSPECTION
Hist compliance date: 1004
Air prog code hist file: 7

State compliance status: IN COMPLIANCE - INSPECTION
Hist compliance date: 1101
Air prog code hist file: 7

State compliance status: IN COMPLIANCE - INSPECTION
Hist compliance date: 1102
Air prog code hist file: 9

State compliance status: IN COMPLIANCE - INSPECTION
Hist compliance date: 1103
Air prog code hist file: 9

State compliance status: IN COMPLIANCE - INSPECTION
Hist compliance date: 1104
Air prog code hist file: 9

State compliance status: IN COMPLIANCE - INSPECTION

CAROLINA POWER & LIGHT (Continued) **1006036622**

Hist compliance date: 1202
Air prog code hist file: 7

State compliance status: IN COMPLIANCE - INSPECTION
Hist compliance date: 1203
Air prog code hist file: 7

State compliance status: IN COMPLIANCE - INSPECTION
Hist compliance date: 1204
Air prog code hist file: 9

State compliance status: IN COMPLIANCE WITH PROCEDURAL REQUIREMENTS
Hist compliance date: 1002
Air prog code hist file: 0

State compliance status: IN COMPLIANCE WITH PROCEDURAL REQUIREMENTS
Hist compliance date: 1101
Air prog code hist file: 0

State compliance status: IN COMPLIANCE WITH PROCEDURAL REQUIREMENTS
Hist compliance date: 1103
Air prog code hist file: 0

State compliance status: IN COMPLIANCE WITH PROCEDURAL REQUIREMENTS
Hist compliance date: 1202
Air prog code hist file: 0

State compliance status: IN COMPLIANCE WITH PROCEDURAL REQUIREMENTS
Hist compliance date: 1204
Air prog code hist file: 0

Compliance & Violation Data by Minor Sources:
Air program code: NSR
Plant air program pollutant: OTHER
Default pollutant classification: MAJOR SOURCE THRESHOLDS ARE NOT DEFINED
Def. poll. compliance status: IN COMPLIANCE - INSPECTION
Def. attainment/non attnmnt: ATTAINMENT AREA FOR GIVEN POLLUTANT
Repeat violator date: Not reported
Turnover compliance: Not reported

Air program code: SIP SOURCE
Plant air program pollutant: OTHER
Default pollutant classification: MAJOR SOURCE THRESHOLDS ARE NOT DEFINED
Def. poll. compliance status: IN COMPLIANCE WITH PROCEDURAL REQUIREMENTS
Def. attainment/non attnmnt: ATTAINMENT AREA FOR GIVEN POLLUTANT
Repeat violator date: Not reported
Turnover compliance: Not reported

Air program code: NSPS
Plant air program pollutant: OTHER
Default pollutant classification: MAJOR SOURCE THRESHOLDS ARE NOT DEFINED
Def. poll. compliance status: IN COMPLIANCE - INSPECTION
Def. attainment/non attnmnt: ATTAINMENT AREA FOR GIVEN POLLUTANT
Repeat violator date: Not reported
Turnover compliance: Not reported

L45 **CHARTER SQUARE** **NC LUST** **S109367298**
WSW **501 FAYETTEVILLE STREET** **N/A**
1/4-1/2 **RALEIGH, NC 27601**
0.353 mi.
1864 ft. **Site 2 of 3 in cluster L**

Relative:
Higher

Actual:
334 ft.

LUST:

Facility ID:	Not reported	
UST Number:	RA-6047	
Incident Number:	33585	
Contamination Type:		Groundwater/Both
Source Type:	Leak-underground	
Product Type:	PETROLEUM	
Date Reported:	09/11/2008	
Date Occur:	04/25/2006	
Cleanup:	04/25/2006	
Closure Request:	Not reported	
Close Out:	11/17/2008	
Level Of Soil Cleanup Achieved:		Soil to Groundwater
Tank Regulated Status:		Regulated
# Of Supply Wells:	0	
Commercial/NonCommercial UST Site:		COMMERCIAL
Risk Classification:		L
Risk Class Based On Review:		L
Corrective Action Plan Type:		Not reported
NOV Issue Date:	Not reported	
NORR Issue Date:	Not reported	
Site Priority:	Not reported	
Phase Of LSA Req:	Not reported	
Site Risk Reason:	Not reported	
Land Use:	Residential	
MTBE:	No	
MTBE1:	Unknown	
Flag:	No	
Flag1:	No	
LUR Filed:	11/18/2008	
Release Detection:	0	
Current Status:	File Located in House	
RBCA GW:	Cleanups to alternate standards	
PETOPT:	3	
RPL:	False	
CD Num:	0	
Reel Num:	0	
RPOW:	False	
RPOP:	False	
Error Flag:	0	
Error Code:	N	
Valid:	False	
Lat/Long:	35 46 25.5 - 78 38 21	
Lat/Long Decimal:	35.7737 -78.6391	
Testlat:	Not reported	
Regional Officer Project Mgr:		JFM
Region:		Raleigh
Company:		City of Raleigh
Contact Person:		Bob Panella
Telephone:		Not reported
RP Address:		434 Fayetteville Street
RP City,St,Zip:		Raleigh, NC 27601
RP County:		Not reported

CHARTER SQUARE (Continued) **S109367298**

Comments: (Conv.Center)
5 Min Quad: Not reported

PIRF:

Facility Id:	33585
Date Occurred:	4/25/2006
Date Reported:	9/11/2008
Description Of Incident:	Not reported
Owner/Operator:	Not reported
Ownership:	1
Operation Type:	1
Type:	3
Location:	8
Site Priority:	Not reported
Priority Update:	Not reported
Wells Affected Y/N:	N
Samples Include:	Not reported
7#5 Minute Quad:	Y
5 Minute Quad:	Not reported
Pirf/Min Soil:	Not reported
Release Code:	Not reported
Source Code:	Not reported
Err Type:	2
Cause:	7
Source:	G
Ust Number:	P
Last Modified:	11/17/2008
Incident Phase:	**Closed Out**
NOV Issued:	Not reported
NORR Issued:	Not reported
45 Day Report:	Not reported
Public Meeting Held:	Not reported
Corrective Action Planned:	Not reported
SOC Signed:	Not reported
Reclassification Report:	Not reported
RS Designation:	Not reported
Closure Request Date:	Not reported
Close-out Report:	Not reported

L46 **CONVENTION CENTER PARKING LOTS** **US BROWNFIELDS** **1010376326**
WSW **500 AND 615 FAYETTEVILLE ST MALL, 10 W. SOUTH ST 600, 602, A** **FINDS** **N/A**
1/4-1/2 **RALEIGH, NC 27601**
0.354 mi.
1871 ft. **Site 3 of 3 in cluster L**

Relative:
Higher

Actual:
335 ft.

US BROWNFIELDS:

Recipient name:	Raleigh, City of
Grant type:	Assessment
Property name:	CONVENTION CENTER PARKING LOTS
Property #:	1703-55-5354,1703-66-5359,1703-66-5258,1703-66-8320,1703-76-0380,1703-66-9720
Parcel size:	5.4
Property Description:	Five contiguous parcels, including former gasoline service stations, automotive repair facilities, and dry cleaning operations. A sixth parcel, the former Raleigh Convention Center, was removed from the Brownfield Assessment program due to construction schedule needs. The sites are currently paved parking lots owned by the City of Raleigh and leased to a private operator.

CONVENTION CENTER PARKING LOTS (Continued) **1010376326**

Latitude:	35.77533
Longitude:	-78.63942
HCM label:	Address Matching-House Number
Map scale:	1:24,000
Point of reference:	Center of a Facility or Station
Datum:	World Geodetic System of 1984
ACRES property ID:	21863
Start date:	Not reported
Completed date:	Not reported
Acres cleaned up:	Not reported
Cleanup funding:	Not reported
Cleanup funding source:	Not reported
Assessment funding:	97025
Assessment funding source:	US EPA - Brownfields Assessment Cooperative Agreement
Redevelopment funding:	Not reported
Redev. funding source:	Not reported
Redev. funding entity name:	Not reported
Redevelopment start date:	Not reported
Assessment funding entity:	Not reported
Cleanup funding entity:	Not reported
Grant type:	B
Accomplishment type:	Phase II Environmental Assessment
Accomplishment count:	0
Cooperative agreement #:	96416704
Ownership entity:	Government
Current owner:	City of Raleigh
Did owner change:	N
Cleanup required:	Yes
Video available:	No
Photo available:	Yes
Institutional controls required:	Y
IC Category proprietary controls:	Not reported
IC cat. info. devices:	Y
IC cat. gov. controls:	Not reported
IC cat. enforcement permit tools:	Not reported
IC in place date:	4-Jan-10
IC in place:	Yes
State/tribal program date:	Not reported
State/tribal program ID:	Not reported
State/tribal NFA date:	3-Nov-09
Air contaminated:	Not reported
Air cleaned:	Not reported
Asbestos found:	Not reported
Asbestos cleaned:	Not reported
Controled substance found:	Not reported
Controled substance cleaned:	Not reported
Drinking water affected:	Not reported
Drinking water cleaned:	Not reported
Groundwater affected:	Y
Groundwater cleaned:	Y
Lead contaminant found:	Y
Lead cleaned up:	Y
No media affected:	Not reported
Unknown media affected:	Not reported
Other cleaned up:	Not reported
Other metals found:	Y
Other metals cleaned:	Y

CONVENTION CENTER PARKING LOTS (Continued) **1010376326**

Other contaminants found:	Not reported
Other contams found description:	Not reported
PAHs found:	Y
PAHs cleaned up:	Y
PCBs found:	Not reported
PCBs cleaned up:	Not reported
Petro products found:	Y
Petro products cleaned:	Y
Sediments found:	Not reported
Sediments cleaned:	Not reported
Soil affected:	Y
Soil cleaned up:	Y
Surface water cleaned:	Not reported
Unknown found:	Not reported
VOCs found:	Y
VOCs cleaned:	Not reported
Cleanup other description:	Not reported
Num. of cleanup and re-dev. jobs:	Not reported
Past use greenspace acreage:	Not reported
Past use residential acreage:	Not reported
Past use commercial acreage:	5.4
Past use industrial acreage:	Not reported
Future use greenspace acreage:	Not reported
Future use residential acreage:	Not reported
Future use commercial acreage:	Not reported
Future use industrial acreage:	Not reported
Greenspace acreage and type:	Not reported
Superfund Fed. landowner flag:	N

Recipient name:	Raleigh, City of
Grant type:	Assessment
Property name:	CONVENTION CENTER PARKING LOTS
Property #:	1703-55-5354,1703-66-5359,1703-66-5258,1703-66-8320,1703-76-0380,1703-66-9720
Parcel size:	5.4
Property Description:	Five contiguous parcels, including former gasoline service stations, automotive repair facilities, and dry cleaning operations. A sixth parcel, the former Raleigh Convention Center, was removed from the Brownfield Assessment program due to construction schedule needs. The sites are currently paved parking lots owned by the City of Raleigh and leased to a private operator.
Latitude:	35.77533
Longitude:	-78.63942
HCM label:	Address Matching-House Number
Map scale:	1:24,000
Point of reference:	Center of a Facility or Station
Datum:	World Geodetic System of 1984
ACRES property ID:	21863
Start date:	Not reported
Completed date:	Not reported
Acres cleaned up:	Not reported
Cleanup funding:	Not reported
Cleanup funding source:	Not reported
Assessment funding:	20131
Assessment funding source:	US EPA - Brownfields Assessment Cooperative Agreement
Redevelopment funding:	Not reported
Redev. funding source:	Not reported
Redev. funding entity name:	Not reported

CONVENTION CENTER PARKING LOTS (Continued) **1010376326**

Redevelopment start date:	Not reported
Assessment funding entity:	Not reported
Cleanup funding entity:	Not reported
Grant type:	B
Accomplishment type:	Supplemental Assessment
Accomplishment count:	0
Cooperative agreement #:	96416704
Ownership entity:	Government
Current owner:	City of Raleigh
Did owner change:	N
Cleanup required:	Yes
Video available:	No
Photo available:	Yes
Institutional controls required:	Y
IC Category proprietary controls:	Not reported
IC cat. info. devices:	Y
IC cat. gov. controls:	Not reported
IC cat. enforcement permit tools:	Not reported
IC in place date:	4-Jan-10
IC in place:	Yes
State/tribal program date:	Not reported
State/tribal program ID:	Not reported
State/tribal NFA date:	3-Nov-09
Air contaminated:	Not reported
Air cleaned:	Not reported
Asbestos found:	Not reported
Asbestos cleaned:	Not reported
Controled substance found:	Not reported
Controled substance cleaned:	Not reported
Drinking water affected:	Not reported
Drinking water cleaned:	Not reported
Groundwater affected:	Y
Groundwater cleaned:	Y
Lead contaminant found:	Y
Lead cleaned up:	Y
No media affected:	Not reported
Unknown media affected:	Not reported
Other cleaned up:	Not reported
Other metals found:	Y
Other metals cleaned:	Y
Other contaminants found:	Not reported
Other contams found description:	Not reported
PAHs found:	Y
PAHs cleaned up:	Y
PCBs found:	Not reported
PCBs cleaned up:	Not reported
Petro products found:	Y
Petro products cleaned:	Y
Sediments found:	Not reported
Sediments cleaned:	Not reported
Soil affected:	Y
Soil cleaned up:	Y
Surface water cleaned:	Not reported
Unknown found:	Not reported
VOCs found:	Y
VOCs cleaned:	Not reported
Cleanup other description:	Not reported

CONVENTION CENTER PARKING LOTS (Continued) **1010376326**

Num. of cleanup and re-dev. jobs:	Not reported
Past use greenspace acreage:	Not reported
Past use residential acreage:	Not reported
Past use commercial acreage:	5.4
Past use industrial acreage:	Not reported
Future use greenspace acreage:	Not reported
Future use residential acreage:	Not reported
Future use commercial acreage:	Not reported
Future use industrial acreage:	Not reported
Greenspace acreage and type:	Not reported
Superfund Fed. landowner flag:	N
Recipient name:	Raleigh, City of
Grant type:	Assessment
Property name:	CONVENTION CENTER PARKING LOTS
Property #:	1703-55-5354,1703-66-5359,1703-66-5258,1703-66-8320,1703-76-0380,1703-66-9720
Parcel size:	5.4
Property Description:	Five contiguous parcels, including former gasoline service stations, automotive repair facilities, and dry cleaning operations. A sixth parcel, the former Raleigh Convention Center, was removed from the Brownfield Assessment program due to construction schedule needs. The sites are currently paved parking lots owned by the City of Raleigh and leased to a private operator.
Latitude:	35.77533
Longitude:	-78.63942
HCM label:	Address Matching-House Number
Map scale:	1:24,000
Point of reference:	Center of a Facility or Station
Datum:	World Geodetic System of 1984
ACRES property ID:	21863
Start date:	Not reported
Completed date:	Not reported
Acres cleaned up:	Not reported
Cleanup funding:	Not reported
Cleanup funding source:	Not reported
Assessment funding:	7033
Assessment funding source:	US EPA - Brownfields Assessment Cooperative Agreement
Redevelopment funding:	Not reported
Redev. funding source:	Not reported
Redev. funding entity name:	Not reported
Redevelopment start date:	Not reported
Assessment funding entity:	Not reported
Cleanup funding entity:	Not reported
Grant type:	B
Accomplishment type:	Phase I Environmental Assessment
Accomplishment count:	1
Cooperative agreement #:	96416704
Ownership entity:	Government
Current owner:	City of Raleigh
Did owner change:	N
Cleanup required:	Yes
Video available:	No
Photo available:	Yes
Institutional controls required:	Y
IC Category proprietary controls:	Not reported
IC cat. info. devices:	Y
IC cat. gov. controls:	Not reported

CONVENTION CENTER PARKING LOTS (Continued) **1010376326**

IC cat. enforcement permit tools:	Not reported
IC in place date:	4-Jan-10
IC in place:	Yes
State/tribal program date:	Not reported
State/tribal program ID:	Not reported
State/tribal NFA date:	3-Nov-09
Air contaminated:	Not reported
Air cleaned:	Not reported
Asbestos found:	Not reported
Asbestos cleaned:	Not reported
Controled substance found:	Not reported
Controled substance cleaned:	Not reported
Drinking water affected:	Not reported
Drinking water cleaned:	Not reported
Groundwater affected:	Y
Groundwater cleaned:	Y
Lead contaminant found:	Y
Lead cleaned up:	Y
No media affected:	Not reported
Unknown media affected:	Not reported
Other cleaned up:	Not reported
Other metals found:	Y
Other metals cleaned:	Y
Other contaminants found:	Not reported
Other contams found description:	Not reported
PAHs found:	Y
PAHs cleaned up:	Y
PCBs found:	Not reported
PCBs cleaned up:	Not reported
Petro products found:	Y
Petro products cleaned:	Y
Sediments found:	Not reported
Sediments cleaned:	Not reported
Soil affected:	Y
Soil cleaned up:	Y
Surface water cleaned:	Not reported
Unknown found:	Not reported
VOCs found:	Y
VOCs cleaned:	Not reported
Cleanup other description:	Not reported
Num. of cleanup and re-dev. jobs:	Not reported
Past use greenspace acreage:	Not reported
Past use residential acreage:	Not reported
Past use commercial acreage:	5.4
Past use industrial acreage:	Not reported
Future use greenspace acreage:	Not reported
Future use residential acreage:	Not reported
Future use commercial acreage:	Not reported
Future use industrial acreage:	Not reported
Greenspace acreage and type:	Not reported
Superfund Fed. landowner flag:	N

Recipient name:	Raleigh, City of
Grant type:	BCRLF
Property name:	CONVENTION CENTER PARKING LOTS
Property #:	1703-55-5354,1703-66-5359,1703-66-5258,1703-66-8320,1703-76-0380,1703-66-9720
Parcel size:	5.4

CONVENTION CENTER PARKING LOTS (Continued) **1010376326**

Property Description:	Five contiguous parcels, including former gasoline service stations, automotive repair facilities, and dry cleaning operations. A sixth parcel, the former Raleigh Convention Center, was removed from the Brownfield Assessment program due to construction schedule needs. The sites are currently paved parking lots owned by the City of Raleigh and leased to a private operator.
Latitude:	35.77533
Longitude:	-78.63942
HCM label:	Address Matching-House Number
Map scale:	1:24,000
Point of reference:	Center of a Facility or Station
Datum:	World Geodetic System of 1984
ACRES property ID:	21863
Start date:	18-Sep-07
Completed date:	15-Jul-09
Acres cleaned up:	2.21
Cleanup funding:	186132
Cleanup funding source:	US EPA - Brownfields RLF Loan
Assessment funding:	Not reported
Assessment funding source:	Not reported
Redevelopment funding:	Not reported
Redev. funding source:	Not reported
Redev. funding entity name:	Not reported
Redevelopment start date:	Not reported
Assessment funding entity:	Not reported
Cleanup funding entity:	EPA
Grant type:	B
Accomplishment type:	Not reported
Accomplishment count:	0
Cooperative agreement #:	97432901
Ownership entity:	Government
Current owner:	City of Raleigh
Did owner change:	N
Cleanup required:	Yes
Video available:	No
Photo available:	Yes
Institutional controls required:	Y
IC Category proprietary controls:	Not reported
IC cat. info. devices:	Y
IC cat. gov. controls:	Not reported
IC cat. enforcement permit tools:	Not reported
IC in place date:	4-Jan-10
IC in place:	Yes
State/tribal program date:	Not reported
State/tribal program ID:	Not reported
State/tribal NFA date:	3-Nov-09
Air contaminated:	Not reported
Air cleaned:	Not reported
Asbestos found:	Not reported
Asbestos cleaned:	Not reported
Controled substance found:	Not reported
Controled substance cleaned:	Not reported
Drinking water affected:	Not reported
Drinking water cleaned:	Not reported
Groundwater affected:	Y
Groundwater cleaned:	Y
Lead contaminant found:	Y

CONVENTION CENTER PARKING LOTS (Continued) **1010376326**

Lead cleaned up:	Y
No media affected:	Not reported
Unknown media affected:	Not reported
Other cleaned up:	Not reported
Other metals found:	Y
Other metals cleaned:	Y
Other contaminants found:	Not reported
Other contams found description:	Not reported
PAHs found:	Y
PAHs cleaned up:	Y
PCBs found:	Not reported
PCBs cleaned up:	Not reported
Petro products found:	Y
Petro products cleaned:	Y
Sediments found:	Not reported
Sediments cleaned:	Not reported
Soil affected:	Y
Soil cleaned up:	Y
Surface water cleaned:	Not reported
Unknown found:	Not reported
VOCs found:	Y
VOCs cleaned:	Not reported
Cleanup other description:	Not reported
Num. of cleanup and re-dev. jobs:	Not reported
Past use greenspace acreage:	Not reported
Past use residential acreage:	Not reported
Past use commercial acreage:	5.4
Past use industrial acreage:	Not reported
Future use greenspace acreage:	Not reported
Future use residential acreage:	Not reported
Future use commercial acreage:	Not reported
Future use industrial acreage:	Not reported
Greenspace acreage and type:	Not reported
Superfund Fed. landowner flag:	N

FINDS:

Registry ID: 110038697425

Environmental Interest/Information System
US EPA Assessment, Cleanup and Redevelopment Exchange System (ACRES) is an federal online database for Brownfields Grantees to electronically submit data directly to EPA.

M47 **702-706 E. MARTIN STREET** **US BROWNFIELDS** **1010416392**
East **702-706 E. MARTIN STREET** **N/A**
1/4-1/2 **RALEIGH, NC 27601**
0.368 mi.
1942 ft. **Site 1 of 2 in cluster M**

Relative:
Higher

Actual:
312 ft.

US BROWNFIELDS:

Recipient name:	Raleigh, City of
Grant type:	Assessment
Property name:	702-706 E. MARTIN STREET
Property #:	1713-07-3791
Parcel size:	0.07

702-706 E. MARTIN STREET (Continued) **1010416392**

Property Description:	The Site was formerly operated as a dry cleaning facility (Holden s Cleaners) from at least 1970 through 1980. Operation as a dry cleaning facility may have extended into the 1980s, but as of 1990, dry cleaning operations had been discontinued. The site is also located down gradient from known or potentially contaminated historic sites including gasoline service stations, automotive repair facilities, and a printing facility. The City of Raleigh purchased the Site for future redevelopment in the area and in response to neighborhood complaints associated with the Site once it became idle.
Latitude:	35.7765
Longitude:	-78.6276
HCM label:	Not reported
Map scale:	Not reported
Point of reference:	Not reported
Datum:	World Geodetic System of 1984
ACRES property ID:	63821
Start date:	Not reported
Completed date:	Not reported
Acres cleaned up:	Not reported
Cleanup funding:	Not reported
Cleanup funding source:	Not reported
Assessment funding:	7341
Assessment funding source:	US EPA - Brownfields Assessment Cooperative Agreement
Redevelopment funding:	Not reported
Redev. funding source:	Not reported
Redev. funding entity name:	Not reported
Redevelopment start date:	Not reported
Assessment funding entity:	EPA
Cleanup funding entity:	Not reported
Grant type:	B
Accomplishment type:	Phase I Environmental Assessment
Accomplishment count:	1
Cooperative agreement #:	96416704
Ownership entity:	Government
Current owner:	City of Raleigh
Did owner change:	N
Cleanup required:	Unknown
Video available:	No
Photo available:	Yes
Institutional controls required:	U
IC Category proprietary controls:	Not reported
IC cat. info. devices:	Not reported
IC cat. gov. controls:	Not reported
IC cat. enforcement permit tools:	Not reported
IC in place date:	Not reported
IC in place:	Not reported
State/tribal program date:	Not reported
State/tribal program ID:	Not reported
State/tribal NFA date:	Not reported
Air contaminated:	Not reported
Air cleaned:	Not reported
Asbestos found:	Not reported
Asbestos cleaned:	Not reported
Controled substance found:	Not reported
Controled substance cleaned:	Not reported
Drinking water affected:	Not reported
Drinking water cleaned:	Not reported

702-706 E. MARTIN STREET (Continued) **1010416392**

Groundwater affected:	Not reported
Groundwater cleaned:	Not reported
Lead contaminant found:	Not reported
Lead cleaned up:	Not reported
No media affected:	Not reported
Unknown media affected:	Y
Other cleaned up:	Not reported
Other metals found:	Not reported
Other metals cleaned:	Not reported
Other contaminants found:	Not reported
Other contams found description:	Not reported
PAHs found:	Not reported
PAHs cleaned up:	Not reported
PCBs found:	Not reported
PCBs cleaned up:	Not reported
Petro products found:	Not reported
Petro products cleaned:	Not reported
Sediments found:	Not reported
Sediments cleaned:	Not reported
Soil affected:	Not reported
Soil cleaned up:	Not reported
Surface water cleaned:	Not reported
Unknown found:	Y
VOCs found:	Not reported
VOCs cleaned:	Not reported
Cleanup other description:	Not reported
Num. of cleanup and re-dev. jobs:	Not reported
Past use greenspace acreage:	Not reported
Past use residential acreage:	0.02
Past use commercial acreage:	0.05
Past use industrial acreage:	Not reported
Future use greenspace acreage:	Not reported
Future use residential acreage:	Not reported
Future use commercial acreage:	Not reported
Future use industrial acreage:	Not reported
Greenspace acreage and type:	Not reported
Superfund Fed. landowner flag:	Not reported

M48 **CITY OF RALEIGH PROPERTY** **NC SHWS** **S110176632**
East **702 E MARTIN ST** **NC DRYCLEANERS** **N/A**
1/4-1/2 **RALEIGH, NC**
0.368 mi.
1942 ft. **Site 2 of 2 in cluster M**

Relative:
Higher

Actual:
312 ft.

SHWS:

Facility ID:	NONCD0002215
Lat/Longitude:	35.77642 / -78.62789
Geolocation Method:	ON SCREEN PLACEMENT ON GEOREFERENCED MAP

DRYCLEANERS:

Facility ID:	092-0045
Status:	Assessment
Lat/Long:	35.776400000000 -78.62788999999
ID Number:	920045
Shopping Center:	Not reported
Certified Date:	06/03/2011
PM:	JK

CITY OF RALEIGH PROPERTY (Continued) **S110176632**

Project Manager: Jay King
Phone Number: (919)707-8367

Facility ID: 092-0045
Status: Not reported
Lat/Long: 35.776400000000 -78.62788999999
ID Number: 920045
Shopping Center: Not reported
Certified Date: Not reported
PM: Not reported
Project Manager: Not reported
Phone Number: Not reported

N49 West 1/4-1/2 0.374 mi. 1977 ft. **WAKE CO. OFFICE BLDG.** **NC IMD S105912009**
337 SOUTH SALISBURY ST. **NC LAST N/A**
RALEIGH, NC

Site 1 of 2 in cluster N

Relative: Higher

Actual: 330 ft.

IMD:
Region: RAL
Facility ID: 9391
Date Occurred: 8/6/1992
Submit Date: 11/9/1992
GW Contam: No Groundwater Contamination detected
Soil Contam: Yes
Incident Desc: Not reported
Operator: DAVENPORT, AGENT, DAMON
Contact Phone: 919-870-4028
Owner Company: WAKE CO.
Operator Address: P.O. BOX 550
Operator City: RALEIGH
Oper City,St,Zip: RALEIGH, NC 919-870-4028
Ownership: Unknown
Operation: Residential
Material: HYDRAULIC FLUID
Qty Lost 1: Not reported
Qty Recovered 1: Not reported
Source: Spill-surface
Type: Other petroleum product
Location: 8
Setting: Urban
Risk Site: Yes
Site Priority: Not reported
Priority Code: E
Priority Update: 5/30/1998
Dem Contact: JIM ROUSH
Wells Affected: No
Num Affected: 0
Wells Contam: Not reported
Sampled By: Not reported
Samples Include: Not reported
7.5 Min Quad: Not reported
5 Min Quad: K39Q
Latitude: Not reported
Longitude: Not reported
Latitude Number: Not reported
Longitude Number: Not reported

WAKE CO. OFFICE BLDG. (Continued) **S105912009**

Latitude Decimal:	Not reported
Longitude Decimal:	Not reported
GPS:	EST
Agency:	DWQ
Facility ID:	9391
Last Modified:	7/22/2003
Incident Phase:	Follow Up
NOV Issued:	Not reported
NORR Issued:	Not reported
45 Day Report:	Not reported
Public Meeting Held:	Not reported
Corrective Action Planned:	Not reported
SOC Sighned:	Not reported
Reclassification Report:	Not reported
RS Designation:	Not reported
Closure Request Date:	Not reported
Close-out Report:	Not reported

LAST:

Facility ID:	Not reported
UST Number:	RA-9391
Incident Number:	9391
Contamination Type:	NO
Source Type:	19
Product Type:	N
Date Reported:	08/06/1992
Date Occur:	08/06/1992
Cleanup:	Not reported
Closure Request:	Not reported
Close Out:	07/22/2003
Level Of Soil Cleanup Achieved:	Not reported
Tank Regulated Status:	Not reported
# Of Supply Wells:	0
Commercial/NonCommercial UST Site:	Not reported
Risk Classification:	L
Risk Class Based On Review:	L
Corrective Action Plan Type:	Not reported
NOV Issue Date:	Not reported
NORR Issue Date:	Not reported
Site Priority:	20
Phase Of LSA Req:	Not reported
Site Risk Reason:	Not reported
Land Use:	Not reported
MTBE:	No
MTBE1:	Unknown
Flag:	No
Flag1:	No
LUR Filed:	Not reported
Release Detection:	0
Current Status:	C
RBCA GW:	Not reported
PETOPT:	Not reported
RPL:	False
CD Num:	0
Reel Num:	0
RPOW:	False

WAKE CO. OFFICE BLDG. (Continued) **S105912009**

RPOP:	False	
Error Flag:	0	
Error Code:	Not reported	
Valid:	False	
Lat/Long:	35.77583 -78.64333	
Lat/Long Decimal:	35.77583 78.643332	
Testlat:	Not reported	
Regional Officer Project Mgr:		Not reported
Region:		RAL
Company:		WAKE CO.
Contact Person:		DAMON DAVENPORT, AGENT
Telephone:		Not reported
RP Address:		P.O. BOX 550
RP City,St,Zip:		RALEIGH, NC
RP County:		Not reported
Comments:	Not reported	
5 Min Quad:	Not reported	

PIRF:

Facility Id:	9391
Date Occurred:	Not reported
Date Reported:	Not reported
Description Of Incident:	Not reported
Owner/Operator:	Not reported
Ownership:	3
Operation Type:	3
Type:	Not reported
Location:	Not reported
Site Priority:	20E
Priority Update:	Not reported
Wells Affected Y/N:	N
Samples Include:	0
7#5 Minute Quad:	Not reported
5 Minute Quad:	Not reported
Pirf/Min Soil:	Not reported
Release Code:	Not reported
Source Code:	Not reported
Err Type:	Not reported
Cause:	Not reported
Source:	Not reported
Ust Number:	1
Last Modified:	7/22/2003
Incident Phase:	**CO**
NOV Issued:	Not reported
NORR Issued:	Not reported
45 Day Report:	Not reported
Public Meeting Held:	Not reported
Corrective Action Planned:	Not reported
SOC Signed:	Not reported
Reclassification Report:	Not reported
RS Designation:	Not reported
Closure Request Date:	Not reported
Close-out Report:	Not reported

N50 **NEW WAKE CO JAIL** **NC IMD** **S106799724**
West **330 S SALISBURY ST** **NC LUST** **N/A**
1/4-1/2 **RALEIGH, NC**
0.375 mi.
1980 ft. **Site 2 of 2 in cluster N**

Relative:
Higher

Actual:
330 ft.

IMD:

Region:	RAL
Facility ID:	6004
Date Occurred:	9/26/1990
Submit Date:	10/15/1990
GW Contam:	No Groundwater Contamination detected
Soil Contam:	Yes
Incident Desc:	CONTAM. SOIL WAS FOUND IN FRONT OF PARKING DECK BESIDE 1ST FEDERAL BANK. LAW ENGINEERING COLLECTED SAMPLES.
Operator:	Not reported
Contact Phone:	Not reported
Owner Company:	Not reported
Operator Address:	Not reported
Operator City:	Not reported
Oper City,St,Zip:	Not reported
Ownership:	Unknown
Operation:	Not reported
Material:	FUEL OIL
Qty Lost 1:	Not reported
Qty Recovered 1:	NONE
Source:	Leak-underground
Type:	Gasoline/diesel
Location:	8
Setting:	Urban
Risk Site:	L
Site Priority:	45D
Priority Code:	D
Priority Update:	Not reported
Dem Contact:	WDP
Wells Affected:	No
Num Affected:	0
Wells Contam:	Not reported
Sampled By:	Responsible Parties
Samples Include:	Soil Samples
7.5 Min Quad:	Not reported
5 Min Quad:	Not reported
Latitude:	35.77583333
Longitude:	-78.64055555
Latitude Number:	354633
Longitude Number:	783826
Latitude Decimal:	35.7758333333333
Longitude Decimal:	78.6405555555556
GPS:	NOD
Agency:	DWM
Facility ID:	6004
Last Modified:	Not reported
Incident Phase:	RE
NOV Issued:	Not reported
NORR Issued:	Not reported
45 Day Report:	Not reported
Public Meeting Held:	Not reported
Corrective Action Planned:	Not reported
SOC Sighned:	Not reported

NEW WAKE CO JAIL (Continued) **S106799724**

Reclassification Report: Not reported
RS Designation: Not reported
Closure Request Date: Not reported
Close-out Report: Not reported

LUST:
Facility ID: Not reported
UST Number: RA-896
Incident Number: 6004
Contamination Type: Soil
Source Type: Leak-underground
Product Type: PETROLEUM
Date Reported: 09/07/1990
Date Occur: 09/26/1990
Cleanup: Not reported
Closure Request: Not reported
Close Out: Not reported
Level Of Soil Cleanup Achieved: Not reported
Tank Regulated Status: Non Regulated
Of Supply Wells: 0
Commercial/NonCommercial UST Site: NON COMMERCIAL
Risk Classification: L
Risk Class Based On Review: H
Corrective Action Plan Type: Not reported
NOV Issue Date: Not reported
NORR Issue Date: Not reported
Site Priority: 45D
Phase Of LSA Req: Not reported
Site Risk Reason: Not reported
Land Use: Residential
MTBE: No
MTBE1: Unknown
Flag: No
Flag1: No
LUR Filed: Not reported
Release Detection: 0
Current Status: File Located in House
RBCA GW: Not reported
PETOPT: 4
RPL: False
CD Num: Not reported
Reel Num: Not reported
RPOW: False
RPOP: False
Error Flag: 0
Error Code: N
Valid: False
Lat/Long: 35 46 33.42 - 78 38 26.58
Lat/Long Decimal: 35.7759 -78.6407
Testlat: Not reported
Regional Officer Project Mgr: WDP
Region: Raleigh
Company: Not reported
Contact Person: Not reported
Telephone: Not reported
RP Address: Not reported

NEW WAKE CO JAIL (Continued) **S106799724**

RP City,St,Zip: Not reported
RP County: Not reported
Comments: 12/1/2002: Report of ..Contaminated soil excavation and soil testing results.On 9/26/90, during excavation and removal of old sidewalk on Salisbury street in front of parking garage, stained, petroleum (kerosene indicated) contaminanted soils were discove//// Cannot find file, 8/24/06 SMJ
5 Min Quad: K39q

PIRF:
Facility Id: 6004
Date Occurred: 9/7/1990
Date Reported: 10/15/1990
Description Of Incident: CONTAM. SOIL WAS FOUND IN FRONT OF PARKING DECK BESIDE 1ST FEDERAL BANK. LAW ENGINEERING COLLECTED SAMPLES.
Owner/Operator: UNKNOWN
Ownership: 3
Operation Type: Not reported
Type: 4
Location: 8
Site Priority: 45D
Priority Update: Not reported
Wells Affected Y/N: N
Samples Include: 0
7#5 Minute Quad: 3
5 Minute Quad: 2
Pirf/Min Soil: Not reported
Release Code: Not reported
Source Code: Pirf
Err Type: Not reported
Cause: Not reported
Source: Not reported
Ust Number: Not reported

Last Modified: Not reported
Incident Phase: **Response**
NOV Issued: Not reported
NORR Issued: Not reported
45 Day Report: Not reported
Public Meeting Held: Not reported
Corrective Action Planned: Not reported
SOC Signed: Not reported
Reclassification Report: Not reported
RS Designation: Not reported
Closure Request Date: Not reported
Close-out Report: Not reported

---

51 **RICHARDSON, JOHN - PROPERTY** **NC LAST** **S111161355**
South **412 E. SOUTH ST.** **N/A**
1/4-1/2 **RALEIGH, NC 27617**
0.376 mi.
1985 ft.

Relative:
Lower

Actual:
291 ft.

LAST:
Facility ID: N/A
UST Number: RA-92254
Incident Number: 92240
Contamination Type: SL

RICHARDSON, JOHN - PROPERTY (Continued) **S111161355**

Source Type:	11	
Product Type:	P	
Date Reported:	06/28/2011	
Date Occur:	06/28/2011	
Cleanup:	06/28/2011	
Closure Request:	Not reported	
Close Out:	Not reported	
Level Of Soil Cleanup Achieved:		Not reported
Tank Regulated Status:		R
# Of Supply Wells:	0	
Commercial/NonCommercial UST Site:		N
Risk Classification:		Not reported
Risk Class Based On Review:		U
Corrective Action Plan Type:		Not reported
NOV Issue Date:	Not reported	
NORR Issue Date:	Not reported	
Site Priority:	Not reported	
Phase Of LSA Req:	Not reported	
Site Risk Reason:	Not reported	
Land Use:	Not reported	
MTBE:	No	
MTBE1:	Unknown	
Flag:	No	
Flag1:	No	
LUR Filed:	Not reported	
Release Detection:	0	
Current Status:	C	
RBCA GW:	Not reported	
PETOPT:	5	
RPL:	False	
CD Num:	0	
Reel Num:	0	
RPOW:	False	
RPOP:	False	
Error Flag:	0	
Error Code:	N	
Valid:	False	
Lat/Long:	Not reported	
Lat/Long Decimal:	0 0	
Testlat:	Not reported	
Regional Officer Project Mgr:		JFM
Region:		RAL
Company:		Not reported
Contact Person:		John Richardson
Telephone:		Not reported
RP Address:		412 E. South St.
RP City,St,Zip:		Raleigh, NC 276012472
RP County:		Not reported
Comments:	Not reported	
5 Min Quad:	Not reported	

PIRF:

Facility Id:	92240
Date Occurred:	6/28/2011
Date Reported:	6/28/2011
Description Of Incident:	Wake County sent information about this dump
Owner/Operator:	Not reported
Ownership:	4

RICHARDSON, JOHN - PROPERTY (Continued) **S111161355**

Operation Type:	5
Type:	5
Location:	7
Site Priority:	Not reported
Priority Update:	Not reported
Wells Affected Y/N:	N
Samples Include:	Not reported
7#5 Minute Quad:	N
5 Minute Quad:	Not reported
Pirf/Min Soil:	Not reported
Release Code:	Not reported
Source Code:	Not reported
Err Type:	4
Cause:	Not reported
Source:	Not reported
Ust Number:	D
Last Modified:	Not reported
Incident Phase:	**Not reported**
NOV Issued:	Not reported
NORR Issued:	Not reported
45 Day Report:	Not reported
Public Meeting Held:	Not reported
Corrective Action Planned:	Not reported
SOC Signed:	Not reported
Reclassification Report:	Not reported
RS Designation:	Not reported
Closure Request Date:	Not reported
Close-out Report:	Not reported

O52 **NC MUSEUM OF NATURAL SCIENCE-G** **NC IMD** **S104914279**
WNW **123 N SALISBURY ST** **NC LUST** **N/A**
1/4-1/2 **RALEIGH, NC**
0.383 mi.
2020 ft. **Site 1 of 2 in cluster O**

Relative:
Higher

Actual:
348 ft.

IMD:

Region:	RAL
Facility ID:	22121
Date Occurred:	4/16/1996
Submit Date:	7/4/2000
GW Contam:	No Groundwater Contamination detected
Soil Contam:	Yes
Incident Desc:	(1) GAL OLD UST REMOVED 4/16/96. UNKNOWN PETRO AND WATER APPX 20 GAL REMOVED. (2) SAMP TAKEN UNDER UST T1=TPH DRO 711 MG/KG & 23.50 GAS MG/KG
Operator:	DAVID WOOD
Contact Phone:	9197337962
Owner Company:	NC STATE
Operator Address:	301 N WILMINGTON ST. SUITE 405
Operator City:	RALEIGH
Oper City,St,Zip:	RALEIGH, NC 27601-2827
Ownership:	State
Operation:	Public Service
Material:	UNKNOWM PETROLEUM
Qty Lost 1:	Not reported
Qty Recovered 1:	Not reported
Source:	Leak-underground

NC MUSEUM OF NATURAL SCIENCE-G (Continued) **S104914279**

Type: Gasoline/diesel
Location: Facility
Setting: Residential
Risk Site: L
Site Priority: L
Priority Code: L
Priority Update: 8/21/2000
Dem Contact: ZMB
Wells Affected: Not reported
Num Affected: Not reported
Wells Contam: Not reported
Sampled By: Responsible Parties
Samples Include: Soil Samples
7.5 Min Quad: SW/4RAL
5 Min Quad: Not reported
Latitude: 35.77916666
Longitude: -78.63277777
Latitude Number: 354645
Longitude Number: 783758
Latitude Decimal: 35.7791666666667
Longitude Decimal: 78.6327777777778
GPS: NOD
Agency: DWM
Facility ID: 22121
Last Modified: 10/31/2000
Incident Phase: Closed Out
NOV Issued: Not reported
NORR Issued: Not reported
45 Day Report: Not reported
Public Meeting Held: Not reported
Corrective Action Planned: Not reported
SOC Sighned: Not reported
Reclassification Report: Not reported
RS Designation: Not reported
Closure Request Date: Not reported
Close-out Report: 7/24/2000

LUST:
Facility ID: Not reported
UST Number: RA-3478
Incident Number: 22121
Contamination Type: Soil
Source Type: Leak-underground
Product Type: PETROLEUM
Date Reported: 05/09/1996
Date Occur: 04/16/1996
Cleanup: Not reported
Closure Request: 1996-05-09 00:00:00
Close Out: 07/24/2000
Level Of Soil Cleanup Achieved: Not reported
Tank Regulated Status: Regulated
Of Supply Wells: 0
Commercial/NonCommercial UST Site: COMMERCIAL
Risk Classification: L
Risk Class Based On Review: L
Corrective Action Plan Type: Not reported

NC MUSEUM OF NATURAL SCIENCE-G (Continued) **S104914279**

NOV Issue Date:	Not reported
NORR Issue Date:	Not reported
Site Priority:	Not reported
Phase Of LSA Req:	Not reported
Site Risk Reason:	Not reported
Land Use:	Not reported
MTBE:	No
MTBE1:	Unknown
Flag:	No
Flag1:	No
LUR Filed:	Not reported
Release Detection:	0
Current Status:	File Located in Archives
RBCA GW:	Not reported
PETOPT:	5
RPL:	False
CD Num:	137
Reel Num:	60
RPOW:	False
RPOP:	False
Error Flag:	0
Error Code:	N
Valid:	False
Lat/Long:	354645 -783758
Lat/Long Decimal:	0 0
Testlat:	Not reported
Regional Officer Project Mgr:	ZMB
Region:	Raleigh
Company:	NC STATE
Contact Person:	DAVID WOOD
Telephone:	9197337962
RP Address:	301 N WILMINGTON ST. SUITE 405
RP City,St,Zip:	RALEIGH, NC 27601-2827
RP County:	wake
Comments:	Not reported
5 Min Quad:	Not reported

PIRF:

Facility Id:	22121
Date Occurred:	4/16/1996
Date Reported:	7/4/2000
Description Of Incident:	(1) GAL OLD UST REMOVED 4/16/96. UNKNOWN PETRO AND WATER APPX 20 GAL REMOVED. (2) SAMP TAKEN UNDER UST T1=TPH DRO 711 MG/KG & 23.50 GAS MG/KG
Owner/Operator:	DAVID WOOD, OFFICE OF STATE CONSTR
Ownership:	7
Operation Type:	1
Type:	63
Location:	1
Site Priority:	L
Priority Update:	8/21/2000
Wells Affected Y/N:	Not reported
Samples Include:	Not reported
7#5 Minute Quad:	3
5 Minute Quad:	2
Pirf/Min Soil:	SW/4RAL
Release Code:	Not reported
Source Code:	MIN_SOIL

NC MUSEUM OF NATURAL SCIENCE-G (Continued) **S104914279**

Err Type:	Not reported
Cause:	Not reported
Source:	Not reported
Ust Number:	Not reported
Last Modified:	10/31/2000
Incident Phase:	**Closed Out**
NOV Issued:	Not reported
NORR Issued:	Not reported
45 Day Report:	Not reported
Public Meeting Held:	Not reported
Corrective Action Planned:	Not reported
SOC Signed:	Not reported
Reclassification Report:	Not reported
RS Designation:	Not reported
Closure Request Date:	Not reported
Close-out Report:	7/24/2000

P53 **RALEIGH PROFESSIONAL BUILDING** **NC LUST U003295340**
West **127 W HARGETT STREET** **NC UST N/A**
1/4-1/2 **RALEIGH, NC 27608**
0.393 mi.
2073 ft. **Site 1 of 2 in cluster P**

Relative:
Higher

Actual:
342 ft.

LUST:

Facility ID:	00-0-000
UST Number:	RA-2980
Incident Number:	20248
Contamination Type:	Soil
Source Type:	Leak-underground
Product Type:	PETROLEUM
Date Reported:	07/13/1998
Date Occur:	05/20/1998
Cleanup:	Not reported
Closure Request:	1999-01-04 00:00:00
Close Out:	10/20/2000
Level Of Soil Cleanup Achieved:	Not reported
Tank Regulated Status:	Regulated
# Of Supply Wells:	0
Commercial/NonCommercial UST Site:	NON COMMERCIAL
Risk Classification:	L
Risk Class Based On Review:	L
Corrective Action Plan Type:	Not reported
NOV Issue Date:	Not reported
NORR Issue Date:	Not reported
Site Priority:	Not reported
Phase Of LSA Req:	1
Site Risk Reason:	Not reported
Land Use:	Not reported
MTBE:	No
MTBE1:	Unknown
Flag:	No
Flag1:	No
LUR Filed:	Not reported
Release Detection:	0
Current Status:	File Located in Archives
RBCA GW:	Not reported
PETOPT:	4

RALEIGH PROFESSIONAL BUILDING (Continued) **U003295340**

RPL:	False
CD Num:	138
Reel Num:	65
RPOW:	False
RPOP:	False
Error Flag:	0
Error Code:	N
Valid:	False
Lat/Long:	354641 -783830
Lat/Long Decimal:	0 0
Testlat:	Not reported
Regional Officer Project Mgr:	WDP
Region:	Raleigh
Company:	RALEIGH PROFESSIONAL ASSOC.
Contact Person:	RALEIGH PROFESSIONAL ASSOC.
Telephone:	919-821-8023
RP Address:	1312 ANNAPOLIS DRIVE
RP City,St,Zip:	RALEIGH, NC 27608-
RP County:	Not reported
Comments:	LSA REC'D 9\\4\\98, MAJOR SOIL CONTAMINATION NO SOIL REMOVAL DUE TO ASPHALT CAP ONLY ENOUGH SOIL WAS
5 Min Quad:	Not reported

PIRF:

Facility Id:	20248
Date Occurred:	5/20/1998
Date Reported:	7/21/1999
Description Of Incident:	MAJOR SOIL CONTAM. WAS CONFIRMED UPON REMOVAL OF UST.
Owner/Operator:	Not reported
Ownership:	4
Operation Type:	6
Type:	3
Location:	8
Site Priority:	L
Priority Update:	7/21/1999
Wells Affected Y/N:	Not reported
Samples Include:	Not reported
7#5 Minute Quad:	3
5 Minute Quad:	1
Pirf/Min Soil:	Not reported
Release Code:	Not reported
Source Code:	PIRF
Err Type:	Not reported
Cause:	Not reported
Source:	Not reported
Ust Number:	Not reported
Last Modified:	5/3/2001
Incident Phase:	**Closed Out**
NOV Issued:	Not reported
NORR Issued:	Not reported
45 Day Report:	Not reported
Public Meeting Held:	Not reported
Corrective Action Planned:	Not reported
SOC Signed:	Not reported
Reclassification Report:	Not reported
RS Designation:	Not reported
Closure Request Date:	Not reported

RALEIGH PROFESSIONAL BUILDING (Continued) **U003295340**

Close-out Report: 10/20/2000

UST:

Facility Id:	00-0-0000035630
Contact:	RALEIGH PROFESSIONAL ASSOCIATES
Contact Address1:	C/O 1312 ANNAPOLIS DR S203
Contact Address2:	Not reported
Contact City/State/Zip:	RALEIGH, NC 27608
FIPS County Desc:	Wake
Latitude:	0
Longitude:	0
Tank Id:	1
Tank Status:	Removed
Installed Date:	01/01/1982
Perm Close Date:	05/20/1998
Product Key:	1
Product Name:	Diesel
Tank Capacity:	125
Root Tank Id:	Not reported
Main Tank:	No
Compartment Tank:	No
Manifold Tank:	Not reported
Commercial:	Yes
Regulated:	Yes
Tank Construction:	Unknown
Piping Construction:	Unknown
Piping System Key:	Unknown
Other CP Tank:	Not reported

P54 **RALEIGH PROFESSIONAL BLDG.** **NC IMD** **S103916891**
West **127 W HARGETT ST** **N/A**
1/4-1/2 **RALEIGH, NC**
0.393 mi.
2073 ft. **Site 2 of 2 in cluster P**

Relative: Higher

Actual: 342 ft.

IMD:

Region:	RAL
Facility ID:	20248
Date Occurred:	5/20/1998
Submit Date:	7/21/1999
GW Contam:	No Groundwater Contamination detected
Soil Contam:	Yes
Incident Desc:	MAJOR SOIL CONTAM. WAS CONFIRMED UPON REMOVAL OF UST.
Operator:	RALEIGH PROFESSIONAL ASSOC.
Contact Phone:	919-821-8023
Owner Company:	RALEIGH PROFESSIONAL ASSOC.
Operator Address:	1312 ANNAPOLIS DRIVE
Operator City:	RALEIGH
Oper City,St,Zip:	RALEIGH, NC 27608-
Ownership:	Private
Operation:	Commercial
Material:	DIESEL
Qty Lost 1:	Not reported
Qty Recovered 1:	Not reported
Source:	Leak-underground
Type:	Gasoline/diesel

RALEIGH PROFESSIONAL BLDG. (Continued) **S103916891**

Location:	8
Setting:	Urban
Risk Site:	L
Site Priority:	L
Priority Code:	L
Priority Update:	7/21/1999
Dem Contact:	WDP
Wells Affected:	Not reported
Num Affected:	Not reported
Wells Contam:	Not reported
Sampled By:	Responsible Parties
Samples Include:	Groundwater Samples
7.5 Min Quad:	Not reported
5 Min Quad:	Not reported
Latitude:	35.77805555
Longitude:	-78.64166666
Latitude Number:	354641
Longitude Number:	783830
Latitude Decimal:	35.7780555555556
Longitude Decimal:	78.6416666666667
GPS:	NOD
Agency:	DWM
Facility ID:	20248
Last Modified:	5/3/2001
Incident Phase:	Closed Out
NOV Issued:	Not reported
NORR Issued:	Not reported
45 Day Report:	Not reported
Public Meeting Held:	Not reported
Corrective Action Planned:	Not reported
SOC Sighned:	Not reported
Reclassification Report:	Not reported
RS Designation:	Not reported
Closure Request Date:	Not reported
Close-out Report:	10/20/2000

O55 **NC DEPARTMENT OF REVENUE** **NC IMD** **S101573718**
WNW **100 W MORGAN ST** **NC LUST** **N/A**
1/4-1/2 **RALEIGH, NC 27601**
0.394 mi.
2078 ft. **Site 2 of 2 in cluster O**

Relative:
Higher

Actual:
349 ft.

IMD:

Region:	RAL
Facility ID:	12602
Date Occurred:	7/13/1994
Submit Date:	8/24/1994
GW Contam:	No Groundwater Contamination detected
Soil Contam:	Yes
Incident Desc:	CP&L FOUND AN ORPHAN FUEL OIL TANK. MINOR SOIL CONTAM. CONFIRMED.
Operator:	MR. TONY JORDAN
Contact Phone:	Not reported
Owner Company:	DEPARTMENT OF ADMINISTRATION
Operator Address:	116 W JONES ST
Operator City:	RALEIGH
Oper City,St,Zip:	RALEIGH, NC 27603-
Ownership:	Municipal

NC DEPARTMENT OF REVENUE (Continued) **S101573718**

Operation: Public Service
Material: #2 FUEL OIL
Qty Lost 1: Not reported
Qty Recovered 1: Not reported
Source: Leak-underground
Type: Gasoline/diesel
Location: 8
Setting: Urban
Risk Site: L
Site Priority: 20E
Priority Code: L
Priority Update: 4/16/1998
Dem Contact: SMJ
Wells Affected: Not reported
Num Affected: 0
Wells Contam: Not reported
Sampled By: Not reported
Samples Include: Not reported
7.5 Min Quad: Not reported
5 Min Quad: Not reported
Latitude: 35.7796
Longitude: -78.6401
Latitude Number: Not reported
Longitude Number: Not reported
Latitude Decimal: Not reported
Longitude Decimal: Not reported
GPS: NOD
Agency: DWM
Facility ID: 12602
Last Modified: Not reported
Incident Phase: RE
NOV Issued: Not reported
NORR Issued: Not reported
45 Day Report: Not reported
Public Meeting Held: Not reported
Corrective Action Planned: Not reported
SOC Sighned: Not reported
Reclassification Report: Not reported
RS Designation: Not reported
Closure Request Date: Not reported
Close-out Report: Not reported

LUST:
Facility ID: Not reported
UST Number: RA-2062
Incident Number: 12602
Contamination Type: Soil
Source Type: Leak-underground
Product Type: PETROLEUM
Date Reported: 07/13/1994
Date Occur: 07/13/1994
Cleanup: Not reported
Closure Request: Not reported
Close Out: 10/11/2006
Level Of Soil Cleanup Achieved: Soil to Groundwater
Tank Regulated Status: Non Regulated

NC DEPARTMENT OF REVENUE (Continued) **S101573718**

# Of Supply Wells:	0
Commercial/NonCommercial UST Site:	NON COMMERCIAL
Risk Classification:	L
Risk Class Based On Review:	L
Corrective Action Plan Type:	Not reported
NOV Issue Date:	Not reported
NORR Issue Date:	Not reported
Site Priority:	20E
Phase Of LSA Req:	Not reported
Site Risk Reason:	Not reported
Land Use:	Residential
MTBE:	No
MTBE1:	No
Flag:	No
Flag1:	No
LUR Filed:	Not reported
Release Detection:	0
Current Status:	File Located in Archives
RBCA GW:	Cleanups to 2L.0202 standards
PETOPT:	4
RPL:	False
CD Num:	352
Reel Num:	321
RPOW:	False
RPOP:	False
Error Flag:	0
Error Code:	N
Valid:	False
Lat/Long:	35 46 37.98 - 78 38 37.92
Lat/Long Decimal:	35.7772 -78.6438
Testlat:	Not reported
Regional Officer Project Mgr:	SMJ
Region:	Raleigh
Company:	DEPARTMENT OF ADMINISTRATION
Contact Person:	secretary britt cobb
Telephone:	Not reported
RP Address:	116 W JONES ST
RP City,St,Zip:	RALEIGH, NC 27603-
RP County:	Not reported
Comments:	11/02 Require LSA to determine risk but is a STF lead site.KAH-a heating oil tank ws found during utilities work along road adjacent to bldg
5 Min Quad:	K39q

PIRF:

Facility Id:	12602
Date Occurred:	7/13/1994
Date Reported:	8/24/1994
Description Of Incident:	CP&L FOUND AN ORPHAN FUEL OIL TANK. MINOR SOIL CONTAM. CONFIRMED.
Owner/Operator:	Not reported
Ownership:	1
Operation Type:	1
Type:	4
Location:	8
Site Priority:	20E
Priority Update:	4/16/1998
Wells Affected Y/N:	Not reported
Samples Include:	0

NC DEPARTMENT OF REVENUE (Continued) **S101573718**

7#5 Minute Quad:	Not reported
5 Minute Quad:	Not reported
Pirf/Min Soil:	Not reported
Release Code:	Not reported
Source Code:	Min_Soil
Err Type:	Not reported
Cause:	Not reported
Source:	Not reported
Ust Number:	Not reported
Last Modified:	Not reported
Incident Phase:	**Closed Out**
NOV Issued:	Not reported
NORR Issued:	Not reported
45 Day Report:	Not reported
Public Meeting Held:	Not reported
Corrective Action Planned:	Not reported
SOC Signed:	Not reported
Reclassification Report:	Not reported
RS Designation:	Not reported
Closure Request Date:	Not reported
Close-out Report:	Not reported

Q56 **STATE FAIRGROUNDS (VAULT)** **NC IMD** **S101574227**
WNW **HILLSBOROUGH RD** **NC LUST** **N/A**
1/4-1/2 **RALEIGH, NC 27607** **NC LAST**
0.400 mi.
2111 ft. **Site 1 of 3 in cluster Q**

Relative:
Higher

Actual:
355 ft.

IMD:

Region:	RAL
Facility ID:	11269
Date Occurred:	11/24/1993
Submit Date:	8/5/1993
GW Contam:	No Groundwater Contamination detected
Soil Contam:	Yes
Incident Desc:	SOIL CONTAMINATION FOUND DURING CONSTRUCTION OF NEW BUILDINGS AT NC STATE FAIRGROUNDS NEXT TO DORTEN. GPS DATA GATHERED ON NE SIDE OF DORTEN ARENA NEAR FRAMED D
Operator:	UHN, DOVE K
Contact Phone:	Not reported
Owner Company:	WOOTEN CO
Operator Address:	Not reported
Operator City:	Not reported
Oper City,St,Zip:	NC
Ownership:	8
Operation:	Agricultural
Material:	PETRO
Qty Lost 1:	Not reported
Qty Recovered 1:	Not reported
Source:	Unknown
Type:	Gasoline/diesel
Location:	Facility
Setting:	Industrial
Risk Site:	Not reported
Site Priority:	Not reported
Priority Code:	NOD
Priority Update:	Not reported

STATE FAIRGROUNDS (VAULT) (Continued) **S101574227**

Dem Contact: JIM ROUSH
Wells Affected: No
Num Affected: 0
Wells Contam: Not reported
Sampled By: Not reported
Samples Include: Not reported
7.5 Min Quad: Not reported
5 Min Quad: Not reported
Latitude: Not reported
Longitude: Not reported
Latitude Number: Not reported
Longitude Number: Not reported
Latitude Decimal: Not reported
Longitude Decimal: Not reported
GPS: EST
Agency: DWQ
Facility ID: 11269
Last Modified: 6/13/2003
Incident Phase: NOD
NOV Issued: Not reported
NORR Issued: Not reported
45 Day Report: Not reported
Public Meeting Held: Not reported
Corrective Action Planned: Not reported
SOC Sighned: Not reported
Reclassification Report: Not reported
RS Designation: Not reported
Closure Request Date: Not reported
Close-out Report: Not reported

LUST:
Facility ID: Not reported
UST Number: RA-1855
Incident Number: 11269
Contamination Type: Soil
Source Type: Unknown
Product Type: PETROLEUM
Date Reported: 08/05/1993
Date Occur: 06/30/1993
Cleanup: Not reported
Closure Request: Not reported
Close Out: 11/05/1993
Level Of Soil Cleanup Achieved: Not reported
Tank Regulated Status: Regulated
Of Supply Wells: 0
Commercial/NonCommercial UST Site: COMMERCIAL
Risk Classification: Not reported
Risk Class Based On Review: Not reported
Corrective Action Plan Type: Not reported
NOV Issue Date: Not reported
NORR Issue Date: Not reported
Site Priority: Not reported
Phase Of LSA Req: Not reported
Site Risk Reason: Not reported
Land Use: Not reported
MTBE: No

STATE FAIRGROUNDS (VAULT) (Continued) **S101574227**

MTBE1:	Unknown
Flag:	No
Flag1:	No
LUR Filed:	Not reported
Release Detection:	0
Current Status:	File Located in Archives
RBCA GW:	Not reported
PETOPT:	3
RPL:	False
CD Num:	26
Reel Num:	56
RPOW:	False
RPOP:	False
Error Flag:	0
Error Code:	N
Valid:	False
Lat/Long:	Not reported
Lat/Long Decimal:	0 0
Testlat:	Not reported
Regional Officer Project Mgr:	Not reported
Region:	Raleigh
Company:	WOOTEN CO
Contact Person:	DOVE KUHN
Telephone:	Not reported
RP Address:	120 N. BOYLAN AVENUE
RP City,St,Zip:	RALIEGH, NC 27603-
RP County:	Not reported
Comments:	Not reported
5 Min Quad:	Not reported

PIRF:

Facility Id:	11269
Date Occurred:	6/30/1993
Date Reported:	11/24/1993
Description Of Incident:	SOIL CONTAMINATION FOUND DURING CONSTRUCTION OF NEW BUILDINGS AT NC STATE FAIRGROUNDS NEXT TO DORTEN ARENA.
Owner/Operator:	DOVE K UHN
Ownership:	7
Operation Type:	0
Type:	3
Location:	1
Site Priority:	Not reported
Priority Update:	Not reported
Wells Affected Y/N:	Not reported
Samples Include:	0
7#5 Minute Quad:	Not reported
5 Minute Quad:	Not reported
Pirf/Min Soil:	Not reported
Release Code:	Not reported
Source Code:	Min_Soil
Err Type:	Not reported
Cause:	Not reported
Source:	Not reported
Ust Number:	Not reported
Last Modified:	12/22/1993
Incident Phase:	**Closed Out**
NOV Issued:	Not reported

STATE FAIRGROUNDS (VAULT) (Continued) **S101574227**

NORR Issued:	Not reported
45 Day Report:	Not reported
Public Meeting Held:	Not reported
Corrective Action Planned:	Not reported
SOC Signed:	Not reported
Reclassification Report:	Not reported
RS Designation:	Not reported
Closure Request Date:	Not reported
Close-out Report:	8/9/1993

LAST:

Facility ID:	Not reported
UST Number:	RA-11269
Incident Number:	11269
Contamination Type:	NO
Source Type:	1
Product Type:	N
Date Reported:	11/24/1993
Date Occur:	11/24/1993
Cleanup:	Not reported
Closure Request:	Not reported
Close Out:	Not reported
Level Of Soil Cleanup Achieved:	Not reported
Tank Regulated Status:	Not reported
# Of Supply Wells:	0
Commercial/NonCommercial UST Site:	Not reported
Risk Classification:	Not reported
Risk Class Based On Review:	U
Corrective Action Plan Type:	Not reported
NOV Issue Date:	Not reported
NORR Issue Date:	Not reported
Site Priority:	0
Phase Of LSA Req:	Not reported
Site Risk Reason:	Not reported
Land Use:	Not reported
MTBE:	No
MTBE1:	Unknown
Flag:	No
Flag1:	No
LUR Filed:	Not reported
Release Detection:	0
Current Status:	C
RBCA GW:	Not reported
PETOPT:	Not reported
RPL:	False
CD Num:	0
Reel Num:	0
RPOW:	False
RPOP:	False
Error Flag:	0
Error Code:	Not reported
Valid:	False
Lat/Long:	35.79398 -78.70959
Lat/Long Decimal:	35.79398 78.709598
Testlat:	Not reported
Regional Officer Project Mgr:	Not reported
Region:	RAL

STATE FAIRGROUNDS (VAULT) (Continued) **S101574227**

Company:	WOOTEN CO
Contact Person:	DOVE UHN
Telephone:	Not reported
RP Address:	Not reported
RP City,St,Zip:	NC
RP County:	Not reported
Comments:	SOIL CONTAMINATION FOUND DURING CONSTRUCTION OF NEW BUILDINGS AT NC STATE FAIRGROUNDS NEXT TO DORTEN. GPS DATA GATHERED ON NE SIDE OF DORTEN ARENA NEAR FRAMED DOME BUILDINGS 6/6/2003
5 Min Quad:	Not reported

PIRF:

Facility Id:	11269
Date Occurred:	Not reported
Date Reported:	Not reported
Description Of Incident:	Not reported
Owner/Operator:	Not reported
Ownership:	8
Operation Type:	2
Type:	Not reported
Location:	Not reported
Site Priority:	0NOD
Priority Update:	Not reported
Wells Affected Y/N:	N
Samples Include:	0
7#5 Minute Quad:	Not reported
5 Minute Quad:	Not reported
Pirf/Min Soil:	Not reported
Release Code:	Not reported
Source Code:	Not reported
Err Type:	Not reported
Cause:	Not reported
Source:	Not reported
Ust Number:	0
Last Modified:	6/13/2003
Incident Phase:	**NO**
NOV Issued:	Not reported
NORR Issued:	Not reported
45 Day Report:	Not reported
Public Meeting Held:	Not reported
Corrective Action Planned:	Not reported
SOC Signed:	Not reported
Reclassification Report:	Not reported
RS Designation:	Not reported
Closure Request Date:	Not reported
Close-out Report:	Not reported

Q57 **MEREDITH COLLEGE BREWER CENTER** **NC IMD** **S101572700**
WNW **HILLSBOROUGH ST** **NC LUST** **N/A**
1/4-1/2 **RALEIGH, NC 27607**
0.400 mi.
2111 ft. **Site 2 of 3 in cluster Q**

Relative:
Higher

Actual:
355 ft.

IMD:

Region:	RAL
Facility ID:	9176
Date Occurred:	9/17/1992

MEREDITH COLLEGE BREWER CENTER (Continued) **S101572700**

Submit Date: 9/29/1992
GW Contam: No Groundwater Contamination detected
Soil Contam: Yes
Incident Desc: FUEL OIL MISSING FROM TANK
Operator: CLARK SUTTLE
Contact Phone: 9198298516
Owner Company: MEREDITH COLLEGE
Operator Address: 3800 HILLSBOROUGH ST
Operator City: RALEIGH
Oper City,St,Zip: RALEIGH, NC 27607-5298
Ownership: Private
Operation: Educational/Religious
Material: FUEL OIL
Qty Lost 1: Not reported
Qty Recovered 1: Not reported
Source: Leak-underground
Type: Gasoline/diesel
Location: Residence
Setting: Residential
Risk Site: Not reported
Site Priority: 0E
Priority Code: E
Priority Update: Not reported
Dem Contact: WDP
Wells Affected: Not reported
Num Affected: 0
Wells Contam: Not reported
Sampled By: Not reported
Samples Include: Not reported
7.5 Min Quad: Not reported
5 Min Quad: Not reported
Latitude: 35.79833333
Longitude: -78.68777777
Latitude Number: 354754
Longitude Number: 784116
Latitude Decimal: 35.7983333333333
Longitude Decimal: 78.6877777777778
GPS: NOD
Agency: DWM
Facility ID: 9176
Last Modified: 3/15/1999
Incident Phase: Closed Out
NOV Issued: Not reported
NORR Issued: Not reported
45 Day Report: Not reported
Public Meeting Held: Not reported
Corrective Action Planned: Not reported
SOC Sighned: Not reported
Reclassification Report: Not reported
RS Designation: Not reported
Closure Request Date: Not reported
Close-out Report: 9/21/1992

LUST:
Facility ID: 00-0-000
UST Number: RA-1440

MEREDITH COLLEGE BREWER CENTER (Continued) **S101572700**

Incident Number:	9176	
Contamination Type:		Soil
Source Type:	Leak-underground	
Product Type:	PETROLEUM	
Date Reported:	09/17/1992	
Date Occur:	09/17/1992	
Cleanup:	Not reported	
Closure Request:	Not reported	
Close Out:	09/30/1992	
Level Of Soil Cleanup Achieved:		Not reported
Tank Regulated Status:		Non Regulated
# Of Supply Wells:	0	
Commercial/NonCommercial UST Site:		NON COMMERCIAL
Risk Classification:		Not reported
Risk Class Based On Review:		L
Corrective Action Plan Type:		Not reported
NOV Issue Date:	Not reported	
NORR Issue Date:	Not reported	
Site Priority:	0	
Phase Of LSA Req:	Not reported	
Site Risk Reason:	Not reported	
Land Use:	Not reported	
MTBE:	No	
MTBE1:	Unknown	
Flag:	No	
Flag1:	No	
LUR Filed:	Not reported	
Release Detection:	0	
Current Status:	File Located in Archives	
RBCA GW:	Not reported	
PETOPT:	4	
RPL:	False	
CD Num:	26	
Reel Num:	58	
RPOW:	False	
RPOP:	False	
Error Flag:	0	
Error Code:	N	
Valid:	False	
Lat/Long:	354754 -784116	
Lat/Long Decimal:	0 0	
Testlat:	Not reported	
Regional Officer Project Mgr:		WDP
Region:		Raleigh
Company:		MEREDITH COLLEGE
Contact Person:		CLARK SUTTLE
Telephone:		9198298516
RP Address:		3800 HILLSBOROUGH ST
RP City,St,Zip:		RALEIGH, NC 27607-5298
RP County:		Not reported
Comments:	Not reported	
5 Min Quad:	K40l	

PIRF:

Facility Id:	9176
Date Occurred:	9/17/1992
Date Reported:	9/29/1992
Description Of Incident:	FUEL OIL MISSING FROM TANK

MEREDITH COLLEGE BREWER CENTER (Continued) **S101572700**

Owner/Operator:	CLARK SUTTLE
Ownership:	4
Operation Type:	4
Type:	4
Location:	7
Site Priority:	0E
Priority Update:	Not reported
Wells Affected Y/N:	Not reported
Samples Include:	0
7#5 Minute Quad:	Not reported
5 Minute Quad:	Not reported
Pirf/Min Soil:	Not reported
Release Code:	Not reported
Source Code:	Min_Soil
Err Type:	Not reported
Cause:	Not reported
Source:	Not reported
Ust Number:	Not reported
Last Modified:	3/15/1999
Incident Phase:	**Closed Out**
NOV Issued:	Not reported
NORR Issued:	Not reported
45 Day Report:	Not reported
Public Meeting Held:	Not reported
Corrective Action Planned:	Not reported
SOC Signed:	Not reported
Reclassification Report:	Not reported
RS Designation:	Not reported
Closure Request Date:	Not reported
Close-out Report:	9/21/1992

Q58 **MITCHELL DISTRIBUTING COMPANY** **NC IMD** **S101572192**
WNW **HWY 54** **NC LUST** **N/A**
1/4-1/2 **RALEIGH, NC 27607**
0.400 mi.
2111 ft. **Site 3 of 3 in cluster Q**

Relative:
Higher

Actual:
355 ft.

IMD:

Region:	RAL
Facility ID:	8058
Date Occurred:	7/16/1991
Submit Date:	6/3/1992
GW Contam:	No Groundwater Contamination detected
Soil Contam:	Yes
Incident Desc:	CONTAMINATION FOUND DURING UST REMOVAL
Operator:	Not reported
Contact Phone:	7043767554
Owner Company:	MITCHELL DIST CO
Operator Address:	3535 N GRAHAM ST
Operator City:	CHARLOTTE
Oper City,St,Zip:	CHARLOTTE, NC 28210-
Ownership:	Private
Operation:	Commercial
Material:	MOTOR OIL
Qty Lost 1:	Not reported
Qty Recovered 1:	Not reported
Source:	Leak-underground

MITCHELL DISTRIBUTING COMPANY (Continued) **S101572192**

Type: Gasoline/diesel
Location: Facility
Setting: Urban
Risk Site: Not reported
Site Priority: Not reported
Priority Code: Not reported
Priority Update: Not reported
Dem Contact: WDP
Wells Affected: Not reported
Num Affected: 0
Wells Contam: Not reported
Sampled By: Not reported
Samples Include: Not reported
7.5 Min Quad: Not reported
5 Min Quad: Not reported
Latitude: Not reported
Longitude: Not reported
Latitude Number: Not reported
Longitude Number: Not reported
Latitude Decimal: Not reported
Longitude Decimal: Not reported
GPS: NOD
Agency: DWM
Facility ID: 8058
Last Modified: 3/15/1999
Incident Phase: Closed Out
NOV Issued: Not reported
NORR Issued: Not reported
45 Day Report: Not reported
Public Meeting Held: Not reported
Corrective Action Planned: Not reported
SOC Sighned: Not reported
Reclassification Report: Not reported
RS Designation: Not reported
Closure Request Date: Not reported
Close-out Report: 5/22/1992

LUST:
Facility ID: 00-0-000
UST Number: RA-1217
Incident Number: 8058
Contamination Type: Soil
Source Type: Leak-underground
Product Type: PETROLEUM
Date Reported: 02/24/1992
Date Occur: 07/16/1991
Cleanup: Not reported
Closure Request: Not reported
Close Out: 05/22/1992
Level Of Soil Cleanup Achieved: Not reported
Tank Regulated Status: Regulated
Of Supply Wells: 0
Commercial/NonCommercial UST Site: COMMERCIAL
Risk Classification: Not reported
Risk Class Based On Review: L
Corrective Action Plan Type: Not reported

MITCHELL DISTRIBUTING COMPANY (Continued) **S101572192**

NOV Issue Date:	Not reported
NORR Issue Date:	Not reported
Site Priority:	0
Phase Of LSA Req:	Not reported
Site Risk Reason:	Not reported
Land Use:	Not reported
MTBE:	No
MTBE1:	Unknown
Flag:	No
Flag1:	No
LUR Filed:	Not reported
Release Detection:	0
Current Status:	File Located in Archives
RBCA GW:	Not reported
PETOPT:	3
RPL:	False
CD Num:	27
Reel Num:	59
RPOW:	False
RPOP:	False
Error Flag:	0
Error Code:	N
Valid:	False
Lat/Long:	Not reported
Lat/Long Decimal:	0 0
Testlat:	Not reported
Regional Officer Project Mgr:	WDP
Region:	Raleigh
Company:	MITCHELL DIST CO
Contact Person:	Not reported
Telephone:	7043767554
RP Address:	3535 N GRAHAM ST
RP City,St,Zip:	CHARLOTTE, NC 28210-
RP County:	Not reported
Comments:	Not reported
5 Min Quad:	Not reported

PIRF:

Facility Id:	8058
Date Occurred:	7/16/1991
Date Reported:	6/3/1992
Description Of Incident:	CONTAMINATION FOUND DURING UST REMOVAL
Owner/Operator:	Not reported
Ownership:	4
Operation Type:	6
Type:	5
Location:	1
Site Priority:	Not reported
Priority Update:	Not reported
Wells Affected Y/N:	Not reported
Samples Include:	0
7#5 Minute Quad:	Not reported
5 Minute Quad:	Not reported
Pirf/Min Soil:	Not reported
Release Code:	Not reported
Source Code:	Min_Soil
Err Type:	Not reported
Cause:	Not reported

MITCHELL DISTRIBUTING COMPANY (Continued) **S101572192**

Source:	Not reported
Ust Number:	Not reported
Last Modified:	3/15/1999
Incident Phase:	**Closed Out**
NOV Issued:	Not reported
NORR Issued:	Not reported
45 Day Report:	Not reported
Public Meeting Held:	Not reported
Corrective Action Planned:	Not reported
SOC Signed:	Not reported
Reclassification Report:	Not reported
RS Designation:	Not reported
Closure Request Date:	Not reported
Close-out Report:	5/22/1992

R59 **SOUTHERN BELL(GLC 21311)** **NC IMD** **S101524302**
WNW **121 W MORGAN ST** **N/A**
1/4-1/2 **RALEIGH, NC**
0.409 mi.
2162 ft. **Site 1 of 3 in cluster R**

Relative:
Higher

Actual:
349 ft.

IMD:

Region:	RAL
Facility ID:	10996
Date Occurred:	8/16/1993
Submit Date:	10/6/1993
GW Contam:	Yes, Groundwater Contamination has been detected
Soil Contam:	No
Incident Desc:	UPON REMOVAL OF UST, CONTAMINATED SOIL WAS DISCOVERED.
Operator:	MS. PAGE FREY
Contact Phone:	2059770794
Owner Company:	BELL SOUTH TELECOMMUNICATIONS,
Operator Address:	3535 COLONNADE PKWAY,ROOM E7J
Operator City:	BIRMINGHAM
Oper City,St,Zip:	BIRMINGHAM, AL 35243-
Ownership:	Private
Operation:	Commercial
Material:	DIESEL
Qty Lost 1:	Not reported
Qty Recovered 1:	Not reported
Source:	Leak-underground
Type:	Gasoline/diesel
Location:	Facility
Setting:	Urban
Risk Site:	L
Site Priority:	20E
Priority Code:	L
Priority Update:	4/16/1998
Dem Contact:	SMJ
Wells Affected:	Not reported
Num Affected:	0
Wells Contam:	Not reported
Sampled By:	Responsible Parties
Samples Include:	Soil Samples
7.5 Min Quad:	Not reported
5 Min Quad:	K39Q
Latitude:	35.77888888

SOUTHERN BELL(GLC 21311) (Continued) **S101524302**

Longitude:	-78.64111111
Latitude Number:	354644
Longitude Number:	783828
Latitude Decimal:	35.7788888888889
Longitude Decimal:	78.6411111111111
GPS:	NOD
Agency:	DWM
Facility ID:	10996
Last Modified:	Not reported
Incident Phase:	RE
NOV Issued:	Not reported
NORR Issued:	Not reported
45 Day Report:	Not reported
Public Meeting Held:	Not reported
Corrective Action Planned:	Not reported
SOC Sighned:	Not reported
Reclassification Report:	Not reported
RS Designation:	Not reported
Closure Request Date:	Not reported
Close-out Report:	Not reported

R60 **BELL SOUTH RLGHNCMO 21311** **NC LUST** **U003143219**
WNW **121 W MORGAN ST** **NC UST** **N/A**
1/4-1/2 **RALEIGH, NC 27601** **NC Financial Assurance**
0.409 mi.
2162 ft. **Site 2 of 3 in cluster R**

Relative:
Higher

Actual:
349 ft.

LUST:

Facility ID:	00-0-000	
UST Number:	RA-1812	
Incident Number:	10996	
Contamination Type:		Groundwater/Both
Source Type:	Leak-underground	
Product Type:	PETROLEUM	
Date Reported:	09/08/1993	
Date Occur:	08/16/1993	
Cleanup:	Not reported	
Closure Request:	Not reported	
Close Out:	10/20/2006	
Level Of Soil Cleanup Achieved:		Residential
Tank Regulated Status:		Regulated
# Of Supply Wells:	0	
Commercial/NonCommercial UST Site:		COMMERCIAL
Risk Classification:		L
Risk Class Based On Review:		L
Corrective Action Plan Type:		Not reported
NOV Issue Date:	Not reported	
NORR Issue Date:	09/03/2002	
Site Priority:	20E	
Phase Of LSA Req:	Not reported	
Site Risk Reason:	Not reported	
Land Use:	Industrial/commercial	
MTBE:	No	
MTBE1:	No	
Flag:	No	
Flag1:	No	
LUR Filed:	10/31/2006	

BELL SOUTH RLGHNCMO 21311 (Continued) **U003143219**

Release Detection: 0
Current Status: File Located in Archives
RBCA GW: Cleanups to 2L.0202 standards
PETOPT: 3
RPL: False
CD Num: 352
Reel Num: 322
RPOW: False
RPOP: False
Error Flag: 0
Error Code: N
Valid: False
Lat/Long: 35 46 47.46 - 78 38 25.44
Lat/Long Decimal: 35.7798 -78.6404
Testlat: Not reported
Regional Officer Project Mgr: SMJ
Region: Raleigh
Company: BELL SOUTH TELECOMMUNICATIONS,
Contact Person: MS. PAGE FREY
Telephone: 2059770794
RP Address: 3535 COLONNADE PKWAY,ROOM E7J
RP City,St,Zip: BIRMINGHAM, AL 35243-
RP County: Not reported
Comments: 9/3/02 DB indicates that NORR for LSA was sent 6/27/00, but no copy in file. So KAH sent out 2nd NORR requiring LSA on 9/3/02 due to 2 diesel ust releases in 1993 and 1996 with soil contamination and gw contaminatio in response to a 8/7/02 letter from Da/////////////// 1/30/03 Review of LSA received 1/28/03 detremined low risk and residential landuse. GW bdl on 11/4/02. Action; send NORR est. low risk. KAH // NRP recorded by Wake County Reg of Deeds 10/31/06, Book 12241, Page 2792-2795, RKD.
5 Min Quad: K39q

PIRF:
Facility Id: 10996
Date Occurred: 8/16/1993
Date Reported: 10/6/1993
Description Of Incident: UPON REMOVAL OF UST, CONTAMINATED SOIL WAS DISCOVERED.
Owner/Operator: KAYE JONES
Ownership: 4
Operation Type: 6
Type: 3
Location: 1
Site Priority: 20E
Priority Update: 4/16/1998
Wells Affected Y/N: Not reported
Samples Include: 0
7#5 Minute Quad: 3
5 Minute Quad: 2
Pirf/Min Soil: Not reported
Release Code: K39Q
Source Code: Pirf
Err Type: Not reported
Cause: Not reported
Source: Not reported
Ust Number: Not reported

Last Modified: Not reported

BELL SOUTH RLGHNCMO 21311 (Continued) **U003143219**

Incident Phase:	**Closed Out**
NOV Issued:	Not reported
NORR Issued:	Not reported
45 Day Report:	Not reported
Public Meeting Held:	Not reported
Corrective Action Planned:	Not reported
SOC Signed:	Not reported
Reclassification Report:	Not reported
RS Designation:	Not reported
Closure Request Date:	Not reported
Close-out Report:	Not reported

UST:

Facility Id:	00-0-0000005672
Contact:	BELLSOUTH TELECOMMUNICATIONS INC
Contact Address1:	7825 RED TOP ROAD/SARA A BUFORD
Contact Address2:	Not reported
Contact City/State/Zip:	MACCLENNY, FL 32063
FIPS County Desc:	Wake
Latitude:	35.7796
Longitude:	-78.6405

Tank Id:	1
Tank Status:	Removed
Installed Date:	07/14/1968
Perm Close Date:	08/31/1993
Product Key:	1
Product Name:	Diesel
Tank Capacity:	10000
Root Tank Id:	Not reported
Main Tank:	No
Compartment Tank:	No
Manifold Tank:	Not reported
Commercial:	Yes
Regulated:	Yes
Tank Construction:	Single Wall Steel
Piping Construction:	Single Wall Steel
Piping System Key:	Unknown
Other CP Tank:	Not reported

Tank Id:	2
Tank Status:	Removed
Installed Date:	07/14/1970
Perm Close Date:	05/08/1996
Product Key:	1
Product Name:	Diesel
Tank Capacity:	30000
Root Tank Id:	Not reported
Main Tank:	No
Compartment Tank:	No
Manifold Tank:	Not reported
Commercial:	Yes
Regulated:	Yes
Tank Construction:	Single Wall Steel
Piping Construction:	Single Wall Steel
Piping System Key:	Unknown

BELL SOUTH RLGHNCMO 21311 (Continued) **U003143219**

Other CP Tank:	Not reported

Tank Id:	3
Tank Status:	Removed
Installed Date:	07/14/1970
Perm Close Date:	05/08/1996
Product Key:	1
Product Name:	Diesel
Tank Capacity:	30000
Root Tank Id:	Not reported
Main Tank:	No
Compartment Tank:	No
Manifold Tank:	Not reported
Commercial:	Yes
Regulated:	Yes
Tank Construction:	Single Wall Steel
Piping Construction:	Single Wall Steel
Piping System Key:	Unknown
Other CP Tank:	Not reported

Tank Id:	A1
Tank Status:	Current
Installed Date:	05/08/1996
Perm Close Date:	Not reported
Product Key:	1
Product Name:	Diesel
Tank Capacity:	20000
Root Tank Id:	Not reported
Main Tank:	No
Compartment Tank:	No
Manifold Tank:	0
Commercial:	Yes
Regulated:	Yes
Tank Construction:	Single Wall FRP
Piping Construction:	Single Wall FRP
Piping System Key:	Unknown
Other CP Tank:	Not reported

Tank Id:	A2
Tank Status:	Current
Installed Date:	05/08/1996
Perm Close Date:	Not reported
Product Key:	1
Product Name:	Diesel
Tank Capacity:	20000
Root Tank Id:	Not reported
Main Tank:	No
Compartment Tank:	No
Manifold Tank:	0
Commercial:	Yes
Regulated:	Yes
Tank Construction:	Single Wall FRP
Piping Construction:	Single Wall FRP
Piping System Key:	Unknown

BELL SOUTH RLGHNCMO 21311 (Continued) **U003143219**

Other CP Tank: Not reported

NC Financial Assurance 1:
Facility ID: 0-005672
Region: 1
Financial Responsibility Code: Not reported
Financial Responsibility Desc: SPECIALTY 9723041

R61
WNW
1/4-1/2
0.409 mi.
2162 ft.

BELLSOUTH - MORGAN ST. **NC LUST TRUST** **S105218664**
121 WEST MORGAN STREET **N/A**
RALEIGH, NC

Site 3 of 3 in cluster R

Relative:
Higher

Actual:
349 ft.

LUST TRUST:
Facility ID: 21311
Site ID: 10996
Site Note: Not reported
Site Eligible?: True
Commercial Find: 100% Commercial
Priority Rank: Not reported
Deductable Amount: 20000
3rd Party Deductable Amt: 0
Sum 3rd Party Amt Applied: 0

Click this hyperlink while viewing on your computer to access additional NC LUST TRUST: detail in the EDR Site Report.

S62
WSW
1/4-1/2
0.431 mi.
2275 ft.

NC D0A-CABARRUS ST. PARKING DE **NC IMD** **S105765254**
436 S SALISBURY ST **N/A**
RALEIGH, NC

Site 1 of 2 in cluster S

Relative:
Higher

Actual:
328 ft.

IMD:
Region: RAL
Facility ID: 21249
Date Occurred: 11/4/1999
Submit Date: 12/2/1999
GW Contam: No Groundwater Contamination detected
Soil Contam: Yes
Incident Desc: Not reported
Operator: AARON GALAGHER
Contact Phone: 919-890-3079
Owner Company: CITY OF RALEIGH
Operator Address: 222 W. HARGETT ST.,RM 307
Operator City: RALEIGH
Oper City,St,Zip: RALEIGH, NC 27602-
Ownership: Not reported
Operation: Not reported
Material: Not reported
Qty Lost 1: Not reported
Qty Recovered 1: Not reported
Source: Leak-underground
Type: Gasoline/diesel
Location: Not reported

NC D0A-CABARRUS ST. PARKING DE (Continued) **S105765254**

Setting:	Not reported
Risk Site:	L
Site Priority:	Not reported
Priority Code:	Not reported
Priority Update:	Not reported
Dem Contact:	JFM
Wells Affected:	Not reported
Num Affected:	Not reported
Wells Contam:	Not reported
Sampled By:	Not reported
Samples Include:	Not reported
7.5 Min Quad:	Not reported
5 Min Quad:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Latitude Number:	Not reported
Longitude Number:	Not reported
Latitude Decimal:	Not reported
Longitude Decimal:	Not reported
GPS:	NOD
Agency:	DWM
Facility ID:	21249
Last Modified:	7/6/2000
Incident Phase:	Closed Out
NOV Issued:	Not reported
NORR Issued:	Not reported
45 Day Report:	Not reported
Public Meeting Held:	Not reported
Corrective Action Planned:	Not reported
SOC Sighned:	Not reported
Reclassification Report:	Not reported
RS Designation:	Not reported
Closure Request Date:	Not reported
Close-out Report:	4/25/2000

S63 **CABARRUS ST PARKING DECK** **NC IMD** **U001823960**
WSW **436 S SALISBURY ST** **NC LUST** **N/A**
1/4-1/2 **RALEIGH, NC 27601** **NC LUST TRUST**
0.431 mi. **NC UST**
2275 ft. **Site 2 of 2 in cluster S**

Relative:
Higher

Actual:
328 ft.

IMD:

Region:	RAL
Facility ID:	11900
Date Occurred:	1/9/1992
Submit Date:	3/18/1994
GW Contam:	No Groundwater Contamination detected
Soil Contam:	Yes
Incident Desc:	UPON REMOVAL OF 3 USTS, MINOR SOIL CONTAMINATION WAS CONFIRMED.
Operator:	DUNN TRUST
Contact Phone:	Not reported
Owner Company:	Not reported
Operator Address:	2626 GLENWOOD AVE. SUITE 160
Operator City:	RALEIGH
Oper City,St,Zip:	RALEIGH, NC 27601-
Ownership:	Private
Operation:	Commercial

CABARRUS ST PARKING DECK (Continued) **U001823960**

Material: PETROLEUM
Qty Lost 1: Not reported
Qty Recovered 1: Not reported
Source: Leak-underground
Type: Gasoline/diesel
Location: Facility
Setting: Urban
Risk Site: Not reported
Site Priority: Not reported
Priority Code: Not reported
Priority Update: Not reported
Dem Contact: WDP
Wells Affected: Not reported
Num Affected: 0
Wells Contam: Not reported
Sampled By: Not reported
Samples Include: Not reported
7.5 Min Quad: Not reported
5 Min Quad: Not reported
Latitude: 35.775
Longitude: -78.64055555
Latitude Number: 354630
Longitude Number: 783826
Latitude Decimal: 35.775
Longitude Decimal: 78.6405555555556
GPS: NOD
Agency: DWM
Facility ID: 11900
Last Modified: 12/10/2001
Incident Phase: Closed Out
NOV Issued: Not reported
NORR Issued: Not reported
45 Day Report: Not reported
Public Meeting Held: Not reported
Corrective Action Planned: Not reported
SOC Sighned: Not reported
Reclassification Report: Not reported
RS Designation: Not reported
Closure Request Date: 4/4/2001
Close-out Report: 8/24/2001

LUST:
Facility ID: 00-0-000
UST Number: RA-1937
Incident Number: 11900
Contamination Type: Soil
Source Type: Leak-underground
Product Type: PETROLEUM
Date Reported: 03/12/1993
Date Occur: 01/09/1992
Cleanup: Not reported
Closure Request: Not reported
Close Out: 03/09/1994
Level Of Soil Cleanup Achieved: Not reported
Tank Regulated Status: Regulated
Of Supply Wells: 0

CABARRUS ST PARKING DECK (Continued) **U001823960**

Commercial/NonCommercial UST Site: COMMERCIAL
Risk Classification: Not reported
Risk Class Based On Review: L
Corrective Action Plan Type: Not reported
NOV Issue Date: Not reported
NORR Issue Date: Not reported
Site Priority: Not reported
Phase Of LSA Req: Not reported
Site Risk Reason: Not reported
Land Use: Not reported
MTBE: No
MTBE1: Unknown
Flag: No
Flag1: No
LUR Filed: Not reported
Release Detection: 0
Current Status: File Located in Archives
RBCA GW: Not reported
PETOPT: 5
RPL: False
CD Num: 27
Reel Num: 60
RPOW: False
RPOP: False
Error Flag: 0
Error Code: N
Valid: False
Lat/Long: 35 46 30 -78 38 26
Lat/Long Decimal: 0 0
Testlat: Not reported
Regional Officer Project Mgr: WDP
Region: Raleigh
Company: Not reported
Contact Person: DUNN TRUST
Telephone: Not reported
RP Address: 2626 GLENWOOD AVE. SUITE 160
RP City,St,Zip: RALEIGH, NC 27601-
RP County: Not reported
Comments: UPON REMOVAL OF 3 USTS, MINOR SOIL CONTAMINATION WAS CONFIRMED.
5 Min Quad: Not reported

PIRF:
Facility Id: 11900
Date Occurred: 1/9/1992
Date Reported: 3/18/1994
Description Of Incident: UPON REMOVAL OF 3 USTS, MINOR SOIL CONTAMINATION WAS CONFIRMED.
Owner/Operator: DUNN TRUST
Ownership: 4
Operation Type: 6
Type: 5
Location: 1
Site Priority: Not reported
Priority Update: Not reported
Wells Affected Y/N: Not reported
Samples Include: 0
7#5 Minute Quad: Not reported
5 Minute Quad: Not reported
Pirf/Min Soil: Not reported

CABARRUS ST PARKING DECK (Continued) **U001823960**

Release Code:	Not reported
Source Code:	Min_Soil
Err Type:	Not reported
Cause:	Not reported
Source:	Not reported
Ust Number:	Not reported
Last Modified:	12/10/2001
Incident Phase:	**Closed Out**
NOV Issued:	Not reported
NORR Issued:	Not reported
45 Day Report:	Not reported
Public Meeting Held:	Not reported
Corrective Action Planned:	Not reported
SOC Signed:	Not reported
Reclassification Report:	Not reported
RS Designation:	Not reported
Closure Request Date:	4/4/2001
Close-out Report:	8/24/2001

Facility ID:	00-0-000
UST Number:	RA-3247
Incident Number:	21249
Contamination Type:	Soil
Source Type:	Leak-underground
Product Type:	PETROLEUM
Date Reported:	12/02/1999
Date Occur:	11/04/1999
Cleanup:	11/04/1999
Closure Request:	2000-04-03 00:00:00
Close Out:	04/25/2000
Level Of Soil Cleanup Achieved:	Industrial/Commercial
Tank Regulated Status:	Regulated
# Of Supply Wells:	0
Commercial/NonCommercial UST Site:	NON COMMERCIAL
Risk Classification:	L
Risk Class Based On Review:	L
Corrective Action Plan Type:	Not reported
NOV Issue Date:	Not reported
NORR Issue Date:	01/10/2000
Site Priority:	Not reported
Phase Of LSA Req:	Not reported
Site Risk Reason:	Not reported
Land Use:	Not reported
MTBE:	No
MTBE1:	Unknown
Flag:	No
Flag1:	No
LUR Filed:	Not reported
Release Detection:	0
Current Status:	File Located in Archives
RBCA GW:	Not reported
PETOPT:	5
RPL:	False
CD Num:	137
Reel Num:	60
RPOW:	False

CABARRUS ST PARKING DECK (Continued) **U001823960**

RPOP:	False	
Error Flag:	0	
Error Code:	N	
Valid:	False	
Lat/Long:	Not reported	
Lat/Long Decimal:	0 0	
Testlat:	Not reported	
Regional Officer Project Mgr:		JFM
Region:		Raleigh
Company:		CITY OF RALEIGH
Contact Person:		AARON GALAGHER
Telephone:		919-890-3079
RP Address:		222 W. HARGETT ST.,RM 307
RP City,St,Zip:		RALEIGH, NC 27602-
RP County:		Not reported
Comments:	Not reported	
5 Min Quad:	Not reported	

PIRF:

Facility Id:	21249
Date Occurred:	Not reported
Date Reported:	Not reported
Description Of Incident:	Not reported
Owner/Operator:	Not reported
Ownership:	Not reported
Operation Type:	Not reported
Type:	Not reported
Location:	Not reported
Site Priority:	Not reported
Priority Update:	Not reported
Wells Affected Y/N:	Not reported
Samples Include:	Not reported
7#5 Minute Quad:	Not reported
5 Minute Quad:	Not reported
Pirf/Min Soil:	Not reported
Release Code:	Not reported
Source Code:	Not reported
Err Type:	Not reported
Cause:	Not reported
Source:	Not reported
Ust Number:	Not reported
Last Modified:	7/6/2000
Incident Phase:	**Closed Out**
NOV Issued:	Not reported
NORR Issued:	Not reported
45 Day Report:	Not reported
Public Meeting Held:	Not reported
Corrective Action Planned:	Not reported
SOC Signed:	Not reported
Reclassification Report:	Not reported
RS Designation:	Not reported
Closure Request Date:	Not reported
Close-out Report:	4/25/2000

LUST TRUST:

Facility ID:	Not reported

CABARRUS ST PARKING DECK (Continued) **U001823960**

Site ID: 11900
Site Note: Not reported
Site Eligible?: True
Commercial Find: 100% Commercial
Priority Rank: Not reported
Deductable Amount: 20000
3rd Party Deductable Amt: 0
Sum 3rd Party Amt Applied: 0

Click this hyperlink while viewing on your computer to access additional NC LUST TRUST: detail in the EDR Site Report.

UST:
Facility Id: 00-0-0000033450
Contact: CITY OF RALEIGH
Contact Address1: PO BOX 590/ATTN:M.MOLNAR
Contact Address2: Not reported
Contact City/State/Zip: RALEIGH, NC 27602-0590
FIPS County Desc: Wake
Latitude: 35.7752
Longitude: -78.6404

Tank Id: 1
Tank Status: Removed
Installed Date: 10/29/1992
Perm Close Date: 11/04/1999
Product Key: 12
Product Name: Motor Oil
Tank Capacity: 270
Root Tank Id: Not reported
Main Tank: No
Compartment Tank: No
Manifold Tank: Not reported
Commercial: Yes
Regulated: Yes
Tank Construction: Single Wall Steel
Piping Construction: Unknown
Piping System Key: Unknown
Other CP Tank: Not reported

Tank Id: 2
Tank Status: Removed
Installed Date: 10/29/1992
Perm Close Date: 11/04/1999
Product Key: 12
Product Name: Motor Oil
Tank Capacity: 550
Root Tank Id: Not reported
Main Tank: No
Compartment Tank: No
Manifold Tank: Not reported
Commercial: Yes
Regulated: Yes
Tank Construction: Single Wall Steel
Piping Construction: Unknown
Piping System Key: Unknown

CABARRUS ST PARKING DECK (Continued) **U001823960**

Other CP Tank: Not reported

T64 **RALEIGH CONVENTION & CONF. CEN** **NC IMD** **S104483173**
SW **500 FAYETTEVILLE STREET MALL** **N/A**
1/4-1/2 **RALEIGH, NC**
0.431 mi.
2277 ft. **Site 1 of 2 in cluster T**

Relative:
Higher

Actual:
332 ft.

IMD:

Region:	RAL
Facility ID:	21258
Date Occurred:	12/17/1999
Submit Date:	1/24/2000
GW Contam:	No Groundwater Contamination detected
Soil Contam:	Yes
Incident Desc:	ONE 20000 GALLON UST HEATING OIL CLOSED IN SITE SOIL CONTAM DETECTED IN SAMPLES COLLECTED AT CLOSURE 35 MG/KG TPH EPA 3550 IN SAMPLE B-4/3 BLS
Operator:	MICKY BARBOUR
Contact Phone:	919-831-6325
Owner Company:	RALEIGH CON. & CONV. CENTER
Operator Address:	500 FAYETTEVILLE STREET
Operator City:	RALEIGH
Oper City,St,Zip:	RALEIGH, NC 27602-
Ownership:	Municipal
Operation:	Public Service
Material:	FUEL OIL
Qty Lost 1:	Not reported
Qty Recovered 1:	Not reported
Source:	Leak-underground
Type:	Gasoline/diesel
Location:	Facility
Setting:	Urban
Risk Site:	L
Site Priority:	Not reported
Priority Code:	Not reported
Priority Update:	1/24/2000
Dem Contact:	JFM
Wells Affected:	Not reported
Num Affected:	Not reported
Wells Contam:	Not reported
Sampled By:	Not reported
Samples Include:	Not reported
7.5 Min Quad:	Not reported
5 Min Quad:	Not reported
Latitude:	35.77222222
Longitude:	-78.64
Latitude Number:	354620
Longitude Number:	783824
Latitude Decimal:	35.7722222222222
Longitude Decimal:	78.64
GPS:	NOD
Agency:	DWM
Facility ID:	21258
Last Modified:	7/6/2000
Incident Phase:	Closed Out
NOV Issued:	Not reported
NORR Issued:	Not reported

RALEIGH CONVENTION & CONF. CEN (Continued) **S104483173**

45 Day Report:	Not reported
Public Meeting Held:	Not reported
Corrective Action Planned:	Not reported
SOC Sighned:	Not reported
Reclassification Report:	Not reported
RS Designation:	Not reported
Closure Request Date:	Not reported
Close-out Report:	5/17/2000

T65 **RALEIGH CIVIC CENTER** **NC LUST U001439637**
SW **500 FAYETTEVILLE ST MALL** **NC UST N/A**
1/4-1/2 **RALEIGH, NC 27601**
0.431 mi.
2277 ft. **Site 2 of 2 in cluster T**

Relative:
Higher

Actual:
332 ft.

LUST:

Facility ID:	00-0-000	
UST Number:	RA-3256	
Incident Number:	21258	
Contamination Type:		Soil
Source Type:	Leak-underground	
Product Type:	PETROLEUM	
Date Reported:	01/21/2000	
Date Occur:	12/17/1999	
Cleanup:	12/17/1999	
Closure Request:	2000-04-18 00:00:00	
Close Out:	05/17/2000	
Level Of Soil Cleanup Achieved:		Residential
Tank Regulated Status:		Non Regulated
# Of Supply Wells:	0	
Commercial/NonCommercial UST Site:		COMMERCIAL
Risk Classification:		L
Risk Class Based On Review:		L
Corrective Action Plan Type:		Not reported
NOV Issue Date:	Not reported	
NORR Issue Date:	Not reported	
Site Priority:	Not reported	
Phase Of LSA Req:	Not reported	
Site Risk Reason:	Not reported	
Land Use:	Not reported	
MTBE:	No	
MTBE1:	Unknown	
Flag:	No	
Flag1:	No	
LUR Filed:	Not reported	
Release Detection:	0	
Current Status:	File Located in Archives	
RBCA GW:	Not reported	
PETOPT:	3	
RPL:	False	
CD Num:	138	
Reel Num:	64	
RPOW:	False	
RPOP:	False	
Error Flag:	0	
Error Code:	N	
Valid:	False	

RALEIGH CIVIC CENTER (Continued) **U001439637**

Lat/Long: 35 27 43.2 - 78 22 56.64
Lat/Long Decimal: 35.4620 -78.3824
Testlat: Not reported
Regional Officer Project Mgr: JFM
Region: Raleigh
Company: RALEIGH CON. & CONV. CENTER
Contact Person: MICKY BARBOUR
Telephone: 919-831-6325
RP Address: 500 FAYETTEVILLE STREET
RP City,St,Zip: RALEIGH, NC 27602-
RP County: Not reported
Comments: Not reported
5 Min Quad: Not reported

PIRF:
Facility Id: 21258
Date Occurred: 12/17/1999
Date Reported: 1/24/2000
Description Of Incident: ONE 20000 GALLON UST HEATING OIL CLOSED IN SITE SOIL CONTAM DETECTED IN SAMPLES COLLECTED AT CLOSURE 35 MG/KG TPH EPA 3550 IN SAMPLE B-4/3 BLS
Owner/Operator: MR MICKEY BARBOUR
Ownership: 1
Operation Type: 1
Type: 4
Location: 1
Site Priority: Not reported
Priority Update: 1/24/2000
Wells Affected Y/N: N
Samples Include: Not reported
7#5 Minute Quad: Y
5 Minute Quad: Not reported
Pirf/Min Soil: Not reported
Release Code: Not reported
Source Code: MIN_SOIL
Err Type: 2
Cause: 3
Source: A
Ust Number: P

Last Modified: 7/6/2000
Incident Phase: **Closed Out**
NOV Issued: Not reported
NORR Issued: Not reported
45 Day Report: Not reported
Public Meeting Held: Not reported
Corrective Action Planned: Not reported
SOC Signed: Not reported
Reclassification Report: Not reported
RS Designation: Not reported
Closure Request Date: Not reported
Close-out Report: 5/17/2000

UST:
Facility Id: 00-0-0000032004
Contact: CITY OF RALEIGH
Contact Address1: PO BOX 590/ATTN:M.MOLNAR

RALEIGH CIVIC CENTER (Continued) **U001439637**

Contact Address2:	Not reported
Contact City/State/Zip:	RALEIGH, NC 27602-0590
FIPS County Desc:	Wake
Latitude:	35.7748
Longitude:	-78.6393
Tank Id:	45
Tank Status:	Removed
Installed Date:	01/04/1977
Perm Close Date:	03/06/2000
Product Key:	6
Product Name:	Heating Oil/Fuel
Tank Capacity:	20000
Root Tank Id:	Not reported
Main Tank:	No
Compartment Tank:	No
Manifold Tank:	Not reported
Commercial:	Yes
Regulated:	No
Tank Construction:	Single Wall Steel
Piping Construction:	Single Wall Steel
Piping System Key:	Unknown
Other CP Tank:	Not reported

---

66 **IVERSON PROPERTY (TERRY)** **NC LUST** **S110987099**
NNE **523 E. LANE STREET** **NC LUST TRUST** **N/A**
1/4-1/2 **RALEIGH, NC**
0.445 mi.
2347 ft.

Relative:
Lower

Actual:
303 ft.

LUST:

Facility ID:	Not reported	
UST Number:	RA-6846	
Incident Number:	33993	
Contamination Type:		Soil
Source Type:	Leak-underground	
Product Type:	PETROLEUM	
Date Reported:	03/21/2011	
Date Occur:	03/21/2011	
Cleanup:	Not reported	
Closure Request:	Not reported	
Close Out:	10/19/2011	
Level Of Soil Cleanup Achieved:		Residential
Tank Regulated Status:		Non Regulated
# Of Supply Wells:	0	
Commercial/NonCommercial UST Site:		NON COMMERCIAL
Risk Classification:		L
Risk Class Based On Review:		L
Corrective Action Plan Type:		Not reported
NOV Issue Date:	Not reported	
NORR Issue Date:	Not reported	
Site Priority:	Not reported	
Phase Of LSA Req:	Not reported	
Site Risk Reason:	Not reported	
Land Use:	Residential	
MTBE:	No	
MTBE1:	No	
Flag:	No	

IVERSON PROPERTY (TERRY) (Continued) **S110987099**

Flag1:	No
LUR Filed:	11/01/2011
Release Detection:	0
Current Status:	File Located in House
RBCA GW:	Cleanups to 2L.0202 standards
PETOPT:	4
RPL:	False
CD Num:	0
Reel Num:	0
RPOW:	False
RPOP:	False
Error Flag:	0
Error Code:	N
Valid:	False
Lat/Long:	35 47 2.1 - 78 37 51.12
Lat/Long Decimal:	35.7839 -78.6308
Testlat:	Not reported
Regional Officer Project Mgr:	smj
Region:	Raleigh
Company:	Not reported
Contact Person:	terry iverson
Telephone:	9192338626
RP Address:	523 e. lane street
RP City,St,Zip:	raleigh, NC 27601
RP County:	Not reported
Comments:	Not reported
5 Min Quad:	Not reported

PIRF:

Facility Id:	33993
Date Occurred:	3/21/2011
Date Reported:	3/21/2011
Description Of Incident:	Not reported
Owner/Operator:	Not reported
Ownership:	4
Operation Type:	3
Type:	4
Location:	7
Site Priority:	Not reported
Priority Update:	Not reported
Wells Affected Y/N:	N
Samples Include:	Not reported
7#5 Minute Quad:	Y
5 Minute Quad:	Not reported
Pirf/Min Soil:	Not reported
Release Code:	Not reported
Source Code:	Not reported
Err Type:	3
Cause:	3
Source:	A
Ust Number:	P
Last Modified:	10/19/2011
Incident Phase:	**Closed Out**
NOV Issued:	Not reported
NORR Issued:	Not reported
45 Day Report:	Not reported
Public Meeting Held:	Not reported

IVERSON PROPERTY (TERRY) (Continued) **S110987099**

Corrective Action Planned:	Not reported
SOC Signed:	Not reported
Reclassification Report:	Not reported
RS Designation:	Not reported
Closure Request Date:	Not reported
Close-out Report:	Not reported

LUST TRUST:

Facility ID:	Not reported
Site ID:	33993
Site Note:	Noncommercial; 100% eligible; $0 deductible. Track this as a site that would have been 5K + 10% as this is receiving 100% because of Session Law 2010-154. [CGS 12/12/11]
Site Eligible?:	True
Commercial Find:	100% Non-Commercial
Priority Rank:	Not reported
Deductable Amount:	0
3rd Party Deductable Amt:	0
Sum 3rd Party Amt Applied:	0

Click this hyperlink while viewing on your computer to access additional NC LUST TRUST: detail in the EDR Site Report.

67
SW
1/4-1/2
0.456 mi.
2408 ft.

CITY OF RALEIGH CONVENTION CEN **NC IMD** **S106896204**
528 S SALISBURY ST **NC LUST** **N/A**
RALEIGH, NC

Relative:
Higher

Actual:
326 ft.

IMD:

Region:	Not reported
Facility ID:	26809
Date Occurred:	2/1/2005
Submit Date:	3/28/2005
GW Contam:	No Groundwater Contamination detected
Soil Contam:	Yes
Incident Desc:	Two [02] 2K-gallon unknown UST, one[01] 560-gallon unknown UST///
Operator:	JEFFREY A. DEAL
Contact Phone:	9198075575
Owner Company:	CITY OF RALEIGH
Operator Address:	301 HILLSBOROUGH STREET
Operator City:	RALEIGH
Oper City,St,Zip:	RALEIGH, NC 27603-
Ownership:	Municipal
Operation:	Public Service
Material:	Not reported
Qty Lost 1:	Not reported
Qty Recovered 1:	Not reported
Source:	Leak-underground
Type:	Gasoline/diesel
Location:	8
Setting:	Not reported
Risk Site:	Not reported
Site Priority:	Not reported
Priority Code:	Not reported
Priority Update:	Not reported
Dem Contact:	JFM

CITY OF RALEIGH CONVENTION CEN (Continued) **S106896204**

Wells Affected: No
Num Affected: Not reported
Wells Contam: Not reported
Sampled By: Y
Samples Include: Not reported
7.5 Min Quad: Not reported
5 Min Quad: Not reported
Latitude: Not reported
Longitude: Not reported
Latitude Number: Not reported
Longitude Number: Not reported
Latitude Decimal: Not reported
Longitude Decimal: Not reported
GPS: 7
Agency: DWM
Facility ID: Not reported
Last Modified: Not reported
Incident Phase: Not reported
NOV Issued: Not reported
NORR Issued: Not reported
45 Day Report: Not reported
Public Meeting Held: Not reported
Corrective Action Planned: Not reported
SOC Sighned: Not reported
Reclassification Report: Not reported
RS Designation: Not reported
Closure Request Date: Not reported
Close-out Report: Not reported

LUST:
Facility ID: Not reported
UST Number: RA-5264
Incident Number: 26809
Contamination Type: Soil
Source Type: Leak-underground
Product Type: PETROLEUM
Date Reported: 02/01/2005
Date Occur: 02/01/2005
Cleanup: 02/01/2005
Closure Request: Not reported
Close Out: 09/16/2008
Level Of Soil Cleanup Achieved: Soil to Groundwater
Tank Regulated Status: Both at same site
Of Supply Wells: 0
Commercial/NonCommercial UST Site: BOTH
Risk Classification: L
Risk Class Based On Review: L
Corrective Action Plan Type: Not reported
NOV Issue Date: Not reported
NORR Issue Date: Not reported
Site Priority: Not reported
Phase Of LSA Req: 1
Site Risk Reason: Not reported
Land Use: Not reported
MTBE: No
MTBE1: Unknown

CITY OF RALEIGH CONVENTION CEN (Continued) **S106896204**

Flag:	No
Flag1:	No
LUR Filed:	Not reported
Release Detection:	0
Current Status:	File Located in House
RBCA GW:	Not reported
PETOPT:	3
RPL:	False
CD Num:	0
Reel Num:	0
RPOW:	False
RPOP:	False
Error Flag:	0
Error Code:	N
Valid:	False
Lat/Long:	35 46 26.04 - 78 38 25.5
Lat/Long Decimal:	35.7739 -78.6404
Testlat:	Not reported
Regional Officer Project Mgr:	JFM
Region:	Raleigh
Company:	CITY OF RALEIGH
Contact Person:	JEFFREY A. DEAL
Telephone:	9198075575
RP Address:	301 HILLSBOROUGH STREET
RP City,St,Zip:	RALEIGH, NC 27603-
RP County:	Not reported
Comments:	Not reported
5 Min Quad:	Not reported

PIRF:

Facility Id:	26809
Date Occurred:	2/1/2005
Date Reported:	3/28/2005
Description Of Incident:	Two [02] 2K-gallon unknown UST, one[01] 560-gallon unknown UST///
Owner/Operator:	Not reported
Ownership:	1
Operation Type:	1
Type:	3
Location:	8
Site Priority:	Not reported
Priority Update:	Not reported
Wells Affected Y/N:	N
Samples Include:	Not reported
7#5 Minute Quad:	Y
5 Minute Quad:	Not reported
Pirf/Min Soil:	Not reported
Release Code:	Not reported
Source Code:	Not reported
Err Type:	2
Cause:	Not reported
Source:	Not reported
Ust Number:	U
Last Modified:	9/16/2008
Incident Phase:	**Closed Out**
NOV Issued:	Not reported
NORR Issued:	Not reported
45 Day Report:	Not reported

CITY OF RALEIGH CONVENTION CEN (Continued) **S106896204**

Public Meeting Held:	Not reported
Corrective Action Planned:	Not reported
SOC Signed:	Not reported
Reclassification Report:	Not reported
RS Designation:	Not reported
Closure Request Date:	Not reported
Close-out Report:	Not reported

68
SW
1/4-1/2
0.458 mi.
2420 ft.

CIVIC CENTER LOTS - CITY OF RALEIGH **NC LUST** **S109034070**
10 WEST SOUTH STREET **N/A**
RALEIGH, NC 27603

Relative:
Higher

Actual:
316 ft.

LUST:

Facility ID:	Not reported	
UST Number:	RA-5933	
Incident Number:	33483	
Contamination Type:		Groundwater/Both
Source Type:	Leak-underground	
Product Type:	PETROLEUM	
Date Reported:	02/07/2008	
Date Occur:	02/07/2008	
Cleanup:	02/07/2008	
Closure Request:	Not reported	
Close Out:	11/03/2009	
Level Of Soil Cleanup Achieved:		Soil to Groundwater
Tank Regulated Status:		Non Regulated
# Of Supply Wells:	0	
Commercial/NonCommercial UST Site:		NON COMMERCIAL
Risk Classification:		L
Risk Class Based On Review:		L
Corrective Action Plan Type:		Not reported
NOV Issue Date:	Not reported	
NORR Issue Date:	Not reported	
Site Priority:	Not reported	
Phase Of LSA Req:	Not reported	
Site Risk Reason:	Free product	
Land Use:	Residential	
MTBE:	No	
MTBE1:	No	
Flag:	No	
Flag1:	No	
LUR Filed:	12/22/2009	
Release Detection:	0	
Current Status:	File Located in House	
RBCA GW:	Cleanups to alternate standards	
PETOPT:	4	
RPL:	False	
CD Num:	0	
Reel Num:	0	
RPOW:	False	
RPOP:	False	
Error Flag:	0	
Error Code:	N	
Valid:	False	
Lat/Long:	35 27 43.26 - 78 22 56.7	
Lat/Long Decimal:	35.4620 -78.3824	

CIVIC CENTER LOTS - CITY OF RALEIGH (Continued) **S109034070**

Testlat:	Not reported
Regional Officer Project Mgr:	JFM
Region:	Raleigh
Company:	city of raleigh planning dept.
Contact Person:	Leonard Moretz
Telephone:	9195162682
RP Address:	one exchange plaza, ste. 400
RP City,St,Zip:	raleigh, NC 27602
RP County:	Not reported
Comments:	John,I wanted to give you an update about this site and let you know that we installed both LSA MWs as of yesterday using hollow stem auger/air rotary methods. MW-9 installed in the former UST-1 location contained measurable free product, approximately 0.25 ft or 3 inches. MW-9 was screened from 40-55 ft. According to the confirmatory samples collected during UST removal, there were a few hits of EDB, 1,2-DCA, Benzene and PCE above Soil-to-Water MSCCs with no evidence of free product in the UST basin. The former UST-1 was noted to have numerous holes in the tank when removed. However, based on the soil concentrations observed during UST excavation and depth to groundwater (48.18 ft), Im wondering if this product is not associated with an older/other release downtown. Free product was not discovered in MW-10 installed in the UST-2/3 basin area. Depth to water in MW-10 was 50-51 ft. David Lubell Hart & Hickman, P.C.3334 Hillsborough StreetRaleigh, North Carolina 27615Phone: (919) 847-4241Fax: (919) 847-4261Cell: (919) 412-5249
5 Min Quad:	Not reported

PIRF:

Facility Id:	33483
Date Occurred:	2/7/2008
Date Reported:	2/7/2008
Description Of Incident:	Not reported
Owner/Operator:	Not reported
Ownership:	4
Operation Type:	5
Type:	4
Location:	1
Site Priority:	Not reported
Priority Update:	Not reported
Wells Affected Y/N:	N
Samples Include:	Not reported
7#5 Minute Quad:	Y
5 Minute Quad:	Not reported
Pirf/Min Soil:	Not reported
Release Code:	Not reported
Source Code:	Not reported
Err Type:	2
Cause:	3
Source:	A
Ust Number:	P
Last Modified:	11/3/2009
Incident Phase:	**Closed Out**
NOV Issued:	Not reported
NORR Issued:	Not reported
45 Day Report:	Not reported
Public Meeting Held:	Not reported
Corrective Action Planned:	Not reported

CIVIC CENTER LOTS - CITY OF RALEIGH (Continued) **S109034070**

SOC Signed: Not reported
Reclassification Report: Not reported
RS Designation: Not reported
Closure Request Date: Not reported
Close-out Report: Not reported

U69 **NEWS & OBSERVER PUBLISHING CO** **RCRA-SQG** **1000373189**
West **215 S MCDOWELL ST** **FINDS** **NCD107870370**
1/4-1/2 **RALEIGH, NC 27602** **NC IMD**
0.459 mi. **NC UST**
2424 ft. **Site 1 of 2 in cluster U**

Relative: Higher

Actual: 338 ft.

RCRA-SQG:
Date form received by agency: 07/31/2008
Facility name: NEWS & OBSERVER PUBLISHING CO
Facility address: 215 S MCDOWELL ST
RALEIGH, NC 27602
EPA ID: NCD107870370
Mailing address: S MCDOWELL ST
RALEIGH, NC 27602
Contact: JANET A DINELLI
Contact address: S MCDOWELL ST
RALEIGH, NC 27602
Contact country: US
Contact telephone: 919-829-4853
Contact email: JDINELLI@NANDO.COM FAX# 919-829-8990
EPA Region: 04
Land type: Private
Classification: Small Small Quantity Generator
Description: Handler: generates more than 100 and less than 1000 kg of hazardous waste during any calendar month and accumulates less than 6000 kg of hazardous waste at any time; or generates 100 kg or less of hazardous waste during any calendar month, and accumulates more than 1000 kg of hazardous waste at any time

Owner/Operator Summary:
Owner/operator name: FRANK DANIELS JR
Owner/operator address: 215 S MCDOWELL ST
RALEIGH, NC 27602
Owner/operator country: Not reported
Owner/operator telephone: Not reported
Legal status: Private
Owner/Operator Type: Owner
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Owner/operator name: JANET A. DINELLI
Owner/operator address: SO. MCDOWELL ST
RALEIGH, NC 27602
Owner/operator country: US
Owner/operator telephone: 919-829-4853
Legal status: Private
Owner/Operator Type: Operator
Owner/Op start date: 07/31/2008
Owner/Op end date: Not reported

NEWS & OBSERVER PUBLISHING CO (Continued) **1000373189**

Handler Activities Summary:
U.S. importer of hazardous waste: No
Mixed waste (haz. and radioactive): No
Recycler of hazardous waste: No
Transporter of hazardous waste: No
Treater, storer or disposer of HW: No
Underground injection activity: No
On-site burner exemption: No
Furnace exemption: No
Used oil fuel burner: No
Used oil processor: No
User oil refiner: No
Used oil fuel marketer to burner: No
Used oil Specification marketer: No
Used oil transfer facility: No
Used oil transporter: No

Historical Generators:
Date form received by agency: 12/09/1998
Facility name: NEWS & OBSERVER PUBLISHING CO
Classification: Small Quantity Generator

Hazardous Waste Summary:
Waste code: F003
Waste name: THE FOLLOWING SPENT NON-HALOGENATED SOLVENTS: XYLENE, ACETONE, ETHYL ACETATE, ETHYL BENZENE, ETHYL ETHER, METHYL ISOBUTYL KETONE, N-BUTYL ALCOHOL, CYCLOHEXANONE, AND METHANOL; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONLY THE ABOVE SPENT NON-HALOGENATED SOLVENTS; AND ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONE OR MORE OF THE ABOVE NON-HALOGENATED SOLVENTS, AND, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THOSE SOLVENTS LISTED IN F001, F002, F004, AND F005, AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

Violation Status: No violations found

Evaluation Action Summary:
Evaluation date: 02/03/1988
Evaluation: FOCUSED COMPLIANCE INSPECTION
Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: State

FINDS:

Registry ID: 110004021709

Environmental Interest/Information System
NC-FITS (North Carolina - Facility Identification Template For States) is North Carolina Department of Environment and Natural Resources' (NCDENR) Facility Identification Template for States that provides a common facility identifier in order to improve accessibility to comprehensive information about environmental regulated entities in the state of North Carolina.

NEWS & OBSERVER PUBLISHING CO (Continued) **1000373189**

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

IMD:

Region:	RAL
Facility ID:	14813
Date Occurred:	9/28/1994
Submit Date:	6/13/2003
GW Contam:	No Groundwater Contamination detected
Soil Contam:	Yes
Incident Desc:	SEP CLOSED SITE OUT. ADDNL DATA MAY BE ON CLOSURE TABLE. GPS DATA GATHERED ON FRONT LAWN OF N AND O BUILDING FACING MCDOWELL STREET 6/6/03.
Operator:	,
Contact Phone:	Not reported
Owner Company:	Not reported
Operator Address:	Not reported
Operator City:	Not reported
Oper City,St,Zip:	Not reported
Ownership:	Federal
Operation:	8
Material:	MINERAL SPIRITS
Qty Lost 1:	Not reported
Qty Recovered 1:	Not reported
Material:	#2 FUEL OIL
Qty Lost:	Not reported
Qty Recovered:	Not reported
Source:	Unknown
Type:	Other inorganics
Location:	Facility
Setting:	Urban
Risk Site:	Not reported
Site Priority:	0
Priority Code:	NOD
Priority Update:	Not reported
Dem Contact:	JIM ROUSH
Wells Affected:	No
Num Affected:	0
Wells Contam:	Not reported
Sampled By:	Not reported
Samples Include:	Not reported
7.5 Min Quad:	Not reported
5 Min Quad:	Not reported
Latitude:	35.777724
Longitude:	-78.641626
Latitude Number:	Not reported
Longitude Number:	Not reported
Latitude Decimal:	Not reported
Longitude Decimal:	Not reported
GPS:	GPS
Agency:	DWQ
Facility ID:	14813

NEWS & OBSERVER PUBLISHING CO (Continued) **1000373189**

Last Modified:	6/13/2003
Incident Phase:	Closed Out
NOV Issued:	Not reported
NORR Issued:	Not reported
45 Day Report:	Not reported
Public Meeting Held:	Not reported
Corrective Action Planned:	Not reported
SOC Sighned:	Not reported
Reclassification Report:	Not reported
RS Designation:	Not reported
Closure Request Date:	Not reported
Close-out Report:	Not reported

UST:

Facility Id:	00-0-0000005647
Contact:	NEWS & OBSERVER PUBLISHING CO.
Contact Address1:	215 SOUTH MCDOWELL STREET
Contact Address2:	Not reported
Contact City/State/Zip:	RALEIGH, NC 27602
FIPS County Desc:	Wake
Latitude:	0
Longitude:	0

Tank Id:	1
Tank Status:	Removed
Installed Date:	05/15/1958
Perm Close Date:	12/21/1989
Product Key:	1
Product Name:	Diesel
Tank Capacity:	5500
Root Tank Id:	Not reported
Main Tank:	No
Compartment Tank:	No
Manifold Tank:	Not reported
Commercial:	Yes
Regulated:	Yes
Tank Construction:	Single Wall Steel
Piping Construction:	Single Wall Steel
Piping System Key:	Unknown
Other CP Tank:	Not reported

Tank Id:	2
Tank Status:	Removed
Installed Date:	05/10/1978
Perm Close Date:	12/21/1989
Product Key:	1
Product Name:	Diesel
Tank Capacity:	4000
Root Tank Id:	Not reported
Main Tank:	No
Compartment Tank:	No
Manifold Tank:	Not reported
Commercial:	Yes
Regulated:	Yes
Tank Construction:	Single Wall Steel

NEWS & OBSERVER PUBLISHING CO (Continued) **1000373189**

Piping Construction: Single Wall Steel
Piping System Key: Unknown
Other CP Tank: Not reported

Tank Id: 3
Tank Status: Removed
Installed Date: 05/10/1978
Perm Close Date: 12/21/1989
Product Key: 1
Product Name: Diesel
Tank Capacity: 4000
Root Tank Id: Not reported
Main Tank: No
Compartment Tank: No
Manifold Tank: Not reported
Commercial: Yes
Regulated: Yes
Tank Construction: Single Wall Steel
Piping Construction: Single Wall Steel
Piping System Key: Unknown
Other CP Tank: Not reported

Tank Id: 4
Tank Status: Removed
Installed Date: 05/10/1978
Perm Close Date: 12/21/1989
Product Key: 1
Product Name: Diesel
Tank Capacity: 4000
Root Tank Id: Not reported
Main Tank: No
Compartment Tank: No
Manifold Tank: Not reported
Commercial: Yes
Regulated: Yes
Tank Construction: Single Wall Steel
Piping Construction: Single Wall Steel
Piping System Key: Unknown
Other CP Tank: Not reported

U70 **NEWS & OBSERVER PUBLISHING CO.** **NC LUST** **S101715103**
West **215 S MCDOWELL ST** **N/A**
1/4-1/2 **RALEIGH, NC 27601**
0.459 mi.
2424 ft. **Site 2 of 2 in cluster U**

Relative:
Higher

Actual:
338 ft.

LUST:
Facility ID: 00-0-000
UST Number: RA-2322
Incident Number: 14813
Contamination Type: Soil
Source Type: Leak-underground
Product Type: PETROLEUM
Date Reported: 09/28/1994
Date Occur: 08/12/1994
Cleanup: Not reported

NEWS & OBSERVER PUBLISHING CO. (Continued) **S101715103**

Closure Request:	Not reported	
Close Out:	11/03/1995	
Level Of Soil Cleanup Achieved:		Not reported
Tank Regulated Status:		Non Regulated
# Of Supply Wells:	0	
Commercial/NonCommercial UST Site:		NON COMMERCIAL
Risk Classification:		Not reported
Risk Class Based On Review:		Not reported
Corrective Action Plan Type:		Not reported
NOV Issue Date:	Not reported	
NORR Issue Date:	Not reported	
Site Priority:	Not reported	
Phase Of LSA Req:	Not reported	
Site Risk Reason:	Not reported	
Land Use:	Not reported	
MTBE:	No	
MTBE1:	Unknown	
Flag:	No	
Flag1:	No	
LUR Filed:	Not reported	
Release Detection:	0	
Current Status:	File Located in Archives	
RBCA GW:	Not reported	
PETOPT:	4	
RPL:	False	
CD Num:	26	
Reel Num:	57	
RPOW:	False	
RPOP:	False	
Error Flag:	0	
Error Code:	N	
Valid:	False	
Lat/Long:	Not reported	
Lat/Long Decimal:	0 0	
Testlat:	Not reported	
Regional Officer Project Mgr:		Not reported
Region:		Raleigh
Company:		NEWS & OBSERVER PUBLISHING CO.
Contact Person:		Not reported
Telephone:		Not reported
RP Address:		215 SOUTH MCDOWELL STREET
RP City,St,Zip:		RALEIGH, NC 27601-
RP County:		WAKE
Comments:	Not reported	
5 Min Quad:	Not reported	

PIRF:

Facility Id:	14813
Date Occurred:	8/12/1994
Date Reported:	11/8/1995
Description Of Incident:	MINOR SOIL CONTAMINATION CONFIRMED FROM RELEASE DISCOVERED DURING TANK CLOSURE.
Owner/Operator:	Not reported
Ownership:	4
Operation Type:	6
Type:	3
Location:	1
Site Priority:	0

NEWS & OBSERVER PUBLISHING CO. (Continued) **S101715103**

Priority Update:	Not reported
Wells Affected Y/N:	Not reported
Samples Include:	0
7#5 Minute Quad:	Not reported
5 Minute Quad:	Not reported
Pirf/Min Soil:	Not reported
Release Code:	Not reported
Source Code:	Min_Soil
Err Type:	Not reported
Cause:	Not reported
Source:	Not reported
Ust Number:	Not reported
Last Modified:	1/5/1996
Incident Phase:	**Closed Out**
NOV Issued:	Not reported
NORR Issued:	Not reported
45 Day Report:	Not reported
Public Meeting Held:	Not reported
Corrective Action Planned:	Not reported
SOC Signed:	Not reported
Reclassification Report:	Not reported
RS Designation:	Not reported
Closure Request Date:	Not reported
Close-out Report:	11/8/1995

V71 **WAKE COUNTY EMS (FORMER)** **NC IMD** **S101522620**
West **201 W MARTIN ST** **NC LUST** **N/A**
1/4-1/2 **RALEIGH, NC** **NC LUST TRUST**
0.464 mi.
2450 ft. **Site 1 of 2 in cluster V**

Relative:
Higher

Actual:
329 ft.

IMD:

Region:	RAL
Facility ID:	5373
Date Occurred:	2/5/1990
Submit Date:	2/6/1990
GW Contam:	Yes, Groundwater Contamination has been detected
Soil Contam:	No
Incident Desc:	CONTAM. SOIL DISCOVERED AFTER TANK REMOVAL.
Operator:	MR. JOHN TAYLOR
Contact Phone:	919-856-5777
Owner Company:	WAKE COUNTY GENERAL SERVICES
Operator Address:	PO BOX 550
Operator City:	RALEIGH
Oper City,St,Zip:	RALEIGH, NC 27602-
Ownership:	County
Operation:	Commercial
Material:	GASOLINE
Qty Lost 1:	Not reported
Qty Recovered 1:	NONE
Source:	Leak-underground
Type:	Gasoline/diesel
Location:	Facility
Setting:	Urban
Risk Site:	L
Site Priority:	45E
Priority Code:	L

WAKE COUNTY EMS (FORMER) (Continued) **S101522620**

Priority Update: 4/16/1998
Dem Contact: WDP
Wells Affected: No
Num Affected: 0
Wells Contam: Not reported
Sampled By: Responsible Parties
Samples Include: Soil Samples
7.5 Min Quad: Not reported
5 Min Quad: Not reported
Latitude: 35.77666666
Longitude: -78.64166666
Latitude Number: 354636
Longitude Number: 783830
Latitude Decimal: 35.7766666666667
Longitude Decimal: 78.6416666666667
GPS: NOD
Agency: DWM
Facility ID: 5373
Last Modified: Not reported
Incident Phase: RE
NOV Issued: Not reported
NORR Issued: Not reported
45 Day Report: Not reported
Public Meeting Held: Not reported
Corrective Action Planned: Not reported
SOC Sighned: Not reported
Reclassification Report: Not reported
RS Designation: Not reported
Closure Request Date: Not reported
Close-out Report: Not reported

LUST:
Facility ID: 00-0-000
UST Number: RA-734
Incident Number: 5373
Contamination Type: Groundwater/Both
Source Type: Leak-underground
Product Type: PETROLEUM
Date Reported: 01/18/1990
Date Occur: 02/05/1990
Cleanup: 01/18/1990
Closure Request: Not reported
Close Out: Not reported
Level Of Soil Cleanup Achieved: Residential
Tank Regulated Status: Regulated
Of Supply Wells: 0
Commercial/NonCommercial UST Site: COMMERCIAL
Risk Classification: L
Risk Class Based On Review: I
Corrective Action Plan Type: Not reported
NOV Issue Date: Not reported
NORR Issue Date: Not reported
Site Priority: 45E
Phase Of LSA Req: Not reported
Site Risk Reason: Gross contaminant levels
Land Use: Residential

WAKE COUNTY EMS (FORMER) (Continued) **S101522620**

MTBE:	No
MTBE1:	Yes
Flag:	No
Flag1:	No
LUR Filed:	Not reported
Release Detection:	0
Current Status:	File Located in House
RBCA GW:	Cleanups to alternate standards
PETOPT:	3
RPL:	False
CD Num:	Not reported
Reel Num:	Not reported
RPOW:	False
RPOP:	False
Error Flag:	0
Error Code:	N
Valid:	False
Lat/Long:	35 46 36.96 - 78 38 30.96
Lat/Long Decimal:	35.7769 -78.6419
Testlat:	Not reported
Regional Officer Project Mgr:	WDP
Region:	Raleigh
Company:	WAKE COUNTY GENERAL SERVICES
Contact Person:	MR. JOHN TAYLOR
Telephone:	919-856-5777
RP Address:	PO BOX 550
RP City,St,Zip:	RALEIGH, NC 27602-
RP County:	Not reported
Comments:	Not reported
5 Min Quad:	Not reported

PIRF:

Facility Id:	5373
Date Occurred:	1/16/1990
Date Reported:	2/6/1990
Description Of Incident:	CONTAM. SOIL DISCOVERED AFTER TANK REMOVAL.
Owner/Operator:	COUNTY OF WAKE
Ownership:	6
Operation Type:	6
Type:	3
Location:	1
Site Priority:	45E
Priority Update:	4/16/1998
Wells Affected Y/N:	N
Samples Include:	0
7#5 Minute Quad:	3
5 Minute Quad:	2
Pirf/Min Soil:	Not reported
Release Code:	Not reported
Source Code:	Pirf
Err Type:	Not reported
Cause:	Not reported
Source:	Not reported
Ust Number:	Not reported
Last Modified:	Not reported
Incident Phase:	**Response**
NOV Issued:	Not reported

WAKE COUNTY EMS (FORMER) (Continued) **S101522620**

NORR Issued:	Not reported
45 Day Report:	Not reported
Public Meeting Held:	Not reported
Corrective Action Planned:	Not reported
SOC Signed:	Not reported
Reclassification Report:	Not reported
RS Designation:	Not reported
Closure Request Date:	Not reported
Close-out Report:	Not reported

LUST TRUST:

Facility ID:	Not reported
Site ID:	5373
Site Note:	Invoice does not generate correctly. Work off last invoice.
Site Eligible?:	True
Commercial Find:	100% Commercial
Priority Rank:	Low
Deductable Amount:	50000
3rd Party Deductable Amt:	0
Sum 3rd Party Amt Applied:	0

Click this hyperlink while viewing on your computer to access additional NC LUST TRUST: detail in the EDR Site Report.

72
NW
1/4-1/2
0.466 mi.
2461 ft.

NC DEPT. OF JUSTICE BLDG. **NC LUST** **S110143847**
128 WEST EDENTON STREET **N/A**
RALEIGH, NC 27603

Relative: Higher

Actual: 352 ft.

LUST:

Facility ID:	Not reported	
UST Number:	RA-6605	
Incident Number:	33770	
Contamination Type:		Soil
Source Type:	Leak-underground	
Product Type:	PETROLEUM	
Date Reported:	12/07/2009	
Date Occur:	12/01/2009	
Cleanup:	Not reported	
Closure Request:	Not reported	
Close Out:	04/08/2010	
Level Of Soil Cleanup Achieved:		Residential
Tank Regulated Status:		Non Regulated
# Of Supply Wells:	0	
Commercial/NonCommercial UST Site:		NON COMMERCIAL
Risk Classification:		L
Risk Class Based On Review:		L
Corrective Action Plan Type:		Not reported
NOV Issue Date:	Not reported	
NORR Issue Date:	Not reported	
Site Priority:	Not reported	
Phase Of LSA Req:	Not reported	
Site Risk Reason:	Not reported	
Land Use:	Residential	
MTBE:	No	
MTBE1:	No	

NC DEPT. OF JUSTICE BLDG. (Continued) **S110143847**

Flag:	No
Flag1:	No
LUR Filed:	Not reported
Release Detection:	0
Current Status:	File Located in House
RBCA GW:	Cleanups to 2L.0202 standards
PETOPT:	4
RPL:	False
CD Num:	0
Reel Num:	0
RPOW:	False
RPOP:	False
Error Flag:	0
Error Code:	N
Valid:	False
Lat/Long:	35 27 54.9 - 78 22 58.14
Lat/Long Decimal:	35.4652 -78.3828
Testlat:	Not reported
Regional Officer Project Mgr:	SMJ
Region:	Raleigh
Company:	Office of the Sec/NCDENR
Contact Person:	jill pafford
Telephone:	9197154193
RP Address:	512 North Salisbury Street
RP City,St,Zip:	raleigh, NC 27604
RP County:	Not reported
Comments:	Not reported
5 Min Quad:	Not reported

PIRF:

Facility Id:	33770
Date Occurred:	12/1/2009
Date Reported:	12/7/2009
Description Of Incident:	Not reported
Owner/Operator:	Not reported
Ownership:	7
Operation Type:	1
Type:	4
Location:	1
Site Priority:	Not reported
Priority Update:	Not reported
Wells Affected Y/N:	N
Samples Include:	Not reported
7#5 Minute Quad:	Y
5 Minute Quad:	Not reported
Pirf/Min Soil:	Not reported
Release Code:	Not reported
Source Code:	Not reported
Err Type:	2
Cause:	7
Source:	A
Ust Number:	P
Last Modified:	4/8/2010
Incident Phase:	**Closed Out**
NOV Issued:	Not reported
NORR Issued:	Not reported
45 Day Report:	Not reported

NC DEPT. OF JUSTICE BLDG. (Continued) **S110143847**

Public Meeting Held:	Not reported
Corrective Action Planned:	Not reported
SOC Signed:	Not reported
Reclassification Report:	Not reported
RS Designation:	Not reported
Closure Request Date:	Not reported
Close-out Report:	Not reported

---

73 WNW 1/4-1/2 0.476 mi. 2514 ft.

RALEIGH POLICE SERVICE CENTER **NC IMD S103717360**
110 S MCDOWELL ST **NC LUST N/A**
RALEIGH, NC

Relative: Higher

Actual: 345 ft.

IMD:

Region:	RAL
Facility ID:	19110
Date Occurred:	9/12/1997
Submit Date:	10/21/1998
GW Contam:	Yes, Groundwater Contamination has been detected
Soil Contam:	No
Incident Desc:	22,000 PPB BENZENE WAS FOUND IN GROUNDWATER.
Operator:	RANDY LAYMON
Contact Phone:	919-890-3395
Owner Company:	RALEIGH POLICE SERVICE CENTER
Operator Address:	PO BOX 590
Operator City:	RALEIGH
Oper City,St,Zip:	RALEIGH, NC 27602-
Ownership:	Municipal
Operation:	Public Service
Material:	GASOLINE
Qty Lost 1:	Not reported
Qty Recovered 1:	Not reported
Source:	Leak-underground
Type:	Gasoline/diesel
Location:	Facility
Setting:	Urban
Risk Site:	I
Site Priority:	60I
Priority Code:	I
Priority Update:	10/21/1998
Dem Contact:	SMJ
Wells Affected:	No
Num Affected:	Not reported
Wells Contam:	Not reported
Sampled By:	Responsible Parties
Samples Include:	Groundwater Samples
7.5 Min Quad:	Not reported
5 Min Quad:	K39Q
Latitude:	35.77888888
Longitude:	-78.64138888
Latitude Number:	354644
Longitude Number:	783829
Latitude Decimal:	35.7788888888889
Longitude Decimal:	78.6413888888889
GPS:	7
Agency:	DWM
Facility ID:	19110

RALEIGH POLICE SERVICE CENTER (Continued) **S103717360**

Last Modified:	Not reported
Incident Phase:	RE
NOV Issued:	Not reported
NORR Issued:	Not reported
45 Day Report:	Not reported
Public Meeting Held:	Not reported
Corrective Action Planned:	Not reported
SOC Sighned:	Not reported
Reclassification Report:	Not reported
RS Designation:	Not reported
Closure Request Date:	Not reported
Close-out Report:	Not reported

LUST:

Facility ID:	00-0-000
UST Number:	RA-2884
Incident Number:	19110
Contamination Type:	Groundwater/Both
Source Type:	Leak-underground
Product Type:	PETROLEUM
Date Reported:	12/31/1997
Date Occur:	09/12/1997
Cleanup:	Not reported
Closure Request:	Not reported
Close Out:	Not reported
Level Of Soil Cleanup Achieved:	Not reported
Tank Regulated Status:	Regulated
# Of Supply Wells:	0
Commercial/NonCommercial UST Site:	COMMERCIAL
Risk Classification:	L
Risk Class Based On Review:	L
Corrective Action Plan Type:	Not reported
NOV Issue Date:	Not reported
NORR Issue Date:	Not reported
Site Priority:	60
Phase Of LSA Req:	Not reported
Site Risk Reason:	Not reported
Land Use:	Residential
MTBE:	No
MTBE1:	Unknown
Flag:	No
Flag1:	No
LUR Filed:	Not reported
Release Detection:	0
Current Status:	File Located in House
RBCA GW:	Not reported
PETOPT:	3
RPL:	False
CD Num:	Not reported
Reel Num:	Not reported
RPOW:	False
RPOP:	False
Error Flag:	0
Error Code:	N
Valid:	False
Lat/Long:	35 46 44.94 - 78 38 29.94

RALEIGH POLICE SERVICE CENTER (Continued) **S103717360**

Lat/Long Decimal:	35.7791 -78.6416
Testlat:	Not reported
Regional Officer Project Mgr:	SMJ
Region:	Raleigh
Company:	RALEIGH POLICE SERVICE CENTER
Contact Person:	RANDY LAYMON
Telephone:	919-890-3395
RP Address:	PO BOX 590
RP City,St,Zip:	RALEIGH, NC 27602-
RP County:	Not reported
Comments:	likely i risk due to GCL hit, but need RS to confirm. NOV for LSA sent 10/3/05. SMJ
5 Min Quad:	K39q

PIRF:

Facility Id:	19110
Date Occurred:	9/12/1997
Date Reported:	10/21/1998
Description Of Incident:	22,000 PPB BENZENE WAS FOUND IN GROUNDWATER.
Owner/Operator:	RANDY LAYMON
Ownership:	1
Operation Type:	1
Type:	3
Location:	1
Site Priority:	60I
Priority Update:	10/21/1998
Wells Affected Y/N:	N
Samples Include:	Not reported
7#5 Minute Quad:	3
5 Minute Quad:	1
Pirf/Min Soil:	Not reported
Release Code:	K39Q
Source Code:	Pirf
Err Type:	Not reported
Cause:	Not reported
Source:	Not reported
Ust Number:	Not reported
Last Modified:	Not reported
Incident Phase:	**Response**
NOV Issued:	Not reported
NORR Issued:	Not reported
45 Day Report:	Not reported
Public Meeting Held:	Not reported
Corrective Action Planned:	Not reported
SOC Signed:	Not reported
Reclassification Report:	Not reported
RS Designation:	Not reported
Closure Request Date:	Not reported
Close-out Report:	Not reported

V74 **NC TRUCKING ASSOC.** **NC LUST** **S111161301**
West **219 WEST MARTIN STREET** **NC LUST TRUST** **N/A**
1/4-1/2 **RALEIGH, NC**
0.480 mi.
2533 ft. **Site 2 of 2 in cluster V**

Relative:
Higher

Actual:
329 ft.

LUST:

Facility ID:	Not reported	
UST Number:	RA-6906	
Incident Number:	39047	
Contamination Type:		Soil
Source Type:	Leak-underground	
Product Type:	PETROLEUM	
Date Reported:	08/22/2010	
Date Occur:	08/22/2010	
Cleanup:	Not reported	
Closure Request:	Not reported	
Close Out:	08/30/2011	
Level Of Soil Cleanup Achieved:		Soil to Groundwater
Tank Regulated Status:		Non Regulated
# Of Supply Wells:	0	
Commercial/NonCommercial UST Site:		NON COMMERCIAL
Risk Classification:		L
Risk Class Based On Review:		L
Corrective Action Plan Type:		Not reported
NOV Issue Date:	Not reported	
NORR Issue Date:	Not reported	
Site Priority:	Not reported	
Phase Of LSA Req:	Not reported	
Site Risk Reason:	Not reported	
Land Use:	Industrial/commercial	
MTBE:	No	
MTBE1:	No	
Flag:	No	
Flag1:	No	
LUR Filed:	Not reported	
Release Detection:	0	
Current Status:	File Located in House	
RBCA GW:	Cleanups to 2L.0202 standards	
PETOPT:	4	
RPL:	False	
CD Num:	0	
Reel Num:	0	
RPOW:	False	
RPOP:	False	
Error Flag:	0	
Error Code:	N	
Valid:	False	
Lat/Long:	35 40 11.46 - 78 39 8.46	
Lat/Long Decimal:	35.6698 -78.6523	
Testlat:	Not reported	
Regional Officer Project Mgr:		smj
Region:		Raleigh
Company:		nc trucking aasoc
Contact Person:		crystal collins
Telephone:		Not reported
RP Address:		219 w. martin street
RP City,St,Zip:		raleigh, NC 27601
RP County:		Not reported

NC TRUCKING ASSOC. (Continued) **S111161301**

Comments: Not reported
5 Min Quad: Not reported

PIRF:

Facility Id:	39047
Date Occurred:	8/22/2010
Date Reported:	8/22/2010
Description Of Incident:	Not reported
Owner/Operator:	Not reported
Ownership:	4
Operation Type:	5
Type:	4
Location:	1
Site Priority:	Not reported
Priority Update:	Not reported
Wells Affected Y/N:	N
Samples Include:	Not reported
7#5 Minute Quad:	Y
5 Minute Quad:	Not reported
Pirf/Min Soil:	Not reported
Release Code:	Not reported
Source Code:	Not reported
Err Type:	3
Cause:	3
Source:	B
Ust Number:	P
Last Modified:	8/30/2011
Incident Phase:	**Closed Out**
NOV Issued:	Not reported
NORR Issued:	Not reported
45 Day Report:	Not reported
Public Meeting Held:	Not reported
Corrective Action Planned:	Not reported
SOC Signed:	Not reported
Reclassification Report:	Not reported
RS Designation:	Not reported
Closure Request Date:	Not reported
Close-out Report:	Not reported

LUST TRUST:

Facility ID:	Not reported
Site ID:	39047
Site Note:	RIF on file. Noncommercial; 100% eligible; $0 deductible.[CGS 1/19/12]
Site Eligible?:	True
Commercial Find:	100% Non-Commercial
Priority Rank:	Not reported
Deductable Amount:	0
3rd Party Deductable Amt:	0
Sum 3rd Party Amt Applied:	0

Click this hyperlink while viewing on your computer to access additional NC LUST TRUST: detail in the EDR Site Report.

W75 **WAKE DEPT OF SOCIAL SERVICES** **NC IMD** **S104483005**
WSW **201 W DAVIE ST** **N/A**
1/4-1/2 **RALEIGH, NC**
0.482 mi.
2546 ft. **Site 1 of 2 in cluster W**

Relative:
Higher

Actual:
311 ft.

IMD:

Region:	RAL
Facility ID:	20890
Date Occurred:	10/8/1999
Submit Date:	11/16/1999
GW Contam:	No Groundwater Contamination detected
Soil Contam:	Yes
Incident Desc:	TWO 6000 GALLON HEATING OIL UST REMOVED FROM SITE SOIL CONTA IN SAMPLES 2620 PPM(EPH 3530) IN SAMPLE T2-S2 NO NORR SENT OUT PHASE I LSA SENT IN ON 11/12/99
Operator:	MR MIKE AULL PROJECT MANAGER
Contact Phone:	919-856-6179
Owner Company:	WAKE COUNTY
Operator Address:	PO BOX 550 FAYETTEVILLE STREET
Operator City:	RALEIGH
Oper City,St,Zip:	RALEIGH, NC 27602-
Ownership:	County
Operation:	Public Service
Material:	HEATING OIL
Qty Lost 1:	Not reported
Qty Recovered 1:	Not reported
Source:	Leak-underground
Type:	Gasoline/diesel
Location:	Facility
Setting:	Industrial
Risk Site:	L
Site Priority:	Not reported
Priority Code:	Not reported
Priority Update:	11/16/1999
Dem Contact:	JFM
Wells Affected:	Not reported
Num Affected:	Not reported
Wells Contam:	Not reported
Sampled By:	Not reported
Samples Include:	Not reported
7.5 Min Quad:	Not reported
5 Min Quad:	Not reported
Latitude:	35.775
Longitude:	-78.64305555
Latitude Number:	354630
Longitude Number:	783835
Latitude Decimal:	35.775
Longitude Decimal:	78.6430555555555
GPS:	7
Agency:	DWM
Facility ID:	20890
Last Modified:	7/6/2000
Incident Phase:	Closed Out
NOV Issued:	Not reported
NORR Issued:	Not reported
45 Day Report:	Not reported
Public Meeting Held:	Not reported
Corrective Action Planned:	Not reported

WAKE DEPT OF SOCIAL SERVICES (Continued) **S104483005**

SOC Sighned: Not reported
Reclassification Report: Not reported
RS Designation: Not reported
Closure Request Date: Not reported
Close-out Report: 5/17/2000

W76 **WAKE DEPT OF SOCIAL SERVICES** **NC IMD** **S105895522**
WSW **201 W DAVIE ST** **NC LUST** **N/A**
1/4-1/2 **RALEIGH, NC 27601**
0.482 mi.
2546 ft. **Site 2 of 2 in cluster W**

Relative:
Higher

Actual:
311 ft.

IMD:
Region: RAL
Facility ID: 26509
Date Occurred: 10/25/1999
Submit Date: 11/12/1999
GW Contam: No Groundwater Contamination detected
Soil Contam: Yes
Incident Desc: Not reported
Operator: WAKE COUNTY
Contact Phone: 919-856-6179
Owner Company: WAKE COUNTY
Operator Address: 336 FAYETTEVILLE STREET MALL
Operator City: RALEIGH
Oper City,St,Zip: RALEIGH, NC 27602
Ownership: Municipal
Operation: Public Service
Material: Not reported
Qty Lost 1: Not reported
Qty Recovered 1: Not reported
Source: Leak-underground
Type: Gasoline/diesel
Location: Facility
Setting: Not reported
Risk Site: L
Site Priority: Not reported
Priority Code: Not reported
Priority Update: Not reported
Dem Contact: JFM
Wells Affected: No
Num Affected: Not reported
Wells Contam: Not reported
Sampled By: y
Samples Include: Not reported
7.5 Min Quad: Not reported
5 Min Quad: Not reported
Latitude: Not reported
Longitude: Not reported
Latitude Number: Not reported
Longitude Number: Not reported
Latitude Decimal: Not reported
Longitude Decimal: Not reported
GPS: NOD
Agency: DWM
Facility ID: Not reported
Last Modified: Not reported

WAKE DEPT OF SOCIAL SERVICES (Continued) **S105895522**

Incident Phase:	Not reported
NOV Issued:	Not reported
NORR Issued:	Not reported
45 Day Report:	Not reported
Public Meeting Held:	Not reported
Corrective Action Planned:	Not reported
SOC Sighned:	Not reported
Reclassification Report:	Not reported
RS Designation:	Not reported
Closure Request Date:	Not reported
Close-out Report:	Not reported

LUST:

Facility ID:	00-0-000
UST Number:	RA-3204
Incident Number:	20890
Contamination Type:	Soil
Source Type:	Leak-underground
Product Type:	PETROLEUM
Date Reported:	11/12/1999
Date Occur:	10/08/1999
Cleanup:	10/08/1999
Closure Request:	Not reported
Close Out:	05/17/2000
Level Of Soil Cleanup Achieved:	Not reported
Tank Regulated Status:	Non Regulated
# Of Supply Wells:	0
Commercial/NonCommercial UST Site:	COMMERCIAL
Risk Classification:	L
Risk Class Based On Review:	L
Corrective Action Plan Type:	Not reported
NOV Issue Date:	Not reported
NORR Issue Date:	Not reported
Site Priority:	Not reported
Phase Of LSA Req:	Not reported
Site Risk Reason:	Not reported
Land Use:	Not reported
MTBE:	No
MTBE1:	Unknown
Flag:	No
Flag1:	No
LUR Filed:	Not reported
Release Detection:	0
Current Status:	File Located in Archives
RBCA GW:	Not reported
PETOPT:	4
RPL:	False
CD Num:	155
Reel Num:	124
RPOW:	False
RPOP:	False
Error Flag:	0
Error Code:	N
Valid:	False
Lat/Long:	354630 -783835
Lat/Long Decimal:	0 0

WAKE DEPT OF SOCIAL SERVICES (Continued) **S105895522**

Testlat:	Not reported	
Regional Officer Project Mgr:		JFM
Region:		Raleigh
Company:		WAKE COUNTY
Contact Person:		MR MIKE AULL PROJECT MANAGER
Telephone:		919-856-6179
RP Address:		PO BOX 550 FAYETTEVILLE STREET
RP City,St,Zip:		RALEIGH, NC 27602-
RP County:		Not reported
Comments:	Not reported	
5 Min Quad:	Not reported	

PIRF:

Facility Id:	20890
Date Occurred:	10/8/1999
Date Reported:	11/16/1999
Description Of Incident:	TWO 6000 GALLON HEATING OIL UST REMOVED FROM SITE SOIL CONTA IN SAMPLES 2620 PPM(EPH 3530) IN SAMPLE T2-S2 NO NORR SENT OUT PHASE I LSA SENT IN ON 11/12/99
Owner/Operator:	MR MIKE AULL PROJECT MANAGERF
Ownership:	6
Operation Type:	1
Type:	4
Location:	1
Site Priority:	Not reported
Priority Update:	11/16/1999
Wells Affected Y/N:	Not reported
Samples Include:	Not reported
7#5 Minute Quad:	Not reported
5 Minute Quad:	Not reported
Pirf/Min Soil:	Not reported
Release Code:	Not reported
Source Code:	MIN_SOIL
Err Type:	Not reported
Cause:	Not reported
Source:	Not reported
Ust Number:	Not reported
Last Modified:	7/6/2000
Incident Phase:	**Closed Out**
NOV Issued:	Not reported
NORR Issued:	Not reported
45 Day Report:	Not reported
Public Meeting Held:	Not reported
Corrective Action Planned:	Not reported
SOC Signed:	Not reported
Reclassification Report:	Not reported
RS Designation:	Not reported
Closure Request Date:	Not reported
Close-out Report:	5/17/2000

X77 **DAVIDSON, MARTHA SPLAWN- HEIRS** **NC IMD** **S103040561**
ENE **817 COTTON ST** **N/A**
1/4-1/2 **RALEIGH, NC**
0.485 mi.
2562 ft. **Site 1 of 2 in cluster X**

Relative:
Higher

Actual:
343 ft.

IMD:

Region:	RAL
Facility ID:	17275
Date Occurred:	Not reported
Submit Date:	2/27/1997
GW Contam:	No Groundwater Contamination detected
Soil Contam:	Yes
Incident Desc:	500 GALLON UST HOME HEATING OIL RUPTURED WHEN CONTRACTOR REMOVED WITHOUT EMPTYING FIRST.
Operator:	MARTHA DAVIDSON,JUANITA LEWIS
Contact Phone:	202/ 829-3467
Owner Company:	PRIVATE ESTATE
Operator Address:	4928 4TH ST. NW
Operator City:	WASHINGTON
Oper City,St,Zip:	WASHINGTON, DC 20011-6103
Ownership:	Private
Operation:	Residential
Material:	#2 HEATING OIL
Qty Lost 1:	Not reported
Qty Recovered 1:	Not reported
Source:	Leak-underground
Type:	Gasoline/diesel
Location:	Residence
Setting:	Residential
Risk Site:	L
Site Priority:	30E
Priority Code:	L
Priority Update:	4/16/1998
Dem Contact:	WDP
Wells Affected:	Not reported
Num Affected:	0
Wells Contam:	Not reported
Sampled By:	Not reported
Samples Include:	Not reported
7.5 Min Quad:	Not reported
5 Min Quad:	Not reported
Latitude:	35.77888888
Longitude:	-78.62583333
Latitude Number:	354644
Longitude Number:	783733
Latitude Decimal:	35.7788888888889
Longitude Decimal:	78.6258333333333
GPS:	NOD
Agency:	DWM
Facility ID:	17275
Last Modified:	Not reported
Incident Phase:	RE
NOV Issued:	Not reported
NORR Issued:	Not reported
45 Day Report:	Not reported
Public Meeting Held:	Not reported
Corrective Action Planned:	Not reported
SOC Sighned:	Not reported

DAVIDSON, MARTHA SPLAWN- HEIRS (Continued) **S103040561**

Reclassification Report: Not reported
RS Designation: Not reported
Closure Request Date: Not reported
Close-out Report: Not reported

X78 **DAVIDSON HEIRS (MARTHA)** **NC LUST** **S105219312**
ENE **817 COTTON ST** **NC LUST TRUST** **N/A**
1/4-1/2 **RALEIGH, NC 27601**
0.485 mi.
2562 ft. **Site 2 of 2 in cluster X**

Relative:
Higher

Actual:
343 ft.

LUST:

Facility ID:	Not reported	
UST Number:	RA-2723	
Incident Number:	17275	
Contamination Type:		Soil
Source Type:	Leak-underground	
Product Type:	PETROLEUM	
Date Reported:	02/27/1997	
Date Occur:	02/26/1997	
Cleanup:	Not reported	
Closure Request:	Not reported	
Close Out:	Not reported	
Level Of Soil Cleanup Achieved:		Not reported
Tank Regulated Status:		Non Regulated
# Of Supply Wells:	0	
Commercial/NonCommercial UST Site:		NON COMMERCIAL
Risk Classification:		L
Risk Class Based On Review:		L
Corrective Action Plan Type:		Not reported
NOV Issue Date:	Not reported	
NORR Issue Date:	Not reported	
Site Priority:	30E	
Phase Of LSA Req:	Not reported	
Site Risk Reason:	Not reported	
Land Use:	Residential	
MTBE:	No	
MTBE1:	No	
Flag:	No	
Flag1:	No	
LUR Filed:	Not reported	
Release Detection:	0	
Current Status:	File Located in House	
RBCA GW:	Not reported	
PETOPT:	4	
RPL:	False	
CD Num:	Not reported	
Reel Num:	Not reported	
RPOW:	False	
RPOP:	False	
Error Flag:	0	
Error Code:	N	
Valid:	False	
Lat/Long:	35 46 44.94 - 78 37 29.7	
Lat/Long Decimal:	35.7791 -78.6249	
Testlat:	Not reported	
Regional Officer Project Mgr:		SMJ

DAVIDSON HEIRS (MARTHA) (Continued) **S105219312**

Region:	Raleigh
Company:	PRIVATE ESTATE
Contact Person:	MARTHA DAVIDSON,JUANITA LEWIS
Telephone:	202/ 829-3467
RP Address:	4928 4TH ST. NW
RP City,St,Zip:	WASHINGTON, DC 20011-6103
RP County:	Not reported
Comments:	Approx. 250 gal./htg.oil spilled during removal of a LUST. Assessment report rec'd 6/2/97.// 1/21/03 Review determined low risk. No pot.receptors found in 4/97 survey.GW in MW1 BDL. Cont. soil remained after overexcavation to 5,430ppm
5 Min Quad:	K39R

PIRF:

Facility Id:	17275
Date Occurred:	2/26/1997
Date Reported:	2/27/1997
Description Of Incident:	500 GALLON UST HOME HEATING OIL RUPTURED WHEN CONTRACTOR REMOVED WITHOUT EMPTYING FIRST.
Owner/Operator:	MARTHA DAVIDSON,JUANITA LEWIS
Ownership:	4
Operation Type:	3
Type:	4
Location:	7
Site Priority:	30E
Priority Update:	4/16/1998
Wells Affected Y/N:	Not reported
Samples Include:	0
7#5 Minute Quad:	Not reported
5 Minute Quad:	Not reported
Pirf/Min Soil:	Not reported
Release Code:	Not reported
Source Code:	Min_Soil
Err Type:	Not reported
Cause:	Not reported
Source:	Not reported
Ust Number:	Not reported
Last Modified:	Not reported
Incident Phase:	**Response**
NOV Issued:	Not reported
NORR Issued:	Not reported
45 Day Report:	Not reported
Public Meeting Held:	Not reported
Corrective Action Planned:	Not reported
SOC Signed:	Not reported
Reclassification Report:	Not reported
RS Designation:	Not reported
Closure Request Date:	Not reported
Close-out Report:	Not reported

LUST TRUST:

Facility ID:	Not reported
Site ID:	17275
Site Note:	Not reported
Site Eligible?:	True
Commercial Find:	100% Non-Commercial

DAVIDSON HEIRS (MARTHA) (Continued) **S105219312**

Priority Rank: Low
Deductable Amount: 0
3rd Party Deductable Amt: 100000
Sum 3rd Party Amt Applied: 0

Click this hyperlink while viewing on your computer to access additional NC LUST TRUST: detail in the EDR Site Report.

79
SW
1/4-1/2
0.487 mi.
2572 ft.

0 WEST SOUTH STREET
0 WEST SOUTH STREET
RALEIGH, NC 27601

US BROWNFIELDS FINDS **1010376327 N/A**

Relative: Higher

Actual: 326 ft.

US BROWNFIELDS:

Recipient name:	Raleigh, City of
Grant type:	Assessment
Property name:	0 WEST SOUTH STREET
Property #:	1703-56-7037
Parcel size:	1.28
Property Description:	The lot is currently vacant. It is a grassy field with railroad alignment transecting the northeastern corner of the lot. Past use includes a former drycleaner and residential uses. Additionally, the property is located down gradient of suspected sources of groundwater contamination, including a former MGP site, two gasoline service stations, a drycleaner, an oil plant, and a machine and welding shop.
Latitude:	35.77229
Longitude:	-78.64417
HCM label:	Not reported
Map scale:	Not reported
Point of reference:	Not reported
Datum:	World Geodetic System of 1984
ACRES property ID:	28221
Start date:	Not reported
Completed date:	Not reported
Acres cleaned up:	Not reported
Cleanup funding:	Not reported
Cleanup funding source:	Not reported
Assessment funding:	5489
Assessment funding source:	US EPA - Brownfields Assessment Cooperative Agreement
Redevelopment funding:	Not reported
Redev. funding source:	Not reported
Redev. funding entity name:	Not reported
Redevelopment start date:	Not reported
Assessment funding entity:	Not reported
Cleanup funding entity:	Not reported
Grant type:	B
Accomplishment type:	Phase I Environmental Assessment
Accomplishment count:	1
Cooperative agreement #:	96416704
Ownership entity:	Government
Current owner:	City of Raleigh
Did owner change:	N
Cleanup required:	Unknown
Video available:	No
Photo available:	Yes
Institutional controls required:	U
IC Category proprietary controls:	Not reported

0 WEST SOUTH STREET (Continued) **1010376327**

IC cat. info. devices:	Not reported
IC cat. gov. controls:	Not reported
IC cat. enforcement permit tools:	Not reported
IC in place date:	Not reported
IC in place:	Unknown
State/tribal program date:	Not reported
State/tribal program ID:	Not reported
State/tribal NFA date:	Not reported
Air contaminated:	Not reported
Air cleaned:	Not reported
Asbestos found:	Not reported
Asbestos cleaned:	Not reported
Controled substance found:	Not reported
Controled substance cleaned:	Not reported
Drinking water affected:	Not reported
Drinking water cleaned:	Not reported
Groundwater affected:	Not reported
Groundwater cleaned:	Not reported
Lead contaminant found:	Not reported
Lead cleaned up:	Not reported
No media affected:	Not reported
Unknown media affected:	Y
Other cleaned up:	Not reported
Other metals found:	Not reported
Other metals cleaned:	Not reported
Other contaminants found:	Not reported
Other contams found description:	Not reported
PAHs found:	Not reported
PAHs cleaned up:	Not reported
PCBs found:	Not reported
PCBs cleaned up:	Not reported
Petro products found:	Not reported
Petro products cleaned:	Not reported
Sediments found:	Not reported
Sediments cleaned:	Not reported
Soil affected:	Not reported
Soil cleaned up:	Not reported
Surface water cleaned:	Not reported
Unknown found:	Y
VOCs found:	Not reported
VOCs cleaned:	Not reported
Cleanup other description:	Not reported
Num. of cleanup and re-dev. jobs:	Not reported
Past use greenspace acreage:	1
Past use residential acreage:	Not reported
Past use commercial acreage:	Not reported
Past use industrial acreage:	0.28
Future use greenspace acreage:	Not reported
Future use residential acreage:	Not reported
Future use commercial acreage:	Not reported
Future use industrial acreage:	Not reported
Greenspace acreage and type:	Not reported
Superfund Fed. landowner flag:	Not reported

FINDS:

Registry ID: 110038712435

0 WEST SOUTH STREET (Continued) **1010376327**

Environmental Interest/Information System
US EPA Assessment, Cleanup and Redevelopment Exchange System (ACRES)
is an federal online database for Brownfields Grantees to
electronically submit data directly to EPA.

80
WSW
1/4-1/2
0.487 mi.
2573 ft.

ENTERPRISE RENT-A-CAR
431 SOUTH MCDOWELL STREET
RALEIGH, NC 27601

NC IMD **U003202308**
NC LUST **N/A**
NC UST
NC Financial Assurance

Relative:
Lower

Actual:
304 ft.

IMD:

Region:	RAL
Facility ID:	26233
Date Occurred:	2/12/2003
Submit Date:	4/3/2003
GW Contam:	No Groundwater Contamination detected
Soil Contam:	Yes
Incident Desc:	Two (2) 10,000-gallon gasoline UST
Operator:	LARRY YOUNG
Contact Phone:	9195463571
Owner Company:	PROGRESS ENERGY SERVICE
Operator Address:	P. O. BOX 1551
Operator City:	RALEIGH
Oper City,St,Zip:	RALEIGH, NC
Ownership:	Private
Operation:	Commercial
Material:	Not reported
Qty Lost 1:	Not reported
Qty Recovered 1:	Not reported
Source:	Leak-underground
Type:	Gasoline/diesel
Location:	Facility
Setting:	Not reported
Risk Site:	H
Site Priority:	Not reported
Priority Code:	Not reported
Priority Update:	Not reported
Dem Contact:	JFM
Wells Affected:	No
Num Affected:	Not reported
Wells Contam:	Not reported
Sampled By:	9
Samples Include:	Not reported
7.5 Min Quad:	Not reported
5 Min Quad:	Not reported
Latitude:	35.77527777
Longitude:	-78.64166666
Latitude Number:	354631
Longitude Number:	783830
Latitude Decimal:	35.7752777777778
Longitude Decimal:	78.6416666666667
GPS:	5
Agency:	DWM
Facility ID:	Not reported
Last Modified:	Not reported
Incident Phase:	Not reported

ENTERPRISE RENT-A-CAR (Continued) **U003202308**

NOV Issued: Not reported
NORR Issued: Not reported
45 Day Report: Not reported
Public Meeting Held: Not reported
Corrective Action Planned: Not reported
SOC Sighned: Not reported
Reclassification Report: Not reported
RS Designation: Not reported
Closure Request Date: Not reported
Close-out Report: Not reported

LUST:
Facility ID: 00-0-000
UST Number: RA-4477
Incident Number: 26233
Contamination Type: Soil
Source Type: Leak-underground
Product Type: PETROLEUM
Date Reported: 04/03/2003
Date Occur: 02/12/2003
Cleanup: 02/12/2003
Closure Request: Not reported
Close Out: 10/22/2003
Level Of Soil Cleanup Achieved: Not reported
Tank Regulated Status: Regulated
Of Supply Wells: 0
Commercial/NonCommercial UST Site: COMMERCIAL
Risk Classification: H
Risk Class Based On Review: L
Corrective Action Plan Type: Not reported
NOV Issue Date: Not reported
NORR Issue Date: Not reported
Site Priority: Not reported
Phase Of LSA Req: 1
Site Risk Reason: Not reported
Land Use: Not reported
MTBE: No
MTBE1: Unknown
Flag: No
Flag1: No
LUR Filed: Not reported
Release Detection: 0
Current Status: File Located in Archives
RBCA GW: Not reported
PETOPT: 3
RPL: False
CD Num: 230
Reel Num: 100
RPOW: False
RPOP: False
Error Flag: 0
Error Code: N
Valid: False
Lat/Long: 35 46 31.08 - 78 38 30.54
Lat/Long Decimal: 35.7753 -78.6418
Testlat: Not reported

ENTERPRISE RENT-A-CAR (Continued) **U003202308**

Regional Officer Project Mgr: JFM
Region: Raleigh
Company: PROGRESS ENERGY SERVICE
Contact Person: LARRY YOUNG
Telephone: 9195463571
RP Address: P. O. BOX 1551
RP City,St,Zip: RALEIGH, NC
RP County: Not reported
Comments: Two 10,000 gallon gasoline USTs. USTs were removed 3/3-5/03. NFA issued 10/22/03 b/c soil and GW sampled during LSA was BDL or below 2L and residential MSCCs. Archive review conducted 2/10/06. SMJ
5 Min Quad: Not reported

PIRF:
Facility Id: 26233
Date Occurred: 2/17/2003
Date Reported: 4/3/2003
Description Of Incident: Two (2) 10,000-gallon gasoline UST
Owner/Operator: Not reported
Ownership: 4
Operation Type: 6
Type: 3
Location: 1
Site Priority: Not reported
Priority Update: Not reported
Wells Affected Y/N: N
Samples Include: Not reported
7#5 Minute Quad: 9
5 Minute Quad: Not reported
Pirf/Min Soil: Not reported
Release Code: Not reported
Source Code: Not reported
Err Type: 2
Cause: Not reported
Source: C
Ust Number: C

Last Modified: Not reported
Incident Phase: **Not reported**
NOV Issued: Not reported
NORR Issued: Not reported
45 Day Report: Not reported
Public Meeting Held: Not reported
Corrective Action Planned: Not reported
SOC Signed: Not reported
Reclassification Report: Not reported
RS Designation: Not reported
Closure Request Date: Not reported
Close-out Report: Not reported

UST:
Facility Id: 00-0-0000006722
Contact: CP&L DBA PROGRESS ENERGY SERV CO
Contact Address1: 100 EAST DAVIE STREET
Contact Address2: TPT14
Contact City/State/Zip: RALEIGH, NC 27601-1849
FIPS County Desc: Wake

ENTERPRISE RENT-A-CAR (Continued) **U003202308**

Latitude:	35.77445
Longitude:	-78.64178
Tank Id:	1
Tank Status:	Removed
Installed Date:	05/08/1984
Perm Close Date:	01/24/1993
Product Key:	3
Product Name:	Gasoline, Gas Mix
Tank Capacity:	10000
Root Tank Id:	Not reported
Main Tank:	No
Compartment Tank:	No
Manifold Tank:	Not reported
Commercial:	Yes
Regulated:	Yes
Tank Construction:	Single Wall Steel
Piping Construction:	Single Wall Steel
Piping System Key:	Unknown
Other CP Tank:	Not reported

Tank Id:	2
Tank Status:	Removed
Installed Date:	05/08/1984
Perm Close Date:	01/24/1993
Product Key:	3
Product Name:	Gasoline, Gas Mix
Tank Capacity:	10000
Root Tank Id:	Not reported
Main Tank:	No
Compartment Tank:	No
Manifold Tank:	Not reported
Commercial:	Yes
Regulated:	Yes
Tank Construction:	Single Wall Steel
Piping Construction:	Single Wall Steel
Piping System Key:	Unknown
Other CP Tank:	Not reported

Tank Id:	3
Tank Status:	Removed
Installed Date:	05/13/1966
Perm Close Date:	12/31/1989
Product Key:	1
Product Name:	Diesel
Tank Capacity:	500
Root Tank Id:	Not reported
Main Tank:	No
Compartment Tank:	No
Manifold Tank:	Not reported
Commercial:	Yes
Regulated:	Yes
Tank Construction:	Single Wall Steel
Piping Construction:	Unknown
Piping System Key:	Unknown

ENTERPRISE RENT-A-CAR (Continued) **U003202308**

Other CP Tank:	Not reported

Tank Id:	4
Tank Status:	Removed
Installed Date:	05/13/1966
Perm Close Date:	08/08/1986
Product Key:	14
Product Name:	Oil, New/Used/Mix
Tank Capacity:	500
Root Tank Id:	Not reported
Main Tank:	No
Compartment Tank:	No
Manifold Tank:	Not reported
Commercial:	Yes
Regulated:	Yes
Tank Construction:	Single Wall Steel
Piping Construction:	Unknown
Piping System Key:	Unknown
Other CP Tank:	Not reported

Tank Id:	5
Tank Status:	Removed
Installed Date:	05/11/1974
Perm Close Date:	05/23/1989
Product Key:	14
Product Name:	Oil, New/Used/Mix
Tank Capacity:	500
Root Tank Id:	Not reported
Main Tank:	No
Compartment Tank:	No
Manifold Tank:	Not reported
Commercial:	Yes
Regulated:	Yes
Tank Construction:	Single Wall Steel
Piping Construction:	Unknown
Piping System Key:	Unknown
Other CP Tank:	Not reported

Tank Id:	A1
Tank Status:	Removed
Installed Date:	01/24/1993
Perm Close Date:	03/05/2003
Product Key:	3
Product Name:	Gasoline, Gas Mix
Tank Capacity:	10000
Root Tank Id:	Not reported
Main Tank:	No
Compartment Tank:	No
Manifold Tank:	Not reported
Commercial:	Yes
Regulated:	Yes
Tank Construction:	Single Wall Steel/FRP
Piping Construction:	Single Wall FRP
Piping System Key:	Unknown

ENTERPRISE RENT-A-CAR (Continued) **U003202308**

Other CP Tank: Not reported

Tank Id: A2
Tank Status: Removed
Installed Date: 01/24/1993
Perm Close Date: 03/05/2003
Product Key: 3
Product Name: Gasoline, Gas Mix
Tank Capacity: 10000
Root Tank Id: Not reported
Main Tank: No
Compartment Tank: No
Manifold Tank: Not reported
Commercial: Yes
Regulated: Yes
Tank Construction: Single Wall Steel/FRP
Piping Construction: Single Wall FRP
Piping System Key: Unknown
Other CP Tank: Not reported

NC Financial Assurance 1:
Facility ID: 0-006722
Region: 1
Financial Responsibility Code: F
Financial Responsibility Desc: SELF/FUND

---

81 **SITE FOUR** **US BROWNFIELDS** **1012104920**
SW **600-616 S. SALISBURY STREET** **FINDS** **N/A**
1/4-1/2 **RALEIGH, NC 27601**
0.491 mi.
2591 ft.

Relative:
Higher

Actual:
327 ft.

US BROWNFIELDS:
Recipient name: Raleigh, City of
Grant type: BCRLF
Property name: SITE FOUR
Property #: 1703665258
Parcel size: 1
Property Description: Property was assessed (Phase I and Phase II) under EPA Assessment Grant BF-96416704-0. The results of the Phase I assessment indicated that a gasoline service station with suspected waste oil tanks had formerly operated on the property. The results of the Phase I assessment indicated that ground water at the property was contaminated with a commingled plume petroleum hydrocarbon and chlorinated volatile organic compounds in excess of NC 2L Ground Water Standards. Sanborn Maps and a ground penetrating radar survey initially interpreted that USTs at the property. Test pit exploratory activity and follow-up EM survey work approved by EPA indicated that the USTs were no longer present at the property. The City is currently negotiating with Empire Properties to purchase the property. As part of the purchase, the City is required to provide Empire Properties with a "clean" property. Empire Properties is planning on constructing an upscale hotel and restaurant at the property. Empire Properties has filed an application with the State of North Carolina to enter this property into the NC Brownfields Program.

SITE FOUR (Continued) **1012104920**

Latitude:	35.77289
Longitude:	-78.6405
HCM label:	Not reported
Map scale:	Not reported
Point of reference:	Not reported
Datum:	World Geodetic System of 1984
ACRES property ID:	72861
Start date:	21-Sep-07
Completed date:	21-Sep-07
Acres cleaned up:	Not reported
Cleanup funding:	13515
Cleanup funding source:	US EPA - Brownfields RLF Loan
Assessment funding:	Not reported
Assessment funding source:	Not reported
Redevelopment funding:	Not reported
Redev. funding source:	Not reported
Redev. funding entity name:	Not reported
Redevelopment start date:	21-Sep-07
Assessment funding entity:	Not reported
Cleanup funding entity:	EPA
Grant type:	N/A
Accomplishment type:	Not reported
Accomplishment count:	0
Cooperative agreement #:	97432901
Ownership entity:	Government
Current owner:	City of Raleigh
Did owner change:	N
Cleanup required:	Yes
Video available:	No
Photo available:	Yes
Institutional controls required:	N
IC Category proprietary controls:	Not reported
IC cat. info. devices:	Not reported
IC cat. gov. controls:	Not reported
IC cat. enforcement permit tools:	Not reported
IC in place date:	Not reported
IC in place:	Not reported
State/tribal program date:	Not reported
State/tribal program ID:	Not reported
State/tribal NFA date:	Not reported
Air contaminated:	Not reported
Air cleaned:	Not reported
Asbestos found:	Not reported
Asbestos cleaned:	Not reported
Controled substance found:	Not reported
Controled substance cleaned:	Not reported
Drinking water affected:	Not reported
Drinking water cleaned:	Not reported
Groundwater affected:	Y
Groundwater cleaned:	Y
Lead contaminant found:	Y
Lead cleaned up:	Not reported
No media affected:	Not reported
Unknown media affected:	Not reported
Other cleaned up:	Y
Other metals found:	Y
Other metals cleaned:	Not reported

SITE FOUR (Continued) **1012104920**

Other contaminants found:	Not reported
Other contams found description:	Not reported
PAHs found:	Not reported
PAHs cleaned up:	Not reported
PCBs found:	Not reported
PCBs cleaned up:	Not reported
Petro products found:	Y
Petro products cleaned:	Y
Sediments found:	Not reported
Sediments cleaned:	Not reported
Soil affected:	Not reported
Soil cleaned up:	Not reported
Surface water cleaned:	Not reported
Unknown found:	Not reported
VOCs found:	Y
VOCs cleaned:	Y
Cleanup other description:	Not reported
Num. of cleanup and re-dev. jobs:	415
Past use greenspace acreage:	Not reported
Past use residential acreage:	Not reported
Past use commercial acreage:	Not reported
Past use industrial acreage:	Not reported
Future use greenspace acreage:	Not reported
Future use residential acreage:	Not reported
Future use commercial acreage:	Not reported
Future use industrial acreage:	Not reported
Greenspace acreage and type:	Not reported
Superfund Fed. landowner flag:	Not reported

FINDS:

Registry ID: 110038726670

Environmental Interest/Information System
US EPA Assessment, Cleanup and Redevelopment Exchange System (ACRES) is an federal online database for Brownfields Grantees to electronically submit data directly to EPA.

---

82 **POOLE PROPERTY (BOBBY)** **NC LUST** **S110776518**
NNE **701 EAST LANE STREET** **N/A**
1/4-1/2 **RALEIGH, NC 27601**
0.491 mi.
2593 ft.

Relative:
Lower

Actual:
294 ft.

LUST:

Facility ID:	Not reported
UST Number:	RA-6838
Incident Number:	33986
Contamination Type:	Groundwater/Both
Source Type:	Leak-underground
Product Type:	PETROLEUM
Date Reported:	03/14/2011
Date Occur:	03/08/2011
Cleanup:	05/03/2011
Closure Request:	Not reported
Close Out:	04/15/2011

POOLE PROPERTY (BOBBY) (Continued) **S110776518**

Level Of Soil Cleanup Achieved: Residential
Tank Regulated Status: Both at same site
Of Supply Wells: 0
Commercial/NonCommercial UST Site: BOTH
Risk Classification: L
Risk Class Based On Review: L
Corrective Action Plan Type: Not reported
NOV Issue Date: Not reported
NORR Issue Date: Not reported
Site Priority: Not reported
Phase Of LSA Req: Not reported
Site Risk Reason: Not reported
Land Use: Residential
MTBE: No
MTBE1: No
Flag: No
Flag1: No
LUR Filed: 04/20/2011
Release Detection: 0
Current Status: File Located in House
RBCA GW: Cleanups to alternate standards
PETOPT: 4
RPL: False
CD Num: 0
Reel Num: 0
RPOW: False
RPOP: False
Error Flag: 0
Error Code: N
Valid: False
Lat/Long: 35 28 12.18 - 78 22 28.44
Lat/Long Decimal: 35.4700 -78.3745
Testlat: Not reported
Regional Officer Project Mgr: smj
Region: Raleigh
Company: Not reported
Contact Person: bobby poole
Telephone: 9196183182
RP Address: 1207 wake forest road
RP City,St,Zip: raleigh, NC 27604
RP County: Not reported
Comments: UST was used to sell kerosene via a hand pump in thestore as late as 2000 as well as heating the building. -MRP//
5 Min Quad: Not reported

PIRF:
Facility Id: 33986
Date Occurred: 3/8/211
Date Reported: 3/14/2011
Description Of Incident: Not reported
Owner/Operator: Not reported
Ownership: 4
Operation Type: 3
Type: 4
Location: 7
Site Priority: Not reported
Priority Update: Not reported
Wells Affected Y/N: N

POOLE PROPERTY (BOBBY) (Continued) **S110776518**

Samples Include:	Not reported
7#5 Minute Quad:	Y
5 Minute Quad:	Not reported
Pirf/Min Soil:	Not reported
Release Code:	Not reported
Source Code:	Not reported
Err Type:	3
Cause:	3
Source:	A
Ust Number:	P
Last Modified:	Not reported
Incident Phase:	**Closed Out**
NOV Issued:	Not reported
NORR Issued:	Not reported
45 Day Report:	Not reported
Public Meeting Held:	Not reported
Corrective Action Planned:	Not reported
SOC Signed:	Not reported
Reclassification Report:	Not reported
RS Designation:	Not reported
Closure Request Date:	Not reported
Close-out Report:	Not reported

Y83 **RALEIGH COAL GAS PLANT NO. 1** **CERCLIS** **1000482204**
WSW **S. MCDOWELL ST AT W. CABARRUS ST** **FINDS** **NCD986188894**
1/2-1 **RALEIGH, NC 27601** **NC SHWS**
0.541 mi. **NC VCP**
2856 ft. **Site 1 of 2 in cluster Y**

Relative:
Lower

Actual:
299 ft.

CERCLIS:

Site ID:	0405665
EPA ID:	NCD986188894
Facility County:	WAKE
Short Name:	RALEIGH COAL GAS PLANT NO
Congressional District:	04
IFMS ID:	Not reported
SMSA Number:	6640
USGC Hydro Unit:	03020201
Federal Facility:	Not a Federal Facility
DMNSN Number:	2.00000
Site Orphan Flag:	N
RCRA ID:	Not reported
USGS Quadrangle:	Not reported
Site Init By Prog:	Not reported
NFRAP Flag:	Not reported
Parent ID:	Not reported
RST Code:	Not reported
EPA Region:	04
Classification:	Not reported
Site Settings Code:	Not reported
NPL Status:	Not on the NPL
DMNSN Unit Code:	ACRE
RBRAC Code:	Not reported
RResp Fed Agency Code:	Not reported
Non NPL Status:	Other Cleanup Activity: State-Lead Cleanup
Non NPL Status Date:	04/19/05
Site Fips Code:	37183

RALEIGH COAL GAS PLANT NO. 1 (Continued) **1000482204**

CC Concurrence Date: / /
CC Concurrence FY: Not reported
Alias EPA ID: Not reported
Site FUDS Flag: Not reported

CERCLIS Site Contact Name(s):

Contact ID: 4270042.00000
Contact Name: Phil Vorsatz
Contact Tel: (404) 562-8789
Contact Title: Remedial Project Manager (RPM)
Contact Email: vorsatz.phillip@epa.gov

Contact ID: 4000084.00000
Contact Name: Jon Borholm
Contact Tel: (404) 562-8820
Contact Title: Remedial Project Manager (RPM)
Contact Email: bornholm.jon@epa.gov

Contact ID: 4270039.00000
Contact Name: Luis Flores
Contact Tel: (404) 562-8807
Contact Title: Remedial Project Manager (RPM)
Contact Email: flores.luis@epa.gov

Contact ID: 4000312.00000
Contact Name: Ken Mallary
Contact Tel: (404) 562-8802
Contact Title: Remedial Project Manager (RPM)
Contact Email: mallary.ken@epa.gov

Contact ID: 4000508.00000
Contact Name: Michael Townsend
Contact Tel: (404) 562-8813
Contact Title: Remedial Project Manager (RPM)
Contact Email: townsend.michael@epa.gov

Contact ID: 4000533.00000
Contact Name: Samantha UrquhartF
Contact Tel: (404) 562-8760
Contact Title: Remedial Project Manager (RPM)
Contact Email: urquhart-foster.samantha@epa.gov

Contact ID: 4000308.00000
Contact Name: Ken Lucas
Contact Tel: (404) 562-8953
Contact Title: Remedial Project Manager (RPM)
Contact Email: Not reported

Contact ID: 4000275.00000
Contact Name: William Joyner
Contact Tel: (404) 562-8795
Contact Title: Site Assessment Manager (SAM)
Contact Email: joyner.william@epa.gov

Contact ID: 13002428.00000
Contact Name: Donna Seadler
Contact Tel: (404) 562-8870

RALEIGH COAL GAS PLANT NO. 1 (Continued) **1000482204**

Contact Title: Site Assessment Manager (SAM)
Contact Email: seadler.donna@epa.gov

Contact ID: 4270104.00000
Contact Name: Jennifer Wendel
Contact Tel: (404) 562-8799
Contact Title: Site Assessment Manager (SAM)
Contact Email: wendel.jennifer@epa.gov

Contact ID: 4272610.00000
Contact Name: Carolyn Callihan
Contact Tel: (404) 562-8913
Contact Title: Site Assessment Manager (SAM)
Contact Email: Carolyn Callihan/R4/USEPA/US,

Alias Comments: Not reported
Site Description: COAL GAS PLANT OPERATED 1889 - 1930. Confirmed this site is covered by the MGP AOC with the State and cleanup is underway

CERCLIS Assessment History:

Action Code: 001
Action: DISCOVERY
Date Started: / /
Date Completed: 05/22/91
Priority Level: Not reported
Operable Unit: SITEWIDE
Primary Responsibility: State, Fund Financed
Planning Status: Not reported
Urgency Indicator: Not reported
Action Anomaly: Not reported

Action Code: 001
Action: PRELIMINARY ASSESSMENT
Date Started: / /
Date Completed: 04/14/93
Priority Level: Low priority for further assessment
Operable Unit: SITEWIDE
Primary Responsibility: State, Fund Financed
Planning Status: Not reported
Urgency Indicator: Not reported
Action Anomaly: Not reported

FINDS:

Registry ID: 110009340203

Environmental Interest/Information System
CERCLIS (Comprehensive Environmental Response, Compensation, and Liability Information System) is the Superfund database that is used to support management in all phases of the Superfund program. The system contains information on all aspects of hazardous waste sites, including an inventory of sites, planned and actual site activities, and financial information.

RALEIGH COAL GAS PLANT NO. 1 (Continued) **1000482204**

SHWS:
Facility ID: NCD986188894
Lat/Longitude: 35.7885119267497 / -78.6429362988889
Geolocation Method: HARD COPY MAP

VCP:
Facility ID: NCD986188894

Y84 **RALEIGH MGP NO. 1** **EDR MGP** **1008407293**
WSW **MCDOWELL AND CABARRUS STREETS** **N/A**
1/2-1 **RALEIGH, NC 27601**
0.546 mi.
2883 ft. **Site 2 of 2 in cluster Y**

Relative:
Lower

Actual:
299 ft.

Manufactured Gas Plants:
Alternate Name:RALEIGH GAS LIGHT CO/STANDARD GAS AND ELECTRIC/CAROLINA POWER AND LIGHT CO. No additional information available

---

85 **CONTEMPORARY ART MUSEUM** **NC SHWS** **S109541381**
West **409 W MARTIN ST** **NC LUST** **N/A**
1/2-1 **RALEIGH, NC**
0.650 mi.
3434 ft.

Relative:
Lower

Actual:
309 ft.

SHWS:
Facility ID: NONCD0002875
Lat/Longitude: 35.77694 / -78.64528
Geolocation Method: SUPPLIED BY OTHERS-UNSUBSTANTIATED

LUST:
Facility ID: Not reported
UST Number: RA-6699
Incident Number: 33856
Contamination Type: Soil
Source Type: Leak-underground
Product Type: PETROLEUM
Date Reported: 06/16/2010
Date Occur: 05/28/2010
Cleanup: 05/28/2010
Closure Request: Not reported
Close Out: Not reported
Level Of Soil Cleanup Achieved: Not reported
Tank Regulated Status: Regulated
Of Supply Wells: 0
Commercial/NonCommercial UST Site: COMMERCIAL
Risk Classification: I
Risk Class Based On Review: H
Corrective Action Plan Type: Not reported
NOV Issue Date: Not reported
NORR Issue Date: Not reported
Site Priority: Not reported
Phase Of LSA Req: Not reported
Site Risk Reason: Free product
Land Use: Not reported
MTBE: No
MTBE1: Unknown

CONTEMPORARY ART MUSEUM (Continued) **S109541381**

Flag:	No
Flag1:	No
LUR Filed:	Not reported
Release Detection:	0
Current Status:	File Located in House
RBCA GW:	Not reported
PETOPT:	3
RPL:	False
CD Num:	0
Reel Num:	0
RPOW:	False
RPOP:	False
Error Flag:	0
Error Code:	N
Valid:	False
Lat/Long:	35 46 37.2 - 78 38 42.84
Lat/Long Decimal:	35.7770 -78.6452
Testlat:	Not reported
Regional Officer Project Mgr:	SJ
Region:	Raleigh
Company:	Contemporary Art Foundation
Contact Person:	Linda Satterfield
Telephone:	Not reported
RP Address:	409 West Martin Street
RP City,St,Zip:	aleigh, NC 27603
RP County:	Not reported
Comments:	1K-gallon gasoline UST removed. 06/19/2010, JFM///
5 Min Quad:	Not reported

PIRF:

Facility Id:	33856
Date Occurred:	5/28/2010
Date Reported:	6/16/2010
Description Of Incident:	1K-gallon gasoline UST removed
Owner/Operator:	Not reported
Ownership:	1
Operation Type:	1
Type:	3
Location:	1
Site Priority:	Not reported
Priority Update:	Not reported
Wells Affected Y/N:	N
Samples Include:	Not reported
7#5 Minute Quad:	Y
5 Minute Quad:	Not reported
Pirf/Min Soil:	Not reported
Release Code:	Not reported
Source Code:	Not reported
Err Type:	2
Cause:	3
Source:	A
Ust Number:	P
Last Modified:	Not reported
Incident Phase:	**Not reported**
NOV Issued:	Not reported
NORR Issued:	Not reported
45 Day Report:	Not reported

CONTEMPORARY ART MUSEUM (Continued) **S109541381**

Public Meeting Held:	Not reported
Corrective Action Planned:	Not reported
SOC Signed:	Not reported
Reclassification Report:	Not reported
RS Designation:	Not reported
Closure Request Date:	Not reported
Close-out Report:	Not reported

---

86 **RALEIGH TTA-WILSON PARCEL** **NC SHWS** **S106916925**
West **200 S WEST ST** **N/A**
1/2-1 **RALEIGH, NC**
0.697 mi.
3681 ft.

Relative: **Higher**

Actual: **320 ft.**

SHWS:

Facility ID:	NONCD0001124
Lat/Longitude:	35.778357 / -78.646182
Geolocation Method:	GEOCODING

Z87 **RALEIGH TTA-SE PARCEL** **NC SHWS** **S106916924**
WNW **S WEST ST & MORGAN ST** **N/A**
1/2-1 **RALEIGH, NC**
0.709 mi.
3743 ft. **Site 1 of 3 in cluster Z**

Relative: **Higher**

Actual: **337 ft.**

SHWS:

Facility ID:	NONCD0001123
Lat/Longitude:	35.77984 / -78.645969
Geolocation Method:	GEOCODING

Z88 **RALEIGH TTA-DILLON PARCEL A** **NC SHWS** **S106916921**
WNW **102 S WEST ST** **N/A**
1/2-1 **RALEIGH, NC**
0.709 mi.
3743 ft. **Site 2 of 3 in cluster Z**

Relative: **Higher**

Actual: **337 ft.**

SHWS:

Facility ID:	NONCD0001125
Lat/Longitude:	35.779679 / -78.64614
Geolocation Method:	GEOCODING

Z89 **ROGERS REALTY PROPERTY** **NC SHWS** **S107497556**
WNW **500 WEST MORGAN, 10 S. STREET** **NC IMD** **N/A**
1/2-1 **RALEIGH, NC**
0.710 mi.
3748 ft. **Site 3 of 3 in cluster Z**

Relative: **Higher**

Actual: **337 ft.**

SHWS:

Facility ID:	NONCD0002416
Lat/Longitude:	35.78 / -78.649
Geolocation Method:	UNKNOWN

ROGERS REALTY PROPERTY (Continued) **S107497556**

IMD:

Region:	RAL
Facility ID:	87548
Date Occurred:	11/9/2005
Submit Date:	11/16/2005
GW Contam:	Yes, Groundwater Contamination has been detected
Soil Contam:	Not reported
Incident Desc:	2.3 PCE, 26 NAPTHALENE FOUND DURING PHASE II.
Operator:	ROGERS, JAMES
Contact Phone:	919-829-1953
Owner Company:	ROGERS REALTY AND INSURANCE
Operator Address:	875-B WASHINGTON STREET
Operator City:	RALEIGH
Oper City,St,Zip:	RALEIGH, NC 919-829-1953
Ownership:	Federal
Operation:	8
Material:	Not reported
Qty Lost 1:	Not reported
Qty Recovered 1:	Not reported
Source:	Unknown
Type:	Other inorganics
Location:	Not reported
Setting:	Not reported
Risk Site:	Not reported
Site Priority:	35
Priority Code:	E
Priority Update:	Not reported
Dem Contact:	J. ROUSH
Wells Affected:	No
Num Affected:	Not reported
Wells Contam:	Not reported
Sampled By:	Not reported
Samples Include:	Not reported
7.5 Min Quad:	Not reported
5 Min Quad:	Not reported
Latitude:	35.78
Longitude:	-78.649
Latitude Number:	Not reported
Longitude Number:	Not reported
Latitude Decimal:	Not reported
Longitude Decimal:	Not reported
GPS:	GPS
Agency:	DWQ
Facility ID:	87548
Last Modified:	11/16/2005
Incident Phase:	Follow Up
NOV Issued:	11/18/2005
NORR Issued:	Not reported
45 Day Report:	Not reported
Public Meeting Held:	Not reported
Corrective Action Planned:	Not reported
SOC Sighned:	Not reported
Reclassification Report:	Not reported
RS Designation:	Not reported
Closure Request Date:	Not reported
Close-out Report:	Not reported

90
WSW
1/2-1
0.810 mi.
4277 ft.

RALEIGH MGP NO. 2 — **EDR MGP** — **1008407294**
600 WEST CABARRUS STREET — **N/A**
RALEIGH, NC 27603

Relative:
Lower

Actual:
288 ft.

Manufactured Gas Plants:
Alternate Name:RALEIGH COAL GAS PLANT NO. 2. No additional information available

---

91
NW
1/2-1
0.948 mi.
5007 ft.

GLENWOOD AVENUE — **NC SHWS** — **S105912282**
413 SOUTH GLENWOOD AVENUE — **NC IMD** — **N/A**
RALEIGH, NC — **NC LAST**

Relative:
Lower

Actual:
300 ft.

SHWS:
Facility ID: NONCD0001780
Lat/Longitude: 35.785495 / -78.647428
Geolocation Method: UNKNOWN

IMD:
Region: RAL
Facility ID: 85103
Date Occurred: 5/23/2000
Submit Date: 12/5/2000
GW Contam: No data entered (data entry person submitted a blank field
Soil Contam: Not reported
Incident Desc: SOIL SAMPLES COLLECTED FOR PROPERTY TRANSFER RESULTED IN 540 PPM AND 284 PPM TPH 9071. ADDITIONAL SAMPLING DETECTED METHYLENE CHLORIDE AT .0301 PPM AND .0363. A
Operator: UNKNOWN,
Contact Phone: Not reported
Owner Company: UNKNOWN
Operator Address:Not reported
Operator City: Not reported
Oper City,St,Zip: Not reported
Ownership: Not Reported
Operation: Not Reported
Material: Not reported
Qty Lost 1: Not reported
Qty Recovered 1: Not reported
Source: Unknown
Type: Other petroleum product
Location: Not reported
Setting: Not reported
Risk Site: Not reported
Site Priority: Not reported
Priority Code: E
Priority Update: Not reported
Dem Contact: JIM ROUSH
Wells Affected: No
Num Affected: 0
Wells Contam: Not reported
Sampled By: Not reported
Samples Include: Not reported
7.5 Min Quad: Not reported
5 Min Quad: Not reported

GLENWOOD AVENUE (Continued) **S105912282**

Latitude:	Not reported
Longitude:	Not reported
Latitude Number:	Not reported
Longitude Number:	Not reported
Latitude Decimal:	Not reported
Longitude Decimal:	Not reported
GPS:	GPS
Agency:	DWQ
Facility ID:	85103
Last Modified:	6/20/2003
Incident Phase:	Discovery
NOV Issued:	Not reported
NORR Issued:	Not reported
45 Day Report:	Not reported
Public Meeting Held:	Not reported
Corrective Action Planned:	Not reported
SOC Sighned:	Not reported
Reclassification Report:	Not reported
RS Designation:	Not reported
Closure Request Date:	Not reported
Close-out Report:	Not reported

LAST:

Facility ID:	Not reported	
UST Number:	RA-85103	
Incident Number:	85103	
Contamination Type:		SL
Source Type:	1	
Product Type:	P	
Date Reported:	05/23/2000	
Date Occur:	05/23/2000	
Cleanup:	Not reported	
Closure Request:	Not reported	
Close Out:	Not reported	
Level Of Soil Cleanup Achieved:		Not reported
Tank Regulated Status:		Not reported
# Of Supply Wells:	0	
Commercial/NonCommercial UST Site:		Not reported
Risk Classification:		Not reported
Risk Class Based On Review:		U
Corrective Action Plan Type:		Not reported
NOV Issue Date:	Not reported	
NORR Issue Date:	Not reported	
Site Priority:	20	
Phase Of LSA Req:	Not reported	
Site Risk Reason:	Not reported	
Land Use:	Not reported	
MTBE:	No	
MTBE1:	Unknown	
Flag:	No	
Flag1:	No	
LUR Filed:	Not reported	
Release Detection:	0	
Current Status:	C	
RBCA GW:	Not reported	
PETOPT:	5	

GLENWOOD AVENUE (Continued) **S105912282**

RPL: False
CD Num: 0
Reel Num: 0
RPOW: False
RPOP: False
Error Flag: 0
Error Code: Not reported
Valid: False
Lat/Long: 35 47 78 38
Lat/Long Decimal: 35.78549 78.647428
Testlat: Not reported
Regional Officer Project Mgr: Not reported
Region: RAL
Company: UNKNOWN
Contact Person: UNKNOWN
Telephone: Not reported
RP Address: Not reported
RP City,St,Zip: NC
RP County: Not reported
Comments: SOIL SAMPLES COLLECTED FOR PROPERTY TRANSFER RESULTED IN 540 PPM AND 284 PPM TPH 9071. ADDITIONAL SAMPLING DETECTED METHYLENE CHLORIDE AT .0301 PPM AND .0363. ALSO, LEAD 13.5 PPM AND 10.1 PPM. PROPERTY IS NOW "HELIOS COFFEE COMPANY" 919-838-5177. 6/03
5 Min Quad: Not reported

PIRF:
Facility Id: 85103
Date Occurred: Not reported
Date Reported: Not reported
Description Of Incident: Not reported
Owner/Operator: Not reported
Ownership: 0
Operation Type: 0
Type: Not reported
Location: Not reported
Site Priority: 20E
Priority Update: Not reported
Wells Affected Y/N: N
Samples Include: 0
7#5 Minute Quad: Not reported
5 Minute Quad: Not reported
Pirf/Min Soil: Not reported
Release Code: Not reported
Source Code: Not reported
Err Type: Not reported
Cause: Not reported
Source: Not reported
Ust Number: 1

Last Modified: 6/20/2003
Incident Phase: DI
NOV Issued: Not reported
NORR Issued: Not reported
45 Day Report: Not reported
Public Meeting Held: Not reported
Corrective Action Planned: Not reported
SOC Signed: Not reported
Reclassification Report: Not reported

GLENWOOD AVENUE (Continued) **S105912282**

RS Designation: Not reported
Closure Request Date: Not reported
Close-out Report: Not reported

92
South
1/2-1
0.963 mi.
5087 ft.

Relative:
Lower

Actual:
259 ft.

ASHLAND INC.
1415 BLOODWORTH ST
RALEIGH, NC 27601

RCRA-TSDF **1000881885**
CERC-NFRAP **NCD088560032**
CORRACTS
RCRA-CESQG
FINDS
2020 COR ACTION
US FIN ASSUR

RCRA-TSDF:
Date form received by agency: 05/17/2012
Facility name: ASHLAND INC.
Facility address: 1415 S. BLOODWORTH STREET
RALEIGH, NC 27601
EPA ID: NCD088560032
Mailing address: BLAZER PARKWAY
DUBLIN, OH 43017
Contact: MICHAEL B DEVER
Contact address: BLAZER PARKWAY EH&S, DS-4
DUBLIN, OH 43017
Contact country: US
Contact telephone: (614) 790-1586
Contact email: MBDEVER@ASHLAND.COM
EPA Region: 04
Land type: Private
Classification: TSDF
Description: Handler is engaged in the treatment, storage or disposal of hazardous waste
Classification: Conditionally Exempt Small Quantity Generator
Description: Handler: generates 100 kg or less of hazardous waste per calendar month, and accumulates 1000 kg or less of hazardous waste at any time; or generates 1 kg or less of acutely hazardous waste per calendar month, and accumulates at any time: 1 kg or less of acutely hazardous waste; or 100 kg or less of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste; or generates 100 kg or less of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste during any calendar month, and accumulates at any time: 1 kg or less of acutely hazardous waste; or 100 kg or less of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste

Owner/Operator Summary:
Owner/operator name: ASHLAND INC.
Owner/operator address: E. RIVER CENTER BLVD
COVINGTON, KY 41012
Owner/operator country: US
Owner/operator telephone: Not reported
Legal status: Private
Owner/Operator Type: Owner
Owner/Op start date: 01/01/1992
Owner/Op end date: Not reported

ASHLAND INC. (Continued) **1000881885**

Owner/operator name: ASHLAND INC.
Owner/operator address: Not reported
Not reported
Owner/operator country: Not reported
Owner/operator telephone: Not reported
Legal status: Private
Owner/Operator Type: Operator
Owner/Op start date: 01/01/1992
Owner/Op end date: Not reported

Handler Activities Summary:
U.S. importer of hazardous waste: No
Mixed waste (haz. and radioactive): No
Recycler of hazardous waste: No
Transporter of hazardous waste: No
Treater, storer or disposer of HW: Yes
Underground injection activity: No
On-site burner exemption: No
Furnace exemption: No
Used oil fuel burner: No
Used oil processor: No
User oil refiner: No
Used oil fuel marketer to burner: No
Used oil Specification marketer: No
Used oil transfer facility: No
Used oil transporter: No

Historical Generators:
Date form received by agency: 03/23/2010
Facility name: ASHLAND INC.
Classification: Small Quantity Generator

Date form received by agency: 02/13/2009
Facility name: ASHLAND INC.
Site name: ASHLAND INC
Classification: Conditionally Exempt Small Quantity Generator

Date form received by agency: 05/12/2008
Facility name: ASHLAND INC.
Classification: Conditionally Exempt Small Quantity Generator

Date form received by agency: 12/08/2005
Facility name: ASHLAND INC.
Site name: ASHLAND DISTRIBUTION
Classification: Small Quantity Generator

Date form received by agency: 11/17/2004
Facility name: ASHLAND INC.
Site name: ASHLAND DISTRIBUTION CO
Classification: Small Quantity Generator

Date form received by agency: 05/14/2004
Facility name: ASHLAND INC.
Site name: ASHLAND DISTRIBUTION COMPANY
Classification: Small Quantity Generator

ASHLAND INC. (Continued) **1000881885**

Date form received by agency: 12/17/2002
Facility name: ASHLAND INC.
Site name: ASHLAND DISTRIBUTION CO
Classification: Large Quantity Generator

Date form received by agency: 02/27/2002
Facility name: ASHLAND INC.
Site name: ASHLAND DISTRIBUTION
Classification: Large Quantity Generator

Date form received by agency: 01/18/2000
Facility name: ASHLAND INC.
Site name: ASHLAND DISTRIBUTION CO
Classification: Large Quantity Generator

Date form received by agency: 01/12/2000
Facility name: ASHLAND INC.
Site name: ASHLAND DISTRIBUTION
Classification: Large Quantity Generator

Date form received by agency: 11/13/1998
Facility name: ASHLAND INC.
Site name: ASHLAND CHEMICAL CO
Classification: Large Quantity Generator

Date form received by agency: 03/01/1996
Facility name: ASHLAND INC.
Site name: ASHLAND CHEMICAL CO.
Classification: Large Quantity Generator

Date form received by agency: 11/14/1994
Facility name: ASHLAND INC.
Site name: ASHLAND DISTRIBUTION CO
Classification: Large Quantity Generator

Date form received by agency: 05/18/1994
Facility name: ASHLAND INC.
Site name: ASHLAND DISTRIBUTION CO
Classification: Large Quantity Generator

Date form received by agency: 04/12/1994
Facility name: ASHLAND INC.
Site name: ASHLAND CHEMICAL COMPANY
Classification: Large Quantity Generator

Date form received by agency: 02/03/1992
Facility name: ASHLAND INC.
Site name: ASHLAND CHEMICAL INC.
Classification: Large Quantity Generator

Hazardous Waste Summary:
Waste code: D001
Waste name: IGNITABLE HAZARDOUS WASTES ARE THOSE WASTES WHICH HAVE A FLASHPOINT OF LESS THAN 140 DEGREES FAHRENHEIT AS DETERMINED BY A PENSKY-MARTENS CLOSED CUP FLASH POINT TESTER. ANOTHER METHOD OF DETERMINING THE FLASH POINT OF A WASTE IS TO REVIEW THE MATERIAL SAFETY DATA SHEET, WHICH CAN BE OBTAINED FROM THE MANUFACTURER OR DISTRIBUTOR OF THE

ASHLAND INC. (Continued) **1000881885**

MATERIAL. LACQUER THINNER IS AN EXAMPLE OF A COMMONLY USED SOLVENT WHICH WOULD BE CONSIDERED AS IGNITABLE HAZARDOUS WASTE.

Corrective Action Summary:

Event date:	06/20/2003
Event:	RFA Completed
Event date:	08/19/2008
Event:	CA552
Event date:	09/20/2010
Event:	CA Prioritization, Facility or area was assigned a medium corrective action priority.
Event date:	06/07/2011
Event:	Current Human Exposures under Control, Yes, Current Human Exposures Under Control has been verified. Based on a review of information contained in the EI determination, current human exposures are expected to be under control at the facility under current and reasonably expected conditions. This determination will be re-evaluated when the Agency/State becomes aware of significant changes at the facility.
Event date:	06/07/2011
Event:	Igration of Contaminated Groundwater under Control, Yes, Migration of Contaminated Groundwater Under Control has been verified. Based on a review of information contained in the EI determination, it has been determined that migration of contaminated groundwater is under control at the facility. Specifically, this determination indicates that the migration of contaminated groundwater is under control, and that monitoring will be conducted to confirm that contaminated groundwater remains within the existing area of contaminated groundwater. This determination will be re-evaluated when the Agency becomes aware of significant changes at the facility.
Event date:	09/17/2012
Event:	CA550NR
Event date:	09/17/2012
Event:	Date For Remedy Selection (CM Imposed)
Event date:	Not reported
Event:	RFA Completed

Facility Has Received Notices of Violations:

Regulation violated:	Not reported
Area of violation:	Generators - Pre-transport
Date violation determined:	04/15/2004
Date achieved compliance:	06/03/2004
Violation lead agency:	State
Enforcement action:	WRITTEN INFORMAL
Enforcement action date:	04/26/2004
Enf. disposition status:	Not reported
Enf. disp. status date:	Not reported
Enforcement lead agency:	State
Proposed penalty amount:	Not reported

ASHLAND INC. (Continued) **1000881885**

Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: SR - 262.41
Area of violation: Generators - Records/Reporting
Date violation determined: 03/03/1994
Date achieved compliance: 04/15/1994
Violation lead agency: State
Enforcement action: WRITTEN INFORMAL
Enforcement action date: 04/05/1994
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: State
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: SR - 264.54
Area of violation: Generators - General
Date violation determined: 09/16/1992
Date achieved compliance: 11/02/1992
Violation lead agency: State
Enforcement action: WRITTEN INFORMAL
Enforcement action date: 09/16/1992
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: State
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: Not reported
Area of violation: TSD IS-Ground-Water Monitoring
Date violation determined: 06/05/1990
Date achieved compliance: 06/01/1992
Violation lead agency: State
Enforcement action: Not reported
Enforcement action date: Not reported
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: Not reported
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: Not reported
Area of violation: TSD - General
Date violation determined: 08/27/1987
Date achieved compliance: 06/01/1992
Violation lead agency: State
Enforcement action: Not reported
Enforcement action date: Not reported
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: Not reported
Proposed penalty amount: Not reported
Final penalty amount: Not reported

ASHLAND INC. (Continued) **1000881885**

Paid penalty amount: Not reported

Regulation violated: SR - 262.
Area of violation: Generators - General
Date violation determined: 10/30/1985
Date achieved compliance: 06/01/1992
Violation lead agency: State
Enforcement action: INITIAL 3008(A) COMPLIANCE
Enforcement action date: 11/15/1985
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: State
Proposed penalty amount: 85000
Final penalty amount: 8500
Paid penalty amount: 8500

Regulation violated: SR - 264.
Area of violation: TSD - General
Date violation determined: 10/30/1985
Date achieved compliance: 06/01/1992
Violation lead agency: State
Enforcement action: INITIAL 3008(A) COMPLIANCE
Enforcement action date: 11/15/1985
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: State
Proposed penalty amount: 85000
Final penalty amount: 8500
Paid penalty amount: 8500

Regulation violated: SR - 264.
Area of violation: TSD IS-Ground-Water Monitoring
Date violation determined: 10/30/1985
Date achieved compliance: 06/01/1992
Violation lead agency: State
Enforcement action: INITIAL 3008(A) COMPLIANCE
Enforcement action date: 11/15/1985
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: State
Proposed penalty amount: 85000
Final penalty amount: 8500
Paid penalty amount: 8500

Evaluation Action Summary:
Evaluation date: 05/24/2012
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: State

Evaluation date: 03/22/2012
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: State

ASHLAND INC. (Continued) **1000881885**

Evaluation date: 03/22/2012
Evaluation: FINANCIAL RECORD REVIEW
Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: State

Evaluation date: 03/20/2012
Evaluation: FINANCIAL RECORD REVIEW
Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: State

Evaluation date: 08/30/2011
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: State

Evaluation date: 08/16/2011
Evaluation: FINANCIAL RECORD REVIEW
Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: State

Evaluation date: 07/26/2011
Evaluation: NON-FINANCIAL RECORD REVIEW
Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: State

Evaluation date: 01/12/2011
Evaluation: NON-FINANCIAL RECORD REVIEW
Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: State

Evaluation date: 09/28/2010
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: State

Evaluation date: 09/16/2010
Evaluation: FINANCIAL RECORD REVIEW
Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: State

Evaluation date: 07/06/2010
Evaluation: NON-FINANCIAL RECORD REVIEW
Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: State

Evaluation date: 06/08/2010
Evaluation: NON-FINANCIAL RECORD REVIEW
Area of violation: Not reported

ASHLAND INC. (Continued) **1000881885**

Date achieved compliance: Not reported
Evaluation lead agency: State

Evaluation date: 03/23/2010
Evaluation: GROUNDWATER MONITORING EVALUATION
Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: State

Evaluation date: 12/15/2009
Evaluation: NON-FINANCIAL RECORD REVIEW
Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: State

Evaluation date: 08/17/2009
Evaluation: FINANCIAL RECORD REVIEW
Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: State

Evaluation date: 05/29/2009
Evaluation: NON-FINANCIAL RECORD REVIEW
Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: State

Evaluation date: 12/15/2008
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: State

Evaluation date: 11/25/2008
Evaluation: NON-FINANCIAL RECORD REVIEW
Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: State

Evaluation date: 05/28/2008
Evaluation: NON-FINANCIAL RECORD REVIEW
Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: State

Evaluation date: 02/27/2008
Evaluation: NON-FINANCIAL RECORD REVIEW
Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: State

Evaluation date: 02/07/2008
Evaluation: FINANCIAL RECORD REVIEW
Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: State

ASHLAND INC. (Continued) **1000881885**

Evaluation date: 02/01/2008
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: State

Evaluation date: 01/16/2008
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: State

Evaluation date: 08/22/2007
Evaluation: FINANCIAL RECORD REVIEW
Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: EPA

Evaluation date: 06/20/2007
Evaluation: NON-FINANCIAL RECORD REVIEW
Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: State

Evaluation date: 02/20/2007
Evaluation: FINANCIAL RECORD REVIEW
Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: State

Evaluation date: 02/05/2007
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: State

Evaluation date: 11/30/2006
Evaluation: NON-FINANCIAL RECORD REVIEW
Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: State

Evaluation date: 05/02/2006
Evaluation: NON-FINANCIAL RECORD REVIEW
Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: State

Evaluation date: 04/26/2006
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: State

Evaluation date: 01/18/2006
Evaluation: FINANCIAL RECORD REVIEW
Area of violation: Not reported

ASHLAND INC. (Continued) **1000881885**

Date achieved compliance: Not reported
Evaluation lead agency: State

Evaluation date: 10/22/2005
Evaluation: NON-FINANCIAL RECORD REVIEW
Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: State

Evaluation date: 02/15/2005
Evaluation: FINANCIAL RECORD REVIEW
Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: State

Evaluation date: 06/03/2004
Evaluation: COMPLIANCE SCHEDULE EVALUATION
Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: State

Evaluation date: 04/15/2004
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: Generators - Pre-transport
Date achieved compliance: 06/03/2004
Evaluation lead agency: State

Evaluation date: 04/01/2004
Evaluation: GROUNDWATER MONITORING EVALUATION
Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: State

Evaluation date: 01/13/2004
Evaluation: FINANCIAL RECORD REVIEW
Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: State

Evaluation date: 05/22/2003
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: State

Evaluation date: 03/03/2003
Evaluation: FINANCIAL RECORD REVIEW
Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: State

Evaluation date: 03/14/2002
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: State

ASHLAND INC. (Continued) **1000881885**

Evaluation date: 02/25/2002
Evaluation: FINANCIAL RECORD REVIEW
Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: State

Evaluation date: 04/30/2001
Evaluation: FINANCIAL RECORD REVIEW
Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: State

Evaluation date: 03/06/2001
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: State

Evaluation date: 03/02/2000
Evaluation: FINANCIAL RECORD REVIEW
Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: State

Evaluation date: 02/11/2000
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: State

Evaluation date: 04/09/1999
Evaluation: NON-FINANCIAL RECORD REVIEW
Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: State

Evaluation date: 03/10/1999
Evaluation: FINANCIAL RECORD REVIEW
Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: State

Evaluation date: 02/04/1999
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: State

Evaluation date: 05/26/1998
Evaluation: GROUNDWATER MONITORING EVALUATION
Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: State

Evaluation date: 02/23/1998
Evaluation: GROUNDWATER MONITORING EVALUATION
Area of violation: Not reported

ASHLAND INC. (Continued) **1000881885**

Date achieved compliance: Not reported
Evaluation lead agency: State

Evaluation date: 01/08/1998
Evaluation: FINANCIAL RECORD REVIEW
Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: State

Evaluation date: 12/10/1997
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: State

Evaluation date: 08/20/1997
Evaluation: NON-FINANCIAL RECORD REVIEW
Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: State

Evaluation date: 08/08/1997
Evaluation: NON-FINANCIAL RECORD REVIEW
Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: State

Evaluation date: 01/02/1997
Evaluation: FINANCIAL RECORD REVIEW
Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: State

Evaluation date: 12/05/1996
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: State

Evaluation date: 10/23/1996
Evaluation: NON-FINANCIAL RECORD REVIEW
Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: State

Evaluation date: 03/21/1996
Evaluation: NON-FINANCIAL RECORD REVIEW
Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: State

Evaluation date: 03/12/1996
Evaluation: FINANCIAL RECORD REVIEW
Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: State

ASHLAND INC. (Continued) **1000881885**

Evaluation date: 02/27/1996
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: State

Evaluation date: 12/13/1995
Evaluation: NON-FINANCIAL RECORD REVIEW
Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: State

Evaluation date: 08/15/1995
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: State

Evaluation date: 03/28/1995
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: State

Evaluation date: 12/22/1994
Evaluation: FINANCIAL RECORD REVIEW
Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: State

Evaluation date: 08/18/1994
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: State

Evaluation date: 05/11/1994
Evaluation: GROUNDWATER MONITORING EVALUATION
Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: State

Evaluation date: 04/15/1994
Evaluation: COMPLIANCE SCHEDULE EVALUATION
Area of violation: Generators - Records/Reporting
Date achieved compliance: 04/15/1994
Evaluation lead agency: State

Evaluation date: 03/03/1994
Evaluation: FOLLOW-UP INSPECTION
Area of violation: Generators - Records/Reporting
Date achieved compliance: 04/15/1994
Evaluation lead agency: State

Evaluation date: 02/23/1994
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: Not reported

ASHLAND INC. (Continued) **1000881885**

Date achieved compliance: Not reported
Evaluation lead agency: State

Evaluation date: 01/04/1994
Evaluation: FINANCIAL RECORD REVIEW
Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: State

Evaluation date: 12/08/1993
Evaluation: NON-FINANCIAL RECORD REVIEW
Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: State

Evaluation date: 08/28/1993
Evaluation: FOCUSED COMPLIANCE INSPECTION
Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: State

Evaluation date: 08/27/1993
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: State

Evaluation date: 08/23/1993
Evaluation: FINANCIAL RECORD REVIEW
Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: State

Evaluation date: 02/25/1993
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: State

Evaluation date: 11/02/1992
Evaluation: COMPLIANCE SCHEDULE EVALUATION
Area of violation: Generators - General
Date achieved compliance: 11/02/1992
Evaluation lead agency: State

Evaluation date: 09/29/1992
Evaluation: NON-FINANCIAL RECORD REVIEW
Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: State

Evaluation date: 09/16/1992
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: State

ASHLAND INC. (Continued) **1000881885**

Evaluation date: 06/12/1992
Evaluation: NON-FINANCIAL RECORD REVIEW
Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: State

Evaluation date: 05/21/1992
Evaluation: NON-FINANCIAL RECORD REVIEW
Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: State

Evaluation date: 05/20/1992
Evaluation: NON-FINANCIAL RECORD REVIEW
Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: State

Evaluation date: 04/29/1992
Evaluation: NON-FINANCIAL RECORD REVIEW
Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: State

Evaluation date: 03/12/1992
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: State

Evaluation date: 02/27/1992
Evaluation: NON-FINANCIAL RECORD REVIEW
Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: State

Evaluation date: 02/14/1992
Evaluation: GROUNDWATER MONITORING EVALUATION
Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: State

Evaluation date: 01/30/1992
Evaluation: NON-FINANCIAL RECORD REVIEW
Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: State

Evaluation date: 01/09/1992
Evaluation: FINANCIAL RECORD REVIEW
Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: State

Evaluation date: 09/19/1991
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: Not reported

ASHLAND INC. (Continued) **1000881885**

Date achieved compliance: Not reported
Evaluation lead agency: State

Evaluation date: 04/09/1991
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: State

Evaluation date: 01/08/1991
Evaluation: FINANCIAL RECORD REVIEW
Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: State

Evaluation date: 10/24/1990
Evaluation: FINANCIAL RECORD REVIEW
Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: State

Evaluation date: 08/10/1990
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: State

Evaluation date: 06/05/1990
Evaluation: GROUNDWATER MONITORING EVALUATION
Area of violation: TSD IS-Ground-Water Monitoring
Date achieved compliance: 06/01/1992
Evaluation lead agency: State

Evaluation date: 05/22/1990
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: State

Evaluation date: 01/03/1990
Evaluation: FINANCIAL RECORD REVIEW
Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: State

Evaluation date: 09/07/1989
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: State

Evaluation date: 04/13/1989
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: State

ASHLAND INC. (Continued) **1000881885**

Evaluation date: 01/05/1989
Evaluation: FINANCIAL RECORD REVIEW
Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: State

Evaluation date: 09/01/1988
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: State

Evaluation date: 09/01/1988
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: EPA-Initiated Oversight/Observation/Training Actions

Evaluation date: 04/13/1988
Evaluation: FINANCIAL RECORD REVIEW
Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: State

Evaluation date: 12/31/1987
Evaluation: FINANCIAL RECORD REVIEW
Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: State

Evaluation date: 10/12/1987
Evaluation: NON-FINANCIAL RECORD REVIEW
Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: State

Evaluation date: 08/27/1987
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: TSD - General
Date achieved compliance: 06/01/1992
Evaluation lead agency: State

Evaluation date: 10/30/1985
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: TSD - General
Date achieved compliance: 06/01/1992
Evaluation lead agency: State

Evaluation date: 10/30/1985
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: TSD IS-Ground-Water Monitoring
Date achieved compliance: 06/01/1992
Evaluation lead agency: State

Evaluation date: 10/30/1985
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: Generators - General

ASHLAND INC. (Continued) **1000881885**

Date achieved compliance: 06/01/1992
Evaluation lead agency: State

CERC-NFRAP:
Site ID: 0402934
Federal Facility: Not a Federal Facility
NPL Status: Not on the NPL
Non NPL Status: NFRAP-Site does not qualify for the NPL based on existing information

CERCLIS-NFRAP Site Contact Details:
Contact Sequence ID: 4309281.00000
Person ID: 4270042.00000

Contact Sequence ID: 4357155.00000
Person ID: 4000084.00000

Contact Sequence ID: 4368680.00000
Person ID: 4270039.00000

Contact Sequence ID: 4429184.00000
Person ID: 4000312.00000

Contact Sequence ID: 4430101.00000
Person ID: 4000508.00000

Contact Sequence ID: 4537935.00000
Person ID: 4000533.00000

Contact Sequence ID: 4702154.00000
Person ID: 4000308.00000

Contact Sequence ID: 4752008.00000
Person ID: 4000275.00000

Contact Sequence ID: 4777137.00000
Person ID: 13002428.00000

Contact Sequence ID: 4830775.00000
Person ID: 4270104.00000

Contact Sequence ID: 13094084.00000
Person ID: 4272610.00000

CERCLIS-NFRAP Site Alias Name(s):
Alias Name: ASHLAND CHEM CO
Alias Address: Not reported
WAKE, NC

CERCLIS-NFRAP Assessment History:
Action: PRELIMINARY ASSESSMENT
Date Started: / /
Date Completed: 01/31/89
Priority Level: NFRAP-Site does not qualify for the NPL based on existing information

Action: ARCHIVE SITE
Date Started: / /

ASHLAND INC. (Continued) **1000881885**

Date Completed: 01/31/89
Priority Level: Not reported

Action: PRELIMINARY ASSESSMENT
Date Started: / /
Date Completed: 03/01/85
Priority Level: Low priority for further assessment

Action: DISCOVERY
Date Started: / /
Date Completed: 08/01/80
Priority Level: Not reported

CORRACTS:

EPA ID: NCD088560032
EPA Region: 04
Area Name: ENTIRE FACILITY
Actual Date: 20110607
Action: CA725YE - Current Human Exposures Under Control, Yes, Current Human Exposures Under Control has been verified
NAICS Code(s): 56221
Waste Treatment and Disposal
Original schedule date: 20110607
Schedule end date: Not reported

EPA ID: NCD088560032
EPA Region: 04
Area Name: ENTIRE FACILITY
Actual Date: 20110607
Action: CA750YE - Migration of Contaminated Groundwater under Control, Yes, Migration of Contaminated Groundwater Under Control has been verified
NAICS Code(s): 56221
Waste Treatment and Disposal
Original schedule date: 20110607
Schedule end date: Not reported

EPA ID: NCD088560032
EPA Region: 04
Area Name: ENTIRE FACILITY
Actual Date: 20030620
Action: CA050 - RFA Completed
NAICS Code(s): 56221
Waste Treatment and Disposal
Original schedule date: Not reported
Schedule end date: Not reported

EPA ID: NCD088560032
EPA Region: 04
Area Name: ENTIRE FACILITY
Actual Date: 20080819
Action: CA552
NAICS Code(s): 56221
Waste Treatment and Disposal
Original schedule date: Not reported
Schedule end date: Not reported

ASHLAND INC. (Continued) **1000881885**

EPA ID: NCD088560032
EPA Region: 04
Area Name: ENTIRE FACILITY
Actual Date: 20120917
Action: CA400 - Date For Remedy Selection (CM Imposed)
NAICS Code(s): 56221
Waste Treatment and Disposal
Original schedule date: 20120917
Schedule end date: Not reported

EPA ID: NCD088560032
EPA Region: 04
Area Name: ENTIRE FACILITY
Actual Date: 20120917
Action: CA550NR
NAICS Code(s): 56221
Waste Treatment and Disposal
Original schedule date: 20120917
Schedule end date: Not reported

EPA ID: NCD088560032
EPA Region: 04
Area Name: ENTIRE FACILITY
Actual Date: 20100920
Action: CA075ME - CA Prioritization, Facility or area was assigned a medium corrective action priority
NAICS Code(s): 56221
Waste Treatment and Disposal
Original schedule date: 20100920
Schedule end date: Not reported

FINDS:

Registry ID: 110000701027

Environmental Interest/Information System

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

NC-FITS (North Carolina - Facility Identification Template For States) is North Carolina Department of Environment and Natural Resources' (NCDENR) Facility Identification Template for States that provides a common facility identifier in order to improve accessibility to comprehensive information about environmental regulated entities in the state of North Carolina.

HAZARDOUS WASTE BIENNIAL REPORTER

2020 COR ACTION:
EPA ID: NCD088560032
Region: 4

ASHLAND INC. (Continued) **1000881885**

Action: Not reported

US FIN ASSUR:

EPA ID:	NCD088560032
Provider:	ASHLAND INC.
EPA region:	4
County:	WAKE
Mechanism type:	FINANCIAL TEST
Mechanism ID:	FINANCIAL TEST-POST-CLOSURE
Cost estimate:	1487000
Face value:	66776209
Effective date:	12/31/2008

EPA ID:	NCD088560032
Provider:	INDIAN HARBOR INSURANCE COMPANY
EPA region:	4
County:	WAKE
Mechanism type:	INSURANCE
Mechanism ID:	PEC002835501
Cost estimate:	1487000
Face value:	1487000
Effective date:	4/10/2010

EPA ID:	NCD088560032
Provider:	ASHLAND INC.
EPA region:	4
County:	WAKE
Mechanism type:	FINANCIAL TEST
Mechanism ID:	2011 Submittal
Cost estimate:	1504844
Face value:	61158345
Effective date:	3/31/2011

EPA ID:	NCD088560032
Provider:	ARGONAUT INSURANCE COMPANY
EPA region:	4
County:	WAKE
Mechanism type:	SURETY BOND GUARANTEEING PAYMENTS TO A TRUST FUND
Mechanism ID:	SUR0017666
Cost estimate:	1540960
Face value:	1540960
Effective date:	1/31/2012

EPA ID:	NCD088560032
Provider:	PNC BANK
EPA region:	4
County:	WAKE
Mechanism type:	STANDBY TRUST
Mechanism ID:	20-70-002-3619662
Cost estimate:	1540960
Face value:	0
Effective date:	2/3/2012

Count: 43 records. ORPHAN SUMMARY

City	EDR ID	Site Name	Site Address	Zip	Database(s)
GARNER	U001434684	COUNTRY CUPBOARD 1	1825 HWY 70 E	27610	NC UST
GARNER	S111161356	INSERV DIESEL FUEL RELEASE	S NC HWY 401	27603	NC LAST
RALEIGH	U003134393	DILLARDS EXXON	RT 10 & LEESVILLE RD	27603	NC UST
RALEIGH	U001435049	N.W. POOLE WELL & PUMP CO.. I	RT 12	27610	NC UST
RALEIGH	S108437662	NC DEPT. OF AGRICULTURE LF	HC 1656 & TRINITY RD STATE FA		NC OLI
RALEIGH	U003143244	HOLDERS STORE	RT 2 & ROCK QUARRY RD	27610	NC UST
RALEIGH	U003134380	MCEWEN LUMBER COMPANY	RT 2	27610	NC UST
RALEIGH	U001435541	VILLAGE CONVENIENT MART	HWY 401 S	27603	NC UST, NC Financial Assurance
RALEIGH	S106916923	RALEIGH TTA-DILLON PARCEL C	510TH & 602ND W MARTIN ST		NC SHWS
RALEIGH	U003993975	SHEETZ INC 371	5200TH NEW BERN AVE & ROGERS		NC UST
RALEIGH	U001435414	EATMANS CARPETS	HWY 70 E	27601	NC UST
RALEIGH	1003868962	AUBURN CHURCH ROAD DRUM	AUBURN CHURCH RD		CERC-NFRAP, NC SHWS
RALEIGH	S109164270	NC DEPT OF AGRICULTURE PESTICIDE P	BLUE RIDGE RD		NC SWF/LF
RALEIGH	S109164276	W E GARRISON COMPANY	2200 N BLVD		NC SWF/LF
RALEIGH	1011307563	SE CORNER BRANCH & BLOUNT STREET	BRANCH & BLOUNT STS	27601	US BROWNFIELDS, FINDS
RALEIGH	S103554516	RALEIGH COAL GAS PLANT NO. 2	W CABARRUS ST		NC SHWS, NC VCP
RALEIGH	S110629987	HANDEE HUGOS # 79.	2825 CAPITAL NORTH BLVD		NC LUST, NC LUST TRUST
RALEIGH	S110629833	NORTH WAKE CO HHW COLLECTION FACIL	9037 DEPOINE DR		NC SWF/LF
RALEIGH	S112168951	WAKE COUNTY CDLF	9025 DEPONIES DR		NC SWF/LF
RALEIGH	1007711301	BLOCK A-24 PARKING DECK	NORTH EAST QUAD OF CABARRUS ST	27601	FINDS
RALEIGH	S103240128	CAROLINA POWER & LIGHT CO	HARRIS PLANT SITE		NC SWF/LF, NC HIST LF
RALEIGH	S113193260	FMW/MJH PROPERTY	2604 HILLSBOROUGH ST	27603	NC LUST
RALEIGH	S105764980	WHITE WALL SHELL	HILLSBOROUGH ST		NC SHWS, NC IMD
RALEIGH	S106168546	NC STATE UNIVERSITY COMPOST FACILI	INWOOD RD		NC SWF/LF, NC HIST LF
RALEIGH	S109136151	MEDLIN-DAVIS DRY CLEANERS-SALISBUR	W JONES AND SALISBURY STS		NC SHWS, NC VCP
RALEIGH	S109015476	RALEIGH NEUSE RIVER WWTP METHANOL	NEUSE RIV		NC SHWS
RALEIGH	S109015513	NCDOT SITE # 29	NORTHSIDE DR		NC SHWS
RALEIGH	S105163931	N.C. STATE FAIR LANDFILL	NOWELL RD		NC SWF/LF, NC HIST LF
RALEIGH	S102443304	OLDE STAGE GOLF & COUNTRY CLUB	OLD STAGE ROAD SR 1006		NC IMD, NC LAST
RALEIGH	S106349416	NCDOT SITE-C.C. MANGUM US 64E	5201 OLD US 64 EAST		NC SHWS, NC IMD
RALEIGH	S102868001	WAREHOUSE OF TIRES(FORMER)	325 S PERSON ST	27601	NC LUST TRUST
RALEIGH	1012118144	BLOCK A-24 PARKING DECK	NE QUAD OF CABARRUS ST. AND BL	27601	FINDS
RALEIGH	S105163771	CP&L DEMO SITE	SHEARON HARRIS PLANT		NC SWF/LF, NC HIST LF
RALEIGH	S108437664	RALEIGH CITY OF - LANDFILL	USHY 64		NC SWF/LF, NC Financial Assurance
RALEIGH	S108965472	AMOCO #60257	USHY 64		NC LUST TRUST
RALEIGH	S105488696	BURLINGTON INDUSTRIES, INC.	USHY 1 N		NC SHWS
RALEIGH	S103229465	SIR WALTER GUN CLUB	USHY 64		NC SHWS
RALEIGH	U003143291	PHILLIPS 66 COMPANY #023263	USHY 70 E	27603	NC UST
RALEIGH	U003143290	PHILLIPS 66 COMPANY #023226	USHY 1 & BUFFALO RD	27604	NC UST
RALEIGH	S105702832	WAKE OIL SERVICE	USHY 70		NC IMD, NC LUST
RALEIGH	S105163986	ROBUCK LANDFILL	VICTORY CHURCH RD		NC SWF/LF, NC HIST LF
RALEIGH	S106916922	RALEIGH TTA-DILLON PARCEL B	S WEST ST		NC SHWS

Count: 43 records. ORPHAN SUMMARY

City	EDR ID	Site Name	Site Address	Zip	Database(s)
RALEIGH	S105163792	DOROTHEA DIX	WESTERN BLVD		NC SWF/LF, NC HIST LF

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

To maintain currency of the following federal and state databases, EDR contacts the appropriate governmental agency on a monthly or quarterly basis, as required.

Number of Days to Update: Provides confirmation that EDR is reporting records that have been updated within 90 days from the date the government agency made the information available to the public.

STANDARD ENVIRONMENTAL RECORDS

Federal NPL site list

NPL: National Priority List

National Priorities List (Superfund). The NPL is a subset of CERCLIS and identifies over 1,200 sites for priority cleanup under the Superfund Program. NPL sites may encompass relatively large areas. As such, EDR provides polygon coverage for over 1,000 NPL site boundaries produced by EPA's Environmental Photographic Interpretation Center (EPIC) and regional EPA offices.

Date of Government Version: 02/01/2013
Date Data Arrived at EDR: 03/01/2013
Date Made Active in Reports: 03/13/2013
Number of Days to Update: 12

Source: EPA
Telephone: N/A
Last EDR Contact: 05/09/2013
Next Scheduled EDR Contact: 07/22/2013
Data Release Frequency: Quarterly

NPL Site Boundaries

Sources:

EPA's Environmental Photographic Interpretation Center (EPIC)
Telephone: 202-564-7333

EPA Region 1
Telephone 617-918-1143

EPA Region 6
Telephone: 214-655-6659

EPA Region 3
Telephone 215-814-5418

EPA Region 7
Telephone: 913-551-7247

EPA Region 4
Telephone 404-562-8033

EPA Region 8
Telephone: 303-312-6774

EPA Region 5
Telephone 312-886-6686

EPA Region 9
Telephone: 415-947-4246

EPA Region 10
Telephone 206-553-8665

Proposed NPL: Proposed National Priority List Sites

A site that has been proposed for listing on the National Priorities List through the issuance of a proposed rule in the Federal Register. EPA then accepts public comments on the site, responds to the comments, and places on the NPL those sites that continue to meet the requirements for listing.

Date of Government Version: 02/01/2013
Date Data Arrived at EDR: 03/01/2013
Date Made Active in Reports: 03/13/2013
Number of Days to Update: 12

Source: EPA
Telephone: N/A
Last EDR Contact: 05/09/2013
Next Scheduled EDR Contact: 07/22/2013
Data Release Frequency: Quarterly

NPL LIENS: Federal Superfund Liens

Federal Superfund Liens. Under the authority granted the USEPA by CERCLA of 1980, the USEPA has the authority to file liens against real property in order to recover remedial action expenditures or when the property owner received notification of potential liability. USEPA compiles a listing of filed notices of Superfund Liens.

Date of Government Version: 10/15/1991
Date Data Arrived at EDR: 02/02/1994
Date Made Active in Reports: 03/30/1994
Number of Days to Update: 56

Source: EPA
Telephone: 202-564-4267
Last EDR Contact: 08/15/2011
Next Scheduled EDR Contact: 11/28/2011
Data Release Frequency: No Update Planned

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Federal Delisted NPL site list

DELISTED NPL: National Priority List Deletions

The National Oil and Hazardous Substances Pollution Contingency Plan (NCP) establishes the criteria that the EPA uses to delete sites from the NPL. In accordance with 40 CFR 300.425.(e), sites may be deleted from the NPL where no further response is appropriate.

Date of Government Version: 02/01/2013
Date Data Arrived at EDR: 03/01/2013
Date Made Active in Reports: 03/13/2013
Number of Days to Update: 12

Source: EPA
Telephone: N/A
Last EDR Contact: 05/09/2013
Next Scheduled EDR Contact: 07/22/2013
Data Release Frequency: Quarterly

Federal CERCLIS list

CERCLIS: Comprehensive Environmental Response, Compensation, and Liability Information System

CERCLIS contains data on potentially hazardous waste sites that have been reported to the USEPA by states, municipalities, private companies and private persons, pursuant to Section 103 of the Comprehensive Environmental Response, Compensation, and Liability Act (CERCLA). CERCLIS contains sites which are either proposed to or on the National Priorities List (NPL) and sites which are in the screening and assessment phase for possible inclusion on the NPL.

Date of Government Version: 02/04/2013
Date Data Arrived at EDR: 03/01/2013
Date Made Active in Reports: 03/13/2013
Number of Days to Update: 12

Source: EPA
Telephone: 703-412-9810
Last EDR Contact: 04/05/2013
Next Scheduled EDR Contact: 06/10/2013
Data Release Frequency: Quarterly

FEDERAL FACILITY: Federal Facility Site Information listing

A listing of National Priority List (NPL) and Base Realignment and Closure (BRAC) sites found in the Comprehensive Environmental Response, Compensation and Liability Information System (CERCLIS) Database where EPA Federal Facilities Restoration and Reuse Office is involved in cleanup activities.

Date of Government Version: 07/31/2012
Date Data Arrived at EDR: 10/09/2012
Date Made Active in Reports: 12/20/2012
Number of Days to Update: 72

Source: Environmental Protection Agency
Telephone: 703-603-8704
Last EDR Contact: 04/10/2013
Next Scheduled EDR Contact: 07/22/2013
Data Release Frequency: Varies

Federal CERCLIS NFRAP site List

CERCLIS-NFRAP: CERCLIS No Further Remedial Action Planned

Archived sites are sites that have been removed and archived from the inventory of CERCLIS sites. Archived status indicates that, to the best of EPA's knowledge, assessment at a site has been completed and that EPA has determined no further steps will be taken to list this site on the National Priorities List (NPL), unless information indicates this decision was not appropriate or other considerations require a recommendation for listing at a later time. This decision does not necessarily mean that there is no hazard associated with a given site; it only means that, based upon available information, the location is not judged to be a potential NPL site.

Date of Government Version: 02/05/2013
Date Data Arrived at EDR: 03/01/2013
Date Made Active in Reports: 03/13/2013
Number of Days to Update: 12

Source: EPA
Telephone: 703-412-9810
Last EDR Contact: 04/05/2013
Next Scheduled EDR Contact: 03/11/2013
Data Release Frequency: Quarterly

Federal RCRA CORRACTS facilities list

CORRACTS: Corrective Action Report

CORRACTS identifies hazardous waste handlers with RCRA corrective action activity.

Date of Government Version: 02/12/2013
Date Data Arrived at EDR: 02/21/2013
Date Made Active in Reports: 02/27/2013
Number of Days to Update: 6

Source: EPA
Telephone: 800-424-9346
Last EDR Contact: 05/02/2013
Next Scheduled EDR Contact: 07/15/2013
Data Release Frequency: Quarterly

Federal RCRA non-CORRACTS TSD facilities list

RCRA-TSDF: RCRA - Treatment, Storage and Disposal

RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Transporters are individuals or entities that move hazardous waste from the generator offsite to a facility that can recycle, treat, store, or dispose of the waste. TSDFs treat, store, or dispose of the waste.

Date of Government Version: 02/12/2013
Date Data Arrived at EDR: 02/15/2013
Date Made Active in Reports: 02/27/2013
Number of Days to Update: 12

Source: Environmental Protection Agency
Telephone: (404) 562-8651
Last EDR Contact: 05/02/2013
Next Scheduled EDR Contact: 07/15/2013
Data Release Frequency: Quarterly

Federal RCRA generators list

RCRA-LQG: RCRA - Large Quantity Generators

RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Large quantity generators (LQGs) generate over 1,000 kilograms (kg) of hazardous waste, or over 1 kg of acutely hazardous waste per month.

Date of Government Version: 02/12/2013
Date Data Arrived at EDR: 02/15/2013
Date Made Active in Reports: 02/27/2013
Number of Days to Update: 12

Source: Environmental Protection Agency
Telephone: (404) 562-8651
Last EDR Contact: 05/02/2013
Next Scheduled EDR Contact: 07/15/2013
Data Release Frequency: Quarterly

RCRA-SQG: RCRA - Small Quantity Generators

RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Small quantity generators (SQGs) generate between 100 kg and 1,000 kg of hazardous waste per month.

Date of Government Version: 02/12/2013
Date Data Arrived at EDR: 02/15/2013
Date Made Active in Reports: 02/27/2013
Number of Days to Update: 12

Source: Environmental Protection Agency
Telephone: (404) 562-8651
Last EDR Contact: 05/02/2013
Next Scheduled EDR Contact: 07/15/2013
Data Release Frequency: Quarterly

RCRA-CESQG: RCRA - Conditionally Exempt Small Quantity Generators

RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Conditionally exempt small quantity generators (CESQGs) generate less than 100 kg of hazardous waste, or less than 1 kg of acutely hazardous waste per month.

Date of Government Version: 02/12/2013
Date Data Arrived at EDR: 02/15/2013
Date Made Active in Reports: 02/27/2013
Number of Days to Update: 12

Source: Environmental Protection Agency
Telephone: (404) 562-8651
Last EDR Contact: 05/02/2013
Next Scheduled EDR Contact: 07/15/2013
Data Release Frequency: Varies

Federal institutional controls / engineering controls registries

US ENG CONTROLS: Engineering Controls Sites List

A listing of sites with engineering controls in place. Engineering controls include various forms of caps, building foundations, liners, and treatment methods to create pathway elimination for regulated substances to enter environmental media or effect human health.

Date of Government Version: 03/14/2013
Date Data Arrived at EDR: 03/29/2013
Date Made Active in Reports: 05/10/2013
Number of Days to Update: 42

Source: Environmental Protection Agency
Telephone: 703-603-0695
Last EDR Contact: 03/11/2013
Next Scheduled EDR Contact: 06/24/2013
Data Release Frequency: Varies

US INST CONTROL: Sites with Institutional Controls

A listing of sites with institutional controls in place. Institutional controls include administrative measures, such as groundwater use restrictions, construction restrictions, property use restrictions, and post remediation care requirements intended to prevent exposure to contaminants remaining on site. Deed restrictions are generally required as part of the institutional controls.

Date of Government Version: 03/14/2013
Date Data Arrived at EDR: 03/29/2013
Date Made Active in Reports: 05/10/2013
Number of Days to Update: 42

Source: Environmental Protection Agency
Telephone: 703-603-0695
Last EDR Contact: 03/11/2013
Next Scheduled EDR Contact: 06/24/2013
Data Release Frequency: Varies

LUCIS: Land Use Control Information System

LUCIS contains records of land use control information pertaining to the former Navy Base Realignment and Closure properties.

Date of Government Version: 12/09/2005
Date Data Arrived at EDR: 12/11/2006
Date Made Active in Reports: 01/11/2007
Number of Days to Update: 31

Source: Department of the Navy
Telephone: 843-820-7326
Last EDR Contact: 05/20/2013
Next Scheduled EDR Contact: 09/02/2013
Data Release Frequency: Varies

Federal ERNS list

ERNS: Emergency Response Notification System

Emergency Response Notification System. ERNS records and stores information on reported releases of oil and hazardous substances.

Date of Government Version: 12/31/2012
Date Data Arrived at EDR: 01/17/2013
Date Made Active in Reports: 02/15/2013
Number of Days to Update: 29

Source: National Response Center, United States Coast Guard
Telephone: 202-267-2180
Last EDR Contact: 04/02/2013
Next Scheduled EDR Contact: 07/15/2013
Data Release Frequency: Annually

State- and tribal - equivalent NPL

HSDS: Hazardous Substance Disposal Site

Locations of uncontrolled and unregulated hazardous waste sites. The file includes sites on the National Priority List as well as those on the state priority list.

Date of Government Version: 08/09/2011
Date Data Arrived at EDR: 11/08/2011
Date Made Active in Reports: 12/05/2011
Number of Days to Update: 27

Source: North Carolina Center for Geographic Information and Analysis
Telephone: 919-754-6580
Last EDR Contact: 05/03/2013
Next Scheduled EDR Contact: 08/19/2013
Data Release Frequency: Biennially

State- and tribal - equivalent CERCLIS

SHWS: Inactive Hazardous Sites Inventory

State Hazardous Waste Sites. State hazardous waste site records are the states' equivalent to CERCLIS. These sites may or may not already be listed on the federal CERCLIS list. Priority sites planned for cleanup using state funds (state equivalent of Superfund) are identified along with sites where cleanup will be paid for by potentially responsible parties. Available information varies by state.

Date of Government Version: 01/15/2013
Date Data Arrived at EDR: 03/20/2013
Date Made Active in Reports: 03/28/2013
Number of Days to Update: 8

Source: Department of Environment, Health and Natural Resources
Telephone: 919-508-8400
Last EDR Contact: 03/20/2013
Next Scheduled EDR Contact: 07/01/2013
Data Release Frequency: Quarterly

State and tribal landfill and/or solid waste disposal site lists

SWF/LF: List of Solid Waste Facilities

Solid Waste Facilities/Landfill Sites. SWF/LF type records typically contain an inventory of solid waste disposal facilities or landfills in a particular state. Depending on the state, these may be active or inactive facilities or open dumps that failed to meet RCRA Subtitle D Section 4004 criteria for solid waste landfills or disposal sites.

Date of Government Version: 04/01/2013
Date Data Arrived at EDR: 04/02/2013
Date Made Active in Reports: 05/09/2013
Number of Days to Update: 37

Source: Department of Environment and Natural Resources
Telephone: 919-733-0692
Last EDR Contact: 04/02/2013
Next Scheduled EDR Contact: 07/15/2013
Data Release Frequency: Semi-Annually

OLI: Old Landfill Inventory

Old landfill inventory location information. (Does not include no further action sites and other agency lead sites).

Date of Government Version: 04/05/2013
Date Data Arrived at EDR: 04/18/2013
Date Made Active in Reports: 05/09/2013
Number of Days to Update: 21

Source: Department of Environment & Natural Resources
Telephone: 919-733-4996
Last EDR Contact: 04/16/2013
Next Scheduled EDR Contact: 07/29/2013
Data Release Frequency: Varies

State and tribal leaking storage tank lists

LUST: Regional UST Database

This database contains information obtained from the Regional Offices. It provides a more detailed explanation of current and historic activity for individual sites, as well as what was previously found in the Incident Management Database. Sites in this database with Incident Numbers are considered LUSTs.

Date of Government Version: 02/08/2013
Date Data Arrived at EDR: 02/13/2013
Date Made Active in Reports: 04/02/2013
Number of Days to Update: 48

Source: Department of Environment and Natural Resources
Telephone: 919-733-1308
Last EDR Contact: 05/16/2013
Next Scheduled EDR Contact: 08/26/2013
Data Release Frequency: Quarterly

LUST TRUST: State Trust Fund Database

This database contains information about claims against the State Trust Funds for reimbursements for expenses incurred while remediating Leaking USTs.

Date of Government Version: 04/03/2013
Date Data Arrived at EDR: 04/17/2013
Date Made Active in Reports: 05/09/2013
Number of Days to Update: 22

Source: Department of Environment and Natural Resources
Telephone: 919-733-1315
Last EDR Contact: 10/17/2013
Next Scheduled EDR Contact: 07/29/2013
Data Release Frequency: Semi-Annually

LAST: Leaking Aboveground Storage Tanks
A listing of leaking aboveground storage tank site locations.

Date of Government Version: 02/08/2013
Date Data Arrived at EDR: 02/13/2013
Date Made Active in Reports: 03/28/2013
Number of Days to Update: 43

Source: Department of Environment & Natural Resources
Telephone: 877-623-6748
Last EDR Contact: 05/16/2013
Next Scheduled EDR Contact: 08/26/2013
Data Release Frequency: Quarterly

INDIAN LUST R9: Leaking Underground Storage Tanks on Indian Land
LUSTs on Indian land in Arizona, California, New Mexico and Nevada

Date of Government Version: 03/01/2013
Date Data Arrived at EDR: 03/01/2013
Date Made Active in Reports: 04/12/2013
Number of Days to Update: 42

Source: Environmental Protection Agency
Telephone: 415-972-3372
Last EDR Contact: 04/29/2013
Next Scheduled EDR Contact: 08/12/2013
Data Release Frequency: Quarterly

INDIAN LUST R8: Leaking Underground Storage Tanks on Indian Land
LUSTs on Indian land in Colorado, Montana, North Dakota, South Dakota, Utah and Wyoming.

Date of Government Version: 08/27/2012
Date Data Arrived at EDR: 08/28/2012
Date Made Active in Reports: 10/16/2012
Number of Days to Update: 49

Source: EPA Region 8
Telephone: 303-312-6271
Last EDR Contact: 04/29/2013
Next Scheduled EDR Contact: 08/12/2013
Data Release Frequency: Quarterly

INDIAN LUST R7: Leaking Underground Storage Tanks on Indian Land
LUSTs on Indian land in Iowa, Kansas, and Nebraska

Date of Government Version: 12/31/2012
Date Data Arrived at EDR: 02/28/2013
Date Made Active in Reports: 04/12/2013
Number of Days to Update: 43

Source: EPA Region 7
Telephone: 913-551-7003
Last EDR Contact: 04/29/2013
Next Scheduled EDR Contact: 08/12/2013
Data Release Frequency: Varies

INDIAN LUST R6: Leaking Underground Storage Tanks on Indian Land
LUSTs on Indian land in New Mexico and Oklahoma.

Date of Government Version: 09/12/2011
Date Data Arrived at EDR: 09/13/2011
Date Made Active in Reports: 11/11/2011
Number of Days to Update: 59

Source: EPA Region 6
Telephone: 214-665-6597
Last EDR Contact: 04/29/2013
Next Scheduled EDR Contact: 08/12/2013
Data Release Frequency: Varies

INDIAN LUST R4: Leaking Underground Storage Tanks on Indian Land
LUSTs on Indian land in Florida, Mississippi and North Carolina.

Date of Government Version: 02/06/2013
Date Data Arrived at EDR: 02/08/2013
Date Made Active in Reports: 04/12/2013
Number of Days to Update: 63

Source: EPA Region 4
Telephone: 404-562-8677
Last EDR Contact: 04/29/2013
Next Scheduled EDR Contact: 08/12/2013
Data Release Frequency: Semi-Annually

INDIAN LUST R1: Leaking Underground Storage Tanks on Indian Land
A listing of leaking underground storage tank locations on Indian Land.

Date of Government Version: 09/28/2012
Date Data Arrived at EDR: 11/01/2012
Date Made Active in Reports: 04/12/2013
Number of Days to Update: 162

Source: EPA Region 1
Telephone: 617-918-1313
Last EDR Contact: 05/01/2013
Next Scheduled EDR Contact: 08/12/2013
Data Release Frequency: Varies

INDIAN LUST R10: Leaking Underground Storage Tanks on Indian Land
LUSTs on Indian land in Alaska, Idaho, Oregon and Washington.

Date of Government Version: 02/05/2013
Date Data Arrived at EDR: 02/06/2013
Date Made Active in Reports: 04/12/2013
Number of Days to Update: 65
Source: EPA Region 10
Telephone: 206-553-2857
Last EDR Contact: 04/29/2013
Next Scheduled EDR Contact: 08/12/2013
Data Release Frequency: Quarterly

State and tribal registered storage tank lists

UST: Petroleum Underground Storage Tank Database
Registered Underground Storage Tanks. UST's are regulated under Subtitle I of the Resource Conservation and Recovery Act (RCRA) and must be registered with the state department responsible for administering the UST program. Available information varies by state program.

Date of Government Version: 02/12/2013
Date Data Arrived at EDR: 02/13/2013
Date Made Active in Reports: 04/02/2013
Number of Days to Update: 48
Source: Department of Environment and Natural Resources
Telephone: 919-733-1308
Last EDR Contact: 05/16/2013
Next Scheduled EDR Contact: 08/26/2013
Data Release Frequency: Quarterly

AST: AST Database
Facilities with aboveground storage tanks that have a capacity greater than 21,000 gallons.

Date of Government Version: 03/25/2013
Date Data Arrived at EDR: 03/25/2013
Date Made Active in Reports: 04/02/2013
Number of Days to Update: 8
Source: Department of Environment and Natural Resources
Telephone: 919-715-6183
Last EDR Contact: 03/25/2013
Next Scheduled EDR Contact: 07/08/2013
Data Release Frequency: Semi-Annually

INDIAN UST R6: Underground Storage Tanks on Indian Land
The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 6 (Louisiana, Arkansas, Oklahoma, New Mexico, Texas and 65 Tribes).

Date of Government Version: 05/10/2011
Date Data Arrived at EDR: 05/11/2011
Date Made Active in Reports: 06/14/2011
Number of Days to Update: 34
Source: EPA Region 6
Telephone: 214-665-7591
Last EDR Contact: 04/29/2013
Next Scheduled EDR Contact: 08/12/2013
Data Release Frequency: Semi-Annually

INDIAN UST R7: Underground Storage Tanks on Indian Land
The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 7 (Iowa, Kansas, Missouri, Nebraska, and 9 Tribal Nations).

Date of Government Version: 12/31/2012
Date Data Arrived at EDR: 02/28/2013
Date Made Active in Reports: 04/12/2013
Number of Days to Update: 43
Source: EPA Region 7
Telephone: 913-551-7003
Last EDR Contact: 04/29/2013
Next Scheduled EDR Contact: 08/12/2013
Data Release Frequency: Varies

INDIAN UST R8: Underground Storage Tanks on Indian Land
The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 8 (Colorado, Montana, North Dakota, South Dakota, Utah, Wyoming and 27 Tribal Nations).

Date of Government Version: 08/27/2012
Date Data Arrived at EDR: 08/28/2012
Date Made Active in Reports: 10/16/2012
Number of Days to Update: 49
Source: EPA Region 8
Telephone: 303-312-6137
Last EDR Contact: 04/29/2013
Next Scheduled EDR Contact: 08/12/2013
Data Release Frequency: Quarterly

INDIAN UST R9: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 9 (Arizona, California, Hawaii, Nevada, the Pacific Islands, and Tribal Nations).

Date of Government Version: 02/21/2013
Date Data Arrived at EDR: 02/26/2013
Date Made Active in Reports: 04/12/2013
Number of Days to Update: 45

Source: EPA Region 9
Telephone: 415-972-3368
Last EDR Contact: 04/29/2013
Next Scheduled EDR Contact: 08/12/2013
Data Release Frequency: Quarterly

INDIAN UST R1: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 1 (Connecticut, Maine, Massachusetts, New Hampshire, Rhode Island, Vermont and ten Tribal Nations).

Date of Government Version: 09/28/2012
Date Data Arrived at EDR: 11/07/2012
Date Made Active in Reports: 04/12/2013
Number of Days to Update: 156

Source: EPA, Region 1
Telephone: 617-918-1313
Last EDR Contact: 04/29/2013
Next Scheduled EDR Contact: 08/12/2013
Data Release Frequency: Varies

INDIAN UST R4: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 4 (Alabama, Florida, Georgia, Kentucky, Mississippi, North Carolina, South Carolina, Tennessee and Tribal Nations)

Date of Government Version: 02/06/2013
Date Data Arrived at EDR: 02/08/2013
Date Made Active in Reports: 04/12/2013
Number of Days to Update: 63

Source: EPA Region 4
Telephone: 404-562-9424
Last EDR Contact: 04/29/2013
Next Scheduled EDR Contact: 08/12/2013
Data Release Frequency: Semi-Annually

INDIAN UST R5: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 5 (Michigan, Minnesota and Wisconsin and Tribal Nations).

Date of Government Version: 08/02/2012
Date Data Arrived at EDR: 08/03/2012
Date Made Active in Reports: 11/05/2012
Number of Days to Update: 94

Source: EPA Region 5
Telephone: 312-886-6136
Last EDR Contact: 04/29/2013
Next Scheduled EDR Contact: 08/12/2013
Data Release Frequency: Varies

INDIAN UST R10: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 10 (Alaska, Idaho, Oregon, Washington, and Tribal Nations).

Date of Government Version: 02/05/2013
Date Data Arrived at EDR: 02/06/2013
Date Made Active in Reports: 04/12/2013
Number of Days to Update: 65

Source: EPA Region 10
Telephone: 206-553-2857
Last EDR Contact: 04/29/2013
Next Scheduled EDR Contact: 08/12/2013
Data Release Frequency: Quarterly

FEMA UST: Underground Storage Tank Listing

A listing of all FEMA owned underground storage tanks.

Date of Government Version: 01/01/2010
Date Data Arrived at EDR: 02/16/2010
Date Made Active in Reports: 04/12/2010
Number of Days to Update: 55

Source: FEMA
Telephone: 202-646-5797
Last EDR Contact: 04/18/2013
Next Scheduled EDR Contact: 07/29/2013
Data Release Frequency: Varies

State and tribal institutional control / engineering control registries

INST CONTROL: No Further Action Sites With Land Use Restrictions Monitoring
A land use restricted site is a property where there are limits or requirements on future use of the property due to varying levels of cleanup possible, practical, or necessary at the site.

Date of Government Version: 01/15/2013
Date Data Arrived at EDR: 03/20/2013
Date Made Active in Reports: 03/28/2013
Number of Days to Update: 8
Source: Department of Environment, Health and Natural Resources
Telephone: 919-508-8400
Last EDR Contact: 12/17/2110
Next Scheduled EDR Contact: 07/01/2013
Data Release Frequency: Quarterly

State and tribal voluntary cleanup sites

INDIAN VCP R1: Voluntary Cleanup Priority Listing
A listing of voluntary cleanup priority sites located on Indian Land located in Region 1.

Date of Government Version: 09/28/2012
Date Data Arrived at EDR: 10/02/2012
Date Made Active in Reports: 10/16/2012
Number of Days to Update: 14
Source: EPA, Region 1
Telephone: 617-918-1102
Last EDR Contact: 04/05/2013
Next Scheduled EDR Contact: 07/15/2013
Data Release Frequency: Varies

INDIAN VCP R7: Voluntary Cleanup Priority Lisitng
A listing of voluntary cleanup priority sites located on Indian Land located in Region 7.

Date of Government Version: 03/20/2008
Date Data Arrived at EDR: 04/22/2008
Date Made Active in Reports: 05/19/2008
Number of Days to Update: 27
Source: EPA, Region 7
Telephone: 913-551-7365
Last EDR Contact: 04/20/2009
Next Scheduled EDR Contact: 07/20/2009
Data Release Frequency: Varies

VCP: Responsible Party Voluntary Action Sites
Responsible Party Voluntary Action site locations.

Date of Government Version: 01/15/2013
Date Data Arrived at EDR: 03/20/2013
Date Made Active in Reports: 03/28/2013
Number of Days to Update: 8
Source: Department of Environment and Natural Resources
Telephone: 919-508-8400
Last EDR Contact: 03/20/2013
Next Scheduled EDR Contact: 07/01/2013
Data Release Frequency: Semi-Annually

State and tribal Brownfields sites

BROWNFIELDS: Brownfields Projects Inventory
A brownfield site is an abandoned, idled, or underused property where the threat of environmental contamination has hindered its redevelopment. All of the sites in the inventory are working toward a brownfield agreement for cleanup and liabitliy control.

Date of Government Version: 04/04/2013
Date Data Arrived at EDR: 04/10/2013
Date Made Active in Reports: 05/23/2013
Number of Days to Update: 43
Source: Department of Environment and Natural Resources
Telephone: 919-733-4996
Last EDR Contact: 04/10/2013
Next Scheduled EDR Contact: 07/22/2013
Data Release Frequency: Varies

ADDITIONAL ENVIRONMENTAL RECORDS

Local Brownfield lists

US BROWNFIELDS: A Listing of Brownfields Sites
Brownfields are real property, the expansion, redevelopment, or reuse of which may be complicated by the presence or potential presence of a hazardous substance, pollutant, or contaminant. Cleaning up and reinvesting in these properties takes development pressures off of undeveloped, open land, and both improves and protects the environment. Assessment, Cleanup and Redevelopment Exchange System (ACRES) stores information reported by EPA Brownfields grant recipients on brownfields properties assessed or cleaned up with grant funding as well as information on Targeted Brownfields Assessments performed by EPA Regions. A listing of ACRES Brownfield sites is obtained from Cleanups in My Community. Cleanups in My Community provides information on Brownfields properties for which information is reported back to EPA, as well as areas served by Brownfields grant programs.

Date of Government Version: 12/10/2012
Date Data Arrived at EDR: 12/11/2012
Date Made Active in Reports: 12/20/2012
Number of Days to Update: 9

Source: Environmental Protection Agency
Telephone: 202-566-2777
Last EDR Contact: 03/26/2013
Next Scheduled EDR Contact: 07/08/2013
Data Release Frequency: Semi-Annually

Local Lists of Landfill / Solid Waste Disposal Sites

ODI: Open Dump Inventory
An open dump is defined as a disposal facility that does not comply with one or more of the Part 257 or Part 258 Subtitle D Criteria.

Date of Government Version: 06/30/1985
Date Data Arrived at EDR: 08/09/2004
Date Made Active in Reports: 09/17/2004
Number of Days to Update: 39

Source: Environmental Protection Agency
Telephone: 800-424-9346
Last EDR Contact: 06/09/2004
Next Scheduled EDR Contact: N/A
Data Release Frequency: No Update Planned

DEBRIS REGION 9: Torres Martinez Reservation Illegal Dump Site Locations
A listing of illegal dump sites location on the Torres Martinez Indian Reservation located in eastern Riverside County and northern Imperial County, California.

Date of Government Version: 01/12/2009
Date Data Arrived at EDR: 05/07/2009
Date Made Active in Reports: 09/21/2009
Number of Days to Update: 137

Source: EPA, Region 9
Telephone: 415-947-4219
Last EDR Contact: 04/29/2013
Next Scheduled EDR Contact: 08/12/2013
Data Release Frequency: No Update Planned

HIST LF: Solid Waste Facility Listing
A listing of solid waste facilities.

Date of Government Version: 11/06/2006
Date Data Arrived at EDR: 02/13/2007
Date Made Active in Reports: 03/02/2007
Number of Days to Update: 17

Source: Department of Environment & Natural Resources
Telephone: 919-733-0692
Last EDR Contact: 01/19/2009
Next Scheduled EDR Contact: 04/19/2009
Data Release Frequency: Quarterly

SWRCY: Recycling Center Listing
A listing of recycling center locations.

Date of Government Version: 08/06/2012
Date Data Arrived at EDR: 08/08/2012
Date Made Active in Reports: 09/13/2012
Number of Days to Update: 36

Source: Department of Environment & Natural Resources
Telephone: 919-707-8137
Last EDR Contact: 05/28/2013
Next Scheduled EDR Contact: 08/19/2013
Data Release Frequency: Varies

INDIAN ODI: Report on the Status of Open Dumps on Indian Lands
Location of open dumps on Indian land.

Date of Government Version: 12/31/1998
Date Data Arrived at EDR: 12/03/2007
Date Made Active in Reports: 01/24/2008
Number of Days to Update: 52

Source: Environmental Protection Agency
Telephone: 703-308-8245
Last EDR Contact: 05/03/2013
Next Scheduled EDR Contact: 08/19/2013
Data Release Frequency: Varies

Local Lists of Hazardous waste / Contaminated Sites

US CDL: Clandestine Drug Labs
A listing of clandestine drug lab locations. The U.S. Department of Justice ("the Department") provides this web site as a public service. It contains addresses of some locations where law enforcement agencies reported they found chemicals or other items that indicated the presence of either clandestine drug laboratories or dumpsites. In most cases, the source of the entries is not the Department, and the Department has not verified the entry and does not guarantee its accuracy. Members of the public must verify the accuracy of all entries by, for example, contacting local law enforcement and local health departments.

Date of Government Version: 03/04/2013
Date Data Arrived at EDR: 03/12/2013
Date Made Active in Reports: 05/10/2013
Number of Days to Update: 59

Source: Drug Enforcement Administration
Telephone: 202-307-1000
Last EDR Contact: 03/04/2013
Next Scheduled EDR Contact: 06/17/2013
Data Release Frequency: Quarterly

US HIST CDL: National Clandestine Laboratory Register

A listing of clandestine drug lab locations. The U.S. Department of Justice ("the Department") provides this web site as a public service. It contains addresses of some locations where law enforcement agencies reported they found chemicals or other items that indicated the presence of either clandestine drug laboratories or dumpsites. In most cases, the source of the entries is not the Department, and the Department has not verified the entry and does not guarantee its accuracy. Members of the public must verify the accuracy of all entries by, for example, contacting local law enforcement and local health departments.

Date of Government Version: 09/01/2007
Date Data Arrived at EDR: 11/19/2008
Date Made Active in Reports: 03/30/2009
Number of Days to Update: 131

Source: Drug Enforcement Administration
Telephone: 202-307-1000
Last EDR Contact: 03/23/2009
Next Scheduled EDR Contact: 06/22/2009
Data Release Frequency: No Update Planned

Local Land Records

LIENS 2: CERCLA Lien Information

A Federal CERCLA ('Superfund') lien can exist by operation of law at any site or property at which EPA has spent Superfund monies. These monies are spent to investigate and address releases and threatened releases of contamination. CERCLIS provides information as to the identity of these sites and properties.

Date of Government Version: 02/06/2013
Date Data Arrived at EDR: 04/25/2013
Date Made Active in Reports: 05/10/2013
Number of Days to Update: 15

Source: Environmental Protection Agency
Telephone: 202-564-6023
Last EDR Contact: 04/29/2013
Next Scheduled EDR Contact: 08/12/2013
Data Release Frequency: Varies

Records of Emergency Release Reports

HMIRS: Hazardous Materials Information Reporting System

Hazardous Materials Incident Report System. HMIRS contains hazardous material spill incidents reported to DOT.

Date of Government Version: 12/31/2012
Date Data Arrived at EDR: 01/03/2013
Date Made Active in Reports: 02/27/2013
Number of Days to Update: 55

Source: U.S. Department of Transportation
Telephone: 202-366-4555
Last EDR Contact: 04/02/2013
Next Scheduled EDR Contact: 07/15/2013
Data Release Frequency: Annually

IMD: Incident Management Database

Groundwater and/or soil contamination incidents

Date of Government Version: 07/21/2006
Date Data Arrived at EDR: 08/01/2006
Date Made Active in Reports: 08/23/2006
Number of Days to Update: 22

Source: Department of Environment and Natural Resources
Telephone: 919-733-3221
Last EDR Contact: 07/01/2011
Next Scheduled EDR Contact: 10/17/2011
Data Release Frequency: No Update Planned

SPILLS 80: SPILLS80 data from FirstSearch

Spills 80 includes those spill and release records available from FirstSearch databases prior to 1990. Typically, they may include chemical, oil and/or hazardous substance spills recorded before 1990. Duplicate records that are already included in EDR incident and release records are not included in Spills 80.

Date of Government Version: 06/14/2001
Date Data Arrived at EDR: 01/03/2013
Date Made Active in Reports: 03/06/2013
Number of Days to Update: 62

Source: FirstSearch
Telephone: N/A
Last EDR Contact: 01/03/2013
Next Scheduled EDR Contact: N/A
Data Release Frequency: No Update Planned

SPILLS 90: SPILLS90 data from FirstSearch

Spills 90 includes those spill and release records available exclusively from FirstSearch databases. Typically, they may include chemical, oil and/or hazardous substance spills recorded after 1990. Duplicate records that are already included in EDR incident and release records are not included in Spills 90.

Date of Government Version: 09/27/2012
Date Data Arrived at EDR: 01/03/2013
Date Made Active in Reports: 03/06/2013
Number of Days to Update: 62

Source: FirstSearch
Telephone: N/A
Last EDR Contact: 01/03/2013
Next Scheduled EDR Contact: N/A
Data Release Frequency: No Update Planned

Other Ascertainable Records

RCRA NonGen / NLR: RCRA - Non Generators

RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Non-Generators do not presently generate hazardous waste.

Date of Government Version: 02/12/2013
Date Data Arrived at EDR: 02/15/2013
Date Made Active in Reports: 02/27/2013
Number of Days to Update: 12

Source: Environmental Protection Agency
Telephone: (404) 562-8651
Last EDR Contact: 05/02/2013
Next Scheduled EDR Contact: 07/15/2013
Data Release Frequency: Varies

DOT OPS: Incident and Accident Data

Department of Transporation, Office of Pipeline Safety Incident and Accident data.

Date of Government Version: 07/31/2012
Date Data Arrived at EDR: 08/07/2012
Date Made Active in Reports: 09/18/2012
Number of Days to Update: 42

Source: Department of Transporation, Office of Pipeline Safety
Telephone: 202-366-4595
Last EDR Contact: 05/07/2013
Next Scheduled EDR Contact: 08/19/2013
Data Release Frequency: Varies

DOD: Department of Defense Sites

This data set consists of federally owned or administered lands, administered by the Department of Defense, that have any area equal to or greater than 640 acres of the United States, Puerto Rico, and the U.S. Virgin Islands.

Date of Government Version: 12/31/2005
Date Data Arrived at EDR: 11/10/2006
Date Made Active in Reports: 01/11/2007
Number of Days to Update: 62

Source: USGS
Telephone: 888-275-8747
Last EDR Contact: 04/19/2013
Next Scheduled EDR Contact: 07/29/2013
Data Release Frequency: Semi-Annually

FUDS: Formerly Used Defense Sites

The listing includes locations of Formerly Used Defense Sites properties where the US Army Corps of Engineers is actively working or will take necessary cleanup actions.

Date of Government Version: 12/31/2011
Date Data Arrived at EDR: 02/26/2013
Date Made Active in Reports: 03/13/2013
Number of Days to Update: 15

Source: U.S. Army Corps of Engineers
Telephone: 202-528-4285
Last EDR Contact: 03/11/2013
Next Scheduled EDR Contact: 06/24/2013
Data Release Frequency: Varies

CONSENT: Superfund (CERCLA) Consent Decrees

Major legal settlements that establish responsibility and standards for cleanup at NPL (Superfund) sites. Released periodically by United States District Courts after settlement by parties to litigation matters.

Date of Government Version: 12/31/2011
Date Data Arrived at EDR: 01/15/2013
Date Made Active in Reports: 03/13/2013
Number of Days to Update: 57

Source: Department of Justice, Consent Decree Library
Telephone: Varies
Last EDR Contact: 04/01/2013
Next Scheduled EDR Contact: 07/15/2013
Data Release Frequency: Varies

ROD: Records Of Decision

Record of Decision. ROD documents mandate a permanent remedy at an NPL (Superfund) site containing technical and health information to aid in the cleanup.

Date of Government Version: 12/18/2012
Date Data Arrived at EDR: 03/13/2013
Date Made Active in Reports: 04/12/2013
Number of Days to Update: 30

Source: EPA
Telephone: 703-416-0223
Last EDR Contact: 03/13/2013
Next Scheduled EDR Contact: 06/24/2013
Data Release Frequency: Annually

UMTRA: Uranium Mill Tailings Sites

Uranium ore was mined by private companies for federal government use in national defense programs. When the mills shut down, large piles of the sand-like material (mill tailings) remain after uranium has been extracted from the ore. Levels of human exposure to radioactive materials from the piles are low; however, in some cases tailings were used as construction materials before the potential health hazards of the tailings were recognized.

Date of Government Version: 09/14/2010
Date Data Arrived at EDR: 10/07/2011
Date Made Active in Reports: 03/01/2012
Number of Days to Update: 146

Source: Department of Energy
Telephone: 505-845-0011
Last EDR Contact: 05/28/2013
Next Scheduled EDR Contact: 09/09/2013
Data Release Frequency: Varies

US MINES: Mines Master Index File

Contains all mine identification numbers issued for mines active or opened since 1971. The data also includes violation information.

Date of Government Version: 02/05/2013
Date Data Arrived at EDR: 04/18/2013
Date Made Active in Reports: 05/10/2013
Number of Days to Update: 22

Source: Department of Labor, Mine Safety and Health Administration
Telephone: 303-231-5959
Last EDR Contact: 03/06/2013
Next Scheduled EDR Contact: 06/17/2013
Data Release Frequency: Semi-Annually

TRIS: Toxic Chemical Release Inventory System

Toxic Release Inventory System. TRIS identifies facilities which release toxic chemicals to the air, water and land in reportable quantities under SARA Title III Section 313.

Date of Government Version: 12/31/2009
Date Data Arrived at EDR: 09/01/2011
Date Made Active in Reports: 01/10/2012
Number of Days to Update: 131

Source: EPA
Telephone: 202-566-0250
Last EDR Contact: 05/29/2013
Next Scheduled EDR Contact: 09/09/2013
Data Release Frequency: Annually

TSCA: Toxic Substances Control Act

Toxic Substances Control Act. TSCA identifies manufacturers and importers of chemical substances included on the TSCA Chemical Substance Inventory list. It includes data on the production volume of these substances by plant site.

Date of Government Version: 12/31/2006
Date Data Arrived at EDR: 09/29/2010
Date Made Active in Reports: 12/02/2010
Number of Days to Update: 64

Source: EPA
Telephone: 202-260-5521
Last EDR Contact: 03/28/2013
Next Scheduled EDR Contact: 07/08/2013
Data Release Frequency: Every 4 Years

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

FTTS: FIFRA/ TSCA Tracking System - FIFRA (Federal Insecticide, Fungicide, & Rodenticide Act)/TSCA (Toxic Substances Control Act)
FTTS tracks administrative cases and pesticide enforcement actions and compliance activities related to FIFRA, TSCA and EPCRA (Emergency Planning and Community Right-to-Know Act). To maintain currency, EDR contacts the Agency on a quarterly basis.

Date of Government Version: 04/09/2009
Date Data Arrived at EDR: 04/16/2009
Date Made Active in Reports: 05/11/2009
Number of Days to Update: 25
Source: EPA/Office of Prevention, Pesticides and Toxic Substances
Telephone: 202-566-1667
Last EDR Contact: 05/28/2013
Next Scheduled EDR Contact: 09/09/2013
Data Release Frequency: Quarterly

FTTS INSP: FIFRA/ TSCA Tracking System - FIFRA (Federal Insecticide, Fungicide, & Rodenticide Act)/TSCA (Toxic Substances Control Act)
A listing of FIFRA/TSCA Tracking System (FTTS) inspections and enforcements.

Date of Government Version: 04/09/2009
Date Data Arrived at EDR: 04/16/2009
Date Made Active in Reports: 05/11/2009
Number of Days to Update: 25
Source: EPA
Telephone: 202-566-1667
Last EDR Contact: 05/28/2013
Next Scheduled EDR Contact: 09/09/2013
Data Release Frequency: Quarterly

HIST FTTS: FIFRA/TSCA Tracking System Administrative Case Listing
A complete administrative case listing from the FIFRA/TSCA Tracking System (FTTS) for all ten EPA regions. The information was obtained from the National Compliance Database (NCDB). NCDB supports the implementation of FIFRA (Federal Insecticide, Fungicide, and Rodenticide Act) and TSCA (Toxic Substances Control Act). Some EPA regions are now closing out records. Because of that, and the fact that some EPA regions are not providing EPA Headquarters with updated records, it was decided to create a HIST FTTS database. It included records that may not be included in the newer FTTS database updates. This database is no longer updated.

Date of Government Version: 10/19/2006
Date Data Arrived at EDR: 03/01/2007
Date Made Active in Reports: 04/10/2007
Number of Days to Update: 40
Source: Environmental Protection Agency
Telephone: 202-564-2501
Last EDR Contact: 12/17/2007
Next Scheduled EDR Contact: 03/17/2008
Data Release Frequency: No Update Planned

HIST FTTS INSP: FIFRA/TSCA Tracking System Inspection & Enforcement Case Listing
A complete inspection and enforcement case listing from the FIFRA/TSCA Tracking System (FTTS) for all ten EPA regions. The information was obtained from the National Compliance Database (NCDB). NCDB supports the implementation of FIFRA (Federal Insecticide, Fungicide, and Rodenticide Act) and TSCA (Toxic Substances Control Act). Some EPA regions are now closing out records. Because of that, and the fact that some EPA regions are not providing EPA Headquarters with updated records, it was decided to create a HIST FTTS database. It included records that may not be included in the newer FTTS database updates. This database is no longer updated.

Date of Government Version: 10/19/2006
Date Data Arrived at EDR: 03/01/2007
Date Made Active in Reports: 04/10/2007
Number of Days to Update: 40
Source: Environmental Protection Agency
Telephone: 202-564-2501
Last EDR Contact: 12/17/2008
Next Scheduled EDR Contact: 03/17/2008
Data Release Frequency: No Update Planned

SSTS: Section 7 Tracking Systems
Section 7 of the Federal Insecticide, Fungicide and Rodenticide Act, as amended (92 Stat. 829) requires all registered pesticide-producing establishments to submit a report to the Environmental Protection Agency by March 1st each year. Each establishment must report the types and amounts of pesticides, active ingredients and devices being produced, and those having been produced and sold or distributed in the past year.

Date of Government Version: 12/31/2009
Date Data Arrived at EDR: 12/10/2010
Date Made Active in Reports: 02/25/2011
Number of Days to Update: 77
Source: EPA
Telephone: 202-564-4203
Last EDR Contact: 04/29/2013
Next Scheduled EDR Contact: 08/12/2013
Data Release Frequency: Annually

ICIS: Integrated Compliance Information System

The Integrated Compliance Information System (ICIS) supports the information needs of the national enforcement and compliance program as well as the unique needs of the National Pollutant Discharge Elimination System (NPDES) program.

Date of Government Version: 07/20/2011
Date Data Arrived at EDR: 11/10/2011
Date Made Active in Reports: 01/10/2012
Number of Days to Update: 61

Source: Environmental Protection Agency
Telephone: 202-564-5088
Last EDR Contact: 04/15/2013
Next Scheduled EDR Contact: 07/29/2013
Data Release Frequency: Quarterly

PADS: PCB Activity Database System

PCB Activity Database. PADS Identifies generators, transporters, commercial storers and/or brokers and disposers of PCB's who are required to notify the EPA of such activities.

Date of Government Version: 11/01/2012
Date Data Arrived at EDR: 01/16/2013
Date Made Active in Reports: 05/10/2013
Number of Days to Update: 114

Source: EPA
Telephone: 202-566-0500
Last EDR Contact: 04/19/2013
Next Scheduled EDR Contact: 07/29/2013
Data Release Frequency: Annually

MLTS: Material Licensing Tracking System

MLTS is maintained by the Nuclear Regulatory Commission and contains a list of approximately 8,100 sites which possess or use radioactive materials and which are subject to NRC licensing requirements. To maintain currency, EDR contacts the Agency on a quarterly basis.

Date of Government Version: 06/21/2011
Date Data Arrived at EDR: 07/15/2011
Date Made Active in Reports: 09/13/2011
Number of Days to Update: 60

Source: Nuclear Regulatory Commission
Telephone: 301-415-7169
Last EDR Contact: 03/11/2013
Next Scheduled EDR Contact: 06/24/2013
Data Release Frequency: Quarterly

RADINFO: Radiation Information Database

The Radiation Information Database (RADINFO) contains information about facilities that are regulated by U.S. Environmental Protection Agency (EPA) regulations for radiation and radioactivity.

Date of Government Version: 04/09/2013
Date Data Arrived at EDR: 04/11/2013
Date Made Active in Reports: 05/10/2013
Number of Days to Update: 29

Source: Environmental Protection Agency
Telephone: 202-343-9775
Last EDR Contact: 04/11/2013
Next Scheduled EDR Contact: 07/22/2013
Data Release Frequency: Quarterly

FINDS: Facility Index System/Facility Registry System

Facility Index System. FINDS contains both facility information and 'pointers' to other sources that contain more detail. EDR includes the following FINDS databases in this report: PCS (Permit Compliance System), AIRS (Aerometric Information Retrieval System), DOCKET (Enforcement Docket used to manage and track information on civil judicial enforcement cases for all environmental statutes), FURS (Federal Underground Injection Control), C-DOCKET (Criminal Docket System used to track criminal enforcement actions for all environmental statutes), FFIS (Federal Facilities Information System), STATE (State Environmental Laws and Statutes), and PADS (PCB Activity Data System).

Date of Government Version: 10/23/2011
Date Data Arrived at EDR: 12/13/2011
Date Made Active in Reports: 03/01/2012
Number of Days to Update: 79

Source: EPA
Telephone: (404) 562-9900
Last EDR Contact: 03/12/2013
Next Scheduled EDR Contact: 06/24/2013
Data Release Frequency: Quarterly

RAATS: RCRA Administrative Action Tracking System

RCRA Administration Action Tracking System. RAATS contains records based on enforcement actions issued under RCRA pertaining to major violators and includes administrative and civil actions brought by the EPA. For administration actions after September 30, 1995, data entry in the RAATS database was discontinued. EPA will retain a copy of the database for historical records. It was necessary to terminate RAATS because a decrease in agency resources made it impossible to continue to update the information contained in the database.

Date of Government Version: 04/17/1995
Date Data Arrived at EDR: 07/03/1995
Date Made Active in Reports: 08/07/1995
Number of Days to Update: 35

Source: EPA
Telephone: 202-564-4104
Last EDR Contact: 06/02/2008
Next Scheduled EDR Contact: 09/01/2008
Data Release Frequency: No Update Planned

RMP: Risk Management Plans

When Congress passed the Clean Air Act Amendments of 1990, it required EPA to publish regulations and guidance for chemical accident prevention at facilities using extremely hazardous substances. The Risk Management Program Rule (RMP Rule) was written to implement Section 112(r) of these amendments. The rule, which built upon existing industry codes and standards, requires companies of all sizes that use certain flammable and toxic substances to develop a Risk Management Program, which includes a(n): Hazard assessment that details the potential effects of an accidental release, an accident history of the last five years, and an evaluation of worst-case and alternative accidental releases; Prevention program that includes safety precautions and maintenance, monitoring, and employee training measures; and Emergency response program that spells out emergency health care, employee training measures and procedures for informing the public and response agencies (e.g the fire department) should an accident occur.

Date of Government Version: 05/08/2012
Date Data Arrived at EDR: 05/25/2012
Date Made Active in Reports: 07/10/2012
Number of Days to Update: 46

Source: Environmental Protection Agency
Telephone: 202-564-8600
Last EDR Contact: 04/29/2013
Next Scheduled EDR Contact: 08/12/2013
Data Release Frequency: Varies

BRS: Biennial Reporting System

The Biennial Reporting System is a national system administered by the EPA that collects data on the generation and management of hazardous waste. BRS captures detailed data from two groups: Large Quantity Generators (LQG) and Treatment, Storage, and Disposal Facilities.

Date of Government Version: 12/31/2011
Date Data Arrived at EDR: 02/26/2013
Date Made Active in Reports: 04/19/2013
Number of Days to Update: 52

Source: EPA/NTIS
Telephone: 800-424-9346
Last EDR Contact: 02/26/2013
Next Scheduled EDR Contact: 06/10/2013
Data Release Frequency: Biennially

UIC: Underground Injection Wells Listing

A listing of uncerground injection wells locations.

Date of Government Version: 02/11/2013
Date Data Arrived at EDR: 02/12/2013
Date Made Active in Reports: 03/28/2013
Number of Days to Update: 44

Source: Department of Environment & Natural Resources
Telephone: 919-807-6412
Last EDR Contact: 05/13/2013
Next Scheduled EDR Contact: 08/26/2013
Data Release Frequency: Varies

DRYCLEANERS: Drycleaning Sites

Potential and known drycleaning sites, active and abandoned, that the Drycleaning Solvent Cleanup Program has knowledge of and entered into this database.

Date of Government Version: 02/06/2013
Date Data Arrived at EDR: 03/26/2013
Date Made Active in Reports: 05/09/2013
Number of Days to Update: 44

Source: Department of Environment & Natural Resources
Telephone: 919-508-8400
Last EDR Contact: 03/26/2013
Next Scheduled EDR Contact: 07/08/2013
Data Release Frequency: Varies

NPDES: NPDES Facility Location Listing

General information regarding NPDES(National Pollutant Discharge Elimination System) permits.

Date of Government Version: 02/08/2013
Date Data Arrived at EDR: 04/09/2013
Date Made Active in Reports: 04/19/2013
Number of Days to Update: 10

Source: Department of Environment & Natural Resources
Telephone: 919-733-7015
Last EDR Contact: 05/28/2013
Next Scheduled EDR Contact: 08/19/2013
Data Release Frequency: Varies

INDIAN RESERV: Indian Reservations

This map layer portrays Indian administered lands of the United States that have any area equal to or greater than 640 acres.

Date of Government Version: 12/31/2005
Date Data Arrived at EDR: 12/08/2006
Date Made Active in Reports: 01/11/2007
Number of Days to Update: 34

Source: USGS
Telephone: 202-208-3710
Last EDR Contact: 04/19/2013
Next Scheduled EDR Contact: 07/29/2013
Data Release Frequency: Semi-Annually

SCRD DRYCLEANERS: State Coalition for Remediation of Drycleaners Listing

The State Coalition for Remediation of Drycleaners was established in 1998, with support from the U.S. EPA Office of Superfund Remediation and Technology Innovation. It is comprised of representatives of states with established drycleaner remediation programs. Currently the member states are Alabama, Connecticut, Florida, Illinois, Kansas, Minnesota, Missouri, North Carolina, Oregon, South Carolina, Tennessee, Texas, and Wisconsin.

Date of Government Version: 03/07/2011
Date Data Arrived at EDR: 03/09/2011
Date Made Active in Reports: 05/02/2011
Number of Days to Update: 54

Source: Environmental Protection Agency
Telephone: 615-532-8599
Last EDR Contact: 05/06/2013
Next Scheduled EDR Contact: 08/05/2013
Data Release Frequency: Varies

US AIRS MINOR: Air Facility System Data

A listing of minor source facilities.

Date of Government Version: 01/23/2013
Date Data Arrived at EDR: 01/30/2013
Date Made Active in Reports: 05/10/2013
Number of Days to Update: 100

Source: EPA
Telephone: 202-564-5962
Last EDR Contact: 04/01/2013
Next Scheduled EDR Contact: 07/15/2013
Data Release Frequency: Annually

US AIRS (AFS): Aerometric Information Retrieval System Facility Subsystem (AFS)

The database is a sub-system of Aerometric Information Retrieval System (AIRS). AFS contains compliance data on air pollution point sources regulated by the U.S. EPA and/or state and local air regulatory agencies. This information comes from source reports by various stationary sources of air pollution, such as electric power plants, steel mills, factories, and universities, and provides information about the air pollutants they produce. Action, air program, air program pollutant, and general level plant data. It is used to track emissions and compliance data from industrial plants.

Date of Government Version: 01/23/2013
Date Data Arrived at EDR: 01/30/2013
Date Made Active in Reports: 05/10/2013
Number of Days to Update: 100

Source: EPA
Telephone: 202-564-5962
Last EDR Contact: 04/01/2013
Next Scheduled EDR Contact: 07/15/2013
Data Release Frequency: Annually

COAL ASH: Coal Ash Disposal Sites

A listing of coal combustion products distribution permits issued by the Division for the treatment, storage, transportation, use and disposal of coal combustion products.

Date of Government Version: 12/31/2007
Date Data Arrived at EDR: 08/04/2009
Date Made Active in Reports: 08/17/2009
Number of Days to Update: 13

Source: Department of Environment & Natural Resources
Telephone: 919-807-6359
Last EDR Contact: 05/06/2013
Next Scheduled EDR Contact: 08/19/2013
Data Release Frequency: Varies

PRP: Potentially Responsible Parties

A listing of verified Potentially Responsible Parties

Date of Government Version: 12/02/2012
Date Data Arrived at EDR: 01/03/2013
Date Made Active in Reports: 03/13/2013
Number of Days to Update: 69

Source: EPA
Telephone: 202-564-6023
Last EDR Contact: 04/04/2013
Next Scheduled EDR Contact: 07/15/2013
Data Release Frequency: Quarterly

2020 COR ACTION: 2020 Corrective Action Program List

The EPA has set ambitious goals for the RCRA Corrective Action program by creating the 2020 Corrective Action Universe. This RCRA cleanup baseline includes facilities expected to need corrective action. The 2020 universe contains a wide variety of sites. Some properties are heavily contaminated while others were contaminated but have since been cleaned up. Still others have not been fully investigated yet, and may require little or no remediation. Inclusion in the 2020 Universe does not necessarily imply failure on the part of a facility to meet its RCRA obligations.

Date of Government Version: 11/11/2011
Date Data Arrived at EDR: 05/18/2012
Date Made Active in Reports: 05/25/2012
Number of Days to Update: 7

Source: Environmental Protection Agency
Telephone: 703-308-4044
Last EDR Contact: 05/17/2013
Next Scheduled EDR Contact: 08/26/2013
Data Release Frequency: Varies

LEAD SMELTER 2: Lead Smelter Sites

A list of several hundred sites in the U.S. where secondary lead smelting was done from 1931and 1964. These sites may pose a threat to public health through ingestion or inhalation of contaminated soil or dust

Date of Government Version: 04/05/2001
Date Data Arrived at EDR: 10/27/2010
Date Made Active in Reports: 12/02/2010
Number of Days to Update: 36

Source: American Journal of Public Health
Telephone: 703-305-6451
Last EDR Contact: 12/02/2009
Next Scheduled EDR Contact: N/A
Data Release Frequency: No Update Planned

LEAD SMELTER 1: Lead Smelter Sites

A listing of former lead smelter site locations.

Date of Government Version: 01/29/2013
Date Data Arrived at EDR: 02/14/2013
Date Made Active in Reports: 02/27/2013
Number of Days to Update: 13

Source: Environmental Protection Agency
Telephone: 703-603-8787
Last EDR Contact: 04/08/2013
Next Scheduled EDR Contact: 07/22/2013
Data Release Frequency: Varies

EPA WATCH LIST: EPA WATCH LIST

EPA maintains a "Watch List" to facilitate dialogue between EPA, state and local environmental agencies on enforcement matters relating to facilities with alleged violations identified as either significant or high priority. Being on the Watch List does not mean that the facility has actually violated the law only that an investigation by EPA or a state or local environmental agency has led those organizations to allege that an unproven violation has in fact occurred. Being on the Watch List does not represent a higher level of concern regarding the alleged violations that were detected, but instead indicates cases requiring additional dialogue between EPA, state and local agencies - primarily because of the length of time the alleged violation has gone unaddressed or unresolved.

Date of Government Version: 12/31/2012
Date Data Arrived at EDR: 02/18/2013
Date Made Active in Reports: 05/10/2013
Number of Days to Update: 81

Source: Environmental Protection Agency
Telephone: 617-520-3000
Last EDR Contact: 05/10/2013
Next Scheduled EDR Contact: 08/26/2013
Data Release Frequency: Quarterly

US FIN ASSUR: Financial Assurance Information

All owners and operators of facilities that treat, store, or dispose of hazardous waste are required to provide proof that they will have sufficient funds to pay for the clean up, closure, and post-closure care of their facilities.

Date of Government Version: 03/04/2013
Date Data Arrived at EDR: 03/15/2013
Date Made Active in Reports: 05/10/2013
Number of Days to Update: 56

Source: Environmental Protection Agency
Telephone: 202-566-1917
Last EDR Contact: 05/20/2013
Next Scheduled EDR Contact: 09/02/2013
Data Release Frequency: Quarterly

FEDLAND: Federal and Indian Lands

Federally and Indian administrated lands of the United States. Lands included are administrated by: Army Corps of Engineers, Bureau of Reclamation, National Wild and Scenic River, National Wildlife Refuge, Public Domain Land, Wilderness, Wilderness Study Area, Wildlife Management Area, Bureau of Indian Affairs, Bureau of Land Management, Department of Justice, Forest Service, Fish and Wildlife Service, National Park Service.

Date of Government Version: 12/31/2005
Date Data Arrived at EDR: 02/06/2006
Date Made Active in Reports: 01/11/2007
Number of Days to Update: 339

Source: U.S. Geological Survey
Telephone: 888-275-8747
Last EDR Contact: 04/19/2013
Next Scheduled EDR Contact: 07/29/2013
Data Release Frequency: N/A

PCB TRANSFORMER: PCB Transformer Registration Database
The database of PCB transformer registrations that includes all PCB registration submittals.

Date of Government Version: 02/01/2011
Date Data Arrived at EDR: 10/19/2011
Date Made Active in Reports: 01/10/2012
Number of Days to Update: 83

Source: Environmental Protection Agency
Telephone: 202-566-0517
Last EDR Contact: 05/03/2013
Next Scheduled EDR Contact: 08/12/2013
Data Release Frequency: Varies

COAL ASH DOE: Sleam-Electric Plan Operation Data
A listing of power plants that store ash in surface ponds.

Date of Government Version: 12/31/2005
Date Data Arrived at EDR: 08/07/2009
Date Made Active in Reports: 10/22/2009
Number of Days to Update: 76

Source: Department of Energy
Telephone: 202-586-8719
Last EDR Contact: 04/18/2013
Next Scheduled EDR Contact: 07/29/2013
Data Release Frequency: Varies

Financial Assurance 2: Financial Assurance Information Listing
Information for solid waste facilities. Financial assurance is intended to ensure that resources are available to pay for the cost of closure, post-closure care, and corrective measures if the owner or operator of a regulated facility is unable or unwilling to pay.

Date of Government Version: 10/02/2012
Date Data Arrived at EDR: 10/03/2012
Date Made Active in Reports: 10/26/2012
Number of Days to Update: 23

Source: Department of Environmental & Natural Resources
Telephone: 919-508-8496
Last EDR Contact: 04/01/2013
Next Scheduled EDR Contact: 07/15/2013
Data Release Frequency: Varies

COAL ASH EPA: Coal Combustion Residues Surface Impoundments List
A listing of coal combustion residues surface impoundments with high hazard potential ratings.

Date of Government Version: 08/17/2010
Date Data Arrived at EDR: 01/03/2011
Date Made Active in Reports: 03/21/2011
Number of Days to Update: 77

Source: Environmental Protection Agency
Telephone: N/A
Last EDR Contact: 03/15/2013
Next Scheduled EDR Contact: 06/24/2013
Data Release Frequency: Varies

Financial Assurance 1: Financial Assurance Information Listing
A listing of financial assurance information for underground storage tank facilities. Financial assurance is intended to ensure that resources are available to pay for the cost of closure, post-closure care, and corrective measures if the owner or operator of a regulated facility is unable or unwilling to pay.

Date of Government Version: 09/23/2011
Date Data Arrived at EDR: 10/06/2011
Date Made Active in Reports: 11/01/2011
Number of Days to Update: 26

Source: Department of Environment & Natural Resources
Telephone: 919-733-1322
Last EDR Contact: 05/16/2013
Next Scheduled EDR Contact: 08/26/2013
Data Release Frequency: Quarterly

Financial Assurance 3: Financial Assurance Information
Hazardous waste financial assurance information.

Date of Government Version: 09/30/2012
Date Data Arrived at EDR: 10/19/2012
Date Made Active in Reports: 11/29/2012
Number of Days to Update: 41

Source: Department of Environment & Natural Resources
Telephone: 919-707-8222
Last EDR Contact: 03/18/2013
Next Scheduled EDR Contact: 07/01/2013
Data Release Frequency: Varies

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

EDR HIGH RISK HISTORICAL RECORDS

EDR Exclusive Records

EDR MGP: EDR Proprietary Manufactured Gas Plants

The EDR Proprietary Manufactured Gas Plant Database includes records of coal gas plants (manufactured gas plants) compiled by EDR's researchers. Manufactured gas sites were used in the United States from the 1800's to 1950's to produce a gas that could be distributed and used as fuel. These plants used whale oil, rosin, coal, or a mixture of coal, oil, and water that also produced a significant amount of waste. Many of the byproducts of the gas production, such as coal tar (oily waste containing volatile and non-volatile chemicals), sludges, oils and other compounds are potentially hazardous to human health and the environment. The byproduct from this process was frequently disposed of directly at the plant site and can remain or spread slowly, serving as a continuous source of soil and groundwater contamination.

Date of Government Version: N/A
Date Data Arrived at EDR: N/A
Date Made Active in Reports: N/A
Number of Days to Update: N/A

Source: EDR, Inc.
Telephone: N/A
Last EDR Contact: N/A
Next Scheduled EDR Contact: N/A
Data Release Frequency: No Update Planned

EDR US Hist Auto Stat: EDR Exclusive Historic Gas Stations

EDR has searched selected national collections of business directories and has collected listings of potential gas station/filling station/service station sites that were available to EDR researchers. EDR's review was limited to those categories of sources that might, in EDR's opinion, include gas station/filling station/service station establishments. The categories reviewed included, but were not limited to gas, gas station, gasoline station, filling station, auto, automobile repair, auto service station, service station, etc. This database falls within a category of information EDR classifies as "High Risk Historical Records", or HRHR. EDR's HRHR effort presents unique and sometimes proprietary data about past sites and operations that typically create environmental concerns, but may not show up in current government records searches.

Date of Government Version: N/A
Date Data Arrived at EDR: N/A
Date Made Active in Reports: N/A
Number of Days to Update: N/A

Source: EDR, Inc.
Telephone: N/A
Last EDR Contact: N/A
Next Scheduled EDR Contact: N/A
Data Release Frequency: Varies

EDR US Hist Cleaners: EDR Exclusive Historic Dry Cleaners

EDR has searched selected national collections of business directories and has collected listings of potential dry cleaner sites that were available to EDR researchers. EDR's review was limited to those categories of sources that might, in EDR's opinion, include dry cleaning establishments. The categories reviewed included, but were not limited to dry cleaners, cleaners, laundry, laundromat, cleaning/laundry, wash & dry etc. This database falls within a category of information EDR classifies as "High Risk Historical Records", or HRHR. EDR's HRHR effort presents unique and sometimes proprietary data about past sites and operations that typically create environmental concerns, but may not show up in current government records searches.

Date of Government Version: N/A
Date Data Arrived at EDR: N/A
Date Made Active in Reports: N/A
Number of Days to Update: N/A

Source: EDR, Inc.
Telephone: N/A
Last EDR Contact: N/A
Next Scheduled EDR Contact: N/A
Data Release Frequency: Varies

EDR US Hist Auto Stat: EDR Proprietary Historic Gas Stations - Cole

Date of Government Version: N/A
Date Data Arrived at EDR: N/A
Date Made Active in Reports: N/A
Number of Days to Update: N/A

Source: N/A
Telephone: N/A
Last EDR Contact: N/A
Next Scheduled EDR Contact: N/A
Data Release Frequency: Varies

EDR US Hist Cleaners: EDR Proprietary Historic Dry Cleaners - Cole

Date of Government Version: N/A
Date Data Arrived at EDR: N/A
Date Made Active in Reports: N/A
Number of Days to Update: N/A

Source: N/A
Telephone: N/A
Last EDR Contact: N/A
Next Scheduled EDR Contact: N/A
Data Release Frequency: Varies

OTHER DATABASE(S)

Depending on the geographic area covered by this report, the data provided in these specialty databases may or may not be complete. For example, the existence of wetlands information data in a specific report does not mean that all wetlands in the area covered by the report are included. Moreover, the absence of any reported wetlands information does not necessarily mean that wetlands do not exist in the area covered by the report.

CT MANIFEST: Hazardous Waste Manifest Data
Facility and manifest data. Manifest is a document that lists and tracks hazardous waste from the generator through transporters to a tsd facility.

Date of Government Version: 02/18/2013
Date Data Arrived at EDR: 02/18/2013
Date Made Active in Reports: 03/21/2013
Number of Days to Update: 31

Source: Department of Energy & Environmental Protection
Telephone: 860-424-3375
Last EDR Contact: 05/21/2013
Next Scheduled EDR Contact: 09/02/2013
Data Release Frequency: Annually

NJ MANIFEST: Manifest Information
Hazardous waste manifest information.

Date of Government Version: 12/31/2011
Date Data Arrived at EDR: 07/19/2012
Date Made Active in Reports: 08/28/2012
Number of Days to Update: 40

Source: Department of Environmental Protection
Telephone: N/A
Last EDR Contact: 04/19/2013
Next Scheduled EDR Contact: 07/29/2013
Data Release Frequency: Annually

NY MANIFEST: Facility and Manifest Data
Manifest is a document that lists and tracks hazardous waste from the generator through transporters to a TSD facility.

Date of Government Version: 02/01/2013
Date Data Arrived at EDR: 02/07/2013
Date Made Active in Reports: 03/15/2013
Number of Days to Update: 36

Source: Department of Environmental Conservation
Telephone: 518-402-8651
Last EDR Contact: 05/09/2013
Next Scheduled EDR Contact: 08/19/2013
Data Release Frequency: Annually

PA MANIFEST: Manifest Information
Hazardous waste manifest information.

Date of Government Version: 12/31/2011
Date Data Arrived at EDR: 07/23/2012
Date Made Active in Reports: 09/18/2012
Number of Days to Update: 57

Source: Department of Environmental Protection
Telephone: 717-783-8990
Last EDR Contact: 04/23/2013
Next Scheduled EDR Contact: 08/05/2013
Data Release Frequency: Annually

RI MANIFEST: Manifest information
Hazardous waste manifest information

Date of Government Version: 12/31/2011
Date Data Arrived at EDR: 06/22/2012
Date Made Active in Reports: 07/31/2012
Number of Days to Update: 39

Source: Department of Environmental Management
Telephone: 401-222-2797
Last EDR Contact: 05/28/2013
Next Scheduled EDR Contact: 09/09/2013
Data Release Frequency: Annually

WI MANIFEST: Manifest Information
Hazardous waste manifest information.

Date of Government Version: 12/31/2011
Date Data Arrived at EDR: 07/19/2012
Date Made Active in Reports: 09/27/2012
Number of Days to Update: 70

Source: Department of Natural Resources
Telephone: N/A
Last EDR Contact: 03/18/2013
Next Scheduled EDR Contact: 07/01/2013
Data Release Frequency: Annually

Oil/Gas Pipelines: This data was obtained by EDR from the USGS in 1994. It is referred to by USGS as GeoData Digital Line Graphs from 1:100,000-Scale Maps. It was extracted from the transportation category including some oil, but primarily gas pipelines.

Electric Power Transmission Line Data
Source: Rextag Strategies Corp.
Telephone: (281) 769-2247
U.S. Electric Transmission and Power Plants Systems Digital GIS Data

Sensitive Receptors: There are individuals deemed sensitive receptors due to their fragile immune systems and special sensitivity to environmental discharges. These sensitive receptors typically include the elderly, the sick, and children. While the location of all sensitive receptors cannot be determined, EDR indicates those buildings and facilities - schools, daycares, hospitals, medical centers, and nursing homes - where individuals who are sensitive receptors are likely to be located.

AHA Hospitals:
Source: American Hospital Association, Inc.
Telephone: 312-280-5991
The database includes a listing of hospitals based on the American Hospital Association's annual survey of hospitals.

Medical Centers: Provider of Services Listing
Source: Centers for Medicare & Medicaid Services
Telephone: 410-786-3000
A listing of hospitals with Medicare provider number, produced by Centers of Medicare & Medicaid Services, a federal agency within the U.S. Department of Health and Human Services.

Nursing Homes
Source: National Institutes of Health
Telephone: 301-594-6248
Information on Medicare and Medicaid certified nursing homes in the United States.

Public Schools
Source: National Center for Education Statistics
Telephone: 202-502-7300
The National Center for Education Statistics' primary database on elementary and secondary public education in the United States. It is a comprehensive, annual, national statistical database of all public elementary and secondary schools and school districts, which contains data that are comparable across all states.

Private Schools
Source: National Center for Education Statistics
Telephone: 202-502-7300
The National Center for Education Statistics' primary database on private school locations in the United States.

Daycare Centers: Child Care Facility List
Source: Department of Health & Human Services
Telephone: 919-662-4499

Flood Zone Data: This data, available in select counties across the country, was obtained by EDR in 2003 & 2011 from the Federal Emergency Management Agency (FEMA). Data depicts 100-year and 500-year flood zones as defined by FEMA.

NWI: National Wetlands Inventory. This data, available in select counties across the country, was obtained by EDR in 2002 and 2005 from the U.S. Fish and Wildlife Service.

State Wetlands Data: Wetlands Inventory
Source: Department of Environment & Natural Resources
Telephone: 919-733-2090

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Scanned Digital USGS 7.5' Topographic Map (DRG)
Source: United States Geologic Survey
A digital raster graphic (DRG) is a scanned image of a U.S. Geological Survey topographic map. The map images are made by scanning published paper maps on high-resolution scanners. The raster image is georeferenced and fit to the Universal Transverse Mercator (UTM) projection.

STREET AND ADDRESS INFORMATION

© 2010 Tele Atlas North America, Inc. All rights reserved. This material is proprietary and the subject of copyright protection and other intellectual property rights owned by or licensed to Tele Atlas North America, Inc. The use of this material is subject to the terms of a license agreement. You will be held liable for any unauthorized copying or disclosure of this material.

GEOCHECK ®- PHYSICAL SETTING SOURCE ADDENDUM

TARGET PROPERTY ADDRESS

WOOD PILE BLOCK A-45
218 S. BLOODWORTH STREET
RALEIGH, NC 27601

TARGET PROPERTY COORDINATES

Latitude (North):	35.7774 - 35° 46' 38.64''
Longitude (West):	78.6337 - 78° 38' 1.32''
Universal Tranverse Mercator:	Zone 17
UTM X (Meters):	713891.2
UTM Y (Meters):	3961642.5
Elevation:	310 ft. above sea level

USGS TOPOGRAPHIC MAP

Target Property Map:	35078-G6 RALEIGH WEST, NC
Most Recent Revision:	1993
East Map:	35078-G5 RALEIGH EAST, NC
Most Recent Revision:	1993

EDR's GeoCheck Physical Setting Source Addendum is provided to assist the environmental professional in forming an opinion about the impact of potential contaminant migration.

Assessment of the impact of contaminant migration generally has two principal investigative components:

1. Groundwater flow direction, and
2. Groundwater flow velocity.

Groundwater flow direction may be impacted by surface topography, hydrology, hydrogeology, characteristics of the soil, and nearby wells. Groundwater flow velocity is generally impacted by the nature of the geologic strata.

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

GROUNDWATER FLOW DIRECTION INFORMATION

Groundwater flow direction for a particular site is best determined by a qualified environmental professional using site-specific well data. If such data is not reasonably ascertainable, it may be necessary to rely on other sources of information, such as surface topographic information, hydrologic information, hydrogeologic data collected on nearby properties, and regional groundwater flow information (from deep aquifers).


TOPOGRAPHIC INFORMATION

Surface topography may be indicative of the direction of surficial groundwater flow. This information can be used to assist the environmental professional in forming an opinion about the impact of nearby contaminated properties or, should contamination exist on the target property, what downgradient sites might be impacted.

TARGET PROPERTY TOPOGRAPHY

General Topographic Gradient: General South

SURROUNDING TOPOGRAPHY: ELEVATION PROFILES

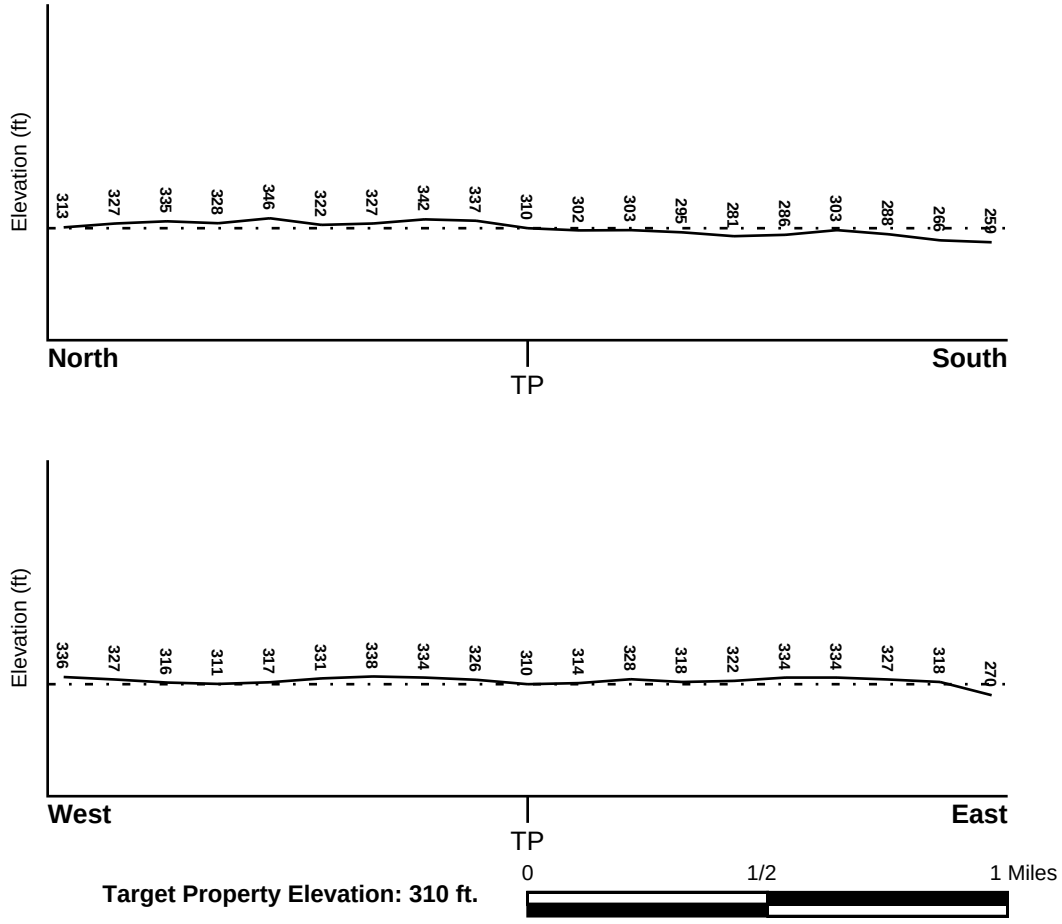

Source: Topography has been determined from the USGS 7.5' Digital Elevation Model and should be evaluated on a relative (not an absolute) basis. Relative elevation information between sites of close proximity should be field verified.

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

HYDROLOGIC INFORMATION

Surface water can act as a hydrologic barrier to groundwater flow. Such hydrologic information can be used to assist the environmental professional in forming an opinion about the impact of nearby contaminated properties or, should contamination exist on the target property, what downgradient sites might be impacted.

Refer to the Physical Setting Source Map following this summary for hydrologic information (major waterways and bodies of water).

FEMA FLOOD ZONE

Target Property County	FEMA Flood Electronic Data
WAKE, NC	YES - refer to the Overview Map and Detail Map

Flood Plain Panel at Target Property: 37183C - FEMA DFIRM Flood data

Additional Panels in search area: Not Reported

NATIONAL WETLAND INVENTORY

NWI Quad at Target Property	NWI Electronic Data Coverage
RALEIGH WEST	YES - refer to the Overview Map and Detail Map

HYDROGEOLOGIC INFORMATION

Hydrogeologic information obtained by installation of wells on a specific site can often be an indicator of groundwater flow direction in the immediate area. Such hydrogeologic information can be used to assist the environmental professional in forming an opinion about the impact of nearby contaminated properties or, should contamination exist on the target property, what downgradient sites might be impacted.

AQUIFLOW®

Search Radius: 1.000 Mile.

EDR has developed the AQUIFLOW Information System to provide data on the general direction of groundwater flow at specific points. EDR has reviewed reports submitted by environmental professionals to regulatory authorities at select sites and has extracted the date of the report, groundwater flow direction as determined hydrogeologically, and the depth to water table.

MAP ID	LOCATION FROM TP	GENERAL DIRECTION GROUNDWATER FLOW
1	0 - 1/8 Mile SW	SW
2	1/8 - 1/4 Mile SSE	SSE
3	1/4 - 1/2 Mile WSW	SE
4	1/4 - 1/2 Mile ENE	Not Reported
5	1/4 - 1/2 Mile WNW	Not Reported
A8	1/4 - 1/2 Mile West	Not Reported
9	1/2 - 1 Mile West	Not Reported
10	1/2 - 1 Mile West	SE
11	1/2 - 1 Mile WNW	NE
12	1/2 - 1 Mile ESE	Not Reported
13	1/2 - 1 Mile West	Not Reported
14	1/2 - 1 Mile ENE	Varies
15	1/2 - 1 Mile North	NE
16	1/2 - 1 Mile WNW	Not Reported

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

MAP ID	LOCATION FROM TP	GENERAL DIRECTION GROUNDWATER FLOW
17	1/2 - 1 Mile WSW	Not Reported
18	1/2 - 1 Mile NW	NW
19	1/2 - 1 Mile WNW	ENE
20	1/2 - 1 Mile NE	NW
B21	1/2 - 1 Mile SSW	SW
B22	1/2 - 1 Mile SSW	Not Reported
23	1/2 - 1 Mile NW	NW

For additional site information, refer to Physical Setting Source Map Findings.

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

GROUNDWATER FLOW VELOCITY INFORMATION

Groundwater flow velocity information for a particular site is best determined by a qualified environmental professional using site specific geologic and soil strata data. If such data are not reasonably ascertainable, it may be necessary to rely on other sources of information, including geologic age identification, rock stratigraphic unit and soil characteristics data collected on nearby properties and regional soil information. In general, contaminant plumes move more quickly through sandy-gravelly types of soils than silty-clayey types of soils.

GEOLOGIC INFORMATION IN GENERAL AREA OF TARGET PROPERTY

Geologic information can be used by the environmental professional in forming an opinion about the relative speed at which contaminant migration may be occurring.

ROCK STRATIGRAPHIC UNIT

Era:	Paleozoic
System:	Pennsylvanian
Series:	Felsic paragneiss and schist
Code:	mm1 *(decoded above as Era, System & Series)*

GEOLOGIC AGE IDENTIFICATION

Category: Metamorphic Rocks

Geologic Age and Rock Stratigraphic Unit Source: P.G. Schruben, R.E. Arndt and W.J. Bawiec, Geology of the Conterminous U.S. at 1:2,500,000 Scale - a digital representation of the 1974 P.B. King and H.M. Beikman Map, USGS Digital Data Series DDS - 11 (1994).

DOMINANT SOIL COMPOSITION IN GENERAL AREA OF TARGET PROPERTY

The U.S. Department of Agriculture's (USDA) Soil Conservation Service (SCS) leads the National Cooperative Soil Survey (NCSS) and is responsible for collecting, storing, maintaining and distributing soil survey information for privately owned lands in the United States. A soil map in a soil survey is a representation of soil patterns in a landscape. Soil maps for STATSGO are compiled by generalizing more detailed (SSURGO) soil survey maps. The following information is based on Soil Conservation Service STATSGO data.

Soil Component Name: URBAN LAND

Soil Surface Texture: variable

Hydrologic Group: Not reported

Soil Drainage Class: Not reported

Hydric Status: Soil does not meet the requirements for a hydric soil.

Corrosion Potential - Uncoated Steel: Not Reported

Depth to Bedrock Min: > 10 inches

Depth to Bedrock Max: > 10 inches

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

Soil Layer Information							
	Boundary			Classification			
Layer	Upper	Lower	Soil Texture Class	AASHTO Group	Unified Soil	Permeability Rate (in/hr)	Soil Reaction (pH)
1	0 inches	6 inches	variable	Not reported	Not reported	Max: 0.00 Min: 0.00	Max: 0.00 Min: 0.00

OTHER SOIL TYPES IN AREA

Based on Soil Conservation Service STATSGO data, the following additional subordinant soil types may appear within the general area of target property.

Soil Surface Textures: sandy loam
fine sandy loam
loam

Surficial Soil Types: sandy loam
fine sandy loam
loam

Shallow Soil Types: clay loam
clay
sandy clay

Deeper Soil Types: sandy loam

LOCAL / REGIONAL WATER AGENCY RECORDS

EDR Local/Regional Water Agency records provide water well information to assist the environmental professional in assessing sources that may impact ground water flow direction, and in forming an opinion about the impact of contaminant migration on nearby drinking water wells.

WELL SEARCH DISTANCE INFORMATION

DATABASE	SEARCH DISTANCE (miles)
Federal USGS	1.000
Federal FRDS PWS	Nearest PWS within 1 mile
State Database	1.000

FEDERAL USGS WELL INFORMATION

MAP ID	WELL ID	LOCATION FROM TP
A7	USGS40000890499	1/4 - 1/2 Mile WSW

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

FEDERAL FRDS PUBLIC WATER SUPPLY SYSTEM INFORMATION

MAP ID	WELL ID	LOCATION FROM TP
6	NC0392720	1/4 - 1/2 Mile South

Note: PWS System location is not always the same as well location.

STATE DATABASE WELL INFORMATION

MAP ID	WELL ID	LOCATION FROM TP
No Wells Found		

OTHER STATE DATABASE INFORMATION


NORTH CAROLINA NATURAL HERITAGE ELEMENT OCCURRENCES

ID	Class
NC50001354	Animal
NC50009970	Animal

NORTH CAROLINA SIGNIFICANT NATURAL HERITAGE AREAS DATABASE:

ID	Name
NC10002116	WALNUT CREEK BOTTOMLAND FORESTS

PHYSICAL SETTING SOURCE MAP - 3618453.2s

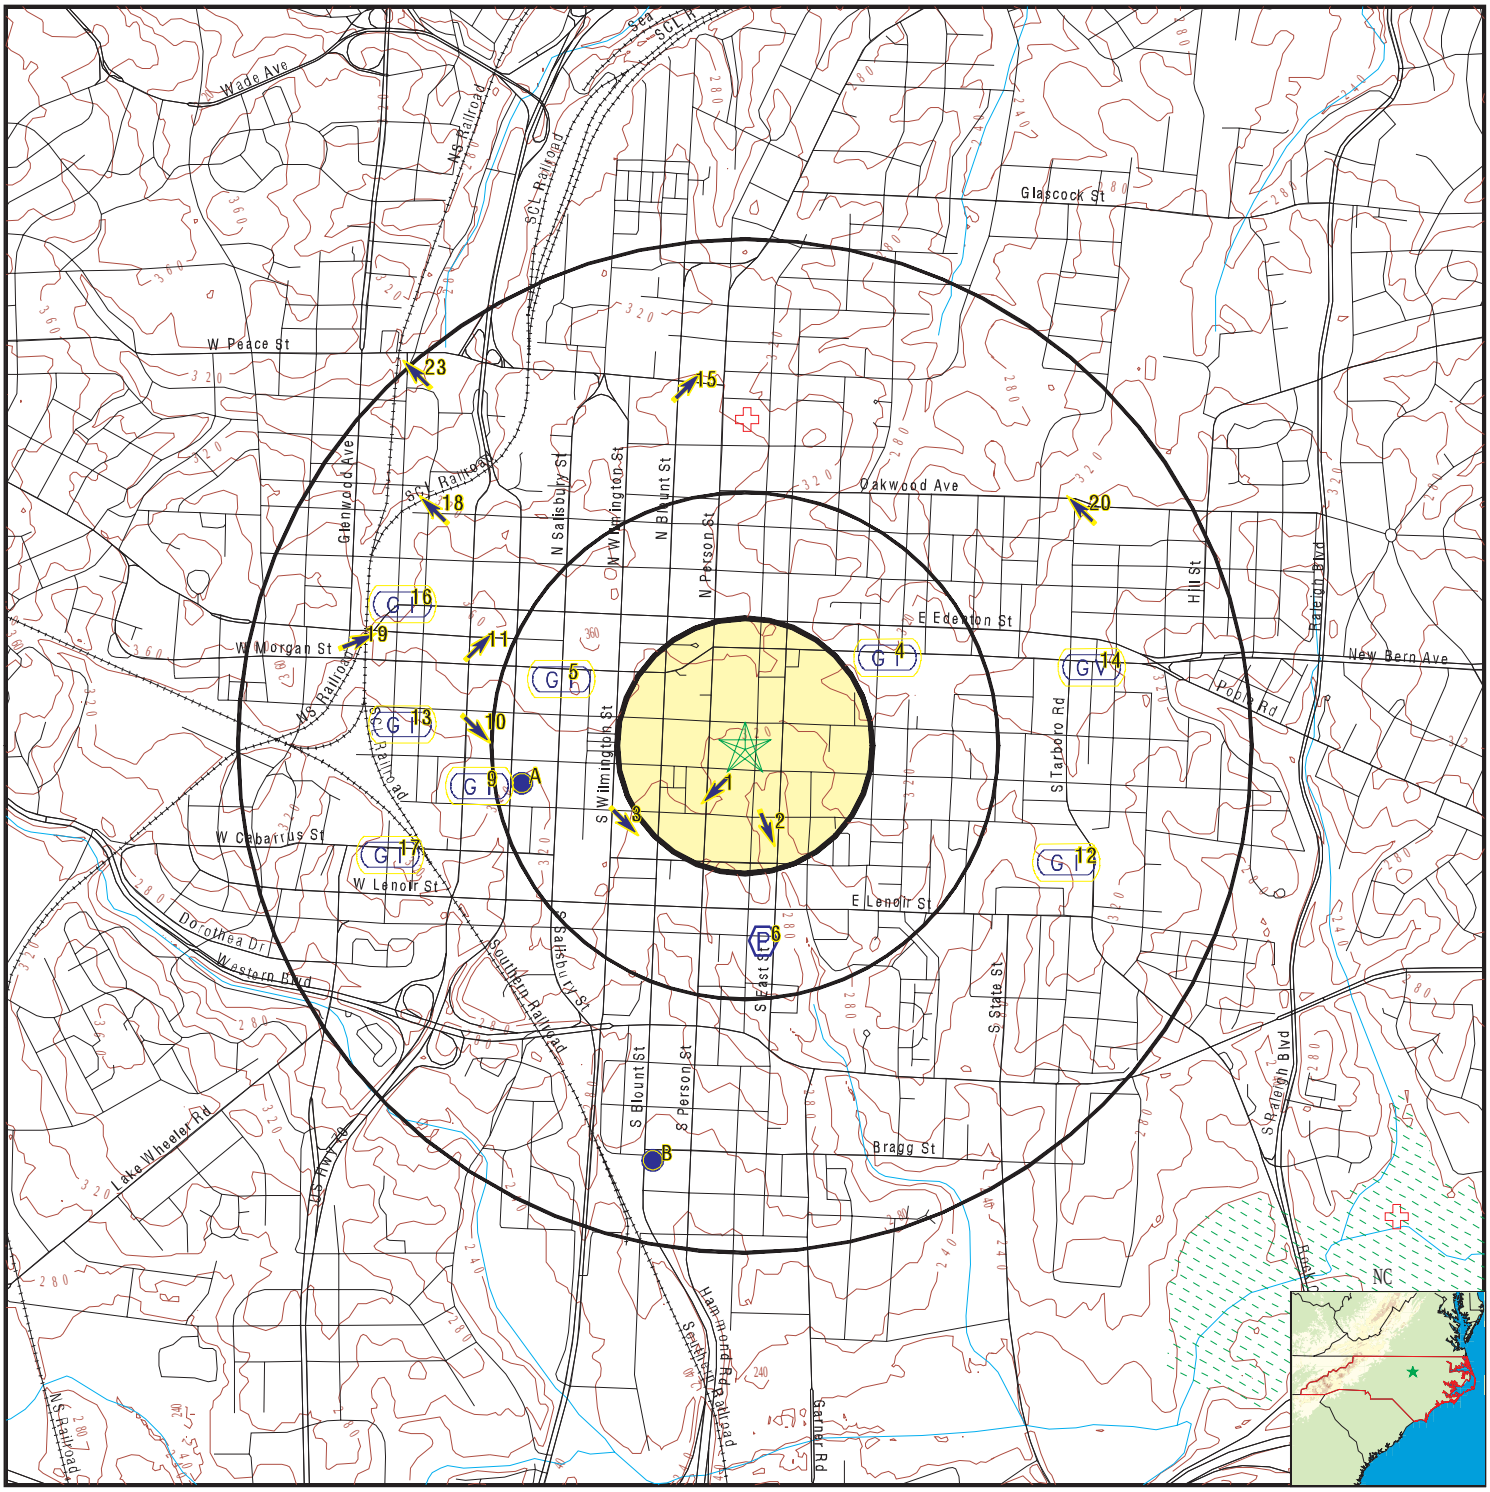

- County Boundary
- Major Roads
- Contour Lines
- Earthquake epicenter, Richter 5 or greater
- Water Wells
- Public Water Supply Wells
- Cluster of Multiple Icons
- Groundwater Flow Direction
- Indeterminate Groundwater Flow at Location
- Groundwater Flow Varies at Location
- Wildlife Areas
- Natural Areas
- Rare & Endangered Species

SITE NAME:	Wood Pile Block A-45	CLIENT:	Geologix, Inc.
ADDRESS:	218 S. Bloodworth Street Raleigh NC 27601	CONTACT:	Rob Livermon
LAT/LONG:	35.7774 / 78.6337	INQUIRY #:	3618453.2s
		DATE:	May 29, 2013 10:52 am

Copyright © 2013 EDR, Inc. © 2010 Tele Atlas Rel. 07/2009.

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID Direction Distance Elevation			Database	EDR ID Number
1 **SW** **0 - 1/8 Mile** **Higher**	Site ID: Groundwater Flow: Shallowest Water Table Depth: Deepest Water Table Depth: Average Water Table Depth: Depth to rock - shallowest: Depth to rock - deepest: Depth to rock - average: Date:	3897 SW 31.0 38.2 Not Reported Not Reported Not Reported Not Reported 01/07/1991	**AQUIFLOW**	**30573**
2 **SSE** **1/8 - 1/4 Mile** **Lower**	Site ID: Groundwater Flow: Shallowest Water Table Depth: Deepest Water Table Depth: Average Water Table Depth: Depth to rock - shallowest: Depth to rock - deepest: Depth to rock - average: Date:	10820 SSE 13.0 15.0 Not Reported Not Reported Not Reported Not Reported 05/27/1998	**AQUIFLOW**	**40048**
3 **WSW** **1/4 - 1/2 Mile** **Higher**	Site ID: Groundwater Flow: Shallowest Water Table Depth: Deepest Water Table Depth: Average Water Table Depth: Depth to rock - shallowest: Depth to rock - deepest: Depth to rock - average: Date:	1011 SE Not Reported Not Reported Not Reported Not Reported Not Reported Not Reported 05/1993	**AQUIFLOW**	**31007**
4 **ENE** **1/4 - 1/2 Mile** **Higher**	Site ID: Groundwater Flow: Shallowest Water Table Depth: Deepest Water Table Depth: Average Water Table Depth: Depth to rock - shallowest: Depth to rock - deepest: Depth to rock - average: Date:	10430 Not Reported 24.5 27.5 Not Reported Not Reported Not Reported Not Reported 09/21/1992	**AQUIFLOW**	**36733**
5 **WNW** **1/4 - 1/2 Mile** **Higher**	Site ID: Groundwater Flow: Shallowest Water Table Depth: Deepest Water Table Depth: Average Water Table Depth: Depth to rock - shallowest: Depth to rock - deepest: Depth to rock - average: Date:	10996 Not Reported Not Reported Not Reported 33.33 Not Reported Not Reported Not Reported 02/16/1995	**AQUIFLOW**	**30988**

Map ID
Direction
Distance
Elevation | Database | EDR ID Number

6
South
1/4 - 1/2 Mile
Lower | **FRDS PWS** | **NC0392720**

Pwsid:	NC0392720	Epa region:	04
State:	NC	County:	Wake
Pws name:	ANGUS BARN		
Population Served:	100	Pwssvcconn:	6
PWS Source:	Groundwater		
Pws type:	NTNCWS		
Status:	Active	Owner type:	Private
Facility id:	2268		
Facility name:	STORAGE_HYDRO_1		
Facility type:	Storage	Treatment process:	hypochlorination, post
Treatment objective:	disinfection		
Contact name:	AARDAL, GREG		
Original name:	AARDAL, GREG		
Contact phone:	919-787-3506	Contact address1:	PO BOX 6357
Contact address2:	Not Reported		
Contact city:	RALEIGH		
Contact zip:	27628		
Facility id:	31108		
Facility name:	WELL #1		
Facility type:	Well	Treatment process:	hypochlorination, post
Treatment objective:	disinfection		
Facility id:	31109		
Facility name:	WELL #2		
Facility type:	Well	Treatment process:	hypochlorination, post
Treatment objective:	disinfection		
Facility id:	31110		
Facility name:	WELL #3		
Facility type:	Well	Treatment process:	hypochlorination, post
Treatment objective:	disinfection		
Facility id:	31111		
Facility name:	WELL #4(DISCONNECTED)		
Facility type:	Well	Treatment process:	hypochlorination, post
Treatment objective:	disinfection		
Facility id:	31112		
Facility name:	WELL #5		
Facility type:	Well	Treatment process:	hypochlorination, post
Treatment objective:	disinfection		
Facility id:	31113		
Facility name:	WELL #6		
Facility type:	Well	Treatment process:	hypochlorination, post
Treatment objective:	disinfection		

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Facility id: 57349
Facility name: DISTRIBUTION SYSTEM
Facility type: Distribution_system_zone Treatment process: hypochlorination, post
Treatment objective: disinfection

Facility id: 604
Facility name: STORAGE_ELEVATED_1
Facility type: Storage Treatment process: hypochlorination, post
Treatment objective: disinfection

Facility id: 9364
Facility name: TREATMENT_PLT_WELL #3/STORAGE
Facility type: Treatment_plant Treatment process: hypochlorination, post
Treatment objective: disinfection

PWS ID: NC0392720
Date Initiated: 7706 Date Deactivated: Not Reported
PWS Name: ANGUS BARN
RALEIGH, NC 27628

Addressee / Facility: System Owner/Responsible Party
GREG AARDAL OR MANAGER NOW
PO BOX 6357
RALEIGH, NC 27628

Addressee / Facility: System Owner/Responsible Party
ANGUS BARN LTD--MS VAN EURE
PO BOX 6357
RALEIGH, NC 27628

Facility Latitude: 35 53 58 Facility Longitude: 078 45 58
Facility Latitude: 35 46 18 Facility Longitude: 078 38 00
City Served: RALEIGH
Treatment Class: Treated Population: 00000400

PWS currently has or had major violation(s) or enforcement: YES

VIOLATIONS INFORMATION:

Violation ID: 9403562 Source ID: 000 PWS Phone: Not Reported
Vio. beginning Date: 04/01/94 Vio. end Date: 06/30/94 Vio. Period: 003 Months
Num required Samples: Not Reported Number of Samples Taken: Not Reported
Analysis Result: Not Reported Maximum Contaminant Level: Not Reported
Analysis Method: Not Reported
Violation Type: Monitoring, Routine Major (TCR)
Contaminant: COLIFORM (TCR)
Vio. Awareness Date: 071694

Violation ID: 9413732 Source ID: Not Reported PWS Phone: Not Reported
Vio. beginning Date: 07/01/93 Vio. end Date: 12/31/93 Vio. Period: 006 Months
Num required Samples: Not Reported Number of Samples Taken: Not Reported
Analysis Result: Not Reported Maximum Contaminant Level: Not Reported
Analysis Method: Not Reported
Violation Type: Initial Tap Sampling for Pb and Cu
Contaminant: LEAD & COPPER RULE
Vio. Awareness Date: Not Reported

ENFORCEMENT INFORMATION:

System Name:	ANGUS BARN		
Violation Type:	Monitoring and Reporting Stage 1		
Contaminant:	0999		
Compliance Period:	1/1/2004 0:00:00 - 3/31/2004 0:00:00		
Violation ID:	1004		
Enforcement Date:	8/31/2004 0:00:00	Enf. Action:	State Compliance Achieved
System Name:	ANGUS BARN		
Violation Type:	Monitoring and Reporting Stage 1		
Contaminant:	0999		
Compliance Period:	1/1/2004 0:00:00 - 3/31/2004 0:00:00		
Violation ID:	1004		
Enforcement Date:	8/25/2004 0:00:00	Enf. Action:	State Formal NOV Issued
System Name:	ANGUS BARN		
Violation Type:	Monitoring and Reporting Stage 1		
Contaminant:	0999		
Compliance Period:	1/1/2004 0:00:00 - 3/31/2004 0:00:00		
Violation ID:	1004		
Enforcement Date:	8/25/2004 0:00:00	Enf. Action:	State Formal NOV Issued
System Name:	ANGUS BARN		
Violation Type:	Monitoring and Reporting Stage 1		
Contaminant:	0999		
Compliance Period:	1/1/2004 0:00:00 - 3/31/2004 0:00:00		
Violation ID:	1004		
Enforcement Date:	8/25/2004 0:00:00	Enf. Action:	State Public Notif Requested
System Name:	ANGUS BARN		
Violation Type:	Monitoring and Reporting Stage 1		
Contaminant:	0999		
Compliance Period:	1/1/2004 0:00:00 - 3/31/2004 0:00:00		
Violation ID:	1004		
Enforcement Date:	8/31/2004 0:00:00	Enf. Action:	State Compliance Achieved
System Name:	ANGUS BARN		
Violation Type:	Monitoring and Reporting Stage 1		
Contaminant:	0999		
Compliance Period:	1/1/2004 0:00:00 - 3/31/2004 0:00:00		
Violation ID:	1004		
Enforcement Date:	8/25/2004 0:00:00	Enf. Action:	State Public Notif Requested
System Name:	ANGUS BARN		
Violation Type:	Monitoring and Reporting Stage 1		
Contaminant:	0999		
Compliance Period:	4/1/2004 0:00:00 - 6/30/2004 0:00:00		
Violation ID:	1104		
Enforcement Date:	8/25/2004 0:00:00	Enf. Action:	State Public Notif Requested
System Name:	ANGUS BARN		
Violation Type:	Monitoring and Reporting Stage 1		
Contaminant:	0999		
Compliance Period:	4/1/2004 0:00:00 - 6/30/2004 0:00:00		
Violation ID:	1104		
Enforcement Date:	8/25/2004 0:00:00	Enf. Action:	State Public Notif Requested
System Name:	ANGUS BARN		
Violation Type:	Monitoring and Reporting Stage 1		
Contaminant:	0999		
Compliance Period:	4/1/2004 0:00:00 - 6/30/2004 0:00:00		
Violation ID:	1104		
Enforcement Date:	8/25/2004 0:00:00	Enf. Action:	State Formal NOV Issued

ENFORCEMENT INFORMATION:

System Name:	ANGUS BARN		
Violation Type:	Monitoring and Reporting Stage 1		
Contaminant:	0999		
Compliance Period:	4/1/2004 0:00:00 - 6/30/2004 0:00:00		
Violation ID:	1104		
Enforcement Date:	8/31/2004 0:00:00	Enf. Action:	State Compliance Achieved
System Name:	ANGUS BARN		
Violation Type:	Monitoring and Reporting Stage 1		
Contaminant:	0999		
Compliance Period:	4/1/2004 0:00:00 - 6/30/2004 0:00:00		
Violation ID:	1104		
Enforcement Date:	8/25/2004 0:00:00	Enf. Action:	State Formal NOV Issued
System Name:	ANGUS BARN		
Violation Type:	Monitoring and Reporting Stage 1		
Contaminant:	0999		
Compliance Period:	4/1/2004 0:00:00 - 6/30/2004 0:00:00		
Violation ID:	1104		
Enforcement Date:	8/31/2004 0:00:00	Enf. Action:	State Compliance Achieved
System Name:	ANGUS BARN		
Violation Type:	OCCT Study Recommendation		
Contaminant:	LEAD & COPPER RULE		
Compliance Period:	1/1/2003 0:00:00 - 12/31/2025 0:00:00		
Violation ID:	1205		
Enforcement Date:	1/13/2005 0:00:00	Enf. Action:	State Public Notif Requested
System Name:	ANGUS BARN		
Violation Type:	OCCT Study Recommendation		
Contaminant:	LEAD & COPPER RULE		
Compliance Period:	1/1/2003 0:00:00 - 12/31/2025 0:00:00		
Violation ID:	1205		
Enforcement Date:	1/13/2005 0:00:00	Enf. Action:	State Public Notif Requested
System Name:	ANGUS BARN		
Violation Type:	OCCT Study Recommendation		
Contaminant:	LEAD & COPPER RULE		
Compliance Period:	1/1/2003 0:00:00 - 12/31/2025 0:00:00		
Violation ID:	1205		
Enforcement Date:	1/13/2005 0:00:00	Enf. Action:	State Formal NOV Issued
System Name:	ANGUS BARN		
Violation Type:	OCCT Study Recommendation		
Contaminant:	LEAD & COPPER RULE		
Compliance Period:	1/1/2003 0:00:00 - 12/31/2025 0:00:00		
Violation ID:	1205		
Enforcement Date:	1/13/2005 0:00:00	Enf. Action:	State Formal NOV Issued
System Name:	ANGUS BARN		
Violation Type:	OCCT Study Recommendation		
Contaminant:	LEAD & COPPER RULE		
Compliance Period:	1/1/2003 0:00:00 - 12/31/2025 0:00:00		
Violation ID:	1205		
Enforcement Date:	2/8/2005 0:00:00	Enf. Action:	State Public Notif Received
System Name:	ANGUS BARN		
Violation Type:	OCCT Study Recommendation		
Contaminant:	LEAD & COPPER RULE		
Compliance Period:	1/1/2003 0:00:00 - 12/31/2025 0:00:00		
Violation ID:	1205		
Enforcement Date:	2/8/2005 0:00:00	Enf. Action:	State Public Notif Received

ENFORCEMENT INFORMATION:

System Name:	ANGUS BARN		
Violation Type:	Monitoring and Reporting Stage 1		
Contaminant:	0999		
Compliance Period:	4/1/2005 0:00:00 - 6/30/2005 0:00:00		
Violation ID:	1305		
Enforcement Date:	8/9/2005 0:00:00	Enf. Action:	State Public Notif Requested
System Name:	ANGUS BARN		
Violation Type:	Monitoring and Reporting Stage 1		
Contaminant:	0999		
Compliance Period:	4/1/2005 0:00:00 - 6/30/2005 0:00:00		
Violation ID:	1305		
Enforcement Date:	8/9/2005 0:00:00	Enf. Action:	State Formal NOV Issued
System Name:	ANGUS BARN		
Violation Type:	Monitoring and Reporting Stage 1		
Contaminant:	0999		
Compliance Period:	4/1/2005 0:00:00 - 6/30/2005 0:00:00		
Violation ID:	1305		
Enforcement Date:	8/9/2005 0:00:00	Enf. Action:	State Public Notif Requested
System Name:	ANGUS BARN		
Violation Type:	Monitoring and Reporting Stage 1		
Contaminant:	0999		
Compliance Period:	4/1/2005 0:00:00 - 6/30/2005 0:00:00		
Violation ID:	1305		
Enforcement Date:	8/9/2005 0:00:00	Enf. Action:	State Formal NOV Issued
System Name:	ANGUS BARN		
Violation Type:	Monitoring and Reporting Stage 1		
Contaminant:	0999		
Compliance Period:	4/1/2005 0:00:00 - 6/30/2005 0:00:00		
Violation ID:	1305		
Enforcement Date:	8/19/2005 0:00:00	Enf. Action:	State Compliance Achieved
System Name:	ANGUS BARN		
Violation Type:	Monitoring and Reporting Stage 1		
Contaminant:	0999		
Compliance Period:	4/1/2005 0:00:00 - 6/30/2005 0:00:00		
Violation ID:	1305		
Enforcement Date:	8/19/2005 0:00:00	Enf. Action:	State Compliance Achieved
System Name:	ANGUS BARN		
Violation Type:	Other Non-NPDWR Potential Health Risks		
Contaminant:	7500		
Compliance Period:	11/10/2004 0:00:00 - 12/31/2025 0:00:00		
Violation ID:	3548605		
Enforcement Date:	4/12/2007 0:00:00	Enf. Action:	Not Reported
System Name:	ANGUS BARN		
Violation Type:	Other Non-NPDWR Potential Health Risks		
Contaminant:	7500		
Compliance Period:	11/10/2004 0:00:00 - 12/31/2025 0:00:00		
Violation ID:	3548605		
Enforcement Date:	No Enf Action as of	Enf. Action:	10/17/2006 0:00:00
System Name:	ANGUS BARN		
Violation Type:	Other Non-NPDWR Potential Health Risks		
Contaminant:	7500		
Compliance Period:	8/19/2002 0:00:00 - 12/31/2025 0:00:00		
Violation ID:	4328202		
Enforcement Date:	4/12/2007 0:00:00	Enf. Action:	Not Reported

ENFORCEMENT INFORMATION:

System Name:	ANGUS BARN		
Violation Type:	Other Non-NPDWR Potential Health Risks		
Contaminant:	7500		
Compliance Period:	8/19/2002 0:00:00 - 12/31/2025 0:00:00		
Violation ID:	4328202		
Enforcement Date:	No Enf Action as of	Enf. Action:	10/17/2006 0:00:00
System Name:	ANGUS BARN		
Violation Type:	Other Non-NPDWR Potential Health Risks		
Contaminant:	7500		
Compliance Period:	9/20/2004 0:00:00 - 12/31/2025 0:00:00		
Violation ID:	4383104		
Enforcement Date:	4/12/2007 0:00:00	Enf. Action:	Not Reported
System Name:	ANGUS BARN		
Violation Type:	Other Non-NPDWR Potential Health Risks		
Contaminant:	7500		
Compliance Period:	9/20/2004 0:00:00 - 12/31/2025 0:00:00		
Violation ID:	4383104		
Enforcement Date:	No Enf Action as of	Enf. Action:	10/17/2006 0:00:00
System Name:	ANGUS BARN		
Violation Type:	Monitoring and Reporting Stage 1		
Contaminant:	0999		
Compliance Period:	4/1/2006 0:00:00 - 6/30/2006 0:00:00		
Violation ID:	4383206		
Enforcement Date:	9/28/2006 0:00:00	Enf. Action:	State Formal NOV Issued
System Name:	ANGUS BARN		
Violation Type:	Monitoring and Reporting Stage 1		
Contaminant:	0999		
Compliance Period:	4/1/2006 0:00:00 - 6/30/2006 0:00:00		
Violation ID:	4383206		
Enforcement Date:	9/28/2006 0:00:00	Enf. Action:	State Public Notif Requested
System Name:	ANGUS BARN		
Violation Type:	Monitoring, Repeat Minor (TCR)		
Contaminant:	COLIFORM (TCR)		
Compliance Period:	6/1/2001 0:00:00 - 6/30/2001 0:00:00		
Violation ID:	601		
Enforcement Date:	8/8/2001 0:00:00	Enf. Action:	State Public Notif Requested
System Name:	ANGUS BARN		
Violation Type:	Monitoring, Repeat Minor (TCR)		
Contaminant:	COLIFORM (TCR)		
Compliance Period:	6/1/2001 0:00:00 - 6/30/2001 0:00:00		
Violation ID:	601		
Enforcement Date:	8/8/2001 0:00:00	Enf. Action:	State Formal NOV Issued
System Name:	ANGUS BARN		
Violation Type:	Monitoring, Repeat Minor (TCR)		
Contaminant:	COLIFORM (TCR)		
Compliance Period:	6/1/2001 0:00:00 - 6/30/2001 0:00:00		
Violation ID:	601		
Enforcement Date:	4/30/2004 0:00:00	Enf. Action:	State Compliance Achieved
System Name:	ANGUS BARN		
Violation Type:	Monitoring, Repeat Minor (TCR)		
Contaminant:	COLIFORM (TCR)		
Compliance Period:	6/1/2001 0:00:00 - 6/30/2001 0:00:00		
Violation ID:	601		
Enforcement Date:	8/8/2001 0:00:00	Enf. Action:	State Public Notif Requested

ENFORCEMENT INFORMATION:

System Name:	ANGUS BARN		
Violation Type:	Monitoring, Repeat Minor (TCR)		
Contaminant:	COLIFORM (TCR)		
Compliance Period:	6/1/2001 0:00:00 - 6/30/2001 0:00:00		
Violation ID:	601		
Enforcement Date:	8/8/2001 0:00:00	Enf. Action:	State Formal NOV Issued
System Name:	ANGUS BARN		
Violation Type:	Monitoring, Repeat Minor (TCR)		
Contaminant:	COLIFORM (TCR)		
Compliance Period:	6/1/2001 0:00:00 - 6/30/2001 0:00:00		
Violation ID:	601		
Enforcement Date:	4/30/2004 0:00:00	Enf. Action:	State Compliance Achieved
System Name:	ANGUS BARN		
Violation Type:	Monitoring, Routine Minor (TCR)		
Contaminant:	COLIFORM (TCR)		
Compliance Period:	7/1/2001 0:00:00 - 7/31/2001 0:00:00		
Violation ID:	701		
Enforcement Date:	4/30/2004 0:00:00	Enf. Action:	State Compliance Achieved
System Name:	ANGUS BARN		
Violation Type:	Monitoring, Routine Minor (TCR)		
Contaminant:	COLIFORM (TCR)		
Compliance Period:	7/1/2001 0:00:00 - 7/31/2001 0:00:00		
Violation ID:	701		
Enforcement Date:	9/12/2001 0:00:00	Enf. Action:	State Formal NOV Issued
System Name:	ANGUS BARN		
Violation Type:	Monitoring, Routine Minor (TCR)		
Contaminant:	COLIFORM (TCR)		
Compliance Period:	7/1/2001 0:00:00 - 7/31/2001 0:00:00		
Violation ID:	701		
Enforcement Date:	9/12/2001 0:00:00	Enf. Action:	State Public Notif Requested
System Name:	ANGUS BARN		
Violation Type:	Monitoring, Routine Minor (TCR)		
Contaminant:	COLIFORM (TCR)		
Compliance Period:	7/1/2001 0:00:00 - 7/31/2001 0:00:00		
Violation ID:	701		
Enforcement Date:	4/30/2004 0:00:00	Enf. Action:	State Compliance Achieved
System Name:	ANGUS BARN		
Violation Type:	Monitoring, Routine Minor (TCR)		
Contaminant:	COLIFORM (TCR)		
Compliance Period:	7/1/2001 0:00:00 - 7/31/2001 0:00:00		
Violation ID:	701		
Enforcement Date:	9/12/2001 0:00:00	Enf. Action:	State Public Notif Requested
System Name:	ANGUS BARN		
Violation Type:	Monitoring, Routine Minor (TCR)		
Contaminant:	COLIFORM (TCR)		
Compliance Period:	7/1/2001 0:00:00 - 7/31/2001 0:00:00		
Violation ID:	701		
Enforcement Date:	9/12/2001 0:00:00	Enf. Action:	State Formal NOV Issued
System Name:	ANGUS BARN		
Violation Type:	Follow-up and Routine Tap Sampling		
Contaminant:	LEAD & COPPER RULE		
Compliance Period:	1/1/2003 0:00:00 - 6/30/2004 0:00:00		
Violation ID:	803		
Enforcement Date:	9/10/2003 0:00:00	Enf. Action:	State Public Notif Requested

ENFORCEMENT INFORMATION:

System Name:	ANGUS BARN		
Violation Type:	Follow-up and Routine Tap Sampling		
Contaminant:	LEAD & COPPER RULE		
Compliance Period:	1/1/2003 0:00:00 - 12/31/2025 0:00:00		
Violation ID:	803		
Enforcement Date:	9/10/2003 0:00:00	Enf. Action:	State Formal NOV Issued
System Name:	ANGUS BARN		
Violation Type:	Follow-up and Routine Tap Sampling		
Contaminant:	LEAD & COPPER RULE		
Compliance Period:	1/1/2003 0:00:00 - 6/30/2004 0:00:00		
Violation ID:	803		
Enforcement Date:	6/30/2004 0:00:00	Enf. Action:	State Compliance Achieved
System Name:	ANGUS BARN		
Violation Type:	Follow-up and Routine Tap Sampling		
Contaminant:	LEAD & COPPER RULE		
Compliance Period:	1/1/2003 0:00:00 - 6/30/2004 0:00:00		
Violation ID:	803		
Enforcement Date:	9/10/2003 0:00:00	Enf. Action:	State Formal NOV Issued
System Name:	ANGUS BARN		
Violation Type:	Follow-up and Routine Tap Sampling		
Contaminant:	LEAD & COPPER RULE		
Compliance Period:	1/1/2003 0:00:00 - 12/31/2025 0:00:00		
Violation ID:	803		
Enforcement Date:	9/10/2003 0:00:00	Enf. Action:	State Public Notif Requested
System Name:	ANGUS BARN		
Violation Type:	Monitoring, Routine Major (TCR)		
Contaminant:	COLIFORM (TCR)		
Compliance Period:	7/1/2003 0:00:00 - 9/30/2003 0:00:00		
Violation ID:	904		
Enforcement Date:	4/30/2004 0:00:00	Enf. Action:	State Compliance Achieved
System Name:	ANGUS BARN		
Violation Type:	Monitoring, Routine Major (TCR)		
Contaminant:	COLIFORM (TCR)		
Compliance Period:	7/1/2003 0:00:00 - 9/30/2003 0:00:00		
Violation ID:	904		
Enforcement Date:	10/31/2003 0:00:00	Enf. Action:	State Formal NOV Issued
System Name:	ANGUS BARN		
Violation Type:	Monitoring, Routine Major (TCR)		
Contaminant:	COLIFORM (TCR)		
Compliance Period:	7/1/2003 0:00:00 - 9/30/2003 0:00:00		
Violation ID:	904		
Enforcement Date:	4/30/2004 0:00:00	Enf. Action:	State Compliance Achieved
System Name:	ANGUS BARN		
Violation Type:	Monitoring, Routine Major (TCR)		
Contaminant:	COLIFORM (TCR)		
Compliance Period:	7/1/2003 0:00:00 - 9/30/2003 0:00:00		
Violation ID:	904		
Enforcement Date:	10/31/2003 0:00:00	Enf. Action:	State Public Notif Requested
System Name:	ANGUS BARN		
Violation Type:	Monitoring, Routine Major (TCR)		
Contaminant:	COLIFORM (TCR)		
Compliance Period:	7/1/2003 0:00:00 - 9/30/2003 0:00:00		
Violation ID:	904		
Enforcement Date:	10/31/2003 0:00:00	Enf. Action:	State Formal NOV Issued

ENFORCEMENT INFORMATION:

System Name:	ANGUS BARN		
Violation Type:	Monitoring, Routine Major (TCR)		
Contaminant:	COLIFORM (TCR)		
Compliance Period:	7/1/2003 0:00:00 - 9/30/2003 0:00:00		
Violation ID:	904		
Enforcement Date:	10/31/2003 0:00:00	Enf. Action:	State Public Notif Requested

System Name:	ANGUS BARN		
Violation Type:	Initial Tap Sampling for Pb and Cu		
Contaminant:	LEAD & COPPER RULE		
Compliance Period:	1993-07-01 - 2015-12-31		
Violation ID:	9413732		
Enforcement Date:	Not Reported	Enf. Action:	Not Reported

A7
WSW
1/4 - 1/2 Mile
Lower

FED USGS **USGS40000890499**

Org. Identifier:	USGS-NC		
Formal name:	USGS North Carolina Water Science Center		
Monloc Identifier:	USGS-354633078383001		
Monloc name:	WK-174		
Monloc type:	Well		
Monloc desc:	Not Reported		
Huc code:	Not Reported	Drainagearea value:	Not Reported
Drainagearea Units:	Not Reported	Contrib drainagearea:	Not Reported
Contrib drainagearea units:	Not Reported	Latitude:	35.7759849
Longitude:	-78.6413923	Sourcemap scale:	Not Reported
Horiz Acc measure:	1	Horiz Acc measure units:	seconds
Horiz Collection method:	Interpolated from map		
Horiz coord refsys:	NAD83	Vert measure val:	Not Reported
Vert measure units:	Not Reported	Vertacc measure val:	Not Reported
Vert accmeasure units:	Not Reported		
Vertcollection method:	Not Reported		
Vert coord refsys:	Not Reported	Countrycode:	US
Aquifername:	Piedmont and Blue Ridge crystalline-rock aquifers		
Formation type:	Felsic Gneiss		
Aquifer type:	Not Reported		
Construction date:	Not Reported	Welldepth:	243
Welldepth units:	ft	Wellholedepth:	Not Reported
Wellholedepth units:	Not Reported		

Ground-water levels, Number of Measurements: 0

A8
West
1/4 - 1/2 Mile
Higher

AQUIFLOW **30674**

Site ID:	5373
Groundwater Flow:	Not Reported
Shallowest Water Table Depth:	15.82
Deepest Water Table Depth:	30.91
Average Water Table Depth:	Not Reported
Depth to rock - shallowest:	Not Reported
Depth to rock - deepest:	Not Reported
Depth to rock - average:	Not Reported
Date:	06/27/1995

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID Direction Distance Elevation			Database	EDR ID Number
9 **West** **1/2 - 1 Mile** **Higher**	Site ID: Groundwater Flow: Shallowest Water Table Depth: Deepest Water Table Depth: Average Water Table Depth: Depth to rock - shallowest: Depth to rock - deepest: Depth to rock - average: Date:	6004 Not Reported Not Reported Not Reported Not Reported Not Reported Not Reported 8.0 09/21/1990	**AQUIFLOW**	**30649**
10 **West** **1/2 - 1 Mile** **Higher**	Site ID: Groundwater Flow: Shallowest Water Table Depth: Deepest Water Table Depth: Average Water Table Depth: Depth to rock - shallowest: Depth to rock - deepest: Depth to rock - average: Date:	6037 SE 14.46 24.35 Not Reported Not Reported Not Reported Not Reported 02/03/1992	**AQUIFLOW**	**30648**
11 **WNW** **1/2 - 1 Mile** **Higher**	Site ID: Groundwater Flow: Shallowest Water Table Depth: Deepest Water Table Depth: Average Water Table Depth: Depth to rock - shallowest: Depth to rock - deepest: Depth to rock - average: Date:	5372 NE Not Reported Not Reported 40.0 Not Reported Not Reported Not Reported 09/19/1997	**AQUIFLOW**	**30677**
12 **ESE** **1/2 - 1 Mile** **Higher**	Site ID: Groundwater Flow: Shallowest Water Table Depth: Deepest Water Table Depth: Average Water Table Depth: Depth to rock - shallowest: Depth to rock - deepest: Depth to rock - average: Date:	5716 Not Reported Not Reported Not Reported Not Reported Not Reported Not Reported 6.0 04/1991	**AQUIFLOW**	**30655**
13 **West** **1/2 - 1 Mile** **Higher**	Site ID: Groundwater Flow: Shallowest Water Table Depth: Deepest Water Table Depth: Average Water Table Depth: Depth to rock - shallowest: Depth to rock - deepest: Depth to rock - average: Date:	6724 Not Reported 14.32 17.12 Not Reported Not Reported Not Reported Not Reported 04/1996	**AQUIFLOW**	**30718**

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID Direction Distance Elevation			Database	EDR ID Number
14 **ENE** **1/2 - 1 Mile** **Higher**	Site ID: Groundwater Flow: Shallowest Water Table Depth: Deepest Water Table Depth: Average Water Table Depth: Depth to rock - shallowest: Depth to rock - deepest: Depth to rock - average: Date:	6040 Varies 23.23 27.81 Not Reported Not Reported Not Reported 38.5 08/1990	**AQUIFLOW**	**30643**
15 **North** **1/2 - 1 Mile** **Higher**	Site ID: Groundwater Flow: Shallowest Water Table Depth: Deepest Water Table Depth: Average Water Table Depth: Depth to rock - shallowest: Depth to rock - deepest: Depth to rock - average: Date:	4004 NE 40.07 40.99 Not Reported Not Reported Not Reported Not Reported 04/27/1989	**AQUIFLOW**	**40384**
16 **WNW** **1/2 - 1 Mile** **Higher**	Site ID: Groundwater Flow: Shallowest Water Table Depth: Deepest Water Table Depth: Average Water Table Depth: Depth to rock - shallowest: Depth to rock - deepest: Depth to rock - average: Date:	5209 Not Reported 22.0 25.0 Not Reported Not Reported Not Reported Not Reported 10/24/1985	**AQUIFLOW**	**30568**
17 **WSW** **1/2 - 1 Mile** **Higher**	Site ID: Groundwater Flow: Shallowest Water Table Depth: Deepest Water Table Depth: Average Water Table Depth: Depth to rock - shallowest: Depth to rock - deepest: Depth to rock - average: Date:	5210 Not Reported 7.0 8.0 Not Reported Not Reported Not Reported Not Reported 09/28/1989	**AQUIFLOW**	**30569**
18 **NW** **1/2 - 1 Mile** **Higher**	Site ID: Groundwater Flow: Shallowest Water Table Depth: Deepest Water Table Depth: Average Water Table Depth: Depth to rock - shallowest: Depth to rock - deepest: Depth to rock - average: Date:	9987 NW 12.90 18.96 Not Reported 13.0 25.0 Not Reported 12/1992	**AQUIFLOW**	**31004**

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID Direction Distance Elevation			Database	EDR ID Number
19 **WNW** **1/2 - 1 Mile** **Higher**	Site ID: Groundwater Flow: Shallowest Water Table Depth: Deepest Water Table Depth: Average Water Table Depth: Depth to rock - shallowest: Depth to rock - deepest: Depth to rock - average: Date:	11585 ENE 30.0 30.5 Not Reported 31.0 33.0 Not Reported 02/13/1996	**AQUIFLOW**	**36729**
20 **NE** **1/2 - 1 Mile** **Higher**	Site ID: Groundwater Flow: Shallowest Water Table Depth: Deepest Water Table Depth: Average Water Table Depth: Depth to rock - shallowest: Depth to rock - deepest: Depth to rock - average: Date:	7490 NW 22.0 29.0 Not Reported Not Reported Not Reported Not Reported 06/10/1992	**AQUIFLOW**	**30706**
B21 **SSW** **1/2 - 1 Mile** **Lower**	Site ID: Groundwater Flow: Shallowest Water Table Depth: Deepest Water Table Depth: Average Water Table Depth: Depth to rock - shallowest: Depth to rock - deepest: Depth to rock - average: Date:	5051 SW 10.9 14.48 Not Reported Not Reported Not Reported Not Reported 05/15/1996	**AQUIFLOW**	**30576**
B22 **SSW** **1/2 - 1 Mile** **Lower**	Site ID: Groundwater Flow: Shallowest Water Table Depth: Deepest Water Table Depth: Average Water Table Depth: Depth to rock - shallowest: Depth to rock - deepest: Depth to rock - average: Date:	11081 Not Reported 15.0 16.0 Not Reported Not Reported Not Reported Not Reported 02/09/1993	**AQUIFLOW**	**40364**
23 **NW** **1/2 - 1 Mile** **Lower**	Site ID: Groundwater Flow: Shallowest Water Table Depth: Deepest Water Table Depth: Average Water Table Depth: Depth to rock - shallowest: Depth to rock - deepest: Depth to rock - average: Date:	5589 NW 5.73 14.86 Not Reported Not Reported Not Reported Not Reported 07/29/1996	**AQUIFLOW**	**30574**

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance

Database EDR ID Number

NC_NHEO NC50001354

GIS ID: 42998
Classification by Type: Animal
Occurrence Status: X

NC_NHEO NC50009970

GIS ID: 282067
Classification by Type: Animal
Occurrence Status: Extant

NC_SNHA NC10002116

Site Name: WALNUT CREEK BOTTOMLAND FORESTS
Quality: Not Reported
Acres per Polygon: 406.24

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS
RADON

AREA RADON INFORMATION

State Database: NC Radon

Radon Test Results

Num Results	Avg pCi/L	Min pCi/L	Max pCi/L
2	2.95	1.1	4.8

Federal EPA Radon Zone for WAKE County: 2

Note: Zone 1 indoor average level > 4 pCi/L.
: Zone 2 indoor average level >= 2 pCi/L and <= 4 pCi/L.
: Zone 3 indoor average level < 2 pCi/L.

Federal Area Radon Information for WAKE COUNTY, NC

Number of sites tested: 41

Area	Average Activity	% <4 pCi/L	% 4-20 pCi/L	% >20 pCi/L
Living Area - 1st Floor	1.007 pCi/L	95%	5%	0%
Living Area - 2nd Floor	0.600 pCi/L	100%	0%	0%
Basement	4.400 pCi/L	62%	38%	0%

PHYSICAL SETTING SOURCE RECORDS SEARCHED

TOPOGRAPHIC INFORMATION

USGS 7.5' Digital Elevation Model (DEM)
Source: United States Geologic Survey
EDR acquired the USGS 7.5' Digital Elevation Model in 2002 and updated it in 2006. The 7.5 minute DEM corresponds to the USGS 1:24,000- and 1:25,000-scale topographic quadrangle maps. The DEM provides elevation data with consistent elevation units and projection.

Scanned Digital USGS 7.5' Topographic Map (DRG)
Source: United States Geologic Survey
A digital raster graphic (DRG) is a scanned image of a U.S. Geological Survey topographic map. The map images are made by scanning published paper maps on high-resolution scanners. The raster image is georeferenced and fit to the Universal Transverse Mercator (UTM) projection.

HYDROLOGIC INFORMATION

Flood Zone Data: This data, available in select counties across the country, was obtained by EDR in 2003 & 2011 from the Federal Emergency Management Agency (FEMA). Data depicts 100-year and 500-year flood zones as defined by FEMA.

NWI: National Wetlands Inventory. This data, available in select counties across the country, was obtained by EDR in 2002 and 2005 from the U.S. Fish and Wildlife Service.

State Wetlands Data: Wetlands Inventory
Source: Department of Environment & Natural Resources
Telephone: 919-733-2090

HYDROGEOLOGIC INFORMATION

AQUIFLOW^{R} Information System
Source: EDR proprietary database of groundwater flow information
EDR has developed the AQUIFLOW Information System (AIS) to provide data on the general direction of groundwater flow at specific points. EDR has reviewed reports submitted to regulatory authorities at select sites and has extracted the date of the report, hydrogeologically determined groundwater flow direction and depth to water table information.

GEOLOGIC INFORMATION

Geologic Age and Rock Stratigraphic Unit
Source: P.G. Schruben, R.E. Arndt and W.J. Bawiec, Geology of the Conterminous U.S. at 1:2,500,000 Scale - A digital representation of the 1974 P.B. King and H.M. Beikman Map, USGS Digital Data Series DDS - 11 (1994).

STATSGO: State Soil Geographic Database
Source: Department of Agriculture, Natural Resources Conservation Services
The U.S. Department of Agriculture's (USDA) Natural Resources Conservation Service (NRCS) leads the national Conservation Soil Survey (NCSS) and is responsible for collecting, storing, maintaining and distributing soil survey information for privately owned lands in the United States. A soil map in a soil survey is a representation of soil patterns in a landscape. Soil maps for STATSGO are compiled by generalizing more detailed (SSURGO) soil survey maps.

SSURGO: Soil Survey Geographic Database
Source: Department of Agriculture, Natural Resources Conservation Services (NRCS)
Telephone: 800-672-5559
SSURGO is the most detailed level of mapping done by the Natural Resources Conservation Services, mapping scales generally range from 1:12,000 to 1:63,360. Field mapping methods using national standards are used to construct the soil maps in the Soil Survey Geographic (SSURGO) database. SSURGO digitizing duplicates the original soil survey maps. This level of mapping is designed for use by landowners, townships and county natural resource planning and management.

PHYSICAL SETTING SOURCE RECORDS SEARCHED

LOCAL / REGIONAL WATER AGENCY RECORDS

FEDERAL WATER WELLS

PWS: Public Water Systems
Source: EPA/Office of Drinking Water
Telephone: 202-564-3750
Public Water System data from the Federal Reporting Data System. A PWS is any water system which provides water to at least 25 people for at least 60 days annually. PWSs provide water from wells, rivers and other sources.

PWS ENF: Public Water Systems Violation and Enforcement Data
Source: EPA/Office of Drinking Water
Telephone: 202-564-3750
Violation and Enforcement data for Public Water Systems from the Safe Drinking Water Information System (SDWIS) after August 1995. Prior to August 1995, the data came from the Federal Reporting Data System (FRDS).

USGS Water Wells: USGS National Water Inventory System (NWIS)
This database contains descriptive information on sites where the USGS collects or has collected data on surface water and/or groundwater. The groundwater data includes information on wells, springs, and other sources of groundwater.

STATE RECORDS

North Carolina Public Water Supply Wells
Source: Department of Environmental Health
Telephone: 919-715-3243

OTHER STATE DATABASE INFORMATION

NC Natural Areas: Significant Natural Heritage Areas
Source: Center for Geographic Information and Analysis
Telephone: 919-733-2090
A polygon converage identifying sites (terrestrial or aquatic that have particular biodiversity significance. A site's significance may be due to the presenceof rare species, rare or hight quality natural communities, or other important ecological features.

NC Game Lands: Wildlife Resources Commission Game Lands
Source: Center for Geographic Information and Analysis
Telephone: 919-733-2090
All publicly owned game lands managed by the North Carolina Wildlife Resources Commission and as listed in Hunting and Fishing Maps.

NC Natural Heritage Sites: Natural Heritage Element Occurrence Sites
Source: Center for Geographic Information and Analysis
Telephone: 919-733-2090
A point coverage identifying locations of rare and endangered species, occurrences of exemplary or unique natural ecosystems (terrestrial or aquatic), and special animal habitats (e.g., colonial waterbird nesting sites).

RADON

State Database: NC Radon
Source: Department of Environment & Natural Resources
Telephone: 919-733-4984
Radon Statistical and Non Statiscal Data

Area Radon Information
Source: USGS
Telephone: 703-356-4020
The National Radon Database has been developed by the U.S. Environmental Protection Agency (USEPA) and is a compilation of the EPA/State Residential Radon Survey and the National Residential Radon Survey. The study covers the years 1986 - 1992. Where necessary data has been supplemented by information collected at private sources such as universities and research institutions.

PHYSICAL SETTING SOURCE RECORDS SEARCHED

EPA Radon Zones
Source: EPA
Telephone: 703-356-4020
Sections 307 & 309 of IRAA directed EPA to list and identify areas of U.S. with the potential for elevated indoor radon levels.

OTHER

Airport Landing Facilities: Private and public use landing facilities
Source: Federal Aviation Administration, 800-457-6656

Epicenters: World earthquake epicenters, Richter 5 or greater
Source: Department of Commerce, National Oceanic and Atmospheric Administration

STREET AND ADDRESS INFORMATION

© 2010 Tele Atlas North America, Inc. All rights reserved. This material is proprietary and the subject of copyright protection and other intellectual property rights owned by or licensed to Tele Atlas North America, Inc. The use of this material is subject to the terms of a license agreement. You will be held liable for any unauthorized copying or disclosure of this material.

EDR Sanborn Maps

Wood Pile Block A-45
218 S. Bloodworth Street
Raleigh, NC 27601

Inquiry Number: 3618453.3
May 29, 2013

Certified Sanborn® Map Report

EDR® Environmental Data Resources Inc

440 Wheelers Farms Road
Milford, CT 06461
800.352.0050
www.edrnet.com

Certified Sanborn® Map Report

5/29/13

Site Name:
Wood Pile Block A-45
218 S. Bloodworth Street
Raleigh, NC 27601

Client Name:
Geologix, Inc.
5316 Deep Valley Run
Raleigh, NC 27606

EDR Inquiry # 3618453.3

Contact: Rob Livermon

EDR® Environmental Data Resources Inc

The complete Sanborn Library collection has been searched by EDR, and fire insurance maps covering the target property location provided by Geologix, Inc. were identified for the years listed below. The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by Sanborn Library LLC, the copyright holder for the collection.

Certified Sanborn Results:

Site Name: Wood Pile Block A-45
Address: 218 S. Bloodworth Street
City, State, Zip: Raleigh, NC 27601
Cross Street:
P.O. # NA
Project: NA
Certification # 9D15-4CB2-8429

Sanborn® Library search results
Certification # 9D15-4CB2-8429

Maps Provided:

1972
1950
1914
1909
1903
1896

The Sanborn Library includes more than 1.2 million Sanborn fire insurance maps, which track historical property usage in approximately 12,000 American cities and towns. Collections searched:

- ☑ Library of Congress
- ☑ University Publications of America
- ☑ EDR Private Collection

The Sanborn Library LLC Since 1866™

Limited Permission To Make Copies

Geologix, Inc. (the client) is permitted to make up to THREE photocopies of this Sanborn Map transmittal and each fire insurance map accompanying this report solely for the limited use of its customer. No one other than the client is authorized to make copies. Upon request made directly to an EDR Account Executive, the client may be permitted to make a limited number of additional photocopies. This permission is conditioned upon compliance by the client, its customer and their agents with EDR's copyright policy; a copy of which is available upon request.

Disclaimer - Copyright and Trademark notice

This Report contains certain information obtained from a variety of public and other sources reasonably available to Environmental Data Resources, Inc. It cannot be concluded from this Report that coverage information for the target and surrounding properties does not exist from other sources. NO WARRANTY EXPRESSED OR IMPLIED, IS MADE WHATSOEVER IN CONNECTION WITH THIS REPORT. ENVIRONMENTAL DATA RESOURCES, INC. SPECIFICALLY DISCLAIMS THE MAKING OF ANY SUCH WARRANTIES, INCLUDING WITHOUT LIMITATION, MERCHANTABILITY OR FITNESS FOR A PARTICULAR USE OR PURPOSE. ALL RISK IS ASSUMED BY THE USER. IN NO EVENT SHALL ENVIRONMENTAL DATA RESOURCES, INC. BE LIABLE TO ANYONE, WHETHER ARISING OUT OF ERRORS OR OMISSIONS, NEGLIGENCE, ACCIDENT OR ANY OTHER CAUSE, FOR ANY LOSS OF DAMAGE, INCLUDING, WITHOUT LIMITATION, SPECIAL, INCIDENTAL CONSEQUENTIAL, OR EXEMPLARY DAMAGES. ANY LIABILITY ON THE PART OF ENVIRONMENTAL DATA RESOURCES, INC. IS STRICTLY LIMITED TO A REFUND OF THE AMOUNT PAID FOR THIS REPORT. Purchaser accepts this Report "AS IS". Any analyses, estimates, ratings, environmental risk levels or risk codes provided in this Report are provided for illustrative purposes only, and are not intended to provide, nor should they be interpreted as providing any facts regarding, or prediction or forecast of, any environmental risk for any property. Only a Phase I Environmental Site Assessment performed by an environmental professional can provide information regarding the environmental risk for any property. Additionally, the information provided in this Report is not to be construed as legal advice.


Copyright 2013 by Environmental Data Resources, Inc. All rights reserved. Reproduction in any media or format, in whole or in part, of any report or map of Environmental Data Resources, Inc., or its affiliates, is prohibited without prior written permission.

EDR and its logos (including Sanborn and Sanborn Map) are trademarks of Environmental Data Resources, Inc. or its affiliates. All other trademarks used herein are the property of their respective owners.


Sanborn Sheet Thumbnails

This Certified Sanborn Map Report is based upon the following Sanborn Fire Insurance map sheets.

1972 Source Sheets

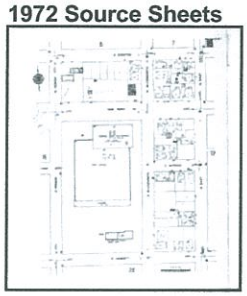

Volume 1, Sheet 16

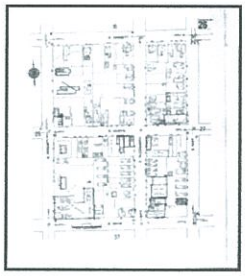


Volume 1, Sheet 26

1950 Source Sheets



Volume 1, Sheet xxxx

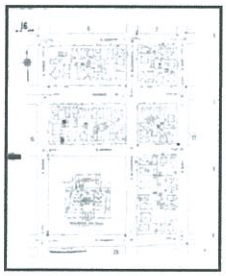

Volume 1, Sheet 16



Volume 1, Sheet 26

1914 Source Sheets



Volume 1, Sheet xxxx



Volume 1, Sheet 16



Volume 1, Sheet 26

1909 Source Sheets



Volume 1, Sheet 9




Volume 1, Sheet 11

1903 Source Sheets




Volume 1, Sheet 6

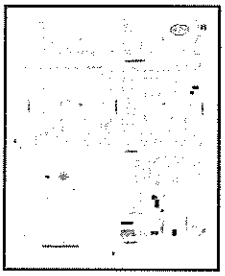


Volume 1, Sheet 8

1896 Source Sheets

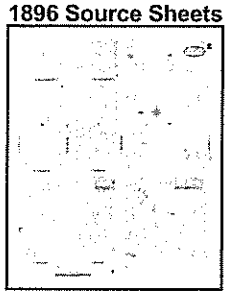

Volume 1, Sheet 2

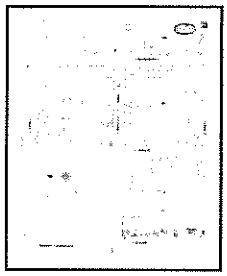

Volume 1, Sheet 3

1972 Certified Sanborn Map




The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Certification #: 9D15-4CB2-8429

Site Name:	Wood Pile Block A-45
Address:	218 S. Bloodworth Street
City, ST, ZIP:	Raleigh NC 27601
Client:	Geologix, Inc.
EDR Inquiry:	3618453.3
Order Date:	5/29/2013 11:53:03 AM
Certification #	9D15-4CB2-8429
Copyright:	1972

This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.



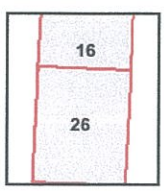


Volume 1, Sheet 16
Volume 1, Sheet 26

0 Feet 150 300 600

N

1950 Certified Sanborn Map

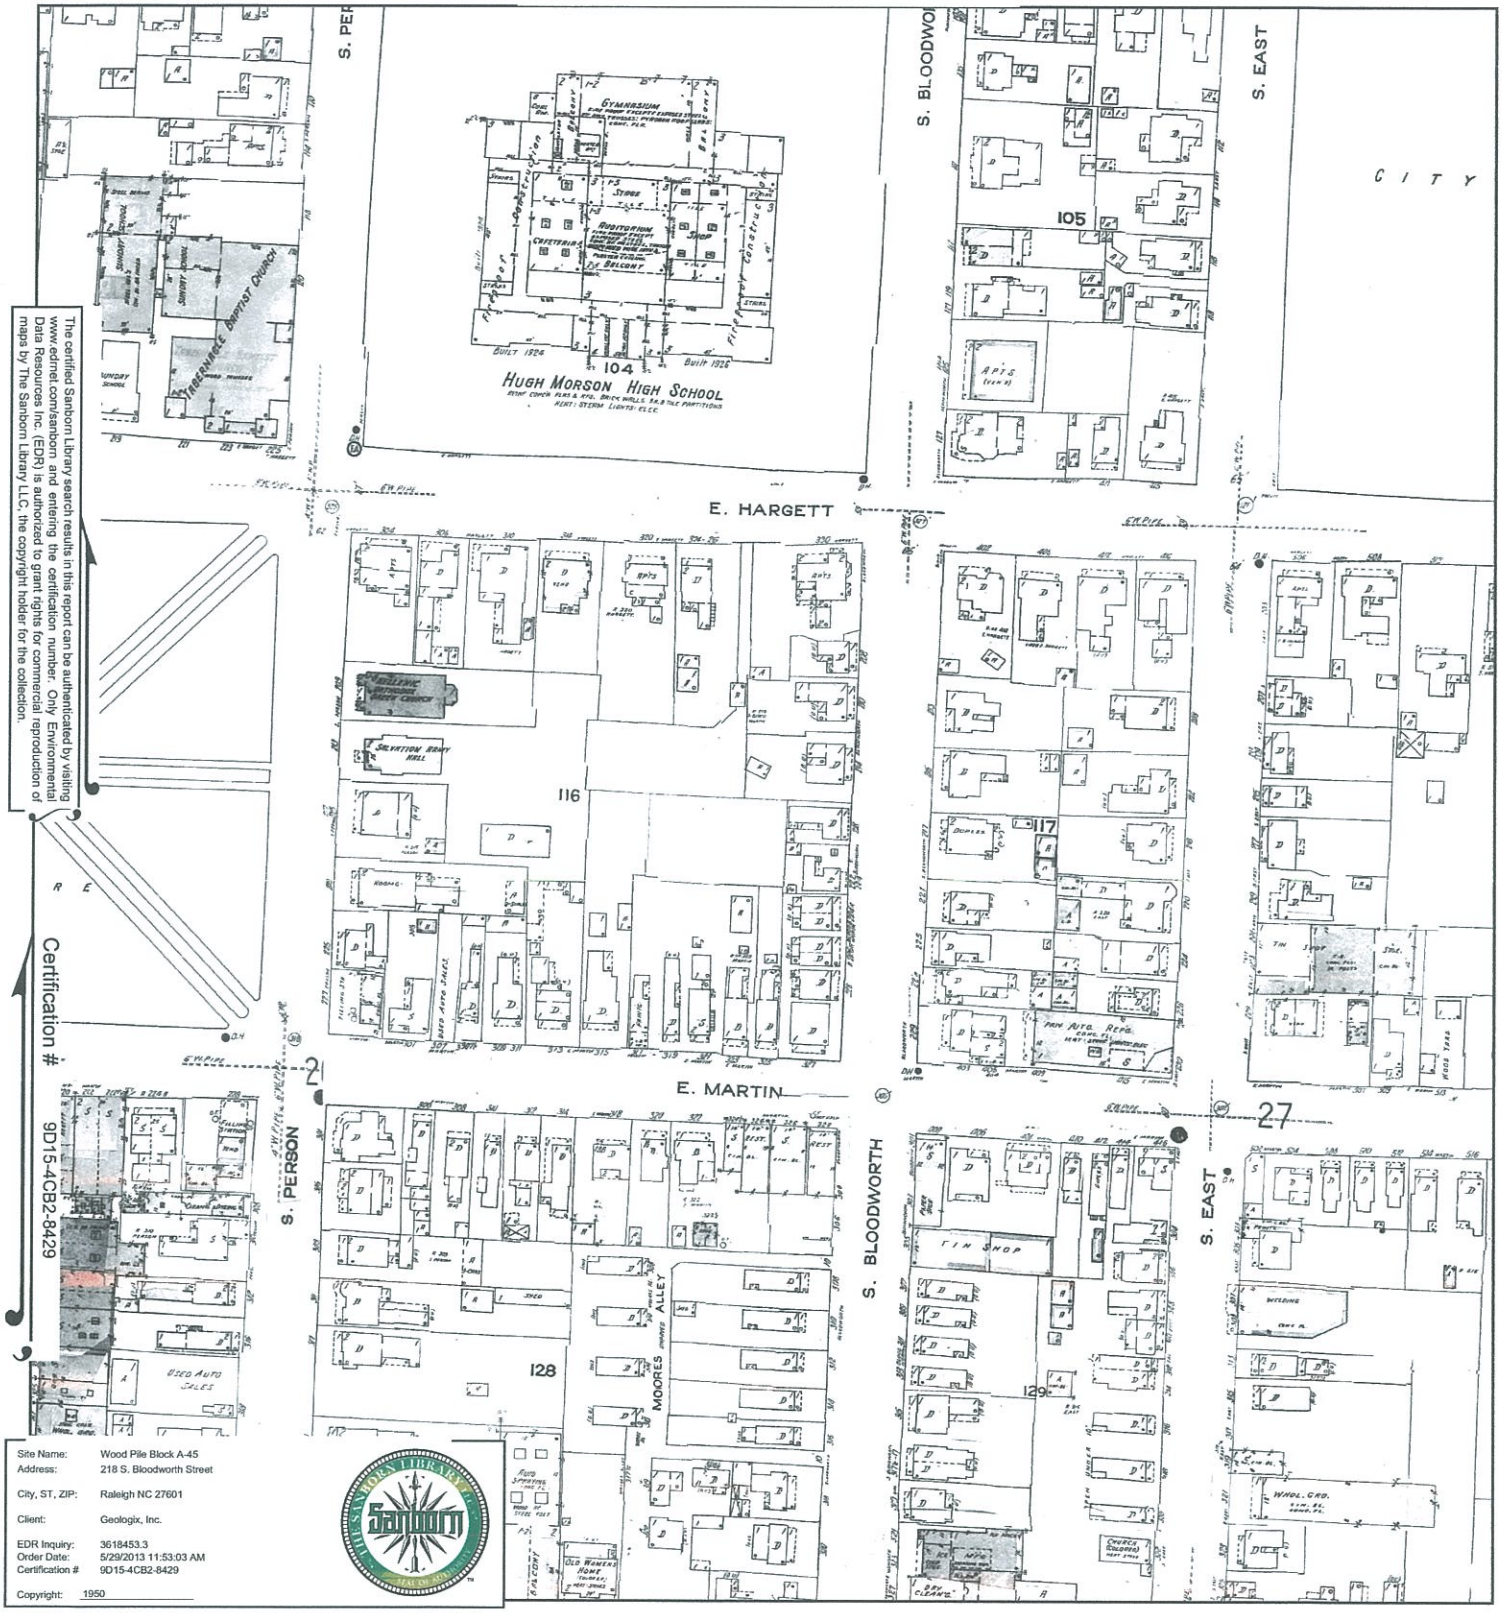


The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Certification #: 9D15-4CB2-8429

Site Name:	Wood Pile Block A-45
Address:	218 S. Bloodworth Street
City, ST, ZIP:	Raleigh NC 27601
Client:	Geologix, Inc.
EDR Inquiry:	3618453.3
Order Date:	5/29/2013 11:53:03 AM
Certification #	9D15-4CB2-8429
Copyright:	1950

This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.



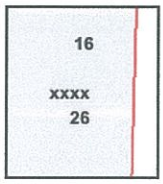

Volume 1, Sheet xxxx
Volume 1, Sheet 16
Volume 1, Sheet 26

0 Feet 150 300 600

N

1914 Certified Sanborn Map




The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Certification # 9D15-4CB2-8429

Site Name:	Wood Pile Block A-45
Address:	218 S. Bloodworth Street
City, ST, ZIP:	Raleigh NC 27601
Client:	Geologix, Inc.
EDR Inquiry:	3618453.3
Order Date:	5/29/2013 11:53:03 AM
Certification #	9D15-4CB2-8429
Copyright:	1914

This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.



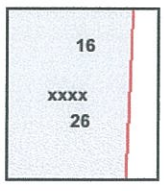


Volume 1, Sheet xxxx
Volume 1, Sheet 16
Volume 1, Sheet 26

0 Feet 150 300 600

N

1909 Certified Sanborn Map

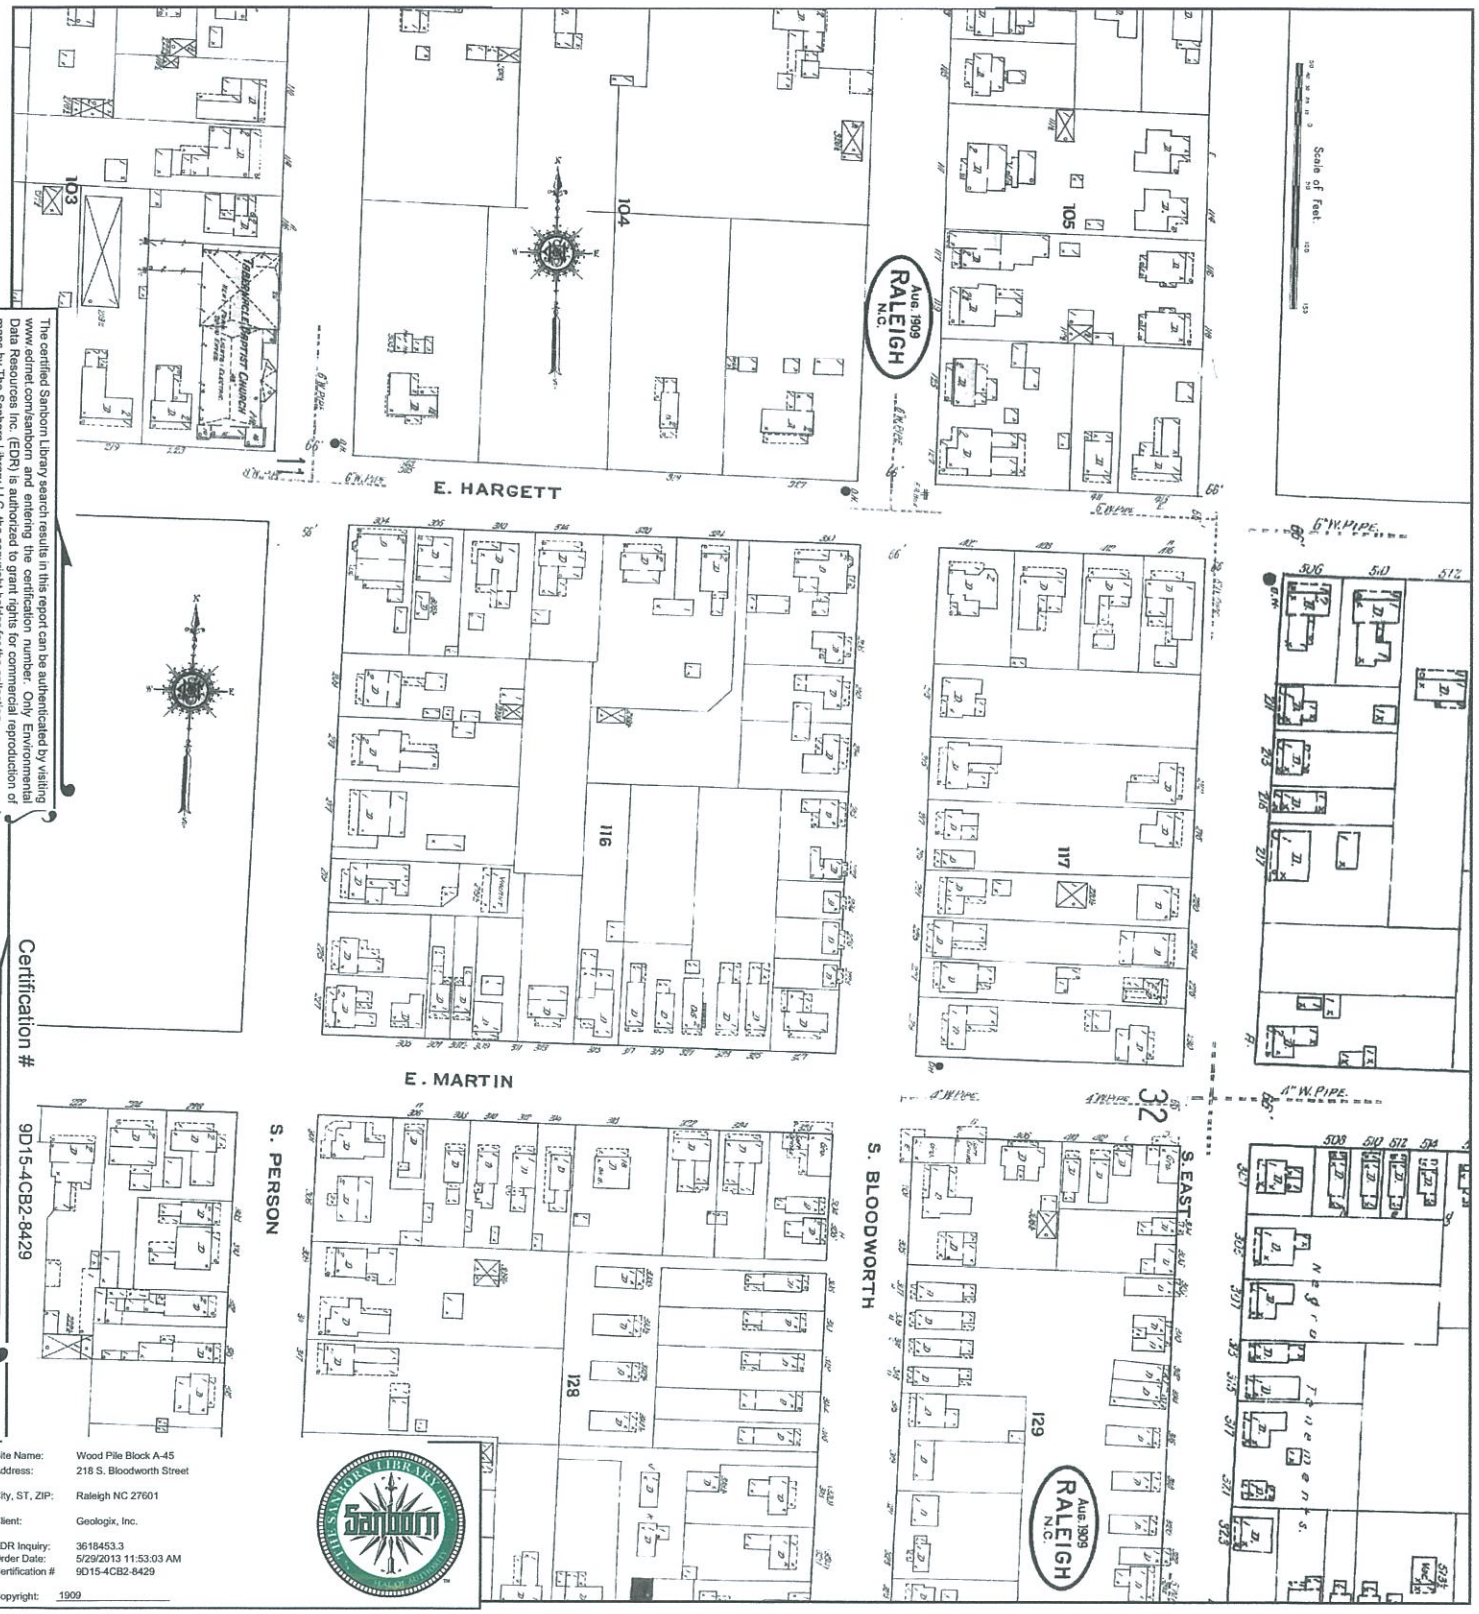

The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Certification # 9D15-4CB2-8429

Site Name:	Wood Pile Block A-45
Address:	218 S. Bloodworth Street
City, ST, ZIP:	Raleigh NC 27601
Client:	Geologix, Inc.
EDR Inquiry:	3618453.3
Order Date:	5/29/2013 11:53:03 AM
Certification #	9D15-4CB2-8429
Copyright:	1909

This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.




Volume 1, Sheet 9
Volume 1, Sheet 11

0 Feet 150 300 600

N

1903 Certified Sanborn Map

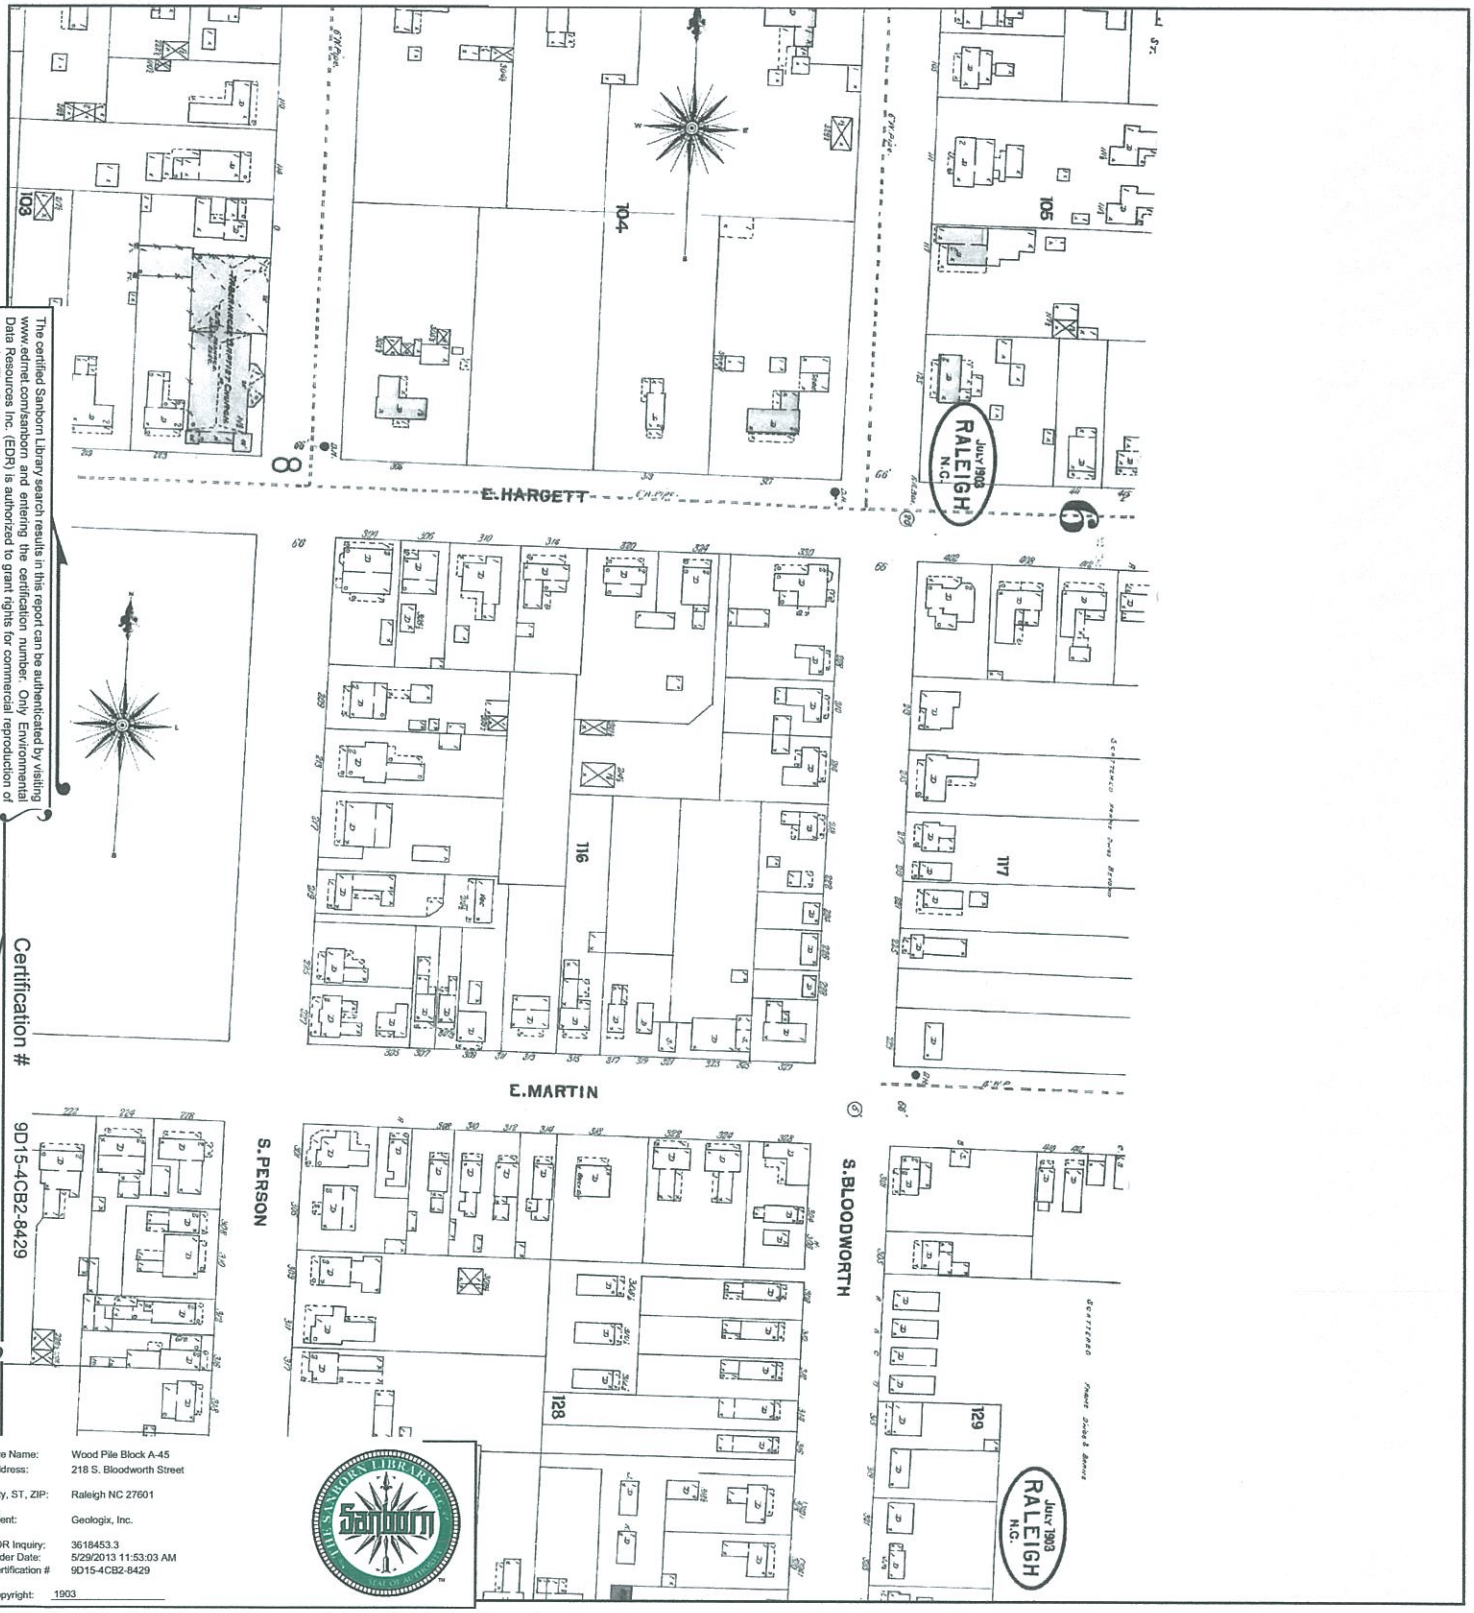


The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Certification # 9D15-4CB2-8429

Site Name:	Wood Pile Block A-45
Address:	218 S. Bloodworth Street
City, ST, ZIP:	Raleigh NC 27601
Client:	Geologix, Inc.
EDR Inquiry:	3618453.3
Order Date:	5/29/2013 11:53:03 AM
Certification #	9D15-4CB2-8429
Copyright:	1903

This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.

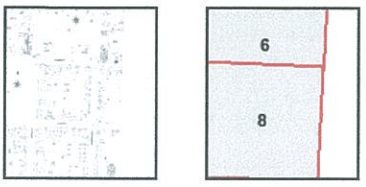


Volume 1, Sheet 6
Volume 1, Sheet 8

0 Feet 150 300 600

N

1896 Certified Sanborn Map

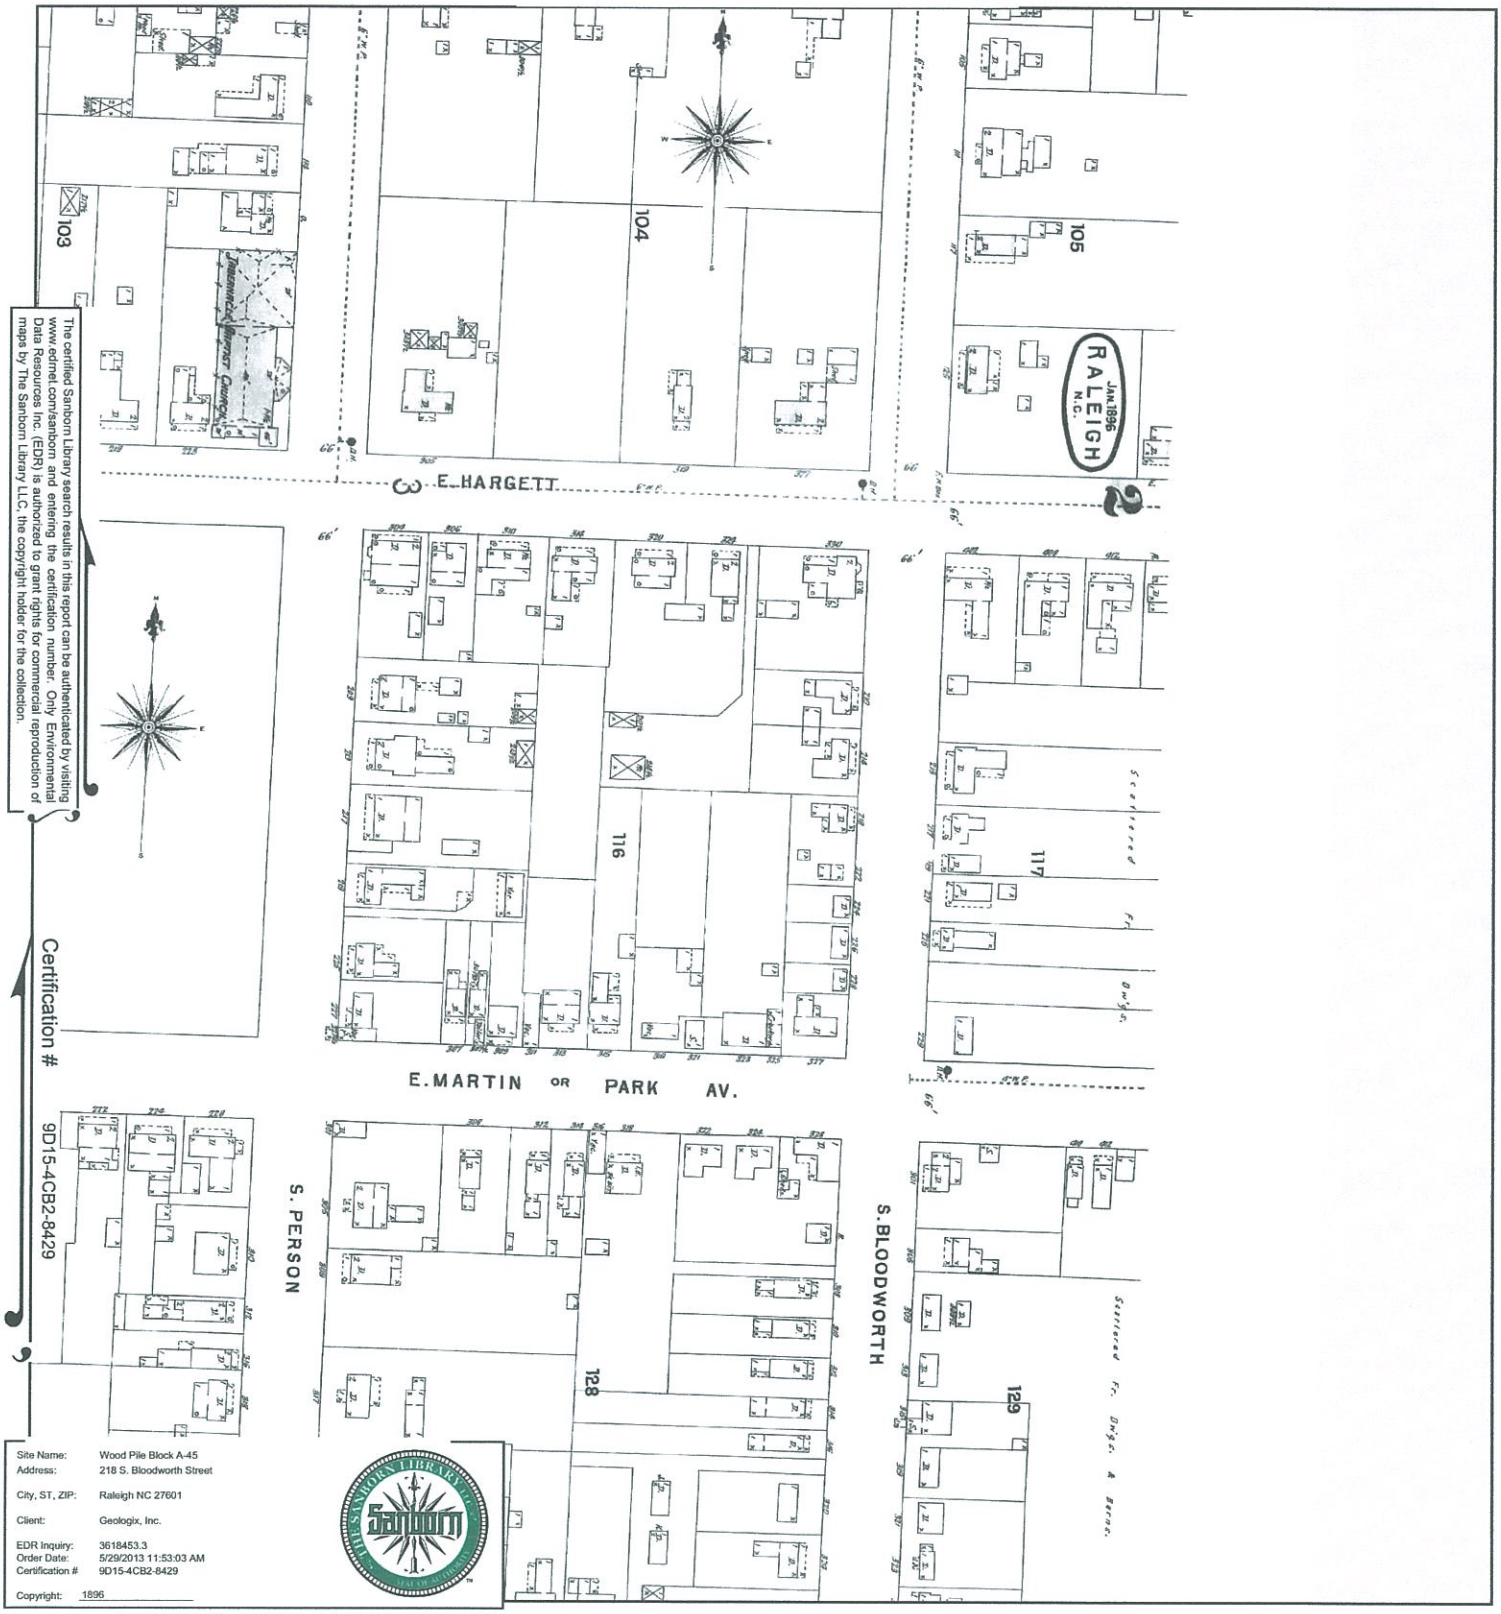


The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Certification # 9D15-4CB2-8429

Site Name:	Wood Pile Block A-45
Address:	218 S. Bloodworth Street
City, ST, ZIP:	Raleigh NC 27601
Client:	Geologix, Inc.
EDR Inquiry:	3618453.3
Order Date:	5/29/2013 11:53:03 AM
Certification #	9D15-4CB2-8429
Copyright:	1896

This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.



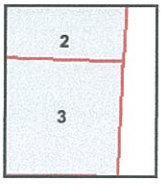

Volume 1, Sheet 2
Volume 1, Sheet 3

0 Feet 150 300 600

N

EDR City Directory Information

Wood Pile Block A-45
218 S. Bloodworth Street
Raleigh, NC 27601

Inquiry Number: 3618453.5
May 29, 2013

The EDR-City Directory Abstract

EDR® Environmental Data Resources Inc

440 Wheelers Farms Road
Milford, CT 06461
800.352.0050
www.edrnet.com

TABLE OF CONTENTS

SECTION

Executive Summary

Findings

City Directory Images

Thank you for your business.
Please contact EDR at 1-800-352-0050
with any questions or comments.

Disclaimer - Copyright and Trademark Notice

This Report contains certain information obtained from a variety of public and other sources reasonably available to Environmental Data Resources, Inc. It cannot be concluded from this Report that coverage information for the target and surrounding properties does not exist from other sources. **NO WARRANTY EXPRESSED OR IMPLIED, IS MADE WHATSOEVER IN CONNECTION WITH THIS REPORT. ENVIRONMENTAL DATA RESOURCES, INC. SPECIFICALLY DISCLAIMS THE MAKING OF ANY SUCH WARRANTIES, INCLUDING WITHOUT LIMITATION, MERCHANTABILITY OR FITNESS FOR A PARTICULAR USE OR PURPOSE. ALL RISK IS ASSUMED BY THE USER. IN NO EVENT SHALL ENVIRONMENTAL DATA RESOURCES, INC. BE LIABLE TO ANYONE, WHETHER ARISING OUT OF ERRORS OR OMISSIONS, NEGLIGENCE, ACCIDENT OR ANY OTHER CAUSE, FOR ANY LOSS OR DAMAGE, INCLUDING, WITHOUT LIMITATION, SPECIAL, INCIDENTAL, CONSEQUENTIAL, OR EXEMPLARY DAMAGES. ANY LIABILITY ON THE PART OF ENVIRONMENTAL DATA RESOURCES, INC. IS STRICTLY LIMITED TO A REFUND OF THE AMOUNT PAID FOR THIS REPORT.** Purchaser accepts this Report "AS IS". Any analyses, estimates, ratings, environmental risk levels or risk codes provided in this Report are provided for illustrative purposes only, and are not intended to provide, nor should they be interpreted as providing any facts regarding, or prediction orforecast of, any environmental risk for any property. Only a Phase I Environmental Site Assessment performed by an environmental professional can provide information regarding the environmental risk for any property. Additionally, the information provided in this Report is not to be construed as legal advice.

Copyright 2013 by Environmental Data Resources, Inc. All rights reserved. Reproduction in any media or format, in whole or in part, of any report or map of Environmental Data Resources, Inc. or its affiliates is prohibited without prior written permission.

EDR and its logos (including Sanborn and Sanborn Map) are trademarks of Environmental Data Resources, Inc. or its affiliates. All other trademarks used herein are the property of their respective owners.

FINDINGS

TARGET PROPERTY INFORMATION

ADDRESS

218 S. Bloodworth Street
Raleigh, NC 27601

FINDINGS DETAIL

Target Property research detail.

BLOODWORTH ST S

218 BLOODWORTH ST S

Year	Uses	Source	
1997	Newsome Frankie Joe & Jill	R.L. Polk & Co Publishers	Image pg. A10
1992	Dunn Mary E	R.L. Polk & Co Publishers	Image pg. A19
1988	Dunn Viola G Mrs	R.L. Polk & Co Publishers	Image pg. A29
1982	Dunn Viola G Mrs	R.L. Polk & Co Publishers	Image pg. A39
1977	Dunn Laddie M	HILL DIRECTORY COMPANY PUBLISHERS	Image pg. A50
1967	DUNN JOHN D	HILL DIRECTORY COMPANY PUBLISHERS	Image pg. A75
1962	Dunn Laddie	Hill Directory Co., Inc.,	Image pg. A91
1957	Mishue Milton	Hill Directory Co., Inc.,	Image pg. A104
1952	Arnold Millard C	Hill Directory Co., Inc.,	Image pg. A122
1941	Johnson Ernest M	Hill Directory Co., Inc.,	Image pg. A147
1936	Newton John W	Hill Directory Co., Inc.,	Image pg. A161
1931	Eubanks Geo W	Hill Directory Co Inc Publishers	Image pg. A176
1926	Hudson N E	Hill Directory Co Inc Publisher	Image pg. A226
1922	Stark Fred	Hill Directory Co. Publishers	Image pg. A240

S BLOODWORTH ST

218 S BLOODWORTH ST

Year	Uses	Source	
2003	English Edward R	City Publishing Co	Image pg. A1
1972	Dunn Laddie M	HILL DIRECTORY COMPANY PUBLISHERS	Image pg. A61

FINDINGS

Year	Uses	Source	
1992	Vacant	R.L. Polk & Co Publishers	Image pg. A19
1988	Vacant	R.L. Polk & Co Publishers	Image pg. A29
1982	Re Entry Inc social serv org	R.L. Polk & Co Publishers	Image pg. A39
1977	Re Entry Inc social serv org	HILL DIRECTORY COMPANY PUBLISHERS	Image pg. A50
1967	KAIMER RAYMOND H	HILL DIRECTORY COMPANY PUBLISHERS	Image pg. A75
1962	Atkins J C	Hill Directory Co., Inc.,	Image pg. A91
	Martin Henry	Hill Directory Co., Inc.,	Image pg. A91
	Myers R J	Hill Directory Co., Inc.,	Image pg. A91
1957	Atkins Jas C	Hill Directory Co., Inc.,	Image pg. A104
	Housholder Leroy D	Hill Directory Co., Inc.,	Image pg. A104
1952	Atkins Jas C	Hill Directory Co., Inc.,	Image pg. A122
1947	Bryant Ruth M	Hill Directory Co., Inc.,	Image pg. A135
1941	Bryant W Thos	Hill Directory Co., Inc.,	Image pg. A147
1936	Bryant W Thos	Hill Directory Co., Inc.,	Image pg. A163
1931	Bryant W Thos	Hill Directory Co Inc Publishers	Image pg. A176
1926	Bryant W T	Hill Directory Co Inc Publisher	Image pg. A226
1922	Betts C H	Hill Directory Co. Publishers	Image pg. A240

208 BLOODWORTH ST S

Year	Uses	Source	
1967	AMAKER Ch ARLOTTE J MRS	HILL DIRECTORY COMPANY PUBLISHERS	Image pg. A75
1962	Hyman John T	Hill Directory Co., Inc.,	Image pg. A91
1957	Vacant	Hill Directory Co., Inc.,	Image pg. A104
1952	Strickland Jas D	Hill Directory Co., Inc.,	Image pg. A122
1947	Perry Percy B	Hill Directory Co., Inc.,	Image pg. A135
1941	Britt Julian D	Hill Directory Co., Inc.,	Image pg. A147
1936	Bunn B B	Hill Directory Co., Inc.,	Image pg. A163
1931	Belvin P Clarence	Hill Directory Co Inc Publishers	Image pg. A176
1926	Fowler E A Mrs	Hill Directory Co Inc Publisher	Image pg. A226
1922	Mims V G	Hill Directory Co. Publishers	Image pg. A240

210 BLOODWORTH ST S

Year	Uses	Source	
1997	Hakim Karium	R.L. Polk & Co Publishers	Image pg. A10
1992	Cambell Barry U	R.L. Polk & Co Publishers	Image pg. A19
1988	Partin Jacqueline H	R.L. Polk & Co Publishers	Image pg. A29
1982	Dewberry Dorothy	R.L. Polk & Co Publishers	Image pg. A39

FINDINGS

Year	Uses	Source	
1977	Lane Martha M	HILL DIRECTORY COMPANY PUBLISHERS	Image pg. A50
1967	BANKS PAUL	HILL DIRECTORY COMPANY PUBLISHERS	Image pg. A75
1962	Banks Paul V	Hill Directory Co., Inc.,	Image pg. A91
1957	Banks Paul	Hill Directory Co., Inc.,	Image pg. A104
1952	Banks Paul	Hill Directory Co., Inc.,	Image pg. A122
1947	Banks Paul	Hill Directory Co., Inc.,	Image pg. A135
1941	Bartholomew Lewis W	Hill Directory Co., Inc.,	Image pg. A147
1936	Bagwell J Lester	Hill Directory Co., Inc.,	Image pg. A163
1931	Maynard Earl T	Hill Directory Co Inc Publishers	Image pg. A176
1926	Belvin P C	Hill Directory Co Inc Publisher	Image pg. A226
1922	Bumgardner L R	Hill Directory Co. Publishers	Image pg. A240

213 BLOODWORTH ST S

Year	Uses	Source	
1997	Smith Louise A	R.L. Polk & Co Publishers	Image pg. A10
1992	Smith Louis H	R.L. Polk & Co Publishers	Image pg. A19
	Smith Lorenzo	R.L. Polk & Co Publishers	Image pg. A19
1988	King Evelyn	R.L. Polk & Co Publishers	Image pg. A29
1982	Smith Louise	R.L. Polk & Co Publishers	Image pg. A39
1977	Lumford Katie	HILL DIRECTORY COMPANY PUBLISHERS	Image pg. A50
1967	AVERY MARY A MRS	HILL DIRECTORY COMPANY PUBLISHERS	Image pg. A75
1962	Bartholomew Lewis W	Hill Directory Co., Inc.,	Image pg. A91
1957	Bartholomew Lewis W	Hill Directory Co., Inc.,	Image pg. A104
1952	Bartholomew Lewis W	Hill Directory Co., Inc.,	Image pg. A122
1947	Bartholomew Lewis W	Hill Directory Co., Inc.,	Image pg. A135
1941	Hogue Chas N	Hill Directory Co., Inc.,	Image pg. A147
1936	Hogue Chas N	Hill Directory Co., Inc.,	Image pg. A163
1931	Thompson Cicero L	Hill Directory Co Inc Publishers	Image pg. A176
1926	Hogue C N	Hill Directory Co Inc Publisher	Image pg. A226
	Adams Arthur	Hill Directory Co Inc Publisher	Image pg. A226
1922	Hogue C N	Hill Directory Co. Publishers	Image pg. A240

214 BLOODWORTH ST S

Year	Uses	Source	
1992	Vacant	R.L. Polk & Co Publishers	Image pg. A19
1988	No Return	R.L. Polk & Co Publishers	Image pg. A29
1982	Williams John T	R.L. Polk & Co Publishers	Image pg. A39

FINDINGS

Year	Uses	Source	
1977	Williams John T	HILL DIRECTORY COMPANY PUBLISHERS	Image pg. A50
1967	MITCHELL HERMAN	HILL DIRECTORY COMPANY PUBLISHERS	Image pg. A75
1962	Jones Lucy T Mrs	Hill Directory Co., Inc.,	Image pg. A91
1957	Jones Lucy T Mrs	Hill Directory Co., Inc.,	Image pg. A104
1952	Jordan Chas J	Hill Directory Co., Inc.,	Image pg. A122
1947	Jordan Chas J	Hill Directory Co., Inc.,	Image pg. A135
	Earp Bernice I	Hill Directory Co., Inc.,	Image pg. A135
1941	Davis MXelvin H	Hill Directory Co., Inc.,	Image pg. A147
1936	Till Eliz A Mrs	Hill Directory Co., Inc.,	Image pg. A163
1931	Eason Moses	Hill Directory Co Inc Publishers	Image pg. A176
1926	Creech P J	Hill Directory Co Inc Publisher	Image pg. A226
	Martin W C	Hill Directory Co Inc Publisher	Image pg. A226
1922	Bailey R L	Hill Directory Co. Publishers	Image pg. A240

215 BLOODWORTH ST S

Year	Uses	Source	
1967	BOYKIN ANNE K MRS	HILL DIRECTORY COMPANY PUBLISHERS	Image pg. A75
1962	Boykin Anne K Mrs	Hill Directory Co., Inc.,	Image pg. A91
1957	Boykins Geo A	Hill Directory Co., Inc.,	Image pg. A104
1952	Poole Manley G	Hill Directory Co., Inc.,	Image pg. A122
1947	Poole Mallie G	Hill Directory Co., Inc.,	Image pg. A135
1941	Jordan Chas J	Hill Directory Co., Inc.,	Image pg. A147
1936	Kelly John W	Hill Directory Co., Inc.,	Image pg. A163
	Grimmer Jas B	Hill Directory Co., Inc.,	Image pg. A161
1931	Hamilton Ernest B	Hill Directory Co Inc Publishers	Image pg. A176
1926	Kelly J M	Hill Directory Co Inc Publisher	Image pg. A226
1922	Kelley J M	Hill Directory Co. Publishers	Image pg. A240

217 BLOODWORTH ST S

Year	Uses	Source	
1967	APARTMENTS	HILL DIRECTORY COMPANY PUBLISHERS	Image pg. A75
	SCOTT MARY	HILL DIRECTORY COMPANY PUBLISHERS	Image pg. A75
	MILES ANN	HILL DIRECTORY COMPANY PUBLISHERS	Image pg. A75
	STEWART HOWARD	HILL DIRECTORY COMPANY PUBLISHERS	Image pg. A75

FINDINGS

Year	Uses	Source	
1988	Smith Loise A	R.L. Polk & Co Publishers	Image pg. A29
1982	Ray Mary D	R.L. Polk & Co Publishers	Image pg. A39
1977	Banks Paul	HILL DIRECTORY COMPANY PUBLISHERS	Image pg. A50
1967	KING BUNNY	HILL DIRECTORY COMPANY PUBLISHERS	Image pg. A75
1962	King Bunny	Hill Directory Co., Inc.,	Image pg. A91
1957	King Bunny	Hill Directory Co., Inc.,	Image pg. A104
1947	Black Chas E	Hill Directory Co., Inc.,	Image pg. A135
1941	Patton Jas F	Hill Directory Co., Inc.,	Image pg. A147
1936	Terry Wm T	Hill Directory Co., Inc.,	Image pg. A161
1931	Terry Wm T	Hill Directory Co Inc Publishers	Image pg. A176
1926	Terry W T	Hill Directory Co Inc Publisher	Image pg. A226
1922	Terry W T	Hill Directory Co. Publishers	Image pg. A240

222 BLOODWORTH ST S

Year	Uses	Source	
1992	Not Verified	R.L. Polk & Co Publishers	Image pg. A19
1988	Vacant	R.L. Polk & Co Publishers	Image pg. A29
1957	Vacant	Hill Directory Co., Inc.,	Image pg. A104
1952	Martin Lucy I Mrs	Hill Directory Co., Inc.,	Image pg. A122
1947	Martin Lucy I Mrs	Hill Directory Co., Inc.,	Image pg. A135
1941	Martin Lucy I Mrs	Hill Directory Co., Inc.,	Image pg. A147
1936	Martin Lucy I Mrs	Hill Directory Co., Inc.,	Image pg. A161
1931	Martin Lucy I Mrs	Hill Directory Co Inc Publishers	Image pg. A176
1926	Martin L I Mrs	Hill Directory Co Inc Publisher	Image pg. A226
1922	Martin L I Mrs	Hill Directory Co. Publishers	Image pg. A240

224 BLOODWORTH ST S

Year	Uses	Source	
1992	Harris Donald	R.L. Polk & Co Publishers	Image pg. A19
1988	Harris Clydie	R.L. Polk & Co Publishers	Image pg. A29
1982	Harris Oris	R.L. Polk & Co Publishers	Image pg. A39
1977	Lane Dixon	HILL DIRECTORY COMPANY PUBLISHERS	Image pg. A50
1967	HUNTER BEATRICE R MRS	HILL DIRECTORY COMPANY PUBLISHERS	Image pg. A75
1962	Hunter Beatrice R Mrs	Hill Directory Co., Inc.,	Image pg. A91
1957	Brannan G Clark	Hill Directory Co., Inc.,	Image pg. A104
1952	Brannan G Clark	Hill Directory Co., Inc.,	Image pg. A122
1947	Brannan G Clark	Hill Directory Co., Inc.,	Image pg. A135

FINDINGS

Year	Uses	Source	
1941	Allen Harry B	Hill Directory Co., Inc.,	Image pg. A147
1936	Sexton L Garland	Hill Directory Co., Inc.,	Image pg. A161
	Kelly Carson H	Hill Directory Co., Inc.,	Image pg. A161
1931	Vacant	Hill Directory Co Inc Publishers	Image pg. A176
1926	Phelps R M	Hill Directory Co Inc Publisher	Image pg. A226
1922	Thornton W S	Hill Directory Co. Publishers	Image pg. A240

225 BLOODWORTH ST S

Year	Uses	Source	
1982	Vacant	R.L. Polk & Co Publishers	Image pg. A39
1977	No Return	HILL DIRECTORY COMPANY PUBLISHERS	Image pg. A50
1967	HARRIS NELLIE MRS	HILL DIRECTORY COMPANY PUBLISHERS	Image pg. A75
1962	Vacant	Hill Directory Co., Inc.,	Image pg. A91
1957	Vacaht	Hill Directory Co., Inc.,	Image pg. A104
1952	Labat Ben J	Hill Directory Co., Inc.,	Image pg. A122
1947	King Berry E	Hill Directory Co., Inc.,	Image pg. A135
1941	Poole Rosa Mrs	Hill Directory Co., Inc.,	Image pg. A147
1936	Bartholomew Lewis W	Hill Directory Co., Inc.,	Image pg. A161
1931	Vacant	Hill Directory Co Inc Publishers	Image pg. A176
1926	Ballance J D	Hill Directory Co Inc Publisher	Image pg. A226
1922	Morris R E	Hill Directory Co. Publishers	Image pg. A240

226 BLOODWORTH ST S

Year	Uses	Source	
1962	Bryant Thos	Hill Directory Co., Inc.,	Image pg. A91
1957	Fowler Shelton H	Hill Directory Co., Inc.,	Image pg. A104
1952	Fowler Shelton H	Hill Directory Co., Inc.,	Image pg. A122
1947	Fowler Wm S	Hill Directory Co., Inc.,	Image pg. A135
1941	Warwick Bonco A	Hill Directory Co., Inc.,	Image pg. A147
1936	Wicker Kath R Mrs	Hill Directory Co., Inc.,	Image pg. A161
1931	Cash J Clarence	Hill Directory Co Inc Publishers	Image pg. A176
1926	Stiebel Daisy Mrs	Hill Directory Co Inc Publisher	Image pg. A226
	Stephenson A C	Hill Directory Co Inc Publisher	Image pg. A226
1922	Booker P C	Hill Directory Co. Publishers	Image pg. A240

227 BLOODWORTH ST S

Year	Uses	Source	
1992	Not Verified 2 Hses	R.L. Polk & Co Publishers	Image pg. A19

FINDINGS

Year	Uses	Source	
1992	Not Verified 2 Hses	R.L. Polk & Co Publishers	Image pg. A19
1988	Shears Linda D	R.L. Polk & Co Publishers	Image pg. A29
1982	Vacant	R.L. Polk & Co Publishers	Image pg. A39
1977	Rogers C Preston	HILL DIRECTORY COMPANY PUBLISHERS	Image pg. A50
1967	KING LENA B MRS	HILL DIRECTORY COMPANY PUBLISHERS	Image pg. A75
1962	King T Frank	Hill Directory Co., Inc.,	Image pg. A91
1957	King T Frank	Hill Directory Co., Inc.,	Image pg. A104
1952	mus tchr	Hill Directory Co., Inc.,	Image pg. A124
	King T Frank	Hill Directory Co., Inc.,	Image pg. A122
1947	King T Frank	Hill Directory Co., Inc.,	Image pg. A135
1941	King T Frank	Hill Directory Co., Inc.,	Image pg. A147
1936	King T Prank	Hill Directory Co., Inc.,	Image pg. A161
1931	King T Frank	Hill Directory Co Inc Publishers	Image pg. A176
1926	Ragan J P	Hill Directory Co Inc Publisher	Image pg. A226
	Love J J	Hill Directory Co Inc Publisher	Image pg. A226
1922	King T F	Hill Directory Co. Publishers	Image pg. A240

228 BLOODWORTH ST S

Year	Uses	Source	
1997	Jackson Rosa	R.L. Polk & Co Publishers	Image pg. A10
1992	Daniels Maggie	R.L. Polk & Co Publishers	Image pg. A19
	Jackson Rosa	R.L. Polk & Co Publishers	Image pg. A19
1988	Vacant	R.L. Polk & Co Publishers	Image pg. A29
1982	Collins Lovie	R.L. Polk & Co Publishers	Image pg. A39
1977	Collins Lovie	HILL DIRECTORY COMPANY PUBLISHERS	Image pg. A50
1967	BUNCH EFF IE MRS	HILL DIRECTORY COMPANY PUBLISHERS	Image pg. A75
1957	Dodd Jack B	Hill Directory Co., Inc.,	Image pg. A104
1952	Dodd Jack B	Hill Directory Co., Inc.,	Image pg. A124
1947	Dodd Jack B	Hill Directory Co., Inc.,	Image pg. A135
1941	Dodd Jack B	Hill Directory Co., Inc.,	Image pg. A147
1936	Dodd J Beni	Hill Directory Co., Inc.,	Image pg. A161
1931	Coates Lula Mrs	Hill Directory Co Inc Publishers	Image pg. A176
1926	Jones 0 M	Hill Directory Co Inc Publisher	Image pg. A226
1922	Jones 0 M	Hill Directory Co. Publishers	Image pg. A240

FINDINGS

312 E MARTIN ST

Year	Uses	Source	
1972	Auto Insurance Service	HILL DIRECTORY COMPANY PUBLISHERS	Image pg. A63
	Convenient Auto Insurance	HILL DIRECTORY COMPANY PUBLISHERS	Image pg. A63

313 E MARTIN ST

Year	Uses	Source	
2012	CAYTON GROUP THE	Cole Information Services	
	SPEECH MASTERS THERAPY SERVICES	Cole Information Services	
2007	DANNY CAYTON	Cole Information Services	
1972	Protective Agency Inc auto ins	HILL DIRECTORY COMPANY PUBLISHERS	Image pg. A63

315 E MARTIN ST

Year	Uses	Source	
1972	OBriant Henry H	HILL DIRECTORY COMPANY PUBLISHERS	Image pg. A63

317 E MARTIN ST

Year	Uses	Source	
1972	Bethany Mission Variety Store	HILL DIRECTORY COMPANY PUBLISHERS	Image pg. A63

318 E MARTIN ST

Year	Uses	Source	
1972	North State Motor Sales	HILL DIRECTORY COMPANY PUBLISHERS	Image pg. A63

319 E MARTIN ST

Year	Uses	Source	
1972	No Return	HILL DIRECTORY COMPANY PUBLISHERS	Image pg. A63

320 E MARTIN ST

Year	Uses	Source	
1972	Hackney Mary	HILL DIRECTORY COMPANY PUBLISHERS	Image pg. A63

325 E MARTIN ST

Year	Uses	Source	
1972	Durham Christine	HILL DIRECTORY COMPANY PUBLISHERS	Image pg. A63

FINDINGS

327 E MARTIN ST

Year	Uses	Source	
2003	No Current Listing	City Publishing Co	Image pg. A5
1972	Young Audrie M	HILL DIRECTORY COMPANY PUBLISHERS	Image pg. A63

332 E MARTIN ST

Year	Uses	Source	
1972	Lassiters Barber Shop	HILL DIRECTORY COMPANY PUBLISHERS	Image pg. A63
	Lassiter Carlton R	HILL DIRECTORY COMPANY PUBLISHERS	Image pg. A63

334 E MARTIN ST

Year	Uses	Source	
1972	Williams Furniture Repair	HILL DIRECTORY COMPANY PUBLISHERS	Image pg. A63

336 E MARTIN ST

Year	Uses	Source	
2003	PIERCE MUSIC & AMUSEMENT CO	City Publishing Co	Image pg. A5

394 E MARTIN ST

Year	Uses	Source	
2012	RALEIGH INSURANCE CENTER	Cole Information Services	

400 E MARTIN ST

Year	Uses	Source	
2012	REGAN BRYAN PHOTOGRAPHY	Cole Information Services	
2007	BRYAN REGAN PHOTOGRAPHY	Cole Information Services	
2003	No Current Listing	City Publishing Co	Image pg. A5
1972	Raleigh Billiard Supply Co	HILL DIRECTORY COMPANY PUBLISHERS	Image pg. A63

403 E MARTIN ST

Year	Uses	Source	
1972	Forte Roosevelt E	HILL DIRECTORY COMPANY PUBLISHERS	Image pg. A63

404 E MARTIN ST

Year	Uses	Source	
2003	Thomas Florence E	City Publishing Co	Image pg. A5
	AUTUMN HOUSE	City Publishing Co	Image pg. A5

416 E MORGAN ST

Year	Uses	Source	
1972	Hunter Flossie Mrs	HILL DIRECTORY COMPANY PUBLISHERS	Image pg. A64
1962	County Foster Home V	Hill Directory Co., Inc.,	Image pg. A94
	Bryant Hazel M Mrs V	Hill Directory Co., Inc.,	Image pg. A94

E. Hargett Street

330 E. Hargett Street

Year	Uses	Source	
1982	Johnson Eliz J	R.L. Polk & Co Publishers	Image pg. A41
1977	Johnson Eliz J	HILL DIRECTORY COMPANY PUBLISHERS	Image pg. A52
1972	Johnson Eliz J	HILL DIRECTORY COMPANY PUBLISHERS	Image pg. A65
1967	JOHNSON ELIZ J	HILL DIRECTORY COMPANY PUBLISHERS	Image pg. A78
1957	Johnson Ernest M	Hill Directory Co., Inc.,	Image pg. A106
1952	Johnson Ernest M	Hill Directory Co., Inc.,	Image pg. A125
1947	Johnson Ernest M	Hill Directory Co., Inc.,	Image pg. A136
1941	Hales Mabel K Mrs	Hill Directory Co., Inc.,	Image pg. A149
1936	Hales Carl E	Hill Directory Co., Inc.,	Image pg. A164
1931	Newton Lonnie C	Hill Directory Co Inc Publishers	Image pg. A179
	Newton Lizzie C Mrs bdg	Hill Directory Co Inc Publishers	Image pg. A179
1926	Vacant	Hill Directory Co Inc Publisher	Image pg. A228
	Y 2 Vacant	Hill Directory Co Inc Publisher	Image pg. A228
1922	Roberts H R	Hill Directory Co. Publishers	Image pg. A241
	Bartlett A E	Hill Directory Co. Publishers	Image pg. A241

E. Martin Street

317 E. Martin Street

Year	Uses	Source	
1997	POWERHOUSE CHURCH OF JESUS CHRIST	R.L. Polk & Co Publishers	Image pg. A12
1992	POWER HOUSE OF JESUS CHRIST	R.L. Polk & Co Publishers	Image pg. A21
1988	Power House Of Jesus Christ	R.L. Polk & Co Publishers	Image pg. A31
1982	Resurrection Church Of Jesus Christ	R.L. Polk & Co Publishers	Image pg. A42
1977	Resurrection Church Of Jesus Christ	HILL DIRECTORY COMPANY PUBLISHERS	Image pg. A53
1972	Bethany Mission Variety Store	HILL DIRECTORY COMPANY PUBLISHERS	Image pg. A66

FINDINGS

Year	Uses	Source	
1967	VACANT	HILL DIRECTORY COMPANY PUBLISHERS	Image pg. A79
1962	Bargain House The genl mdse	Hill Directory Co., Inc.,	Image pg. A95
1957	Vacant	Hill Directory Co., Inc.,	Image pg. A107
1952	Bogasse Prntg Co	Hill Directory Co., Inc.,	Image pg. A126
1947	Murray Jas	Hill Directory Co., Inc.,	Image pg. A137
1941	Thompson WNValter	Hill Directory Co., Inc.,	Image pg. A150
1936	Baucom Victoria C Mrs	Hill Directory Co., Inc.,	Image pg. A165
1931	Vacant	Hill Directory Co Inc Publishers	Image pg. A180
1926	Djinis Gus J	Hill Directory Co Inc Publisher	Image pg. A229
1922	Honeycutt H H	Hill Directory Co. Publishers	Image pg. A242

319 E. Martin Street

Year	Uses	Source	
1977	Vacant	HILL DIRECTORY COMPANY PUBLISHERS	Image pg. A53
1972	No Return	HILL DIRECTORY COMPANY PUBLISHERS	Image pg. A66
1967	WILLIAMS HENRIETTA	HILL DIRECTORY COMPANY PUBLISHERS	Image pg. A79
1962	Williams Henrietta	Hill Directory Co., Inc.,	Image pg. A95
1957	Newton Alma H Mrs	Hill Directory Co., Inc.,	Image pg. A107
1952	Newton Alma D Mrs	Hill Directory Co., Inc.,	Image pg. A126
1947	Newton Alma H Mrs	Hill Directory Co., Inc.,	Image pg. A137
1941	Newton Decatur	Hill Directory Co., Inc.,	Image pg. A150
	Newton Plant & Flower Co	Hill Directory Co., Inc.,	Image pg. A150
	The nuserymn	Hill Directory Co., Inc.,	Image pg. A150
1936	Newton Decatur	Hill Directory Co., Inc.,	Image pg. A165
	Newton Plant & Flower Co	Hill Directory Co., Inc.,	Image pg. A165
	The nurserymn	Hill Directory Co., Inc.,	Image pg. A165
1931	Newton Decatur	Hill Directory Co Inc Publishers	Image pg. A180
1926	Newton Decatur	Hill Directory Co Inc Publisher	Image pg. A229
1922	Newton Decatur	Hill Directory Co. Publishers	Image pg. A242

323 E. Martin Street

Year	Uses	Source	
1967	ROGERS WM	HILL DIRECTORY COMPANY PUBLISHERS	Image pg. A79
1962	Lane Arth J	Hill Directory Co., Inc.,	Image pg. A95
1957	No Return	Hill Directory Co., Inc.,	Image pg. A108
1952	Wiggins Lawrence D	Hill Directory Co., Inc.,	Image pg. A126

Year	Uses	Source	
1947	Wiggins Lawrence D	Hill Directory Co., Inc.,	Image pg. A137
1941	Wiggins Lawrence D	Hill Directory Co., Inc.,	Image pg. A150
1936	Home Edw B	Hill Directory Co., Inc.,	Image pg. A165
1931	Vacant	Hill Directory Co Inc Publishers	Image pg. A181
1926	Vacant	Hill Directory Co Inc Publisher	Image pg. A229
1922	Mooneyham A M	Hill Directory Co. Publishers	Image pg. A242

327 E. Martin Street

Year	Uses	Source	
2003	No Current Listing	City Publishing Co	Image pg. A7
1997	Thorpe Gloria D	R.L. Polk & Co Publishers	Image pg. A12
1992	Thorpe Fidelia	R.L. Polk & Co Publishers	Image pg. A21
	Thorpe Nichole A	R.L. Polk & Co Publishers	Image pg. A21
	Mc Leod Margt	R.L. Polk & Co Publishers	Image pg. A21
1988	Thorpe Fidelia	R.L. Polk & Co Publishers	Image pg. A31
1982	Thrope Fidel	R.L. Polk & Co Publishers	Image pg. A42
1977	No Return	HILL DIRECTORY COMPANY PUBLISHERS	Image pg. A53
1972	Young Audrie M	HILL DIRECTORY COMPANY PUBLISHERS	Image pg. A66
1967	DAVIS ROBT	HILL DIRECTORY COMPANY PUBLISHERS	Image pg. A79
1962	Quiller Mary S Mrs	Hill Directory Co., Inc.,	Image pg. A95
1957	Fowler Sam T	Hill Directory Co., Inc.,	Image pg. A108
1952	Pendergraft Lenora W	Hill Directory Co., Inc.,	Image pg. A126
1947	Pendergraft Estus L	Hill Directory Co., Inc.,	Image pg. A137
1941	Pendergraft Estus L	Hill Directory Co., Inc.,	Image pg. A150
1936	Pendergraft Estus L	Hill Directory Co., Inc.,	Image pg. A165
1931	Vacant	Hill Directory Co Inc Publishers	Image pg. A181
1926	Wilson J J	Hill Directory Co Inc Publisher	Image pg. A229
1922	Wilson J J	Hill Directory Co. Publishers	Image pg. A242

EAST ST S

101 EAST ST S

Year	Uses	Source	
1997	Not Verified	R.L. Polk & Co Publishers	Image pg. A13
1992	CITY CEMETERY	R.L. Polk & Co Publishers	Image pg. A22
1988	City Cemetery	R.L. Polk & Co Publishers	Image pg. A32
1982	City Cemetery	R.L. Polk & Co Publishers	Image pg. A43

FINDINGS

326 HARGETT ST E

Year	Uses	Source	
1967	JONES SALLY T MRS	HILL DIRECTORY COMPANY PUBLISHERS	Image pg. A85
1962	Jones Sally T Mrs	Hill Directory Co., Inc.,	Image pg. A97
1957	Vacant	Hill Directory Co., Inc.,	Image pg. A109
1952	Pearce Doll P Mrs	Hill Directory Co., Inc.,	Image pg. A128
1947	Hill Henry C	Hill Directory Co., Inc.,	Image pg. A139
1941	Andrews Ralph H	Hill Directory Co., Inc.,	Image pg. A152
1936	Hulin Sallie E	Hill Directory Co., Inc.,	Image pg. A169
1931	Torrence S Mason	Hill Directory Co Inc Publishers	Image pg. A183

328 HARGETT ST E

Year	Uses	Source	
1962	Vacant	Hill Directory Co., Inc.,	Image pg. A97

330 HARGETT ST E

Year	Uses	Source	
1982	Johnson Eliz J	R.L. Polk & Co Publishers	Image pg. A44
1977	Johnson Eliz J	HILL DIRECTORY COMPANY PUBLISHERS	Image pg. A55
1972	Johnson Eliz J	HILL DIRECTORY COMPANY PUBLISHERS	Image pg. A68
1967	JOHNSON ELIZ J	HILL DIRECTORY COMPANY PUBLISHERS	Image pg. A85
1957	Johnson Ernest M	Hill Directory Co., Inc.,	Image pg. A109
1952	Johnson Ernest M	Hill Directory Co., Inc.,	Image pg. A128
1947	Johnson Ernest M	Hill Directory Co., Inc.,	Image pg. A139
1941	Hales Mabel K Mrs	Hill Directory Co., Inc.,	Image pg. A152
1936	Hales Carl E	Hill Directory Co., Inc.,	Image pg. A169
1931	Newton Lizzie C Mrs bdg	Hill Directory Co Inc Publishers	Image pg. A183
	Newton Lonnie C	Hill Directory Co Inc Publishers	Image pg. A183
1926	Vacant	Hill Directory Co Inc Publisher	Image pg. A231
	Y 2 Vacant	Hill Directory Co Inc Publisher	Image pg. A231
1922	Roberts H R	Hill Directory Co. Publishers	Image pg. A246
	Bartlett A E	Hill Directory Co. Publishers	Image pg. A246

402 HARGETT ST E

Year	Uses	Source	
1997	Not Verified	R.L. Polk & Co Publishers	Image pg. A14
1992	Jacobs Virginia	R.L. Polk & Co Publishers	Image pg. A23
1988	Jacobs Virgin	R.L. Polk & Co Publishers	Image pg. A33

Year	Uses	Source	
1926	OBryant H H	Hill Directory Co Inc Publisher	Image pg. A232
	Bogasse R B Mrs	Hill Directory Co Inc Publisher	Image pg. A232
1922	Bogasse Samuel	Hill Directory Co. Publishers	Image pg. A247

317 MARTIN ST E

Year	Uses	Source	
1997	POWERHOUSE CHURCH OF JESUS CHRIST	R.L. Polk & Co Publishers	Image pg. A15
1992	POWER HOUSE OF JESUS CHRIST	R.L. Polk & Co Publishers	Image pg. A24
1988	Power House Of Jesus Christ	R.L. Polk & Co Publishers	Image pg. A34
1982	Resurrection Church Of Jesus Christ	R.L. Polk & Co Publishers	Image pg. A45
1977	Resurrection Church Of Jesus Christ	HILL DIRECTORY COMPANY PUBLISHERS	Image pg. A56
1967	VACANT	HILL DIRECTORY COMPANY PUBLISHERS	Image pg. A86
1962	Bargain House The genl mdse	Hill Directory Co., Inc.,	Image pg. A98
1957	Vacant	Hill Directory Co., Inc.,	Image pg. A110
1952	Bogasse Prntg Co	Hill Directory Co., Inc.,	Image pg. A129
1947	Murray Jas	Hill Directory Co., Inc.,	Image pg. A140
1941	Thompson WNValter	Hill Directory Co., Inc.,	Image pg. A154
1936	Baucom Victoria C Mrs	Hill Directory Co., Inc.,	Image pg. A170
1931	Vacant	Hill Directory Co Inc Publishers	Image pg. A184
1926	Djinis Gus J	Hill Directory Co Inc Publisher	Image pg. A232
1922	Honeycutt H H	Hill Directory Co. Publishers	Image pg. A247

318 MARTIN ST E

Year	Uses	Source	
1997	WRIGHT BODY SHOP auto body shop	R.L. Polk & Co Publishers	Image pg. A15
1992	WRIGHTS BODY SHOP auto reprs	R.L. Polk & Co Publishers	Image pg. A24
1988	Wrights Body Shop auto reprs	R.L. Polk & Co Publishers	Image pg. A34
1982	Wrights Body Shop	R.L. Polk & Co Publishers	Image pg. A45
1977	North State Motor Sales Inc	HILL DIRECTORY COMPANY PUBLISHERS	Image pg. A56
1967	VACANT	HILL DIRECTORY COMPANY PUBLISHERS	Image pg. A86
1962	Vacant	Hill Directory Co., Inc.,	Image pg. A98
1957	Tippett L Wm	Hill Directory Co., Inc.,	Image pg. A110
1952	Price Harold B	Hill Directory Co., Inc.,	Image pg. A129
	Pittman Chas R	Hill Directory Co., Inc.,	Image pg. A129
1947	Pittman Chas R	Hill Directory Co., Inc.,	Image pg. A140
1941	Brannan David M	Hill Directory Co., Inc.,	Image pg. A154

Year	Uses	Source	
1941	Pittman Chas R	Hill Directory Co., Inc.,	Image pg. A154
[illegible]	Ellington Robt R	Hill Directory Co., Inc.,	Image pg. A170
	Hunnicutt Herman W	Hill Directory Co., Inc.,	Image pg. A170
1931	Overman Reginald	Hill Directory Co Inc Publishers	Image pg. A184
	Dollar Junius C	Hill Directory Co Inc Publishers	Image pg. A184
1926	Buffaloe H V	Hill Directory Co Inc Publisher	Image pg. A232
	Mitchell M H	Hill Directory Co Inc Publisher	Image pg. A232
1922	Hopkins Richard	Hill Directory Co. Publishers	Image pg. A247

319 MARTIN ST E

Year	Uses	Source	
1977	Vacant	HILL DIRECTORY COMPANY PUBLISHERS	Image pg. A56
1967	WILLIAMS HENRIETTA	HILL DIRECTORY COMPANY PUBLISHERS	Image pg. A86
1962	Williams Henrietta	Hill Directory Co., Inc.,	Image pg. A98
1957	Newton Alma H Mrs	Hill Directory Co., Inc.,	Image pg. A110
1952	Newton Alma D Mrs	Hill Directory Co., Inc.,	Image pg. A129
1947	Newton Alma H Mrs	Hill Directory Co., Inc.,	Image pg. A140
1941	The nuserymn	Hill Directory Co., Inc.,	Image pg. A154
	Newton Decatur	Hill Directory Co., Inc.,	Image pg. A154
	Newton Plant & Flower Co	Hill Directory Co., Inc.,	Image pg. A154
1936	The nurserymn	Hill Directory Co., Inc.,	Image pg. A170
	Newton Plant & Flower Co	Hill Directory Co., Inc.,	Image pg. A170
	Newton Decatur	Hill Directory Co., Inc.,	Image pg. A170
1931	Newton Decatur	Hill Directory Co Inc Publishers	Image pg. A184
1926	Newton Decatur	Hill Directory Co Inc Publisher	Image pg. A232
1922	Newton Decatur	Hill Directory Co. Publishers	Image pg. A247

320 MARTIN ST E

Year	Uses	Source	
1997	Not Verified 2 Hses	R.L. Polk & Co Publishers	Image pg. A15
1992	Williams Walter T	R.L. Polk & Co Publishers	Image pg. A24
1988	William Walter T	R.L. Polk & Co Publishers	Image pg. A34
1982	Jackson Ros	R.L. Polk & Co Publishers	Image pg. A45
1977	No Return	HILL DIRECTORY COMPANY PUBLISHERS	Image pg. A56
1967	MC NEILL CHARLES I	HILL DIRECTORY COMPANY PUBLISHERS	Image pg. A86
	WILDERS INC STGE	HILL DIRECTORY COMPANY PUBLISHERS	Image pg. A86

FINDINGS

Year	Uses	Source	
1962	Partin Zora B Mrs V	Hill Directory Co., Inc.,	Image pg. A98
1957	La Batt R Jas	Hill Directory Co., Inc.,	Image pg. A110
	Taylor Radio & Electrical Co	Hill Directory Co., Inc.,	Image pg. A111
1952	Dean Danl	Hill Directory Co., Inc.,	Image pg. A129
1947	Dean Danl	Hill Directory Co., Inc.,	Image pg. A140
1941	Houchins H Guy	Hill Directory Co., Inc.,	Image pg. A154
1936	Houchins H Guy	Hill Directory Co., Inc.,	Image pg. A170
1931	Houchins H Guy	Hill Directory Co Inc Publishers	Image pg. A185
1926	Houchins H G	Hill Directory Co Inc Publisher	Image pg. A232
1922	Matthews L R	Hill Directory Co. Publishers	Image pg. A247

321 MARTIN ST E

Year	Uses	Source	
1952	Allen Harry B	Hill Directory Co., Inc.,	Image pg. A129
	Matthews Jos L	Hill Directory Co., Inc.,	Image pg. A129
	Matthews Shoe Serv	Hill Directory Co., Inc.,	Image pg. A129
1947	Heath Benuie	Hill Directory Co., Inc.,	Image pg. A140
	rear Blake Wm Z	Hill Directory Co., Inc.,	Image pg. A140
	Martin St Shoe Shop repr	Hill Directory Co., Inc.,	Image pg. A140
1941	Murray Arth	Hill Directory Co., Inc.,	Image pg. A154
	Powell Wm	Hill Directory Co., Inc.,	Image pg. A154
	Moore Neal H shoe repr	Hill Directory Co., Inc.,	Image pg. A154
1936	32 21 1/2 Davis Geo F uphol	Hill Directory Co., Inc.,	Image pg. A170
	32 21 1/2 Davis Geo F uphol	Hill Directory Co., Inc.,	Image pg. A170
1931	1/2 Barnes Nathaniel H	Hill Directory Co Inc Publishers	Image pg. A185
	Vacant	Hill Directory Co Inc Publishers	Image pg. A185
1926	Asheroft James	Hill Directory Co Inc Publisher	Image pg. A232
	Y 2 Kimball C A	Hill Directory Co Inc Publisher	Image pg. A232
1922	2 Kimball C A	Hill Directory Co. Publishers	Image pg. A247
	Ashcroft Nellie Mrs	Hill Directory Co. Publishers	Image pg. A247

322 MARTIN ST E

Year	Uses	Source	
1957	King Sarah H Mrs	Hill Directory Co., Inc.,	Image pg. A111
	King Berry E	Hill Directory Co., Inc.,	Image pg. A111
1952	King Berrie E	Hill Directory Co., Inc.,	Image pg. A129
	Arnold Eddie C	Hill Directory Co., Inc.,	Image pg. A129
1947	Boyette Alex B	Hill Directory Co., Inc.,	Image pg. A140
	rear Vacant	Hill Directory Co., Inc.,	Image pg. A140

FINDINGS

Year	Uses	Source	
1941	Vacant	Hill Directory Co., Inc.,	Image pg. A154
	rear vacant	Hill Directory Co., Inc.,	Image pg. A154
1936	Vacant	Hill Directory Co., Inc.,	Image pg. A170
	rear Russos Nick & Son plant	Hill Directory Co., Inc.,	Image pg. A170
1931	Eubanks Jas M	Hill Directory Co Inc Publishers	Image pg. A185
	rear Russos Gus & Bro plant	Hill Directory Co Inc Publishers	Image pg. A185
1926	Bagwell E P	Hill Directory Co Inc Publisher	Image pg. A232
	Lay Selma Mrs	Hill Directory Co Inc Publisher	Image pg. A232
1922	Russos Nick	Hill Directory Co. Publishers	Image pg. A247

323 MARTIN ST E

Year	Uses	Source	
1967	ROGERS WM	HILL DIRECTORY COMPANY PUBLISHERS	Image pg. A86
1962	Lane Arth J	Hill Directory Co., Inc.,	Image pg. A98
1957	No Return	Hill Directory Co., Inc.,	Image pg. A111
1952	Wiggins Lawrence D	Hill Directory Co., Inc.,	Image pg. A129
1947	Wiggins Lawrence D	Hill Directory Co., Inc.,	Image pg. A140
1941	Wiggins Lawrence D	Hill Directory Co., Inc.,	Image pg. A154
1936	Home Edw B	Hill Directory Co., Inc.,	Image pg. A170
1931	Vacant	Hill Directory Co Inc Publishers	Image pg. A185
1926	Vacant	Hill Directory Co Inc Publisher	Image pg. A232
1922	Mooneyham A M	Hill Directory Co. Publishers	Image pg. A247

324 MARTIN ST E

Year	Uses	Source	
1957	Vacant	Hill Directory Co., Inc.,	Image pg. A111
1947	Robbins Barber Shop	Hill Directory Co., Inc.,	Image pg. A140
	Robbins Leon T	Hill Directory Co., Inc.,	Image pg. A140
1941	Robbins Leon T barber	Hill Directory Co., Inc.,	Image pg. A154
	Fort Della J Mrs	Hill Directory Co., Inc.,	Image pg. A154
1936	Robbins Leon T barber	Hill Directory Co., Inc.,	Image pg. A170
	Fadel Chas K	Hill Directory Co., Inc.,	Image pg. A170
1931	Mc Pherson John	Hill Directory Co Inc Publishers	Image pg. A185
	/2 Vacant	Hill Directory Co Inc Publishers	Image pg. A185
1926	Vacant	Hill Directory Co Inc Publisher	Image pg. A232
1922	Ginsberg Jacob	Hill Directory Co. Publishers	Image pg. A247

FINDINGS

325 MARTIN ST E

Year	Uses	Source	
1992	Vacant	R.L. Polk & Co Publishers	Image pg. A24
1988	Lane Gertrude M	R.L. Polk & Co Publishers	Image pg. A34
1982	Lane Gertrude	R.L. Polk & Co Publishers	Image pg. A45
1977	Vacant	HILL DIRECTORY COMPANY PUBLISHERS	Image pg. A56
1967	WHITE LIMPSON	HILL DIRECTORY COMPANY PUBLISHERS	Image pg. A86
1962	Goodson Theo R	Hill Directory Co., Inc.,	Image pg. A98
1952	Upchurch Jos H	Hill Directory Co., Inc.,	Image pg. A129
1947	Upchurch Jos H	Hill Directory Co., Inc.,	Image pg. A140
1941	Partin Norma S	Hill Directory Co., Inc.,	Image pg. A154
1936	Partin Arth C	Hill Directory Co., Inc.,	Image pg. A170
1931	Sealey Loomis M	Hill Directory Co Inc Publishers	Image pg. A185
1926	Massey P G	Hill Directory Co Inc Publisher	Image pg. A232
1922	Bledsoe W T	Hill Directory Co. Publishers	Image pg. A247

326 MARTIN ST E

Year	Uses	Source	
1962	Maynard Grocery	Hill Directory Co., Inc.,	Image pg. A98
1957	Martin St Food Store gros	Hill Directory Co., Inc.,	Image pg. A111
1941	Harris Sand & Gravel Co	Hill Directory Co., Inc.,	Image pg. A154
1936	Harris Sand & Gravel Co	Hill Directory Co., Inc.,	Image pg. A170
1931	Lovells Used Tire Exch	Hill Directory Co Inc Publishers	Image pg. A185
1926	Tyner J D	Hill Directory Co Inc Publisher	Image pg. A232

327 MARTIN ST E

Year	Uses	Source	
1997	Thorpe Gloria D	R.L. Polk & Co Publishers	Image pg. A15
1992	Mc Leod Margt	R.L. Polk & Co Publishers	Image pg. A24
	Thorpe Nichole A	R.L. Polk & Co Publishers	Image pg. A24
	Thorpe Fidelia	R.L. Polk & Co Publishers	Image pg. A24
1988	Thorpe Fidelia	R.L. Polk & Co Publishers	Image pg. A34
1982	Thrope Fidel	R.L. Polk & Co Publishers	Image pg. A45
1977	No Return	HILL DIRECTORY COMPANY PUBLISHERS	Image pg. A56
1967	DAVIS ROBT	HILL DIRECTORY COMPANY PUBLISHERS	Image pg. A86
1962	Quiller Mary S Mrs	Hill Directory Co., Inc.,	Image pg. A98
1957	Fowler Sam T	Hill Directory Co., Inc.,	Image pg. A111

FINDINGS

Year	Uses	Source	
1972	Hill Jacob A	HILL DIRECTORY COMPANY PUBLISHERS	Image pg. A61
	No Return	HILL DIRECTORY COMPANY PUBLISHERS	Image pg. A61

127 S BLOODWORTH ST

Year	Uses	Source	
1972	Devlin James J Jr Rev	HILL DIRECTORY COMPANY PUBLISHERS	Image pg. A61

210 S BLOODWORTH ST

Year	Uses	Source	
1972	Lane Martha M	HILL DIRECTORY COMPANY PUBLISHERS	Image pg. A61

213 S BLOODWORTH ST

Year	Uses	Source	
2003	No Current Listing	City Publishing Co	Image pg. A1
1972	Murphy C	HILL DIRECTORY COMPANY PUBLISHERS	Image pg. A61

214 S BLOODWORTH ST

Year	Uses	Source	
1972	Mc Dade Maggie	HILL DIRECTORY COMPANY PUBLISHERS	Image pg. A61

221 S BLOODWORTH ST

Year	Uses	Source	
1972	Banks Paul	HILL DIRECTORY COMPANY PUBLISHERS	Image pg. A61

224 S BLOODWORTH ST

Year	Uses	Source	
2003	Kennedy Regina	City Publishing Co	Image pg. A1
	Williams Shereta	City Publishing Co	Image pg. A1
1972	Lane Gertrude	HILL DIRECTORY COMPANY PUBLISHERS	Image pg. A61

225 S BLOODWORTH ST

Year	Uses	Source	
1972	Turner Dorothy M	HILL DIRECTORY COMPANY PUBLISHERS	Image pg. A61

FINDINGS

215 S PERSON ST

Year	Uses	Source	
2012	THE SALVATION ARMY	Cole Information Services	
2003	SALVATION ARMY	City Publishing Co	Image pg. A9

218 S PERSON ST

Year	Uses	Source
2007	NORTH CAROLINA ASSN OF SCHOOL ADMINI	Cole Information Services

225 S PERSON ST

Year	Uses	Source	
2012	KILLO PEST CONTROL COMPANY INC	Cole Information Services	
2007	KILLO PEST CONTROL CO INC	Cole Information Services	
2003	KILLO PEST CONTROL CO	City Publishing Co	Image pg. A9

301 S PERSON ST

Year	Uses	Source	
2012	MOORE SQUARE MUSEUM MAGNET MIDDLE	Cole Information Services	
2007	MOORE SQUARE MUSEUMS MAGNET MIDDLE S	Cole Information Services	
2003	MOORE SQUARE MIDDLE SCHOOL	City Publishing Co	Image pg. A9

316 S PERSON ST

Year	Uses	Source	
2003	CITY MARKET PARKING	City Publishing Co	Image pg. A9

S. Bloodworth Street

210 S. Bloodworth Street

Year	Uses	Source	
1997	Hakim Karium	R.L. Polk & Co Publishers	Image pg. A10
1992	Cambell Barry U	R.L. Polk & Co Publishers	Image pg. A19
1988	Partin Jacqueline H	R.L. Polk & Co Publishers	Image pg. A29
1982	Dewberry Dorothy	R.L. Polk & Co Publishers	Image pg. A39
1977	Lane Martha M	HILL DIRECTORY COMPANY PUBLISHERS	Image pg. A50
1972	Lane Martha M	HILL DIRECTORY COMPANY PUBLISHERS	Image pg. A61
1967	BANKS PAUL	HILL DIRECTORY COMPANY PUBLISHERS	Image pg. A75
1962	Banks Paul V	Hill Directory Co., Inc.,	Image pg. A91

FINDINGS

Year	Uses	Source	
1957	Banks Paul	Hill Directory Co., Inc.,	Image pg. A104
1952	Banks Paul	Hill Directory Co., Inc.,	Image pg. A122
1947	Banks Paul	Hill Directory Co., Inc.,	Image pg. A144
1941	Bartholomew Lewis W	Hill Directory Co., Inc.,	Image pg. A147
1936	Bagwell J Lester	Hill Directory Co., Inc.,	Image pg. A175
1931	Maynard Earl T	Hill Directory Co Inc Publishers	Image pg. A176
1926	Belvin P C	Hill Directory Co Inc Publisher	Image pg. A226
1922	Bumgardner L R	Hill Directory Co. Publishers	Image pg. A240

214 S. Bloodworth Street

Year	Uses	Source	
2003	Bass Allen R	City Publishing Co	Image pg. A1
	Liverman Robert B Jr	City Publishing Co	Image pg. A1
1997	Liverman R Brett Jr	R.L. Polk & Co Publishers	Image pg. A10
	Ball Allen R	R.L. Polk & Co Publishers	Image pg. A10
1992	Beal Mereth K	R.L. Polk & Co Publishers	Image pg. A28
	Vacant	R.L. Polk & Co Publishers	Image pg. A19
1988	No Return	R.L. Polk & Co Publishers	Image pg. A29
	Smith Mary H	R.L. Polk & Co Publishers	Image pg. A38
1982	Smith Mary H	R.L. Polk & Co Publishers	Image pg. A49
	Williams John T	R.L. Polk & Co Publishers	Image pg. A39
1977	Williams John T	HILL DIRECTORY COMPANY PUBLISHERS	Image pg. A50
	Smith Mary H	HILL DIRECTORY COMPANY PUBLISHERS	Image pg. A60
1972	Burchette Ruby Mrs	HILL DIRECTORY COMPANY PUBLISHERS	Image pg. A74
	Mc Dade Maggie	HILL DIRECTORY COMPANY PUBLISHERS	Image pg. A61
1967	MITCHELL HERMAN	HILL DIRECTORY COMPANY PUBLISHERS	Image pg. A75
	BURCHETTE RUBY MRS	HILL DIRECTORY COMPANY PUBLISHERS	Image pg. A90
1962	Branch Maude	Hill Directory Co., Inc.,	Image pg. A103
	Jones Lucy T Mrs	Hill Directory Co., Inc.,	Image pg. A91
1957	Jones Lucy T Mrs	Hill Directory Co., Inc.,	Image pg. A104
	Branch Maude	Hill Directory Co., Inc.,	Image pg. A121
1952	Branch Maude	Hill Directory Co., Inc.,	Image pg. A122
	Jordan Chas J	Hill Directory Co., Inc.,	Image pg. A122
1947	Jordan Chas J	Hill Directory Co., Inc.,	Image pg. A146
	Earp Bernice I	Hill Directory Co., Inc.,	Image pg. A146

FINDINGS

Year	Uses	Source	
1947	Branch Maude	Hill Directory Co., Inc.,	Image pg. A145
1941	Davis MXelvin H	Hill Directory Co., Inc.,	Image pg. A147
	Branch Maude	Hill Directory Co., Inc.,	Image pg. A160
	File Walter C	Hill Directory Co., Inc.,	Image pg. A160
	Miller Newman W	Hill Directory Co., Inc.,	Image pg. A160
1936	Till Eliz A Mrs	Hill Directory Co., Inc.,	Image pg. A175
	Branch Maude	Hill Directory Co., Inc.,	Image pg. A175
	Penny D Emory	Hill Directory Co., Inc.,	Image pg. A175
1931	Branch Maude	Hill Directory Co Inc Publishers	Image pg. A225
	Eason Moses	Hill Directory Co Inc Publishers	Image pg. A176
1926	Martin W C	Hill Directory Co Inc Publisher	Image pg. A226
	Creech P J	Hill Directory Co Inc Publisher	Image pg. A226
	Branch D M	Hill Directory Co Inc Publisher	Image pg. A239
1922	Branch D M	Hill Directory Co. Publishers	Image pg. A240
	Bailey R L	Hill Directory Co. Publishers	Image pg. A240

224 S. Bloodworth Street

Year	Uses	Source	
2003	Kennedy Regina	City Publishing Co	Image pg. A1
	Williams Shereta	City Publishing Co	Image pg. A1
1992	Harris Donald	R.L. Polk & Co Publishers	Image pg. A19
1988	Harris Clydie	R.L. Polk & Co Publishers	Image pg. A29
1982	Harris Oris	R.L. Polk & Co Publishers	Image pg. A39
1977	Lane Dixon	HILL DIRECTORY COMPANY PUBLISHERS	Image pg. A50
1972	Lane Gertrude	HILL DIRECTORY COMPANY PUBLISHERS	Image pg. A61
1967	HUNTER BEATRICE R MRS	HILL DIRECTORY COMPANY PUBLISHERS	Image pg. A75
1962	Hunter Beatrice R Mrs	Hill Directory Co., Inc.,	Image pg. A91
1957	Brannan G Clark	Hill Directory Co., Inc.,	Image pg. A104
1952	Brannan G Clark	Hill Directory Co., Inc.,	Image pg. A122
1947	Brannan G Clark	Hill Directory Co., Inc.,	Image pg. A146
1941	Allen Harry B	Hill Directory Co., Inc.,	Image pg. A147
1936	Sexton L Garland	Hill Directory Co., Inc.,	Image pg. A161
	Kelly Carson H	Hill Directory Co., Inc.,	Image pg. A161
1931	Vacant	Hill Directory Co Inc Publishers	Image pg. A176
1926	Phelps R M	Hill Directory Co Inc Publisher	Image pg. A226
1922	Thornton W S	Hill Directory Co. Publishers	Image pg. A240

FINDINGS

228 S. Bloodworth Street

Year	Uses	Source	
1997	Jackson Rosa	R.L. Polk & Co Publishers	Image pg. A10
1992	Jackson Rosa	R.L. Polk & Co Publishers	Image pg. A19
	Daniels Maggie	R.L. Polk & Co Publishers	Image pg. A19
1988	Vacant	R.L. Polk & Co Publishers	Image pg. A29
1982	Collins Lovie	R.L. Polk & Co Publishers	Image pg. A39
1977	Collins Lovie	HILL DIRECTORY COMPANY PUBLISHERS	Image pg. A50
1972	No Return	HILL DIRECTORY COMPANY PUBLISHERS	Image pg. A61
1967	BUNCH EFF IE MRS	HILL DIRECTORY COMPANY PUBLISHERS	Image pg. A75
1957	Dodd Jack B	Hill Directory Co., Inc.,	Image pg. A104
1952	Dodd Jack B	Hill Directory Co., Inc.,	Image pg. A133
1947	Dodd Jack B	Hill Directory Co., Inc.,	Image pg. A146
1941	Dodd Jack B	Hill Directory Co., Inc.,	Image pg. A147
1936	Dodd J Beni	Hill Directory Co., Inc.,	Image pg. A161
1931	Coates Lula Mrs	Hill Directory Co Inc Publishers	Image pg. A176
1926	Jones 0 M	Hill Directory Co Inc Publisher	Image pg. A226
1922	Jones 0 M	Hill Directory Co. Publishers	Image pg. A240

W HARGETT ST

330 W HARGETT ST

Year	Uses	Source
2012	CAROLINA SPIRITS INC	Cole Information Services
	LEGENDS	Cole Information Services
2007	LEGENDS	Cole Information Services
	CAROLINA SPIRITS INC	Cole Information Services

W MARTIN ST

319 W MARTIN ST

Year	Uses	Source
2012	MEDIA TWO	Cole Information Services
2007	INTERVOLVE INC	Cole Information Services
	SERENTEC INC	Cole Information Services
	EMPIRE PROPERTIES	Cole Information Services

Appendix G

GeoLogix/Geologic Strategies, P.C. - Qualifications of Personnel

GeoLogix
GEOLOGIC STRATEGIES, P.C.
5316 Deep Valley Run Raleigh, NC 27606

GeoLogix/Geologic Strategies, P. C.

Qualifications of Environmental Professionals

Principal: Robert H. Livermon, Jr.

Education: North Carolina State University (B. S. - Geology, 1973)

Licenses: N. C. Board for Licensing of Geologists - **Professional Geologist**, License No. 633

Geologic Strategies, P. C. – **N. C. Professional Geological Corporation,** License No. C-419

Certifications: - **Registered Environmental Manager** No. 9963 - National Registry of Environmental Professionals

- **40-Hour Hazwopper Certified**

The principal of *GeoLogix* has over thirty (30) years of experience in the environmental field. During twenty-two (22) plus years of employment with a local utility, Mr. Livermon performed environmental site assessments for eight (8) years, and waste disposal vendor compliance audits/reviews for twelve (12) years.

Mr. Livermon is experienced in the areas of Phase I Environmental Site Assessments (ESA), site remediation/spill clean-ups, Spill Prevention Control and Countermeasure (SPCC) Plan preparation, environmental permitting, solid waste disposal, waste minimization, and the transportation, storage, treatment/disposal of hazardous substances, toxic substances, and hazardous wastes. Mr. Livermon possesses an across-the-board knowledge of environmental regulations which, along with his years of experience, allows him to perform multi-media environmental compliance audits at commercial/industrial facilities, maintenance facilities, warehouses and garages. Mr. Livermon also has experience in the environmental regulatory area. He was employed for over two years with an environmental agency of the State of North Carolina.

GeoLogix has provided clients with a variety of environmental and geological consulting services since 1995. Over five hundred fifty (550) Phase I Environmental Site Assessments, seventy-five (75) Phase II Environmental Site Assessments or similar site investigations/assessments, forty (40) Underground Storage Tank (UST) closures/site investigations, and one hundred twenty-five (125) waste disposal vendor environmental compliance reviews have been conducted. *GeoLogix* capabilities also include management oversight services (remedial projects), toxic and hazardous waste training, geological consulting services, and other miscellaneous tasks.

EXHIBITS

Environmental Lien Search Information



Home

Wake County Real Estate Data
Ownership History

iMaps
Tax Bills

Real Estate ID **0039069** PIN # **1703886024**

Location Address
319 E MARTIN ST

Property Description
LO112

Account Search

Owner Name	Type	% Own	Stamps	Book	Page	Date
Current **WOOD PILE LLC THE**		**ALL**	**154.00**	**07591**	**0376**	**08-05-1997**
1 Back **KILLOUGH, W J & PAULINE**		**ALL**		**01516**	**0311**	**01-01-1962**
2 Back **HOUSER, NINA METCALF**		**ALL**		**01516**	**0365**	**01-01-1962**
3 Back **MARTIN, LUCY I**		**ALL**		**01091**	**0298**	**03-13-1952**
4 Back **MANGUM, SARAH T & ALBERT G**		**ALL**		**00408**	**0164**	**12-11-1922**

For questions regarding the information displayed on this site, please contact the Revenue Department at RevHelp@wakegov.com or call 919-856-5400.

WAKE COUNTY NC 08/05/97
$154.00

STATE OF NORTH CAROLINA Real Estate Excise Tax

Excise Tax $154.00 000117

BK7591PG0376

PRESENTED FOR REGISTRATION

97 AUG -5 AM 10:24
Recording Time, Book and Page
LAURA M. RIDDICK
REGISTER OF DEEDS
WAKE COUNTY

Tax Lot No. ACCT # 39069 39070 39073

Parcel Identifier No. PARCEL #

Verified by by

County on the day of , 19

Mail after recording to/Hold for: Wallace, Creech & Sarda, L.L.P.

This instrument was prepared by: Wallace, Creech & Sarda, L.L.P.

Brief description for the index:

NORTH CAROLINA GENERAL WARRANTY DEED

THIS DEED made this 31st day of July, 1997, by and between

GRANTOR	GRANTEE
WALTER J. KILLOUGH, Widower, by and through his attorney-in-fact, Mary M. Fower	THE WOOD PILE, L.L.C.

The designation Grantor and Grantee as used herein shall include said parties, their heirs, successors, and assigns, and shall include singular, plural, masculine, feminine or neuter as required by context.

WITNESSETH, that the Grantor, for a valuable consideration paid by the Grantee, the receipt of which is hereby acknowledged, has and by these presents does grant, bargain, sell and convey unto the Grantee in fee simple, all that certain lot or parcel of land situated in the City of _____ Township, Wake County, North Carolina and more particularly described as follows:

See Exhibit A attached hereto and incorporated herein by reference.

12.00

The property hereinabove described was acquired by Grantor in instrument recorded in Book 1201, Page 25; Book 1443, Page 62 and Book 1516, Page 311, Wake County Registry.

A map showing the above described property is recorded in Book of Maps _____, Page _____.

TO HAVE AND TO HOLD the aforesaid lot or parcel of land and all privileges and appurtenances thereto belonging to the Grantee in fee simple.

And the Grantor covenants with the Grantee, that Grantor is seized of the premises in fee simple, has the right to convey the same in fee simple, that title is marketable and free and clear of all encumbrances, and that Grantor will warrant and defend the title against the lawful claims of all persons whosoever except for the exceptions hereinafter stated.
Title to the property hereinabove described is subject to the following exceptions:

1. 1997 Ad Valorem taxes.

2. Easements, restrictions and rights-of-way of record, if any.

IN WITNESS WHEREOF, the Grantor has hereunto set his hand and seal, or if corporate, has caused this instrument to be signed in its corporate name by its duly authorized officers and its seal to be hereunto affixed by authority of its Board of Directors, the day and year first above written.

Walter J. Killough by Mary M. Fowler AIF (Seal)
Walter J. Killough, by and through his Attorney-in-Fact
Mary M. Fowler

(STAMP/SEAL)

M. BRADLEY HARROLD
NOTARY PUBLIC
GUILFORD COUNTY, N. C.
My commission expires 8-16-98

STATE OF NORTH CAROLINA

COUNTY OF WAKE

I, M. Bradley Harrold, a Notary Public in and for said County and State, do hereby certify that Mary M. Fowler, attorney in fact for Walter J. Killough, personally appeared before me this day, and being by me duly sworn, says that she executed the foregoing and annexed instrument for and in behalf of the said Walter J. Killough and that her authority to execute and acknowledge said instrument is contained in an instrument duly executed, acknowledged and recorded in the Office of the Register of Deeds, Wake County, North Carolina, in Book 7581, Page 901, and that this instrument was executed under and by virtue of the authority given by said instrument granting her power of attorney.

I do further certify that the said Mary M. Fowler acknowledged the due execution of the foregoing and annexed instrument for the purposes therein expressed for and in behalf of the said Walter J. Killough.

Witness my hand and official seal, this the 31st day of July, 1997.

M. Bradley Harrold
Notary Public

NORTH CAROLINA — WAKE COUNTY

The foregoing certificate of _____

M. Bradley Harrold

_____ Notar(y)(ies) Public

is (are) certified to be correct. This instrument and this certificate are duly registered at the date and time and in the book and page shown on the first page hereof.

LAURA M. RIDDICK, Register of Deeds

By Elizabeth E. Taylor
Asst./Deputy Register of Deeds

By _____
Asst./Deputy Register of Deeds

EXHIBIT A

BEGINNING at a Set Rebar located in the western right-of-way line of South Bloodworth Street, said Set Rebar being located North 07° 26' 51" East 140.00 feet from the intersection of the western right-of-way line of South Bloodworth Street and the northern right-of-way line of East Martin Street; running thence along the western right-of-way line of South Bloodworth Street North 07° 26' 51" East 35.08 feet to a Set Rebar; thence North 82° 33' 08" West 52.50 feet to an iron pipe; thence North 07° 26' 51" East 35.14 feet to a Set Rebar; thence North 82° 29' 23" West 122.85 feet to an iron pipe; thence South 07° 36' 51" West 67.49 feet to a Set Rebar; thence South 82° 37' 27" East 25.00 feet to an iron pipe; thence South 07° 22' 32" West 143.28 feet to a Set Rebar in the northern right-of-way line of East Martin Street; thence along the northern right-of-way line of East Martin Street South 82° 40' 16" East 45.00 feet to an iron pipe; thence North 07° 19' 44" East 100.08 feet to an iron pipe; thence South 80° 33' 09" East 3.08 feet to an iron pipe; thence North 07° 22' 32" East 43.27 feet to an iron pipe; thence South 82° 37' 27" East 50.04 feet to a Set Rebar; thence South 07° 26' 51" West 3.02 feet to an iron pipe; thence South 82° 33' 21" East 52.50 feet to a Set Rebar, the point and place of BEGINNING, according to a survey prepared by Piedmont Surveying dated October 12, 1994, entitled "Property of Walter J. Killough."

TOGETHER WITH the easements for ingress and egress as described in Deed Book 1443, Page 62 and Deed Book 1201, Page 25, Wake County Registry.

It is the intention of the Grantor to convey all of the land and easements conveyed in Deed Book 1201 at Page 25, Deed Book 1443 at Page 62, and Deed Book 1516 at Page 311, Wake County Registry.

WOODPIL2.DES



Home

Wake County Real Estate Data
Ownership History

iMaps
Tax Bills

Real Estate ID **0048492** PIN # **1703887004**

Location Address
218 S BLOODWORTH ST

Property Description
218 S BLOODWORTH STREET

Account Search

Pin/Parcel History New Search

NORTH CAROLINA Account | Buildings | Land | Deeds | Notes | Sales | Photos | Tax Bill | Map

Go!

Owner Name	Type	% Own	Stamps	Book	Page	Date
Current **WOOD PILE LLC THE**		**ALL**		**07985**	**0188**	**03-30-1998**
1 Back **WILLIAMS, STEVEN J**		**ALL**	**69.00**	**07796**	**0060**	**12-10-1997**
2 Back **MOORE, ALONZO MADISON JR**		**ALL**		**01522**	**0512**	**01-01-1962**
3 Back **MOORE, A M**		**ALL**		**00207**	**0220**	**06-25-1906**
4 Back **THOMPSON, J D & L H**		**ALL**		**0**		

For questions regarding the information displayed on this site, please contact the Revenue Department at RevHelp@wakegov.com or call 919-856-5400.

BK7985PG0188

PRESENTED FOR REGISTRATION

000615

98MAR30 PM 2:41

Excise Tax: $0.00

Recording Time, Book and Page

REGISTER OF DEEDS WAKE COUNTY

Tax Lot No. ACCT #48492

Verified by
by

County on the day of , 19

Mail after recording to/Hold for: Wallace, Creech & Sarda, L.L.P.

This instrument was prepared by: Wallace, Creech & Sarda, L.L.P.

Brief description for the index:

NORTH CAROLINA GENERAL WARRANTY DEED

THIS DEED made this 27th day of March, 1998, by and between

GRANTOR	GRANTEE
STEVEN J. WILLIAMS	THE WOOD PILE, LLC P.O. Box 12862 Raleigh, North Carolina 27605

The designation Grantor and Grantee as used herein shall include said parties, their heirs, successors, and assigns, and shall include singular, plural, masculine, feminine or neuter as required by context.

WITNESSETH, that the Grantor, for a valuable consideration paid by the Grantee, the receipt of which is hereby acknowledged, has and by these presents does grant, bargain, sell and convey unto the Grantee in fee simple, all that certain lot or parcel of land situated in or near the City of Raleigh, Wake County, North Carolina and more particularly described as follows:

BEGINNING at the Southeast corner of the lands of Mrs. S.C. Blake, running thence West along the South line of Mrs. S.C. Blake 52.50 feet to the Southwest line of Mrs. S.C. Blake, thence South along the line of Hannah R. Reeves est. 35 feet to the line of John D. Thompson and Hannah R. Reeves line, thence East along the line of John D. Thompson, 52.50 feet to Bloodworth Street, thence North along the West line of Bloodworth Street 35.00 feet to the point of BEGINNING. Being part of City Lot #108 as shown on Shaffer's Map of City of Raleigh, and the same conveyed to John D. Thompson by Kemp P. Battle and others, by Deed recorded in Book No. 33, Page 413, Register of Deeds Office, Wake County, North Carolina.

This property is known as 218 South Bloodworth Street, Raleigh, North Carolina.

10.00

The property hereinabove described was acquired by Grantor in instrument recorded in Book 7796, Page 60, Wake County Registry.

A map showing the above described property is recorded in Book _____, Page _____.

TO HAVE AND TO HOLD the aforesaid lot or parcel of land and all privileges and appurtenances thereto belonging to the Grantee in fee simple.

And the Grantor covenants with the Grantee, that Grantor is seized of the premises in fee simple, has the right to convey the same in fee simple, that title is marketable and free and clear of all encumbrances, and that Grantor will warrant and defend the title against the lawful claims of all persons whosoever except for the exceptions hereinafter stated.
Title to the property hereinabove described is subject to the following exceptions:

1. 1998 Ad Valorem taxes.

2. Easements, restrictions and rights-of-way of record, if any.

IN WITNESS WHEREOF, the Grantor has hereunto set his hand and seal, or if corporate, has caused this instrument to be signed in its corporate name by its duly authorized officers and its seal to be hereunto affixed by authority of its Board of Directors, the day and year first above written.

_____(Seal)
Steven J. Williams

SEAL-STAMP

M. BRADLEY HARROLD
NOTARY PUBLIC
GUILFORD COUNTY, N. C.
My commission expires 8/15/99

STATE OF NORTH CAROLINA, COUNTY OF WAKE

I, a Notary Public of the County and State aforesaid, certify that Steven J. Williams, personally appeared before me this day and acknowledged the execution of the foregoing instrument. Witness my hand and official stamp or seal, this 30th day of March, 1998.

My commission expires: 8/15/98 M. Bradley Harrold Notary Public

NORTH CAROLINA — WAKE COUNTY

The foregoing certificate of M. Bradley Harrold

_____ Notary(ies) Public

is (are) certified to be correct. This instrument and this certificate are duly registered at the date and time and in the book and page shown on the first page hereof.

LAURA M. RIDDICK, Register of Deeds

By _____
Asst./Deputy Register of Deeds

Home

Wake County Real Estate Data
Ownership History

iMaps
Tax Bills

Real Estate ID **0006045** PIN # **1703886184**

WAKE COUNTY NORTH CAROLINA

Location Address
210 S BLOODWORTH ST

Property Description
210 S BLOODWORTH STREET

Account Search

Pin/Parcel History New Search

Account | Buildings | Land | Deeds | Notes | Sales | Photos | Tax Bill | Map

Go!

Owner Name	Type	% Own	Stamps	Book	Page	Date
Current **WOOD PILE LLC THE**		**ALL**	**105.00**	**07983**	**0781**	**03-30-1998**
1 Back **BARNEY G JOYNER FAMILY TRUST**		**ALL**		**05078**	**0950**	**01-16-1992**
2 Back **BETTS, HAZEL FLEMING MRS**		**ALL**		**0**		
3 Back **BANKS, ROY M & WIFE**		**ALL**		**01090**	**0438**	**02-15-1952**
4 Back **MCGHEE, FLORRIE B MRS**		**ALL**		**00925**	**0499**	**07-20-1945**
5 Back **BLAKE, W R**	**WILL**	**ALL**		**0**		

For questions regarding the information displayed on this site, please contact the Revenue Department at RevHelp@wakegov.com or call 919-856-5400.

BK7983PG0781

PRESENTED FOR REGISTRATION

98 MAR 30 AM 11:45

LARRY REGISTER OF DEEDS WAKE COUNTY

Excise Tax $105.00

000204

Recording Time, Book and Page

WAKE COUNTY NC 03/30/98
$105.00
Real Estate Excise Tax

Tax Lot No. ACCT #6045

Verified by County on the day of , 19

by

Mail after recording to/Hold for: Wallace, Creech & Sarda, L.L.P.

This instrument was prepared by: Wallace, Creech & Sarda, L.L.P.

Brief description for the index:

NORTH CAROLINA GENERAL WARRANTY DEED

THIS DEED made this 18th day of March, 1998, by and between

GRANTOR	GRANTEE
DAVID LEE JOYNER, as Trustee for the BARNEY G. JOYNER FAMILY TRUST, and as Attorney-in-fact for PHYLLIS M. JOYNER, PHYLLIS JOYNER CHAPPELL and CAROLYN JOYNER GROOVER, Trustees for the BARNEY G. JOYNER FAMILY TRUST	THE WOOD PILE, LLC P.O. Box 12862 Raleigh, North Carolina 27605

The designation Grantor and Grantee as used herein shall include said parties, their heirs, successors, and assigns, and shall include singular, plural, masculine, feminine or neuter as required by context.

WITNESSETH, that the Grantor, for a valuable consideration paid by the Grantee, the receipt of which is hereby acknowledged, has and by these presents does grant, bargain, sell and convey unto the Grantee in fee simple, all that certain lot or parcel of land situated in or near the City of Raleigh, Wake County, North Carolina and more particularly described as follows:

BEGINNING at a point in the property line on the west side of South Bloodworth Street 112 feet South from the southwest intersection of East Hargett Street and South Bloodworth Street, runs thence West 90 feet to a stake; thence South 49 feet to a stake; thence East 90 feet to a stake; and thence 49 feet to the point of BEGINNING; and being the same property conveyed to Hazel Fleming Betts by Deed recorded in Book 1090, Page 438, Wake County Registry.

10

The property hereinabove described was acquired by Grantor in instrument recorded in Book ____, Page ____, Wake County Registry.

A map showing the above described property is recorded in Book ____, Page ____.

TO HAVE AND TO HOLD the aforesaid lot or parcel of land and all privileges and appurtenances thereto belonging to the Grantee in fee simple.

And the Grantor covenants with the Grantee, that Grantor is seized of the premises in fee simple, has the right to convey the same in fee simple, that title is marketable and free and clear of all encumbrances, and that Grantor will warrant and defend the title against the lawful claims of all persons whosoever except for the exceptions hereinafter stated.
Title to the property hereinabove described is subject to the following exceptions:

1. 1998 Ad Valorem taxes.

2. Easements, restrictions and/or right-of-ways of record, if any.

IN WITNESS WHEREOF, the Grantor has hereunto set his hand and seal, or if corporate, has caused this instrument to be signed in its corporate name by its duly authorized officers and its seal to be hereunto affixed by authority of its Board of Directors, the day and year first above written.

David Lee Joyner (Seal)
DAVID LEE JOYNER, as Trustee for the BARNEY G. JOYNER FAMILY TRUST, and as Attorney-in-fact for PHYLLIS M. JOYNER, PHYLLIS JOYNER CHAPPELL and CAROLYN JOYNER GROOVER, Trustees for the BARNEY G. JOYNER FAMILY TRUST

ROBERT W. CHAPPELL NOTARY PUBLIC WAKE COUNTY, NC

STATE OF NORTH CAROLINA, COUNTY OF WAKE

I, Robert W. Chappell, a Notary Public in and for said County and State, do hereby certify that David Lee Joyner, as Trustee for the Barney G. Joyner Family Trust and as attorney-in-fact for Phyllis M. Joyner, Phyllis Joyner Chappell and Carolyn Joyner Groover, Trustees for the Barney G. Joyner Family Trust, personally appeared before me this day, and being by me duly sworn, says that he executed the foregoing and annexed instrument as Trustee and for and in behalf of the said Phyllis M. Joyner, Phyllis Joyner Chappell and Carolyn Joyner Groover, Trustees for the Barney G. Joyner Family Trust, and that his authority to execute and acknowledge said instrument on their behalf is contained in an instrument duly executed, acknowledged and recorded in the Office of the Register of Deeds, Wake County, North Carolina, in Book 4552, Page 699, and that this instrument was executed under and by virtue of the authority given by said instrument granting him power of attorney.

I do further certify that the said David Lee Joyner acknowledged the due execution of the foregoing and annexed instrument for the purposes therein expressed for and in behalf of the said Phyllis M. Joyner, Phyllis Joyner Chappell and Carolyn Joyner Groover, Trustees for the Barney G. Joyner Family Trust.

WITNESS my hand and official stamp or seal this 18th day of March, 1998.

My commission expires: 11-22-98 Robert W. Chappell Notary Public

NORTH CAROLINA, Wake COUNTY

The foregoing certificate of Robert W. Chappell Notary(ies) Public is(are) certified to be correct. This instrument and this certificate are duly registered at the date and time and in the book and page shown on the first page hereof.

LAURA M. RIDDICK Register of Deeds

By Asst./Deputy Register of Deeds

Home

Wake County Real Estate Data
Ownership History

iMaps
Tax Bills

Real Estate ID **0014973** PIN # **1703886253**

Location Address
330 E HARGETT ST

Property Description
330 E HARGETT STREET

Account Search

Pin/Parcel History | New Search

Account | Buildings | Land | Deeds | Notes | Sales | Photos | Tax Bill | Map

Go!

Owner Name	Type	% Own	Stamps	Book	Page	Date
Current **WOOD PILE LLC THE**		**ALL**	**300.00**	**07565**	**0862**	**07-22-1997**
1 Back **CORREA, A A**		**ALL**		**0**		
2 Back **SLEDGE, THOS D**		**ALL**		**00041**	**0217**	**02-08-1964**

For questions regarding the information displayed on this site, please contact the Revenue Department at RevHelp@wakegov.com or call 919-856-5400.

BK7565PG0862

WAKE COUNTY NC 07/22/97
$300.00
Real Estate Excise Tax

000526

PRESENTED FOR REGISTRATION
97 JUL 22 PM 3:05
LAURA M. RIDDICK
REGISTER OF DEEDS
WAKE COUNTY

Excise Tax $300.00

Recording Time, Book and Page

Tax Lot No. 14973 and 14974 Parcel Identifier No. A19-A45-13
A19-A45-14

Verified by County on the day of , 19

by

Mail after recording to/Hold for: Wallace, Creech & Sarda, L.L.P.
Post Office Box 12065 Raleigh, NC 27605

This instrument was prepared by Wallace, Creech & Sarda, L.L.P.

Brief description for the index:

NORTH CAROLINA GENERAL WARRANTY DEED

THIS DEED made this 17th day of July, 1997, by and between

GRANTOR	GRANTEE
ALAN ALBERT HARPER, JR. AND WIFE, CAROLYN EASON HARPER JOHN DAVID HARPER AND WIFE, DONNA GREGORY HARPER GEORGE GRAHAM HARPER AND WIFE, ROSIE CLAYTON HARPER JAMES WILLIAM MCGEE HARPER AND WIFE, DENISE SULLIVAN HARPER HOWARD THOMAS HARPER AND WIFE, ANN ROBERTS HARPER MIRIAM HARPER TAYLOR (UNMARRIE) SAMUEL LEE HARPER (UNMARRIED)	THE WOOD PILE, L.L.C., A NORTH CAROLINA LIMITED LIABILITY COMPANY P.O. BOX 18209 RALEIGH, NC 27619

The designation Grantor and Grantee as used herein shall include said parties, their heirs, successors, and assigns, and shall include singular, plural, masculine, feminine or neuter as required by context.

WITNESSETH, that the Grantor, for a valuable consideration paid by the Grantee, the receipt of which is hereby acknowledged, has and by these presents does grant, bargain, sell and convey unto the Grantee in fee simple, all that certain lot or parcel of land situated in the City of Raleigh, Township, Wake County, North Carolina and more particularly described as follows:

See Exhibit A attached heretowhich is incorporated herein by reference.

The property hereinabove described was acquired by Grantor through a Will recorded in Will Book W Page 163, Wake County Registry.

A map showing the above described property is recorded in Book of Maps _____, Page ___.

TO HAVE AND TO HOLD the aforesaid lot or parcel of land and all privileges and appurtenances thereto belonging to the Grantee in fee simple.

And the Grantor covenants with the Grantee, that Grantor is seized of the premises in fee simple, has the right to convey the same in fee simple, that title is marketable and free and clear of all encumbrances, and that Grantor will warrant and defend the title against the lawful claims of all persons whosoever except for the exceptions hereinafter stated.
Title to the property hereinabove described is subject to the following exceptions:

1. 1997 Ad Valorem taxes.

IN WITNESS WHEREOF, the Grantor has hereunto set his hand and seal, or if corporate, has caused this instrument to be signed in its corporate name by its duly authorized officers and its seal to be hereunto affixed by authority of its Board of Directors, the day and year first above written.

John David Harper (Seal)
John David Harper

Donna Gregory Harper (Seal)
Donna Gregory Harper

Alan Albert Harper, Jr. (Seal)
Alan Albert Harper, Jr.

Carolyn Eason Harper (Seal)
Carolyn Eason Harper

George G Harper (Seal)
George Graham Harper

Rosie Clayton Harper (Seal)
Rosie Clayton Harper

James William Mcgee Harper (Seal)
James William Mcgee Harper

Denise Sullivan Harper (Seal)
Denise Sullivan Harper

Howard Thomas Harper (Seal)
Howard Thomas Harper

Ann Roberts Harper (Seal)
Ann Roberts Harper

Miriam Harper Taylor (Seal)
Miriam Harper Taylor

Samuel Lee Harper (Seal)
Samuel Lee Harper

STATE OF Virginia
COUNTY OF Chesterfield

I, a Notary Public for the aforesaid County and State, certify that **John David Harper and Donna Gregory Harper** personally appeared before me and acknowledged the due execution of the foregoing instrument.

Witness my hand and seal this 17 day of July, 1997.

Teresa Elgart
Notary Public

My Commission Expires: July 31, 2000

TERESA ELGART NOTARY PUBLIC COMMONWEALTH OF VIRGINIA

STATE OF North Carolina

COUNTY OF Johnston

I, a Notary Public for the aforesaid County and State, certify that **Alan Albert Harper, Jr. and Carolyn Eason Harper** personally appeared before me and acknowledged the due execution of the foregoing instrument.

Witness my hand and seal this 19th day of July, 1997.

Juan I Cochran
Notary Public

My Commission Expires: 11-03-99

STATE OF North Carolina

COUNTY OF Johnston

I, a Notary Public for the aforesaid County and State, certify that **George Graham Harper and Rosie Clayton Harper** personally appeared before me and acknowledged the due execution of the foregoing instrument.

Witness my hand and seal this 19th day of July, 1997.

Juan I Cochran
Notary Public

My Commission Expires: 11-03-99

STATE OF North Carolina

COUNTY OF Johnston

I, a Notary Public for the aforesaid County and State, certify that **James William Mcgee Harper and Denise Sullivan Harper** personally appeared before me and acknowledged the due execution of the foregoing instrument.

Witness my hand and seal this 19th day of July, 1997.

Juan I. Cochran
Notary Public

My Commission Expires: 11-03-99

STATE OF North Carolina

COUNTY OF Johnston

I, a Notary Public for the aforesaid County and State, certify that **Howard Thomas Harper and Ann Roberts Harper** personally appeared before me and acknowledged the due execution of the foregoing instrument.

Witness my hand and seal this 19th day of July, 1997.

Juan I Cochran
Notary Public

My Commission Expires: 11-03-99

STATE OF North Carolina

COUNTY OF Johnston

I, a Notary Public for the aforesaid County and State, certify that **Miriam Harper Taylor** personally appeared before me and acknowledged the due execution of the foregoing instrument.

Witness my hand and seal this 19th day of July, 1997.

Juan I. Cochran
Notary Public

My Commission Expires: 11-03-99

BK7565PG0865

STATE OF North Carolina

COUNTY OF Johnston

I, a Notary Public for the aforesaid County and State, certify that Samuel Lee Harper personally appeared before me and acknowledged the due execution of the foregoing instrument.

Witness my hand and seal this 19th day of July, 1997.

Jean T Cochran
Notary Public

My Commission Expires: 11-03-99

NORTH CAROLINA, ~~Johnston~~ Wake COUNTY

The foregoing certificate of Teresa Elgit
Jean T. Cochran

Notar(y)(ies) Public is(are) certified to be correct. This instrument and this certificate are duly registered at the date and time and in the book and page shown on the first page hereof.

LAURA M. RIDDICK

Register of Deeds for Wake Co.

By P. Anne Redd
Asst./Deputy Register of Deeds

RPC12629.002

EXHIBIT A

BEGINNING at an existing iron pin located at the intersection of the western right-of-way line of South Bloodworth Street and the southern right-of-way line of East Hargett Street; running thence along the western right-of-way line of South Bloodworth Street South 06° 19' 56" West 109.88 feet to an existing iron pin; thence North 83° 45' 00" West 90.00 feet to a new iron pin; thence South 06° 14' 04" West 97.77 feet to a new iron pin; thence North 85° 18' 10" West 126.50 feet to a point; thence North 06° 42' 04" East 57.56 feet to a point; thence South 84° 15' 44" East 63.52 feet to an existing iron pin; thence North 06° 21' 01" East 151.67 feet to an existing iron pin in the southern right-of-way line of East Hargett Street; thence along the southern right-of-way line of East Hargett Street South 84° 14' 00" East 152.35 feet to an existing iron pin, the point and place of BEGINNING, containing 0.607 acres, more or less, and being 26,434 square feet, according to a survey prepared by John Y. Phelps, Jr., dated July 14, 1997, Field Book 764, entitled "Property of The Wood Pile, LLC".

WOODPILE.DES

Home

Wake County Real Estate Data
Ownership History

iMaps
Tax Bills

Real Estate ID **0066856** PIN # **1703875954**

Location Address
317 E MARTIN ST

Property Description
LO5 R W WINSTON JR PROP

Account Search

Pin/Parcel History | New Search

Account | Buildings | Land | Deeds | Notes | Sales | Photos | Tax Bill | Map

Go!

Owner Name	Type	% Own	Stamps	Book	Page	Date
Current **WOOD PILE LLC THE**		**ALL**		**08647**	**1710**	**08-01-2000**
1 Back **WILLIAMS ROUTH CORPORATION**		**ALL**		**08647**	**1706**	**08-01-2000**
2 Back **WOOD PILE LLC THE**		**ALL**	**65.00**	**07850**	**0657**	**01-15-1998**
3 Back **STANLEY, NORMAN K &EVELYN B**		**ALL**		**02600**	**0327**	**03-21-1978**
4 Back **STANELY, EVLEYN B**		**ALL**		**02412**	**0269**	**06-24-1976**
5 Back **STANLEY, NORMAN D &EVELYN P**		**ALL**		**01973**	**0053**	**02-26-1971**
6 Back **MONDAY, JOHN B &MAVIS R**		**ALL**		**01606**	**0262**	**08-06-1964**
7 Back **BOGASSE, ROSA B**		**ALL**		**00805**	**0377**	**08-01-1939**
8 Back **WINSTON, R W JR**		**ALL**		**0**		

For questions regarding the information displayed on this site, please contact the Revenue Department at RevHelp@wakegov.com or call 919-856-5400.

Home

Wake County Real Estate Data
Ownership History

iMaps
Tax Bills

Real Estate ID **0071314** PIN # **1703876933**

WAKE COUNTY NORTH CAROLINA

Location Address
323 E MARTIN ST

Property Description
323 E MARTIN STREET

Account Search

Pin/Parcel History | New Search

Account | Buildings | Land | Deeds | Notes | Sales | Photos | Tax Bill | Map

Go!

	Owner Name	Type	% Own	Stamps	Book	Page	Date
Current	**WOOD PILE LLC THE**		**ALL**		**08647**	**1710**	**08-01-2000**
1 Back	**WILLIAMS ROUTH CORPORATION**		**ALL**		**08647**	**1706**	**08-01-2000**
2 Back	**WOOD PILE LLC THE**		**ALL**	**45.00**	**07850**	**0662**	**01-15-1998**
3 Back	**TROTTER, SARA OLIVETTE R**		**ALL**		**01546**	**0054**	**04-01-1963**
4 Back	**ROYSTER, VERMONT C**	**WILL**	**GROUP**		**0**		
	TROTTER, SARA O R		**ABOVE**				
	ROYSTER, OLIVETTE B		**GROUP**				
	TROTTER, SARAH R		**ABOVE**				
	ROYSTER, VERMONT C		**ABOVE**				
5 Back	**FULLER HEIGHTS HOUSING CORP**		**ALL**		**01151**	**0120**	**05-01-1954**
6 Back	**WIGGINS, L D & WIFE**		**ALL**		**01151**	**0083**	**04-30-1954**
7 Back	**WINSTON, R W JR**		**ALL**		**00823**	**0287**	**02-10-1940**

For questions regarding the information displayed on this site, please contact the Revenue Department at RevHelp@wakegov.com or call 919-856-5400.

Wake County,NC 123
Laura M Riddick, Register Of Deeds
Presented & Recorded 08/01/2000 10:11:10
Book : 008647 Page : 01710 - 01713

Excise Tax $ 0.00	Recording Time, Book and Page

Tax Lot No. (No Tax ID # has been assigned to these tracts) Parcel Identifier No.

Verified by County on the day of , 20

Hold for/ (Box 202)

Mail after recording to: Wallace, Creech & Sarda, L.L.P., P.O. Box 12065, Raleigh, NC 27605

This instrument was prepared by: Wallace, Creech & Sarda, L.L.P. (without title search)

Brief description for the index: Two 6-foot wide strips of land off East Martin Street

NORTH CAROLINA NON-WARRANTY DEED

THIS DEED made this 13th day of July, 2000, by and between

GRANTOR	GRANTEE
THE WILLIAMS ROUTH CORPORATION	THE WOOD PILE, LLC P.O. Box 12504 Raleigh, NC 27605

The designation Grantor and Grantee as used herein shall include said parties, their heirs, successors, and assigns, and shall include singular, plural, masculine, feminine or neuter as required by context.

WITNESSETH, that the Grantor, for a valuable consideration paid by the Grantee, the receipt of which is hereby acknowledged, has and by these presents does grant, bargain, sell and convey unto the Grantee in fee simple, all that certain lot or parcel of land situated in or near the City of Raleigh, Wake County, North Carolina and more particularly described as follows:

See Exhibit A attached hereto and incorporated herein by reference.

The property hereinabove described was acquired by Grantor in instrument recorded in Book _____, Page _____, Wake County Registry.

A map showing the above described property is recorded in Book of Maps _____, Page _____.

TO HAVE AND TO HOLD the aforesaid lot or parcel of land and all privileges and appurtenances thereto belonging to the Grantee in fee simple.

The Grantor makes no warranty, express or implied, as to title to the property hereinabove described. This conveyance is subject to all easements, restrictions, right-of-ways and Deeds of Trust of record.

IN WITNESS WHEREOF, the Grantor has hereunto set his hand and seal, or if corporate, has caused this instrument to be signed in its corporate name by its duly authorized officers and its seal to be hereunto affixed by authority of its Board of Directors, the day and year first above written.

THE WILLIAMS ROUTH CORPORATION

By: _____ Pres/Dent

Steven J. Williams, President

SEAL-STAMP

M. BRADLEY HARROLD
NOTARY PUBLIC
WAKE COUNTY, N.C.

STATE OF NORTH CAROLINA, COUNTY OF WAKE

I, a Notary Public of the County and State aforesaid, certify that Steven J. Williams, President of The Williams Routh Corporation personally appeared before me this day and acknowledged the execution of the foregoing instrument on behalf of the corporation. Witness my hand and official stamp or seal, this 13th day of June, 2000.

M. Bradley Harrold Notary Public

My commission expires: 8/14/2003

NORTH CAROLINA, _____ COUNTY

The foregoing certificate of _____ Notar(y)(ies) Public is(are) certified to be correct. This instrument and this certificate are duly registered at the date and time and in the book and page shown on the first page hereof.

_____ Register of Deeds

By: _____
Asst./Deputy Register of Deeds

EXHIBIT A

BEING two 6-foot wide strips of land located in the 300 block of East Martin Street, being more particularly described as follows:

Tract 1: (Strip of land lying between the tracts which have been known as 317 and 319 East Martin Street)

BEGINNING at a stake in the northerly line of East Martin Street 19 feet in an easterly direction from the southeasterly corner of the lands formerly owned by Rosa Bogasse; runs thence North 6° 25' East 143 feet to a stake; runs thence South 83° 45' East 6 feet to a stake; runs thence South 6° 15' West 143 feet to a stake in the northerly line of East Martin Street; runs thence with the northerly line of East Martin Street 6 feet to a stake, the point of BEGINNING.

Tract 2: (Strip of land lying between the tracts which have been known as 321 and 323 East Martin Street)

BEGINNING at a stake in the northerly line of East Martin Street 70 feet in an easterly direction from the southeasterly corner of the lands formerly owned by Rosa Bogasse; runs thence North 6° 30' East 100.70 feet to a stake; runs thence South 83° 30' East 6 feet to a stake; runs thence South 6° 30' West 100.70 feet to a stake in the northerly line of East Martin Street; runs thence with the northerly line of East Martin Street North 83° 30' West 6 feet to a stake, the point of BEGINNING, as per plot of same prepared by Sam Powell, R.S., on 5/2/55.

Laura M Riddick
Register of Deeds
Wake County, NC

Book : 008647 Page : 01710 - 01713

Yellow probate sheet is a vital part of your recorded document.
Please retain with original document and submit for rerecording.

Wake County Register of Deeds
Laura M. Riddick
Register of Deeds

North Carolina - Wake County

The foregoing certificate___ of M. Bradley Harrold

_____ Notary(ies) Public is (are) certified to be correct. This instrument and this certificate are duly registered at the date and time and in the book and page shown on the first page hereof.

Laura M. Riddick, Register of Deeds
By: Wendy Parrish
Assistant/Deputy Register of Deeds

This Customer Group
_____ # of Time Stamps Needed

This Document
__1__ New Time Stamp
__4__ # of Pages

Home

Wake County Real Estate Data
Ownership History

iMaps
Tax Bills

Real Estate ID **0004775** PIN # **1703876953**

WAKE COUNTY NORTH CAROLINA

Location Address
325 E MARTIN ST

Property Description
325 E MARTIN STREET

Account Search

Pin/Parcel History | New Search

Account | Buildings | Land | Deeds | Notes | Sales | Photos | Tax Bill | Map

Go!

	Owner Name	Type	% Own	Stamps	Book	Page	Date
Current	**WOOD PILE LLC THE**		**ALL**		**07680**	**0204**	**09-30-1997**
1 Back	**LAWRENCE, LUANNE H &ANDREW O**		**ALL**		**04833**	**0023**	**12-31-1990**
2 Back	**HOUSE, HARPER H &DOLLIE P**		**ALL**		**04413**	**0031**	**12-30-1988**
3 Back	**TRIPLE R REALTY COMPANY**		**ALL**		**03024**	**0143**	**06-11-1982**
4 Back	**COUNTRY ACRES LAND COMPANY**		**ALL**		**02716**	**0184**	**03-27-1979**
5 Back	**BASHFORD, JOHN C**		**ALL**		**01650**	**0053**	**05-28-1965**
6 Back	**CHAMBLEE, H ROYSTER**		**ALL**		**0**		
7 Back	**PIERCE, P E**		**ALL**	**7.70**	**01640**	**0549**	**04-15-1965**
8 Back	**GOODSON, THEODORE**		**ALL**		**0**		
9 Back	**TERRY, F L &WIFE**		**ALL**		**01345**	**0123**	**12-31-1958**
10 Back	**TERRY, ALICE LEE**		**ALL**		**01320**	**0305**	**06-30-1958**
11 Back	**UPCHURCH, NORMA EVELYN SASSER &HUS**		**ALL**		**01310**	**0354**	**03-11-1958**
12 Back	**WINSTON, R W JR**		**ALL**		**00871**	**0240**	**11-03-1941**
13 Back	**ASHEROFF, JAS &WIFE**		**ALL**		**00687**	**0252**	**06-14-1935**

For questions regarding the information displayed on this site, please contact the Revenue Department at RevHelp@wakegov.com or call 919-856-5400.

Home

Wake County Real Estate Data
Ownership History

iMaps
Tax Bills

Real Estate ID **0004771** PIN # **1703876898**

WAKE COUNTY NORTH CAROLINA

Location Address
327 E MARTIN ST

Property Description
327 S MARTIN STREET

Account Search

Pin/Parcel History | New Search

Account | Buildings | Land | Deeds | Notes | Sales | Photos | Tax Bill | Map

Go!

	Owner Name	Type	% Own	Stamps	Book	Page	Date
Current	**WOOD PILE LLC THE**		**ALL**		**07680**	**0204**	**09-30-1997**
1 Back	**LAWRENCE, LUANNE H &ANDREW O**		**ALL**		**04833**	**0023**	**12-31-1990**
2 Back	**HOUSE, HARPER H &DOLLIE P**		**ALL**		**04413**	**0031**	**12-30-1988**
3 Back	**TRIPLE R REALTY COMPANY**		**ALL**		**03024**	**0143**	**06-11-1982**
4 Back	**COUNTRY ACRES LAND COMPANY**		**ALL**		**02716**	**0184**	**03-27-1979**
5 Back	**BASHFORD, JOHN C**		**ALL**		**01650**	**0053**	**05-28-1965**
6 Back	**CHAMBLEE, H ROYSTER**		**ALL**		**0**		
7 Back	**PEIRCE, PRIESTLY E &LILLIE B**		**ALL**		**01586**	**0506**	**03-02-1964**
8 Back	**FORNEY, GARLAND G &WIFE**		**ALL**		**0**		
9 Back	**MCINNIS, J L &WIFE ETAL**		**ALL**		**01299**	**0543**	**12-06-1957**
10 Back	**RAND, J A &WIFE**		**GROUP**		**0**		
	RAND, J A ETALS		**ABOVE**				
11 Back	**RAND, S E MRS**		**ALL**		**00359**	**0596**	**09-02-1920**
12 Back	**CROWDER & RAND**		**ALL**		**00304**	**0314**	**01-07-1916**

For questions regarding the information displayed on this site, please contact the Revenue Department at RevHelp@wakegov.com or call 919-856-5400.

Home

Wake County Real Estate Data
Ownership History

iMaps
Tax Bills

Real Estate ID **0004772** PIN # **1703876991**

WAKE COUNTY NORTH CAROLINA

Location Address
228 S BLOODWORTH ST

Property Description
228 S BLOODWORTH STREET

Account Search

Pin/Parcel History | New Search

Account | Buildings | Land | Deeds | Notes | Sales | Photos | Tax Bill | Map

Go!

	Owner Name	Type	% Own	Stamps	Book	Page	Date
Current	**WOOD PILE LLC THE**		**ALL**		**07680**	**0204**	**09-30-1997**
1 Back	**LAWRENCE, LUANNE H & ANDREW O**		**ALL**		**04833**	**0023**	**12-31-1990**
2 Back	**HOUSE, HARPER H & DOLLIE P**		**ALL**		**04413**	**0031**	**12-30-1988**
3 Back	**TRIPLE R REALTY COMPANY**		**ALL**		**03024**	**0143**	**06-11-1982**
4 Back	**COUNTRY ACRES LAND COMPANY**		**ALL**		**02716**	**0184**	**03-27-1979**
5 Back	**BASHFORD, JOHN C**		**ALL**		**01650**	**0053**	**05-28-1965**
6 Back	**CHAMBLEE, H ROYSTER**		**ALL**		**0**		
7 Back	**PIERCE, PRIESTLY E & LILLIE B**		**ALL**		**01586**	**0506**	**03-02-1964**
8 Back	**FORNEY, GARLAND G & WIFE**		**ALL**		**0**		
9 Back	**MCINNES J L & WIFE**		**ALL**		**01299**	**0543**	**12-06-1957**
10 Back	**RAND, J A & WIFE**		**ABOVE**		**0**		
	MCINNES, J L		**1/2**				
	RUSSELL, O A		**1/2**				
	RAND, NANCY S		**1/2**				
	RUSSELL, O A		**1/2**				
	RAND, S E MRS		**GROUP**				

For questions regarding the information displayed on this site, please contact the Revenue Department at RevHelp@wakegov.com or call 919-856-5400.

Home

Wake County Real Estate Data
Ownership History

iMaps
Tax Bills

Real Estate ID **0004773** PIN # **1703876995**

WAKE COUNTY NORTH CAROLINA

Location Address **226 S BLOODWORTH ST**

Property Description **226 S BLOOLWORTH STREET**

Account Search

Pin/Parcel History New Search Go!

Account | Buildings | Land | Deeds | Notes | Sales | Photos | Tax Bill | Map

	Owner Name	Type	% Own	Stamps	Book	Page	Date
Current	**WOOD PILE LLC THE**		**ALL**		**07680**	**0204**	**09-30-1997**
1 Back	**LAWRENCE, LUANNE H & ANDREW O**		**ALL**		**04833**	**0023**	**12-31-1990**
2 Back	**HOUSE, HARPER H & DOLLIE P**		**ALL**		**04413**	**0031**	**12-30-1988**
3 Back	**TRIPLE R REALTY COMPANY**		**ALL**		**03024**	**0143**	**06-11-1982**
4 Back	**COUNTRY ACRES LAND COMPANY**		**ALL**		**02716**	**0184**	**03-27-1979**
5 Back	**BASHFORD, JOHN C**		**ALL**		**01650**	**0053**	**05-28-1965**
6 Back	**CHAMBLEE, H ROYSTER**		**ALL**		**0**		
7 Back	**PIERCE, PRIESTLY E & LILLIE B**		**ALL**		**01586**	**0506**	**03-02-1964**
8 Back	**FORNEY, GARLAND G & WIFE**		**ALL**		**0**		
9 Back	**MCINNES, J L & WIFE**		**ALL**		**01299**	**0543**	**12-06-1957**
10 Back	**RAND, J A & WIFE**		**ABOVE**		**0**		
	MCINNES, J L		**1/2**				
	RUSSELL, O A		**1/2**				
	RAND, NANCY S		**1/2**				
	RUSSELL, O A		**1/2**				
	RAND, S E MRS		**GROUP**				

For questions regarding the information displayed on this site, please contact the Revenue Department at RevHelp@wakegov.com or call 919-856-5400.

WAKE COUNTY NORTH CAROLINA

Home

Wake County Real Estate Data
Ownership History

iMaps
Tax Bills

Real Estate ID **0004774** PIN # **1703877908**

Location Address **224 S BLOODWORTH ST**

Property Description **224 S BLOODWORTH**

Account Search

Pin/Parcel History New Search Go!

Account | Buildings | Land | Deeds | Notes | Sales | Photos | Tax Bill | Map

	Owner Name	Type	% Own	Stamps	Book	Page	Date
Current	**WOOD PILE LLC THE**		**ALL**		**07680**	**0204**	**09-30-1997**
1 Back	**LAWRENCE, LUANNE H & ANDREW O**		**ALL**		**04833**	**0023**	**12-31-1990**
2 Back	**HOUSE, HARPER H & DOLLIE P**		**ALL**		**04413**	**0031**	**12-30-1988**
3 Back	**TRIPLE R REALTY COMPANY**		**ALL**		**03024**	**0143**	**06-11-1982**
4 Back	**COUNTRY ACRES LAND COMPANY**		**ALL**		**02716**	**0184**	**03-27-1979**
5 Back	**BASHFORD, JOHN C**		**ALL**		**01650**	**0053**	**05-28-1965**
6 Back	**CHAMBLEE, H ROYSTER**		**ALL**		**0**		
7 Back	**PIERCE, PRIESTLY E & LILLY B**		**ALL**		**01586**	**0506**	**03-02-1964**
8 Back	**FORNEY, GARLAND G & WIFE**		**ALL**		**0**		
9 Back	**MCINNES, J L & WIFE**		**ALL**		**01299**	**0543**	**12-06-1957**
10 Back	**RAND, J A & WIFE**		**ABOVE**		**0**		
	MCINNES, J L		**GROUP**				
	RUSSELL, O A		**ABOVE**				
	RAND, NANCY S		**1/2**				
	RUSSELL, O A		**1/2**				
	RAND, S E MRS		**GROUP**				

For questions regarding the information displayed on this site, please contact the Revenue Department at RevHelp@wakegov.com or call 919-856-5400.

Home

Wake County Real Estate Data
Ownership History

iMaps
Tax Bills

Real Estate ID **0004770** PIN # **1703886088**

WAKE COUNTY NORTH CAROLINA

Location Address **214 S BLOODWORTH ST**

Property Description **214 S BLOODWORTH STREET**

Account Search

Pin/Parcel History New Search

Account | Buildings | Land | Deeds | Notes | Sales | Photos | Tax Bill | Map

Go!

Owner Name	Type	% Own	Stamps	Book	Page	Date
Current **WOOD PILE LLC THE**		**ALL**		**07680**	**0204**	**09-30-1997**
1 Back **LAWRENCE, LUANNE H & ANDREW O**		**ALL**		**04833**	**0023**	**12-31-1990**
2 Back **HOUSE, HARPER H & DOLLIE P**		**ALL**		**04413**	**0031**	**12-30-1988**
3 Back **TRIPLE R REALTY COMPANY**		**ALL**		**03024**	**0143**	**06-11-1982**
4 Back **COUNTRY ACRES LAND COMPANY**		**ALL**		**02716**	**0184**	**03-27-1979**
5 Back **BASHFORD, JOHN C**		**ALL**		**01650**	**0053**	**05-28-1965**
6 Back **CHAMBLEE, H ROYSTER**		**ALL**		**0**		
7 Back **PIERCE, P E**		**ALL**		**01595**	**0312**	**05-20-1964**
8 Back **JORDAN, LACY JONES MRS**		**ALL**		**0**		
9 Back **LILES, LILLIE M MRS**		**ALL**		**01091**	**0341**	**03-19-1952**
10 Back **JORDAN, C J & WIFE**		**ALL**		**01091**	**0345**	**03-19-1952**
11 Back **MCGHEE, FLORRIE B MRS**		**ALL**		**00925**	**0437**	**07-14-1945**
12 Back **BLAKE, W R**	**WILL**	**ALL**		**0**		

For questions regarding the information displayed on this site, please contact the Revenue Department at RevHelp@wakegov.com or call 919-856-5400.

WAKE COUNTY NC 09/30/97
1169 $1010.00

STATE OF NORTH CAROLINA Real Estate Excise Tax

Excise Tax $1,010.00

BK7680PG0204

PRESENTED FOR REGISTRATION

000716 97 SEP 30 PM 3:17

Recording Time, Book and Page LAURA M. RIDDICK REGISTER OF DEEDS WAKE COUNTY

Tax Lot No. ACCT #4766, 4769, 4770, 4771, 4772, 4773, 4774, 4775, 4776, 4777, 4778, 4779, 4780 and 12675

Verified by County on the day of , 19
by

Mail after recording to/Hold for: Wallace, Creech & Sarda, L.L.P.

This instrument was prepared by: Wallace, Creech & Sarda, L.L.P.

Brief description for the index: 12 Tracts

NORTH CAROLINA GENERAL WARRANTY DEED

THIS DEED made this 30th day of September, 1997, by and between

GRANTOR	GRANTEE
LUANNE H. LAWRENCE and husband, ANDREW O. LAWRENCE Liability Company	THE WOOD PILE, LLC, a North Carolina Limited Liability Company P.O. Box 18209 Raleigh, NC 27619

The designation Grantor and Grantee as used herein shall include said parties, their heirs, successors, and assigns, and shall include singular, plural, masculine, feminine or neuter as required by context.

WITNESSETH, that the Grantor, for a valuable consideration paid by the Grantee, the receipt of which is hereby acknowledged, has and by these presents does grant, bargain, sell and convey unto the Grantee in fee simple, all that certain lot or parcel of land situated in or near the City of Raleigh, Wake County, North Carolina and more particularly described as follows:

See Exhibit A attached hereto and incorporated herein by reference.

The property hereinabove described was acquired by Grantor in instrument recorded in Book 4833, Page 23, Wake County Registry.

A map showing the above described property is recorded in Book of Maps _____, Page _____.

TO HAVE AND TO HOLD the aforesaid lot or parcel of land and all privileges and appurtenances thereto belonging to the Grantee in fee simple.

And the Grantor covenants with the Grantee, that Grantor is seized of the premises in fee simple, has the right to convey the same in fee simple, that title is marketable and free and clear of all encumbrances, and that Grantor will warrant and defend the title against the lawful claims of all persons whosoever except for the exceptions hereinafter stated.
Title to the property hereinabove described is subject to the following exceptions:

1. 1997 Ad Valorem taxes.

2. Easements, restrictions and right-of-ways of record.

IN WITNESS WHEREOF, the Grantor has hereunto set his hand and seal, or if corporate, has caused this instrument to be signed in its corporate name by its duly authorized officers and its seal to be hereunto affixed by authority of its Board of Directors, the day and year first above written.

Luanne H. Lawrence (Seal)
Luanne H. Lawrence

Andy O. Lawrence (Seal)
Andrew O. Lawrence

SEAL-STAMP

M. BRADLEY HARROLD
NOTARY PUBLIC
GUILFORD COUNTY, N. C.
My commission expires 8/16/98

STATE OF North Carolina, COUNTY OF Wake

I, a Notary Public of the County and State aforesaid, certify that Luanne H. Lawrence and Andrew (Andy) O. Lawrence, personally appeared before me this day and acknowledged the execution of the foregoing instrument. Witness my hand and official stamp or seal, this 30th day of September, 1997.

My commission expires: 8/16/98 M. Bradley Harrold Notary Public

NORTH CAROLINA, Wake COUNTY

The foregoing certificate of M. Bradley Harrold Notary(ies) Public is(are) certified to be correct. This instrument and this certificate are duly registered at the date and time and in the book and page shown on the first page hereof.

LAURA M. RIDDICK
Register of Deeds

By Meta W. Harris
Asst./Deputy Register of Deeds

EXHIBIT A

TRACT 1: No. 213 S. Bloodworth Street, in the City of Raleigh, North Carolina and situated on the east side of S. Bloodworth Street between E. Hargett and E. Martin Streets in the eastern portion of said City, and being a part of Lot No. 123 in the plan (Shaffers map) of the said City, said lot being bounded by an outside line as follows: BEGINNING at a cross mark on the sidewalk on the east side of Bloodworth Street, said mark being 33 feet East from the technical center line of Bloodworth Street and 8.5 feet east from the west face of the gutter curb as now located on the east side of Bloodworth Street, and being 4 feet west from a fence post and said cross mark being 192 feet south from the technical center line of Hargett Street and runs thence northwardly parallel to said technical center line of Bloodworth Street, 63.8 feet, to another cross mark on the sidewalk on the east side of Bloodworth Street, said mark being 33 feet east from the technical center line of Bloodworth Street and 8.5 feet east from the west face of the gutter curb as now located on the east side of Bloodworth Street and said mark being 3.8 feet west from an original iron pipe and runs thence eastwardly along a party fence 71.4 feet to an iron pipe in the Hedrick line, said pipe being 6 feet east from an original iron pipe near a fence; thence southwardly along the west line of said Hedrick lot 64.8 feet to an original iron pipe at a fence dividing this lot from Lot No. 215 S. Bloodworth Street; thence westwardly along said last named fence 74.8 feet to the Beginning, and being Lot No. 2 as shown on map dated December, 1923, by C. L. Mann, C. E., of J. M. Monie Estate (Bloodworth, Hargett and East Streets) registered in office of the Register of Deeds of Wake County, North Carolina, in Book of Maps 1920, page 228, reference to which is made.
ID #0004776 (Tract 1)

TRACT 2: Known as No. 215 S. Bloodworth Street, in the City of Raleigh, North Carolina, and situated on the east side of S. Bloodworth Street between E. Hargett and E. Martin Streets, in the eastern portion of said City, and being part of Lot No. 123, in the plan (Shaffer's Map) of said City; said lot being bounded by an outside line as follows: BEGINNING at a cross mark on the side walk on the east side of Bloodworth Street, said mark being 33 feet east from the technical center line of Bloodworth Street and 8.5 feet east from the west face of the gutter curb as now located on the east side of Bloodworth Street, and said stake being 192 feet south from the technical center line of Hargett Street, and runs thence southwardly parallel with the technical center line of Bloodworth Street 52.8 feet to a nail in the sidewalk in line with an old party fence, said nail being 33 feet east from the technical center line of Bloodworth Street, and 8.6 feet east from the west face of the gutter curb as now located on the east side of Bloodworth Street, and runs thence eastwardly along said party fence 109.4 feet to a stake in another party fence between this lot and Lot No. 212 S. East Street, thence northwardly along said second party fence 52.8 feet to a stake in the south line of the Hedrick lot; thence Westwardly 109.8 feet to the Beginning as shown on map dated December, 1923, by C. L. Mann, C. E., of J. M. Monie Estate, registered office of the Register of Deeds of Wake County, North Carolina, in Book of Maps 1920, page 228, reference to which is made.
ID #0004777 (Tract 2)

TRACT 3: Lying and being in the City of Raleigh and known in the plan of said city as part of Lot #107, and now known as 217 S. Bloodworth Street.

Bounded by a line beginning at Alfred Upchurch's corner on Bloodworth Street, and runs thence south with said street 58 feet to Royster's line; thence east with said Royster's line 105 feet to W. R. Blake's line; thence north with said line 58 feet to said Alfred Upchurch's line; thence with said line west 105 feet to Bloodworth Street, the point of beginning.
ID #0004769 (Tract 3)

TRACT 4: BEGINNING at an iron pipe located in the western line of S. Bloodworth Street, 161.0 feet, as measured along said western line of S. Bloodworth Street in a southern direction from its intersection with the right-of-way line of E. Hargett Street, said iron pipe marking the southeastern corner of the property now or formerly owned by Hazel Betts; runs thence along the said western line of S. Bloodworth Street, South 06° 15' West 49.0 feet to an iron pipe, said iron pipe marking the northeastern corner of the property now or formerly owned by Alonzo Moore; runs thence along the northern line of said Moore and along the northern line of Walter Killough North 82° 20' West 90.0 feet to an iron pipe, said iron pipe marking the southeastern corner of the property now or formerly owned by John Harper; runs thence along the eastern line of said Harper North 06° 15' East 49.0 feet to an iron pipe, said iron pipe marking the southwestern corner of said Betts; runs thence along the southern line of Betts South 82° 20' East 90.0 feet to the point and place of beginning, and being known as 214 S. Bloodworth Street, all according to a survey entitled "Property of Country Acres Land Company", dated March 22, 1979, prepared by John Y. Phelps, Jr., Registered Surveyor.
ID #0004770

TRACT 5: BEGINNING at an iron pipe marking the intersection of the western right-of-way line of S. Bloodworth and the northern right-of-way line of E. Martin Street; runs thence along said northern right-of-way line of E. Martin Street, North 82° 12' West 76.73 feet to an iron pipe, said iron pipe marking the southeastern corner of the property now or formerly owned by Sarah Trotter; runs thence along the eastern line of said Trotter North 06° 21' East 147.27 feet to an iron pipe, said iron pipe marking the northeastern corner of said Trotter; runs thence South 31° 57' East 24.07 feet to an iron pipe in the western line of the property now or formerly owned by W. J. Killough; runs thence with the western line of said Killough South 08° 28' West 3.0 feet to an iron pipe, said iron pipe marking the southwestern corner of said Killough; runs thence along the southern line of said Killough South 81° 53' East 52.58 feet to an iron pipe in the western right-of-way line of said S. Bloodworth Street, said iron pipe marking the southeastern corner of said Killough; runs thence along the western line of said S. Bloodworth Street, South 06° 15' West 143.88 feet to the point and place of beginning, all according to a survey entitled "Property of Country Acres Land Company"; dated March 23, 1979, prepared by John Y. Phelps, Jr., Registered Surveyor.

The above described property is known as 224-226-228 S. Bloodworth Street and 325-327 E. Martin Street.
ID #0004774 - ID #0004773 - ID #0004772 - ID #0004775 - ID #0004771

TRACT 6: Situated at the Southeast corner of the intersection of East Hargett and South Bloodworth Streets in the City of Raleigh, North Carolina and being a part of Lot No. 123 in the plan (Shaffer's map) of said City, and bounded by line as follows:

BEGINNING at a point on the South side of East Hargett Street, said point being 72 feet 6 inches (72' 6") East of the West face of the gutter curb as now located on the East side of said Bloodworth Street; runs thence Southwardly (along the west line of property now owned by John C. Bashford and H. Royster Chamblee) one hundred and one feet and five inches (101'5") more or less to an iron stake in the North line of the Monie lot now or formerly occupied by Mrs. L. F. Bailey and in the West line of formerly Monie lot now or formerly occupied by John C. Bashford and H. Royster Chamblee; thence Westwardly along the North line of said Bailey lot sixty-one feet and seven inches (61' 7") more or less to said Bloodworth Street; thence Northwardly along the East line of Bloodworth Street one hundred and one feet and seven inches (101' 7") more or less, to the said Hargett Street; thence Eastwardly along the South line of said Hargett Street sixcy one feet and six inches (61' 6") more or less, to the Beginning.
ID #0004779 (Known as 402 East Hargett Street).

TRACT 7: BEGINNING at an iron stake on the South side of East Hargett Street in the City of Raleigh, N. C. between Bloodworth and East Streets, the Northwest corner of A. P. Upchurch lot; runs thence South with Upchurch's line 100 feet 8 inches to an iron pin in the line of J. M. Monie; thence East with Monie's line 6 feet to a stake; thence South with said Monie's line 65 feet 5 inches to an iron pipe in another line of said Monie; thence East with Monie's said line 44 feet to an iron stake, Mooneyham's corner; thence North with Mooneyham's line and another line of J. M. Monie 140.25 feet to an iron stake in the driveway, which stake is 4 feet 5 inches from the Northwest corner of the house on adjacent lot and 10 feet East from house on lot herein described; thence in a Northwesterly direction 25-1/2 feet to an iron stake in East Hargett Street; thence West with said Hargett Street 50 feet to point of beginning. Being a part of lot 123 in the plan of the City of Raleigh.
ID #0004778 (Known as 408 East Hargett Street).

TRACT 8: BEGINNING at a stake on the South side of E. Hargett Street, said stake being 33 feet South from the technical center line of Hargett Street, and 18.9 feet South from the North face of the gutter curb as now located on the South side of Hargett Street, and said stake being 74.6 feet, West from the technical center line of East Street and 58.5 feet West from the East face of the gutter curb as now located on the West side of East Street, and runs thence Southwardly parallel to the technical center line of East Street 102.5 feet to a party fence; thence Westwardly 50.6 feet to an original iron pipe on the East line of the Hedrick lot; thence Northwardly 87 feet to an original iron pipe located 4.5 feet West from the building 412 E. Hargett Street; thence Northwestwardly at an angle with preceding line 17.3 feet to a stake on the South side of Hargett Street, said stake being 33 feet South from the technical center line of Hargett Street, and 18.2 feet South from the North face of the gutter curb as now located on the South side of Hargett Street; thence Eastwardly parallel to the technical center line of Hargett Street, 53.4 feet to the Beginning as shown on map December, 1923, by C. L. Mann, C. E., of J. M. Monie Estate (Bloodworth, Hargett and East Streets) registered in the office of the Register of Deeds of Wake County, North Carolina, in Book of Official Maps 1920, page 228, reference to which is made.

Also all the right, title, interest, and estate, of T. B. Denning and wife, Gladys L. Denning, in, on and to all that strip of land adjoining and situated immediately North of the lot above described - said strip being located between the technical North property line and the visible North property line of said Lot No. 412 East Hargett Street, said strip being bounded by an outside line as follows: BEGINNING at the Northeast corner of the lot described above and runs thence Northwardly about eight feet to the visible North property line of said Lot No. 412 East Hargett Street; thence Westwardly along said visible North property line of said lot about 54 feet to an iron pipe, said pipe being fifty feet Eastwardly from the Northeast corner of the Allen Upchurch lot, as marked by an original iron pipe; thence Southeastwardly 8.2 feet to the Northwest corner of the lot above described; thence Eastwardly along the technical North property line of the lot above described 53.4 feet to the Beginning as shown on said map.
ID #0012675 (Known as 412 East Hargett Street).

TRACT 10: Also all the right, title, interest, estate, claim and demand of Walter A. Perry in and on all that strip of land adjoining and situate immediately east on the lot last above described, said strip being located between the technical east property line and the visible east property line of said Lot No. 212 S. East Street, said strip being bounded by an outside line as follows: BEGINNING at the northeast corner of the lot last above described and runs thence East 5.9 feet to an original iron pipe at the post in the visible east property line of said Lot No. 212 S. East Street; thence southwardly along said visible east property line of said lot, 52.8 feet to a post in line with the south property line of the lot last above described; thence westwardly 5.2 feet to the southeast corner of the lot last above described; thence northwardly along the technical east property line of the lot last above described 52.8 feet to the Beginning as shown on said Map of Mann.
ID - Portion of #0004766.

TRACT 11: BEGINNING at the center of the east face of a fence post on the west side of said East Street indicated by an iron pipe at the southeast corner of said Woodall lot, which pipe is located 121 feet 2 inches South of the north face of the gutter curb as now located on the south side of Hargett Street and 11 feet 3 inches west of the east face of the gutter curb as now located on the west side of East Street and runs thence westwardly in a straight line and approximately through the center of the fence posts 96 feet 9 inches to the center of a fence post in the line of the Iden lot; thence southwardly in a straight line and approximately through the center of the fence posts 52 feet 4 inches to the center of a fence post in the O'Connell lot, thence eastwardly in a straight line and approximately through the center of the fence posts 96 feet 8 inches to the center of the east face of a fence post on the west side of East Street indicated by an iron stake which is 11 feet west of the east face of the gutter curb as now located on the west side of East Street; runs thence Northwardly along the west side of East Street 52 feet 6 inches to the Beginning.
ID - Portion of #0004766 (Known as 208 South East Street).

TRACT 12: BEGINNING at a point in the West line of East Street, 49 feet North of the Northeast corner of Mrs. Flora Goodman's lot, which beginning point is the Northeast corner of Daniel Honeycutt's lot; runs thence North along the Western line of East Street about 51-1/2 feet to the Southeast corner of J. H. Monie's lot; thence West with his Southern line 105 feet; thence South in a line parallel with East Street about 51-1/2 feet to the Northwest corner of said Honeycutt's lot; thence east with his Northern line 105 feet to the Northeast corner of said Honeycutt's lot, in the west line of East Street, the Beginning point.
ID - Portion of #0004760 (Known as 218 South East Street).

"End User" Questionnaire

END USER QUESTIONNAIRE

In order to qualify for one of the *Landowner Liability Protections* offered by the Small Business Liability Relief and Brownfields Revitalization Act, the *user* must provide the following information (if available) to the *environmental professional*.

(1) Are you aware of any environmental cleanup liens against the *property* that are filed or recorded under federal, tribal, state or local law? *No.*

(2) Are you aware of any activity and use limitations, such as *engineering controls*, land use restrictions or *institutional controls* that are in place at the site and/or have been filed or recorded in a registry under federal, tribal, state or local law? *No.*

(3) As the user of this ESA do you have any specialized knowledge or experience related to the property or nearby properties? *Adjacent property at 215/219 S. Person Street is under contract, Phase II ESA reported "a dilute groundwater plume from a probable offsite source".* For example, are you involved in the same line of business as the current or former *occupants* of the *property* or an adjoining *property* so that you would have specialized knowledge of the chemicals and processes used by this type of business? No.

(4) Does the purchase price being paid for this *property* reasonably reflect the fair market value of the *property*? *Yes.* If you conclude that there is a difference, have you considered whether the lower purchase price is because contamination is known or believed to be present at the *property*? *N/A*

(5) Are you aware of commonly known or *reasonably ascertainable* information about the *property* that would help the *environmental professional* to identify conditions indicative of releases or threatened releases? No. For example, as *user*,

(a) Do you know the past uses of the *property*? *No.*
(b) Do you know of specific chemicals that are present or once were present at the *property*? *No.*
(c) Do you know of spills or other chemical releases that have taken place at the *property*? *No.*
(d) Do you know of any environmental cleanups that have taken place at the *property*? *No.*

(6) As the *user* of this *ESA*, based on your knowledge and experience related to the property are there any *obvious* indicators that point to the presence or likely presence of contamination at the *property*? *Yes, Based on groundwater plume crossing under property at 215/219 S. Person Street, as described in Phase II, the plume likely crosses under a portion of the subject property.*

USER INFORMATION

User Name: City of Raleigh

Signature: Gregg L. Pollard

Company/Affiliation: City of Raleigh/ Real Estate Services Manager

Address: P.O. Box 590

Raleigh, North Carolina 27602

Date: June 4, 2013

Questionnaire – Subject Property Owner

PHASE I ESA QUESTIONNAIRE

The following questionnaire is for the current or past landowners/property owners of the subject property. It will provide the environmental professional conducting the Phase I Environmental Site Assessment (ESA) with valuable information regarding past and present use(s) of the subject property.

(1) Are you aware of any environmental cleanup liens against the *property* that are filed or recorded under federal, tribal, state or local law? NO

(2) Are you aware of any activity and use limitations, such as *engineering controls*, land use restrictions or *institutional controls* that are in place at the site and/or have been filed or recorded in a registry under federal, tribal, state or local law? NO

(3) Do you have any specialized knowledge or experience related to the property or nearby (adjacent) properties? For example, were chemicals were used on site, or is there an Underground Storage Tank (UST) on the property, on adjacent property, etc. NO

(4) Are you aware of any known or suspected contamination believed to be present at the *property*? NO

(5) Are you aware of commonly known or *reasonably ascertainable* information about the *property* that would help the *environmental professional* to identify conditions indicative of releases or threatened releases? For example,

(a) What is/was the use of the *property*? Residential & parking

(b) Do you know of specific chemicals that are present or once were present at the *property*? NO

(c) Do you know of spills or other chemical releases that have taken place at the *property*? NO

(d) Do you know of any environmental cleanups that have taken place at the *property*? NO

(6) Based on your knowledge and experience related to the property are there any *obvious* indicators that point to the presence or likely presence of contamination at the *property*? NO

(7) In your opinion, is there another key person(s) who would have good knowledge of the site that *GeoLogix* should interview. NO

(8) Is there a well or other source of water on site? NO WELL. CITY WATER.

(9) Are there structures on site? NONE

(10) How long have you owned the *property*? Varies. See Phase I report Exhibit 1.

(11) From whom did you purchase the *property*? 12 parcels, about 8 different parties. See Exhibit 1 in Phase I report.

Person completing questionnaire: Robert H. Livermon, Jr. (GeoLogix) per conversation w/ Gordon Smith on 6-03-13.

Association with subject property: Gordon Smith represents Wood Pile LLC

Please call Rob Livermon (*GeoLogix*) at (919) 859-4544 or (919) 616-6586 (cell) if you have any questions, or you may call to answer any of the above questions over the phone.